

PHASE ONE ENVIRONMENTAL SITE ASSESSMENT

PREPARED FOR:

Trinity Point
8700 Dufferin Street
Vaughan, Ontario

ATTENTION:

Gabe DiMartino

**2072 Lakeshore Road | Burlington,
Ontario**

Grounded Engineering Inc.

File No. 22-282 Rev 2

Issued December 19, 2024



TABLE OF CONTENTS

1	EXECUTIVE SUMMARY	4
2	INTRODUCTION	6
2.1	PHASE ONE PROPERTY INFORMATION	6
3	SCOPE OF INVESTIGATION	6
4	RECORDS REVIEW	7
4.1	GENERAL	7
4.1.1	Phase One Study Area Determination	7
4.1.2	First Developed Use Determination	7
4.1.3	Fire Insurance Plans	7
4.1.4	Chain of Title	11
4.1.5	City Directory	12
4.1.6	Environmental Reports	13
4.2	ENVIRONMENTAL SOURCE INFORMATION	14
4.2.1	ERIS	14
4.2.2	Other Source Information	16
4.3	PHYSICAL SETTING SOURCES	17
4.3.1	Aerial Photographs	17
4.3.2	Topography, Hydrology, Geology	17
4.3.3	Fill Materials	18
4.3.4	Water Bodies and Areas of Natural Significance	18
4.3.5	Well Records	19
4.3.6	Municipal Drinking Water System	19
4.3.7	Well-Head Protection Area	19
5	SITE OPERATING RECORDS	19
6	INTERVIEWS	20
7	SITE RECONNAISSANCE	20
7.1	GENERAL REQUIREMENTS	20
7.2	SPECIFIC OBSERVATIONS AT PHASE ONE PROPERTY	21
7.2.1	Exterior Site Conditions	21
7.2.2	Building Structures and Building Systems	21
7.2.3	Designated Substances and Other Special Attention Items	22
7.2.4	Above Ground Storage Tanks	23
7.2.5	Underground Storage Tanks and Below Grade Structures	23
7.2.6	Enhanced Investigation Property	24
7.3	INVESTIGATION OF THE PHASE ONE STUDY AREA	24
7.4	WATER WELLS, WATERBODIES & AREAS OF NATURAL SIGNIFICANCE	24
7.4.1	Water Wells	24
7.4.2	Waterbodies	24
7.4.3	Areas of Natural Significance	25
7.5	WRITTEN DESCRIPTION OF INVESTIGATION	25



8	REVIEW AND EVALUATION OF INFORMATION	25
8.1	CURRENT AND PAST USES.....	25
8.2	POTENTIALLY CONTAMINATING ACTIVITY	25
8.3	AREAS OF POTENTIAL ENVIRONMENTAL CONCERN.....	29
8.4	PHASE ONE CONCEPTUAL SITE MODEL	29
9	CONCLUSIONS	30
9.1	WHETHER PHASE TWO ENVIRONMENTAL SITE ASSESSMENT REQUIRED BEFORE RECORD OF SITE CONDITION SUBMITTED	30
9.2	RECORD OF SITE CONDITION BASED ON PHASE ONE ENVIRONMENTAL SITE ASSESSMENT ALONE	30
9.3	SIGNATURES.....	30
10	REFERENCES	31
11	LIMITATIONS AND RESTRICTIONS	32
11.1	REPORT USE	32

FIGURES

- Figure 1 – Site Location Plan
- Figure 2 – Phase One Property
- Figure 3 – Phase One Study Area
- Figure 4 – PCA Locations
- Figure 5 – APEC Locations

TABLES

- Table 1 – Table of Current and Past Use
- Table 2 – APEC Table

APPENDICES

- Appendix A – Plan of Survey
- Appendix B – Fire Insurance Plans
- Appendix C – Chain of Title
- Appendix D – City Directory
- Appendix E – ERIS
- Appendix F – Regulatory Responses
- Appendix G – Aerial Photographs
- Appendix H – Topographic and Geologic Maps
- Appendix I – Well Records
- Appendix J – Site Photographs
- Appendix K – Phase One Conceptual Site Model



1 Executive Summary

Trinity Point retained Grounded Engineering Inc., to complete a Phase One Environmental Site Assessment (Phase One ESA) of the Phase One Property (Property) located at southeast intersection of Pearl Street and Lakeshore Boulevard at the municipal address of 2072 Lakeshore Road, Burlington, Ontario.

Revision 2 of this report includes changes to the future development.

The Property is irregular in shape, with a total area of approximately 0.15 ha. The Property consists of a trapezoidal parcel of land south of Lakeshore Road, north of Old Lakeshore Road, and east of Pearl Street. The Property is currently occupied by an existing 1-storey building which is a slab-on-grade structure with no basements (except for a small crawlspace area). The building is presently surrounded by asphalt surface parking and landscaping. The Property is considered to be in commercial land use by the Ontario Ministry of the Environment, Conservation and Parks (MECP). It is understood that the Phase One Property will be developed with a high-rise residential tower with seven (7) levels of underground parking, which will be considered to be in residential land use by the MECP. The Phase One ESA has been prepared to support a Record of Site Condition and in accordance with Ontario Regulation 153/04 (O.Reg. 153/04). The Phase One Property is presented in Figure 2.

The Phase One ESA identified the following Areas of Potential Environmental Concern on the Property (Table 2):

Area of Potential Environmental Concern	Location of Area of Potential Environmental Concern on Phase One Property	Potentially Contaminating Activity	Location of PCA (on-site or off-site)	Contaminants of Potential Concern	Media Potentially Impacted (Groundwater, soil and/or sediment)
APEC 1	Central on the Phase One Property	#28 _A – Gasoline and Associated Products Storage in Fixed Tanks	On-site	PHCs BTEX PAHs	Soil & Groundwater
APEC 2	Entire Phase One Property	#30 _A – Importation of Fill Material of Unknown Quality	On-site	Metals As, Sb, Se B-HWS CN- Hg Cr(VI) Low or High pH PAHs PHCs VOCs BTEX	Soil & Groundwater Soil & Groundwater Soil Soil & Groundwater Soil & Groundwater Soil & Groundwater Soil & Groundwater Soil & Groundwater Soil & Groundwater Soil & Groundwater



APEC 3	Exterior Portions of Phase One Property	#Other1 _A - De-icing Activities	On-site	EC SAR Cl Na	Soil Soil Groundwater Groundwater
APEC 4	Northern Portion of the Phase One Property	#34 _A – Metal Fabrication	Off-Site	Metals As, Sb, Se, Hg Cr(VI) PHCs VOCs BTEX	Groundwater
APEC 5	Southwestern Portion of the Phase One Property	#28 _B – Gasoline and Associated Products Storage in Fixed Tanks	Off-Site	PHCs BTEX PAHs	Groundwater

Further environmental investigations would be required to investigate the Areas of Potential Environmental Concern for the Contaminants of Concern that have been identified on the Property.



2 Introduction

2.1 Phase One Property Information

Trinity Point retained Grounded Engineering Inc., to complete a Phase One Environmental Site Assessment (Phase One ESA) of the Phase One Property (Property) located at southeast corner of intersection of Pearl Street and Lakeshore Boulevard at the municipal address of 2072 Lakeshore Road, Burlington, Ontario. The site location is presented in Figure 1.

The Property is irregular in shape, with a total area of approximately 0.15 ha. The Property consists of a trapezoidal parcel of land south of Lakeshore Road, north of Old Lakeshore Road, and east of Pearl Street.

The Property is currently occupied by an existing 1-storey building which is a slab-on-grade structure with no basements. The building is presently surrounded by asphalt surface parking and landscaping. The Property is considered to be in commercial land use by the Ontario Ministry of the Environment, Conservation and Parks (MECP). It is understood that the Phase One Property will be developed with a high-rise residential tower with seven (7) levels of underground parking, which will be considered to be in residential land use by the MECP. The Phase One ESA has been prepared to support a Record of Site Condition and in accordance with Ontario Regulation 153/04 (O.Reg. 153/04). The Phase One Property is presented in Figure 2.

The Property information is provided below:

Municipal Address	2072 Lakeshore Road
Legal Description	Part of Lots 2, 3, and 4, Registered Plan 92, City of Burlington
PIN(s)	07061-0009
Current Land Use	Commercial
Property Owner Information	Acamar Dwelling Corp.
Person who has engaged the Qualified Person to conduct the Phase One ESA	Gabe DiMartino; Trinity Point

3 Scope of Investigation

The Phase One ESA includes the following components:

- Records review of historical and current occupancies and activities on the Phase One Property and Phase One Study Area.
- Interviews with available personnel with knowledge to the historical and current activities on the Phase One Property.



- Site reconnaissance of the Phase One Property and Study Area to identify potential environmental concerns based on observations of historical and current uses, and potentially contaminating activities at the Phase One Property and in the Study Area.
- Evaluation of information from records review, interviews and site reconnaissance and completion of a conceptual site model (CSM).

4 Records Review

4.1 General

4.1.1 Phase One Study Area Determination

The Phase One Study Area (Study Area) includes all properties located within the 250 m radius from the Phase One Property boundary.

The Study Area includes a mix of commercial and residential properties to the north and west, residential properties to the east and commercial properties to the south. Two water bodies, Rambo Creek, located approximately 170 m northeast, and Lake Ontario, located approximately 60 m south/southeast, were observed in the Study Area. The Study Area is presented in Figure 3.

4.1.2 First Developed Use Determination

The determination of the date of the first developed use of the Phase One Property is based on review of historical records of the Property as follow:

Source of Records	Year of first developed use	Land Use (Industrial/ Commercial/ Community/ Residential/ Parkland/ Institutional)
Fire Insurance Plans (FIP)	1910	The Property appears to be residential.
Chain of Title	1798	Residential
Aerial Photographs	1959	Commercial or residential
City Directory Search	1998	Commercial (Royal LePage Real Estate Services Ltd.)

It is estimated that the first developed use of the Property occurred at or prior to 1910 as residential housing units.

4.1.3 Fire Insurance Plans

Fire Insurance Plans (FIP) from 1889 to 1973 were available for review for the Phase One Property and Study Area. The FIPs are presented in Appendix B. The FIPs identified the following:



Year	Description
1898	Only the western edge of the Property was covered by the available FIP. The western edge of the Property appeared to be developed with a 1 ½-storey residential building and Maria Street (no longer a street) appears to occupy the southern portion of the Property. The following was noted in the Study Area: • Brant Street (currently Pearl Street) was present immediately west of the Property, Water Street (currently Lakeshore Road) was present immediately north of the Property. • Commercial buildings were present to the west across Pearl Street. • A coal shed and wood yard was situated at 396 Elizabeth Street (formerly 12 Elizabeth Street), approximately 165 m northwest of the Site.
1910	The Property was developed with two residential structures: one on the west and one on the east side of the Property with the municipal addresses 2 and 10 Princess Street (currently Lakeshore Road). The following was noted in the Study Area: • Water Street (currently Lakeshore Road) continued south adjacent to the Property (currently Old Lakeshore Road) and the street north adjacent to the Property was formerly Princess Street. • A Paint shop was located at 134 Elizabeth Street, approximately 130 m west of the Property. • A coal shed and wood yard was situated at 396 Elizabeth Street (formerly 12 Elizabeth Street), approximately 165 m northwest of the Property. • Dominion Cannery (Canning & Ketchup Factory) was observed at the current location of 2020 Lakeshore Road (220 m southwest of the Site) at the former address of 34 and 42 Water Street. A tank was also observed on Water Street, north of the facility. • The remaining properties in the Study Area were developed in all directions with possible commercial and/or residential uses.



Year	Description
1924/1932	The Property appears to be developed with two (2) residential buildings, one on the west and one on the east portion of the Property with the municipal addresses 45 and 49 Water Street (East). The following was noted in the Study Area: • Water Street East (currently Old Lakeshore Road) continued south adjacent to the Property and the street north adjacent to the Property was Princess Street (currently Lakeshore Road). • The greenhouse structure at 2069 Lakeshore Road has been removed. • A coal shed and wood yard was situated at 12 Elizabeth Street, approximately 165 m northwest of the Site, labeled as "Milling Coal and Supply Co". • A Hydro Electric Power Commission Transmission Line was observed north of the Site, on the north side of Pine Street. The transmission line expanded along the entire Study Area. • Dominion Cannery was now labeled as The Canadian Cannery Limited (Canning & Ketchup Factory) was observed at 2020 Lakeshore Road (220 m southwest of the Site) at the former address of 34 and 42 Water Street. The tank that was observed north of the facility was not observed on the 1924 FIP. • A garage, repairs facility and show room were observed at 399 Elizabeth Street, located approximately 100 m southwest of the Site (former address of 10 Elizabeth Street). Two USTs were observed adjacent to the facility on Elizabeth Street. • A garage and service station were located at 2029-2031 Lakeshore Road (formerly 21 Water Street), 140 m southwest of the Site. Two USTs were observed on the property. • Oak Bank Inn was formerly located at 2041 Lakeshore Road with three USTs observed on the property, 60 m southwest of the Site. • Two USTs were observed at 2076 Old Lakeshore Road, 20 m south of the Site. • A garage and service station were observed at 2119 Old Lakeshore Road with two USTs, 80 m east of the Site. • The remaining properties in the Study Area were developed in all directions with possible commercial and/or residential uses.



Year	Description
1971	The Property had the address of 2071 Lakeshore Road and 2075 Lakeshore Road. The Property was occupied by an auto service station with a UST located on the west side and a commercial/residential building on the east side of the Property. The following was noted in the Study Area: - Princess Street was changed Gore Road (currently Lakeshore Road) and Water Street was changed to Lakeshore Road (currently Old Lakeshore Road) - An auto body shop and service station were located at 2027 Lakeshore Road (formerly 21 Water Street and 2029-2031 Lakeshore Road), 140 m southwest of the Property. One UST was observed on the property. - An auto service station was observed at 2041 Lakeshore Road with one UST, 60 m southwest of the Property. - A machine shop was located at 2079 Gore Road (currently Lakeshore Road), 20 m north of the Property. - An auto repair shop was observed at 455 John Street, 250 m northwest of the Property. - An auto service station was situated at 2092 Old Lakeshore Road with one UST, 50 m east of the Property. - A garage and service station were located at 2029-2031 Lakeshore Road (formerly 21 Water Street), 140 m southwest of the Property. One UST was observed on the property. - A garage and service station were observed at 2119 Old Lakeshore Road with one USTs, 80 m east of the Property.

The FIP search identified the following Potentially Contaminating Activities (PCAs):

Location of PCA	PCA	Description
2072 Lakeshore Road (formerly 2071 Old Lakeshore Road) Phase One Property	#28 – Gasoline and Associated Products Storage in Fixed Tanks	The Site was occupied by an auto service station with a UST located on the west side of the property on the 1971 FIP.
396 Elizabeth Street 165 m west	#Other2 – Coal Storage #59 – Wood Treating and Preservative Facility and Bulk Storage of Treated and Preserved Wood Products	A coal shed and wood yard were observed on the 1898, 1910, 1924 and 1932 FIPs.
2079 Lakeshore Road. 20 m north	#34 – Metal Fabrication	A machine shop was located in the northern portion of the building at 2079 Lakeshore Road in the 1971 FIP.
2020 Lakeshore Road. (Former address of 34 and 42 Water Street) 220 m southwest	#28 – Gasoline and Associated Products Storage in Fixed Tanks	Dominion Cannery (Canning & Ketchup Factory) was observed at the current location of 2020 Lakeshore Road (220 m southwest of the Site) at the former address of 34 and 42 Water Street on the 1910, 1924 and 1932 FIPs. A tank was also observed on Water Street, north of the facility (only visible on the 1910 FIP).



Location of PCA	PCA	Description
No address, middle northern portion of the Study Area 240 m northwest	#18 – Electricity Generation, Transformation and Power Stations	A Hydro Electric Power Commission Transmission Line was observed north of the Site, on the north side of Pine Street. The transmission line extended along the entire width of the Study Area from east to west on the 1924/1932 FIPs.
399 Elizabeth Street 100 m west	#10 - Commercial Autobody Shops #28 – Gasoline and Associated Products Storage in Fixed Tanks	A garage, repairs facility and show room were observed with two USTs were observed adjacent to the facility on Elizabeth Street on the 1924/1932 FIPs.
2027 Lakeshore Road (formerly 21 Water Street) 140 m southwest	#10 - Commercial Autobody Shops #28 – Gasoline and Associated Products Storage in Fixed Tanks	A garage and service station with two USTs were observed on the property on the 1924/1932 FIPs.
2042 Lakeshore Road. (Formerly 32 Water East) 80 m southwest	#28 – Gasoline and Associated Products Storage in Fixed Tanks	3 USTs in the 1932 FIPs. A gasoline station with 1 UST in the 1971 FIP.
2076 Old Lakeshore Road 20 m south	#28 – Gasoline and Associated Products Storage in Fixed Tanks	Two USTs were observed on the 1924/1932 FIPs.
2029-2031 Lakeshore Road 130 m southwest	#10 - Commercial Autobody Shops #28 – Gasoline and Associated Products Storage in Fixed Tanks	A gasoline and service station with 2 USTs in the 1932 FIP. An Auto Service with 1 UST in the 1971 FIP.
2092 Old Lakeshore Road 80 m northeast	#10 - Commercial Autobody Shops #28 – Gasoline and Associated Products Storage in Fixed Tanks	An Auto Service with 1 UST in the 1971 FIP.
2119 Old Lakeshore Road 150 m northeast	#10 - Commercial Autobody Shops #28 – Gasoline and Associated Products Storage in Fixed Tanks	An Auto Service with 2 USTs in the 1932 FIP. An Auto Service with 1 UST in the 1971 FIP.

4.1.4 Chain of Title

Chain of Title dating back to 1798 was available for review for the Phase One Property. The search identified that the Property was owned by the crown in the 1700s. The Property was subsequently owned by private individuals from the 1700s to 1954 and by corporate entities from 1954 to the present. The Property is currently owned by Acamar Dwelling Corp. as of March 31, 2023. The Chain of Title are presented in Appendix C.



The Chain of Title search identified the following Potentially Contaminating Activities (PCAs):

Location of PCA	PCA	Description
2072 Lakeshore Road Phase One Property	#28 – Gasoline and Associated Products Storage in Fixed Tanks	Owned by Sun Oil Company Limited in 1954.

4.1.5 City Directory

Available City Directories were reviewed for the Property and adjacent properties. The full search results can be found in Appendix D.

The City Directory search identified the following Potentially Contaminating Activities (PCAs):

Location of PCA	PCA	Description
2072 Lakeshore Road (formerly 2071 Lakeshore Road) Phase One Property	#28 – Gasoline and Associated Products Storage in Fixed Tanks	French Douglas Sunco Service Station in 1978. Gore Park Sunco Service Station in 1968 Pascoe & Lee Sunoco Service Station in 1963
2042 Lakeshore Road. (Formerly 32 Water East) 80 m Southwest	#28 – Gasoline and Associated Products Storage in Fixed Tanks	Lakeshore Fina Service Centre in 1978 Rolf's Fina Service Station in 1973 Emerson S & Son Fina Service Station in 1968 Canadian Petrofina Ltd Service Station in 1963
2029-2031 Lakeshore Road 130 m southwest	#10 - Commercial Autobody Shops #28 – Gasoline and Associated Products Storage in Fixed Tanks	Lakeshore Texaco Service Station in 1973 Lakeshore Autobody in 1975-1980 Russel's Autobody in 1970-1975
2119 Old Lakeshore Road 80 m northeast	#28 – Gasoline and Associated Products Storage in Fixed Tanks	Hall's Service Station in 1973/1968/1963
2092 Old Lakeshore Road 80 m northeast	#28 – Gasoline and Associated Products Storage in Fixed Tanks	An auto service station on the 1971 FIP.
2046 Pine Street 100 m west	#10 - Commercial Autobody Shops	Oilfield Auto Service in 1963
420 Martha Street 180 m north	#18 – Electricity Generation, Transformation and Power Stations	Burlington Hydro in 2008 and 2013.



4.1.6 Environmental Reports

The following environmental report(s) was/were provided for review for the Property. The findings of the report(s) is/are summarized below:

Title and File No.	Phase I Environmental Site Assessment, 2072 Lakeshore Road, Burlington, Ontario. File No: 233963.002
Report Date	April 1, 2022
Prepared By	Pinchin Ltd.
Prepared for	The David Landry Family Trust
Description of Data, Analysis or Findings	• The Property was considered to be in commercial land use. • The Phase I ESA was completed for due diligence purposes. • At the time of the site inspection, the Property was occupied by a two-story office building, reportedly constructed in 1910. An addition was constructed on the north portion of the building between 1995 and 1998. The building had a crawl space under the southeast portion of the building. • The report summarized a prior Phase I ESA that was completed by EACL in 2002. The report indicated that a former gasoline station was present on the Property (formerly 2071 Lakeshore Road) between 1950 and early 1980s. No tank decommissioning documents were provided for review. The EACL report was not provided to Grounded for review. • The report identified the following APEC causing PCAs: ○ An inferred pump island associated with a historical automotive service station was observed in the central and southwest portion of the Property. • The Phase I ESA recommended a Phase II ESA to investigate this PCA.

Title and File No.	Phase II Environmental Site Assessment, 2072 Lakeshore Road, Burlington, Ontario. File No: 233698.001
Report Date	March 5, 2019
Prepared By	Pinchin Ltd.
Prepared for	The David Landry Family Trust
Description of Data, Analysis or Findings	• The Phase II ESA was completed to assess the former gasoline station that was on-Site. • Three boreholes (PIN-MW01 to PIN-MW03) were advanced to depth of 4.57 meters below ground surface (mbgs). Each of the boreholes were finished with a monitoring well. The Property was considered to be in commercial land use. • The soil stratigraphy consists of sand with gravel to a maximum depth of 2.1 mbgs. Native materials consisted of silt with trace weather shale that extended to a maximum depth of 3 mbgs. Shale was encountered at the Property around 3 mbgs.



	• Soil and groundwater samples were collected from each borehole/monitoring well and submitted for the analysis of petroleum hydrocarbons (PHCs), polycyclic aromatic hydrocarbons (PAHs), volatile organic compounds (VOC) and/or lead. The results were compared to the 2011 Table 3 Site Condition Standards for coarse textured soil and residential property use (2011 Table 3 SCS). • Soil results indicated that there were no concentrations above the standard for PHC, PAHs or VOCs. There were exceedances of lead in borehole MW02, which had a concentration of 130 ug/g, exceeding the 2011 Table 3 SCS of 120 ug/g. • The groundwater results indicated there were no concentrations exceeding the 2011 Table 3 SCS for PHCs, VOCs, PAHs and lead. • The report concluded that no additional investigations were required at the time.

Title and File No.	Phase I Environmental Site Assessment, 2072 Lakeshore Road, Burlington, Ontario. File No: 233963.002
Report Date	April 1, 2022
Prepared By	Pinchin Ltd.
Prepared for	The David Landry Family Trust
Description of Data, Analysis or Findings	• The report did not identify any new findings since the previous reports were written.

The review of environmental reports identified the following Potentially Contaminating Activities (PCAs):

Location of PCA	PCA	Description
Phase One Property	#30 - Importation of Fill Material of Unknown Quality	The boreholes advanced by Pinchin indicated fill materials are present at the Property.
Phase One Property	#28 – Gasoline and Associated Products Storage in Fixed Tanks	A gasoline service station and associated UST was previously located on the western portion of the Property.

4.2 Environmental Source Information

4.2.1 ERIS

Environmental Risk Information Services Ltd. (ERIS) is a provider of detailed environmental risk data and research for properties in Canada. A search of the ERIS database was requested for the Property and the Study Area. The ERIS report is provided in Appendix E.



Potentially Contaminating Activities (PCAs) were observed within the Study Area. The ERIS search identified the following PCAs:

Location of PCA	PCA	Description
2042 Lakeshore Road. (Formerly 32 Water East) 80 m southwest	#28 – Gasoline and Associated Products Storage in Fixed Tanks	1 retail fuel oil tank in 1991. 1 delisted expired fuel tank, expired in 2009. Generator of oil skimmings & sludges and light fuels in 2013-2014, when it was occupied by Suncor Energy Products.
2093 Lakeshore Road 50 m east	#Other3 – Spills	A spill of hydraulic oil (20L) was reported at this address in 2006 which indicated that soil contamination was possible.
2047 Lakeshore Road/399 Elizabeth Street 80 m west	#Other3 – Spills	Burlington Hydro reported a spill of 10 L transformer oil to the ground in 1992. Burlington Hydro reported a spill containing PCB transmission oil to the ground in 2001.
Parking Lot at Lakeshore and Elizabeth 80 m southwest	#Other3 – Spills	Burlington PUC Vehicle spilled 8 L of hydraulic oil to the parking lot in 1990.
2119 Old Lakeshore Road 80 m northeast	#Other3 – Spills	99 L of transformer oil to the ground due to rotten pole in 1996.

Several sites within the Study Area were identified to have a Record of Site Condition (RSC) including the following sites located near the Property:

- 389 Pearl Street located 20 m north – RSC ID 2375. Residential land use to Residential land use. File Date: 2005/10/26
- 393 Pearl Street located 60 m to the north – RSC ID 2378. Residential land use to Residential land use. File Date: 2005/09/26
- 399 Pearl Street located 30 m to the north – RSC ID 2195. Residential land use to Residential land use. File Date: 2005/09/29
- 380 Martha Street located 20 m to the north – RSC ID 226627. Commercial land use to Residential land use. File Date: 2020/04/30
- 388 Martha Street located 25 m northeast – RSC ID 2196. Residential land use to Residential land use. File Date: 2005/09/29
- 2080 Lakeshore Road located 20 m southwest – RSC ID 210472. Parkland land use to Residential land use. File Date: 2013/10/15
- 394 Martha Street located 35 m northeast – RSC ID 2197. Residential land use to Residential land use. File Date: 2005/09/29



- 2082 Pine Street located 35 m north – RSC ID 2194. Residential land use to Residential land use. File Date: 2005/09/29
- 2078 Pine Street located 35 m north – RSC ID 2193. Residential land use to Residential land use. File Date: 2005/09/29
- 398 Pearl Street located 25 m north – RSC ID 45459. Commercial land use to Residential land use. File Date: 2019/08/08
- 2048 Lakeshore Road located 65 m southwest – RSC ID 209314. Commercial land use to Parkland land use. File Date: 2013/08/08
- 2058 Lakeshore Road located 60 m southwest – RSC ID 209751. Commercial land use to Residential land use. File Date: 2013/08/23
- 2082 Pine Street located 75 m to the north – RSC ID 2195. Residential land use to Residential land use. File Date: 2005/09/29
- 399 Elizabeth Street located 30 m north – RSC ID 1311. Residential land use to Residential land use. File Date: 2005/02/08
- 2048 Lakeshore Road located 80 m southwest – RSC ID 210368. Commercial land use to Residential land use. File Date: 2013/10/16

4.2.2 Other Source Information

Other source information listed below were searched as part of the Phase One ESA. The regulatory information requests and responses are provided in Appendix F and summarized below:

Source of Information	Response
Ministry of the Environment, Conservation and Parks (MECP) PCB Storage Sites and Waste Disposal Sites	The MECP PCB Storage Sites and Waste Disposal Sites were searched through ERIS database and reviewed in Section 4.2.1. No PCB Storage Sites or Waste Disposal Sites were identified on the Property or within the Study Area.
Technical Standards and Safety Authority (TSSA)	A response from the TSSA indicated that there are no fuel storage tanks records in the database for the Phase One Property and adjacent properties. The TSSA response and list of addresses searched is provided in Appendix F
Conservation Authority	A response from the governing Conservation Authority indicates that the Property is located within Conservation Halton's jurisdiction but does not fall within a Conservation Halton regulated area. Immediately south of the Property, the Conservation Halton regulates the area near the shoreline of Lake Ontario.
Zoning	The Property is zoned DL-A – Downtown Old Lakeshore Road Zone A by the City of Burlington Zoning By-Law.
Freedom of Information (FOI)	A response from the MECP to the FOI request has not been received as of the date of this report.

A review of the above sources did not identify any Potentially Contaminating Activities (PCAs).



4.3 Physical Setting Sources

4.3.1 Aerial Photographs

Aerial photographs and satellite images were reviewed as part of the Phase One ESA. The developmental chronology of the Property and the Study Area is summarized below and presented in Appendix G.

Year	Source	Property	Study Area
1959	Aerial photograph from City of Burlington	The Property appeared to be developed with a building on the western portion of the Property and a building on the eastern portion of the Property.	The surrounding area appeared to be used for commercial/residential purposes. Lake Ontario was located approximately 60 m to the south of the Property.
1998	Satellite image from City of Burlington	The Property appears to be developed with present day structures.	Developments in the Study Area to the east and west of the Property appear to be shifting towards multi-story, multi-tenant buildings.
2008	Satellite image from City of Burlington	No significant changes observed.	Further development north of the Property.
2017	Satellite image from City of Burlington	No significant changes observed.	The building to the southwest has been demolished and large-scale construction has begun.
2021	Satellite image from City of Burlington	No significant changes observed	Excavation work taking place northeast of the Property. Large residential and commercial building finished to the southwest of the Property.

The review of aerial photographs did not identify any Potentially Contaminating Activities (PCAs).

4.3.2 Topography, Hydrology, Geology

The Ministry of Natural Resources and Forestry (MNRF) and Ministry of Energy, Northern Development and Mines (MENDM) database were searched to obtain topographic and geological maps of Ontario for review. The maps are provided in Appendix H and the information obtained are summarized below:

Records	Information
Topographic Maps	The Property has an approximate ground surface elevation of 82 - 83 masl and is generally flat lying.



Records	Information
Hydrology	The Property is located within the Lower Rambo Creek Watershed. Locally, groundwater is anticipated to flow southeast towards Lake Ontario, approximately 60 m south of the Property.
Geological Maps	<u>Overburden:</u> The overburden soils are composed of clay to silt textured till derived from glaciolacustrine deposits or shale, underlain by bedrock. <u>Bedrock:</u> Bedrock beneath the site is composed of shale, limestone, dolostone and siltstone and are part of the Queenston Formation. <u>Depth to Bedrock:</u> Based on well records within the Study Area, bedrock is encountered at approximately 6 mbgs.

4.3.3 Fill Materials

Fill material was identified in boreholes advanced by Pinchin in the previous Phase Two ESA. No evidence of disturbed soil or fill areas were observed on the Property.

4.3.4 Water Bodies and Areas of Natural Significance

Maps from MNRF were reviewed to determine if water bodies were present on the Property and within the Study Area. The Ontario Ministry of Natural Resources National Heritage Information Centre database for Areas of Natural or Scientific Interest (ANSIs) was also reviewed as part of the Phase One ESA. The maps are provided in Appendix H and the information is summarized below:

Water Bodies	<u>Property:</u> - No water bodies are located on the Property. <u>Study Area:</u> - Lake Ontario, approximately 60 m south - Rambo Creek, approximately 170 m east
Wetlands	<u>Property:</u> - No Provincially Significant, Non-Provincially Significant, or Unevaluated wetlands are located on the Property. <u>Study Area:</u> - No Provincially Significant, Non-Provincially Significant, or Unevaluated wetlands are located within the Study Area.
ANSIs	<u>Property:</u>



	- No Provincially Significant Life Science or Earth Science ANSIs are located on the Property. <u>Study Area:</u> - No Provincially Significant Life Science or Earth Science ANSIs are located within the Study Area.

4.3.5 Well Records

The Ministry of the Environment, Conservation and Parks (MECP) well records database was accessed online and through ERIS search. All the well records located on the Property and in the Study Area were identified. The comprehensive well record is provided in Appendix I and is summarized below:

Well Records	- Thirty-five (35) monitoring & test wells/holes were identified in the Study Area - Three (3) not used wells were identified in the Study Area - One (1) other well was identified in the Study Area - Five (5) unknown wells were identified in the Study Area
Stratigraphy	- Earth Fill: 0 – 3 mbgs - Sand: 0 – 2 mbgs - Silt: 2 – 3 mbgs - Till: 3 – 5 mbgs - Red Shale: 5 – 25 mbgs
Depth to Bedrock	Bedrock was encountered at 5 - 6 mbgs
Depth to the Water Table	The depth to the water table was measured between 0.6 – 10 mbgs.

4.3.6 Municipal Drinking Water System

The Phase One Property and all other properties within the Phase One Study Area appear to be supplied by a municipal drinking water system as defined in the Safe Drinking Water Act, 2002.

4.3.7 Well-Head Protection Area

The Phase One Property is not located within an area designated in the official plan of the municipality as a well-head protection area or another area designated in the official plan as an area for the protection of groundwater.

5 Site Operating Records

No site operating records were provided for review.



6 Interviews

Interviewee(s)	JoAnn Landry, Broker of Record & President
Date of Interview	February 27, 2023
Location and Methods of Interview	In Person
Justification for Selection	JoAnn Landry has been involved with the Property since 2002.
Relevant Information concerning Potentially Contaminating Activities	• The Property has been in commercial use for over 20 years. • To their knowledge the site has not been used, past or present, for: ○ Industrial operations ○ On-site dry cleaning, ○ Fuel distribution or storage, ○ Vehicle servicing and/or maintenance ○ No bulk storage of chemicals or hazardous products at the Property ○ No knowledge of existing or historical underground/above grade tanks ○ Property is not considered a waste generator with the MECP ○ Property not a registered PCB storage facility ○ No knowledge of spills or leaks of any kind at the Property ○ No wastewater produced at the Property ○ No air emissions produced at the Property ○ No knowledge of any public agency investigations at the Property.

The interview did not identify any PCAs.

7 Site Reconnaissance

7.1 General Requirements

Date and Time of Investigation	8 am, February 27, 2023
Weather Condition	Overcast, windy and -7 °C
Duration of Investigation	3 hours



Was the Facility Operating at the Time of Investigation?	2072 Lakeshore Road was operating as an office.
Name and Qualifications of the Person Conducting the Investigation	Lindsay Levesque, B.Sc., EP

A site reconnaissance of the Phase One Property consisted of detailed observation of the Property including exterior and interior portions of any existing buildings on site, documentation of any areas of potential environmental concern and illustration of relevant structures. Phase One Property features are displayed in Figure 2 and site photographs are presented in Appendix J. The results of the site reconnaissance are provided below.

7.2 Specific Observations at Phase One Property

7.2.1 Exterior Site Conditions

The utilities and services on the Property is summarized below:

Hydro	Buried hydro enters the Property via the south boundary through Old Lakeshore Road.
Gas	Gas lines enter the Property via the south boundary through Old Lakeshore Road.
Communication	Buried communication lines enter the Property via the south boundary through Old Lakeshore Road.
Electrical/Street Lighting	Electrical lines enter the Property via the south boundary through Old Lakeshore Road
Storm Sewer	A catch basin was observed within the parking lot of the Property.
Sanitary Sewer	Manholes were not observed on the Property.
Water Source	The Property is serviced with municipal water.

7.2.2 Building Structures and Building Systems

One building was observed on the Property. The building was built prior to 1970 with an addition constructed in 1995.



Building #	Above Grade Levels	Below Grade Levels	Use	Entry/Exits
2072 Lakeshore Road	Two (2)	One (1)	Commercial (office)	Off of Lakeshore Road and Old Lakeshore Road
Building #		2072 Lakeshore Road		
Walls		Dry wall, brick		
Floors		Tile, carpet		
Ceilings		Suspended ceiling tiles, possible asbestos		
Lighting		Fluorescent/LED		
Exterior		Brick, poured concrete		
Roof (if accessed)		Not Accessed		
Heating and Cooling System		Natural gas		
Drains, Pits, Sumps Observed		No drains, pits, or sumps observed		
Staining and Corrosion		No staining or corrosion observed		
Air Emissions		No sources of air emissions were observed		

7.2.3 Designated Substances and Other Special Attention Items

The non-destructive inspection was carried out in accessible areas and only included a visual assessment for the potential presence of the following materials. No sampling of the building materials was completed:

Asbestos	No obvious evidence of building materials containing asbestos were visually observed in the accessed areas during the site inspection. However, based on the dates of construction of the onsite buildings (prior to 1980), some asbestos containing materials may be present.



Lead	No obvious evidence of materials containing lead were visually observed in the accessed areas during the site inspection. However, based on the dates of construction of the onsite buildings (prior to 1980), some lead containing materials (paint and plumbing) may be present.
Mercury	No obvious evidence of materials containing mercury were visually observed in the accessed areas during the site inspection.
PCBs	No obvious evidence of PCB-containing materials were visually observed in the accessed areas during the site inspection. However, based on the dates of construction of the onsite buildings (prior to 1980), some PCB-containing materials (light ballasts) may be present.
Ozone Depleting Substances	No ozone depleting substances were visually observed in the accessed areas during the site inspection.
UFFI	No obvious evidence of UFFI products were visually observed in the accessed areas during the site inspection.
Mold	No mold depleting substances were visually observed in the accessed areas during the site inspection.
Radioactive Materials	No manmade sources of radiation were observed in the accessed areas during the site inspection.
Herbicides and Pesticides	During the site inspection, no materials containing herbicides or pesticides were observed to be stored or used in the accessed areas at the site.

7.2.4 Above Ground Storage Tanks

One (1) above ground storage tank (AST) was observed on the Property within the crawlspace under the building. The tank was not in use and wrapped in plastic. No odors or staining were observed in the crawlspace. Grounded is of the opinion that this is a decommissioned storage tank, the use of which is unknown, and is not considered a PCA.

7.2.5 Underground Storage Tanks and Below Grade Structures

No obvious evidence of underground storage tanks (USTs) was visually observed on the accessed areas of Property. A hatch was observed in the office, indicating a possible underground structure.



7.2.6 Enhanced Investigation Property

The Property is considered to be an Enhanced Investigation Property due to its historical use as a gas station.

7.3 Investigation of the Phase One Study Area

The site investigation includes an inspection of the Phase One Study Area (Study Area). The adjacent properties were identified below during the investigation.

North	Lakeshore Road (community use) followed by an active construction site (proposed residential land use)
South	Old Lakeshore Road (community land use) followed by a motel (commercial land use)
West	Pearl Street (community land use) followed by a high-rise residential tower (residential land use)
East	Construction site (proposed residential land use based on the signage)

The investigation of the Study Area did not identify any PCAs.

7.4 Water Wells, Waterbodies & Areas of Natural Significance

7.4.1 Water Wells

The Phase One Property and all properties within the Study Area appear to be serviced by a municipal drinking water system.

7.4.2 Waterbodies

There are no waterbodies present on the Phase One Property; the following waterbodies were noted in the Study Area:

Location of Waterbody	Description of Waterbody
60 m South	Lake Ontario
170 m East	Rambo Creek



7.4.3 Areas of Natural Significance

There are no Areas of Natural Significance present on the Phase One Property or within the Study Area.

7.5 Written Description of Investigation

The site reconnaissance identified the following PCAs:

Location of PCA	PCA	Description
Phase One Property	#Other1 – De-icing activities	Salting of the walkways and parking lot was observed during the site reconnaissance.

8 Review and Evaluation of Information

8.1 Current and Past Uses

A Table of Current and Past Uses of the Phase One Property in a form approved by the Director with description of the current and past uses of the Phase One Property to its first developed use is provided in Table 1.

8.2 Potentially Contaminating Activity

The Phase One ESA has been prepared in accordance with Ontario Regulation 153/04 (O.Reg. 153/04). Based on the review of all available historical information and a detailed inspection of the Phase One Property, the following Potentially Contaminating Activities (PCAs) have been identified on the Property and within the Study Area. Areas of Potential Environmental Concerns (APECs) are also identified subsequently.



Location of PCA	PCA	APEC (Yes/No)	Rationalization
2072 Lakeshore Road (formerly 2071 Lakeshore Road) Phase One Property	#28 _A – Gasoline and Associated Products Storage in Fixed Tanks	Yes (APEC 1)	FIP: The Site was occupied by an auto service station with a UST located on the west side of the property on the 1971 FIP. COT: Owned by Sun Oil Company Limited in 1954. CD: French Douglas Sunco Service Station in 1978, Gore Park Sunco Service Station in 1968, and Pascoe & Lee Sunoco Service Station in 1963. Previous Reports: Although Pinchin investigated the former gasoline station at the Property, Grounded is of the opinion that the wells require additional sampling before a determination on whether the PCA can be ruled out can be made. Due to the PCA being on the Property, the QP is of the opinion that the PCA has potential to cause an APEC on the Property.
	#30 _A - Importation of Fill Material of Unknown Quality	Yes (APEC 2)	The boreholes advanced by Pinchin indicated fill materials are present at the Site. Due to the PCA being on the Property, the QP is of the opinion that the PCA has potential to cause an APEC on the Property.
2072 Lakeshore Road (formerly 2071 Lakeshore Road) Exterior Portion of Phase One Property	#Other1 _A – De-icing activities	Yes (APEC 3)	Site Reconnaissance: Salting of the walkways and parking lot was observed during the site reconnaissance. Due to the PCA being on the Property, the QP is of the opinion that the PCA has potential to cause an APEC on the Property.
2079 Lakeshore Road. 20 m north	#34 _A – Metal Fabrication	Yes (APEC 4)	FIPs: A machine shop was located in the northern portion of the building at 2079 Lakeshore Road in the 1971 FIP. Due to proximity and upgradient location, the QP is of the opinion that the PCA has potential to cause an APEC on the Property.
2076 Old Lakeshore Road 20 m south	#28 _B – Gasoline and Associated Products Storage in Fixed Tanks	Yes (APEC 5)	FIPs: Two USTs were observed on the 1924/1932 FIPs. Due to proximity, the QP is of the opinion that the PCA has potential to cause an APEC on the Property.



Location of PCA	PCA	APEC (Yes/No)	Rationalization
2093 Lakeshore Road 50 m east	#Other3 _A – Spills	No	ERIS: A spill of hydraulic oil (20L) was reported at this address in 2006 which indicated that soil contamination was possible. Due to the location of the PCA and small volume of the spill, the QP is of the opinion that the PCA does not have the potential to cause an APEC on the Property.
2042 Lakeshore Road. (Formerly 32 Water East) 80 m southwest	#28 _C – Gasoline and Associated Products Storage in Fixed Tanks	No	FIPs: 3 USTs in the 1932 FIPs. A gasoline station with 1 UST in the 1971 FIP. CD: Lakeshore Fina Service Centre in 1978, Rolf's Fina Service Station in 1973, Emerson S & Son Fina Service Station in 1968, Canadian Petrofina Ltd Service Station in 1963. ERIS: 1 retail fuel oil tank in 1991, 1 delisted expired fuel tank that expired in 2009, and generator of oil skimmings & sludges and light fuels in 2013-2014, when it was occupied by Suncor Energy Products. Due to the location of the PCA, the QP is of the opinion that the PCA does not have the potential to cause an APEC on the Property.
2092 Old Lakeshore Road 80 m northeast	#10 _A - Commercial Autobody Shops	No	FIPs: An Auto Service with 1 UST in the 1971 FIP. CD: An auto service station on the 1971 FIP. Due to the location of the PCA, the QP is of the opinion that the PCA does not have the potential to cause an APEC on the Property.
	#28 _D – Gasoline and Associated Products Storage in Fixed Tanks		
2119 Old Lakeshore Road 150 m northeast	#10 _B - Commercial Autobody Shops	No	FIPs: An Auto Service with 2 USTs in the 1932 FIP. An Auto Service with 1 UST in the 1971 FIP. CD: Hall's Service Station in 1973/1968/1963. ERIS: 99 L of transformer oil to the ground due to rotten pole in 1996. Due to the location of the PCA, the QP is of the opinion that the PCA does not have the potential to cause an APEC on the Property.
	#28 _E – Gasoline and Associated Products Storage in Fixed Tanks		
	#Other3 _B – Spills		



Location of PCA	PCA	APEC (Yes/No)	Rationalization
2047 Lakeshore Road/399 Elizabeth Street 80 west	#Other3 _C – Spills	No	ERIS: Burlington Hydro reported a spill of 10 L transformer oil to the ground in 1992. Burlington Hydro reported a spill containing PCB transmission oil to the ground in 2001. Due to the location of the PCA, the QP is of the opinion that the PCA does not have the potential to cause an APEC on the Property.
Parking Lot at Lakeshore and Elizabeth 80 m southwest	#Other3 _D – Spills	No	ERIS: Burlington PUC Vehicle spilled 8 L of hydraulic oil to the parking lot in 1990. Due to the location of the PCA, the QP is of the opinion that the PCA does not have the potential to cause an APEC on the Property.
399 Elizabeth Street 100 m southwest	#10 _C - Commercial Autobody Shops	No	FIPs: A garage, repairs facility and show room were observed with two USTs were observed adjacent to the facility on Elizabeth Street on the 1924/1932 FIPs. Due to the location of the PCA, the QP is of the opinion that the PCA does not have the potential to cause an APEC on the Property.
	#28 _F – Gasoline and Associated Products Storage in Fixed Tanks		
2046 Pine Street 100 m west	#10 _D - Commercial Autobody Shops	No	CD: Oilfield Auto Service in 1963. Due to the location of the PCA, the QP is of the opinion that the PCA does not have the potential to cause an APEC on the Property.
2029-2031 Lakeshore Road 130 m southwest	#28 _G – Gasoline and Associated Products Storage in Fixed Tanks	No	FIPs: A gasoline and service station with 2 USTs in the 1932 FIP. An Auto Service with 1 UST in the 1971 FIP. CD: Lakeshore Texaco Service Station in 1973, Lakeshore Autobody in 1975-1980, and Russel's Autobody in 1970-1975. Due to the location of the PCA, the QP is of the opinion that the PCA does not have the potential to cause an APEC on the Property.
	#10 _E - Commercial Autobody Shops		
2027 Lakeshore Road (formerly 21 Water Street) 140 m southwest	#10 _F - Commercial Autobody Shops	No	FIPs: A garage and service station with two USTs were observed on the property on the 1924/1932 FIPs. Due to the location of the PCA, the QP is of the opinion that the PCA does not have the potential to cause an APEC on the Property.
	#28 _H – Gasoline and Associated Products Storage in Fixed Tanks		
	#Other2 _A – Coal Storage	No	



Location of PCA	PCA	APEC (Yes/No)	Rationalization
396 Elizabeth Street 165 m west	#59 _A – Wood Treating and Preservative Facility and Bulk Storage of Treated and Preserved Wood Products		FIPs: A coal shed and wood yard was observed on the 1898, 1910, 1924 and 1932 FIPs. Due to the location of the PCA, the QP is of the opinion that the PCA does not have the potential to cause an APEC on the Property.
420 Martha Street 180 m north	#18 _A – Electricity Generation, Transformation and Power Stations	No	CD: Burlington Hydro in 2008 and 2013. Due to the location and distance of the PCA, the QP is of the opinion that the PCA does not have the potential to cause an APEC on the Property.
2020 Lakeshore Road. (Former address of 34 and 42 Water Street) 220 m southwest	#28 _I – Gasoline and Associated Products Storage in Fixed Tanks	No	FIPs: Dominion Cannery (Canning & Ketchup Factory) was observed at the current location of 2020 Lakeshore Road (220 m southwest of the Site) at the former address of 34 and 42 Water Street on the 1910, 1924 and 1932 FIPs. A tank was also observed on Water Street, north of the facility (only visible on the 1910 FIP). Due to the location and distance of the PCA, the QP is of the opinion that the PCA does not have the potential to cause an APEC on the Property.
No address, middle northern portion of the Study Area	#18 _B – Electricity Generation, Transformation and Power Stations	No	FIPs: A Hydro Electric Power Commission Transmission Line was observed north of the Site, on the north side of Pine Street. The transmission line expanded along the entire Study Area on the 1924/1932 FIPs. Due to the location and distance of the PCA, the QP is of the opinion that the PCA does not have the potential to cause an APEC on the Property.

8.3 Areas of Potential Environmental Concern

A table of Areas of Potential Environmental Concern in a form approved by the Director is provided in Table 2. The rationale for the conclusion as to the existence of APECs are summarized above in Section 8.2 of the Phase One ESA.

No uncertainty or absence of information obtained in the Phase One ESA is identified to have an effect on the conclusion of the Phase One ESA.

8.4 Phase One Conceptual Site Model

A Phase One Conceptual Site Model (CSM) is provided in Appendix K.



9 Conclusions

9.1 Whether Phase Two Environmental Site Assessment Required Before Record of Site Condition Submitted

Based on the results of the Phase One ESA, a Phase Two ESA will be required prior to the submission of a Record of Site Condition (RSC). A Phase Two ESA is required to assess the soil and groundwater quality on site to address the identified APECs on the Property.

9.2 Record of Site Condition Based on Phase One Environmental Site Assessment Alone

Based on the results of the Phase One ESA, a Phase Two ESA will be required prior to the submission of a Record of Site Condition (RSC). A Phase Two ESA is required to assess the soil and groundwater quality on site to address the identified APECs on the Property. An RSC cannot be submitted based on the Phase One ESA alone.

9.3 Signatures

The Phase One ESA was conducted by Lindsay Levesque, B.Sc., EP under the supervision of Freesia Waxman, P.Eng., QP_{ESA}. The Phase One ESA has been conducted in general accordance with Ontario Regulation 153/04 (O.Reg. 153/04).

We trust that this report meets your requirements at present.

For and on behalf of our team,



Lindsay Levesque, B.Sc., EP
Consultant



Freesia Waxman, M.A.Sc., P.Eng., QP_{ESA}
Senior Project Engineer



10 References

1. Armstrong, D.K. and Dodge, J.E.P. *Paleozoic Geology Map of Southern Ontario*. Ontario Geological Survey, Miscellaneous Release–Data 219.
2. Chapman, L.J. and Putnam, D.F. 2007. *The Physiography of Southern Ontario*. Ontario Geological Survey. Miscellaneous Release–Data 228.
3. City of Burlington Air Photos. Retrieved from:
<https://burlington.maps.arcgis.com/apps/MapSeries/index.html?appid=1d1783b1e626434f95076cba33a5e540>
4. City of Burlington Zoning Bylaw Interactive Map. Retrieved from:
<https://burlington.maps.arcgis.com/apps/webappviewer/index.html?appid=5bfd88175dea4cc080f46140fd839567>
5. Conservation Halton Planning & Permits Map. Retrieved from:
<https://camaps.maps.arcgis.com/apps/webappviewer/index.html?id=a2928bf280194294a4027111f8ff284a>
6. Gao, C., Shiota, J., Kelly, R.I., Brunton, F.R., van Haaften, S. 2006. Bedrock topography and overburden thickness mapping, southern Ontario. Ontario Geological Survey. Miscellaneous Release—Data 207.
7. Ontario Geological Survey. 2011. 1:250,000 scale bedrock geology of Ontario. Ontario Geological Survey. Miscellaneous Release—Data 126–Revision 1.
8. Ontario Geological Survey. 2010. Surficial geology of Southern Ontario. Ontario Geological Survey. Miscellaneous Release—Data 128–Revised.
9. Ontario Geological Survey. 2000. Quaternary geology, seamless coverage of the Province of Ontario. Ontario Geological Survey. Data Set 14—Revised.
10. Ministry of Environment, Conservation and Parks (MECP). Water Well Information System, Data Catalogue. Retrieved from: <https://data.ontario.ca/dataset/well-records11>.
11. Pinchin Ltd. Phase One Environmental Site Assessment, 2072 Lakeshore Road, Burlington, Ontario. File No.: 233963. Issued January 11, 2019.
12. Pinchin Ltd. Phase Two Environmental Site Assessment, 2072 Lakeshore Road, Burlington, Ontario. File No.: 233698.001. Issued March 9, 2019.
13. Toronto and Region Conservation Authority (TRCA). Regulated Area Search. Retrieved from: <https://trca.ca/planning-permits/regulated-area-search-v3/>



11 Limitations and Restrictions

The assessment should not be considered a comprehensive investigation that eliminates all risks of encountering environmental problems. The information presented in this report is based on information collected during the completion of the Phase One Environmental Site Assessment by Grounded Engineering Inc. It was based on the conditions on the Phase One Property at the time of the site inspection supplemented by a review of historical information to assess the environmental conditions regarding the Phase One Property.

Sampling and analysis of soil, groundwater or any other material was not carried out as part of the Phase One Environmental Site Assessment. As a result, the presence and/or extent of any adverse environmental impact cannot be confirmed. The potential for environmental liability and/or environmental impact is an opinion as a result of the scope of this assessment.

In assessing the environmental conditions and history of the Phase One Property, Grounded Engineering Inc. has relied on information provided by others, as noted in this report, and has assumed that the information provided by those individuals is factual and accurate. Grounded Engineering Inc. accepts no responsibility for any deficiency or inaccuracy in this report resulting from the information provided by those individuals.



If new information regarding the environmental condition of the Phase One Property is identified during future work, or outstanding responses from regulatory agencies indicate outstanding issues on file with respect to the Phase One Property, Grounded Engineering Inc. should be notified so that we may re-evaluate the findings of this assessment and provide amendments.

11.1 Report Use

The authorized user of this report is Trinity Point, for whom this report has been prepared. Grounded Engineering Inc. maintains the copyright and ownership of this document. Reproduction of this report in any format or medium requires explicit prior authorization from Grounded Engineering Inc.

FIGURES



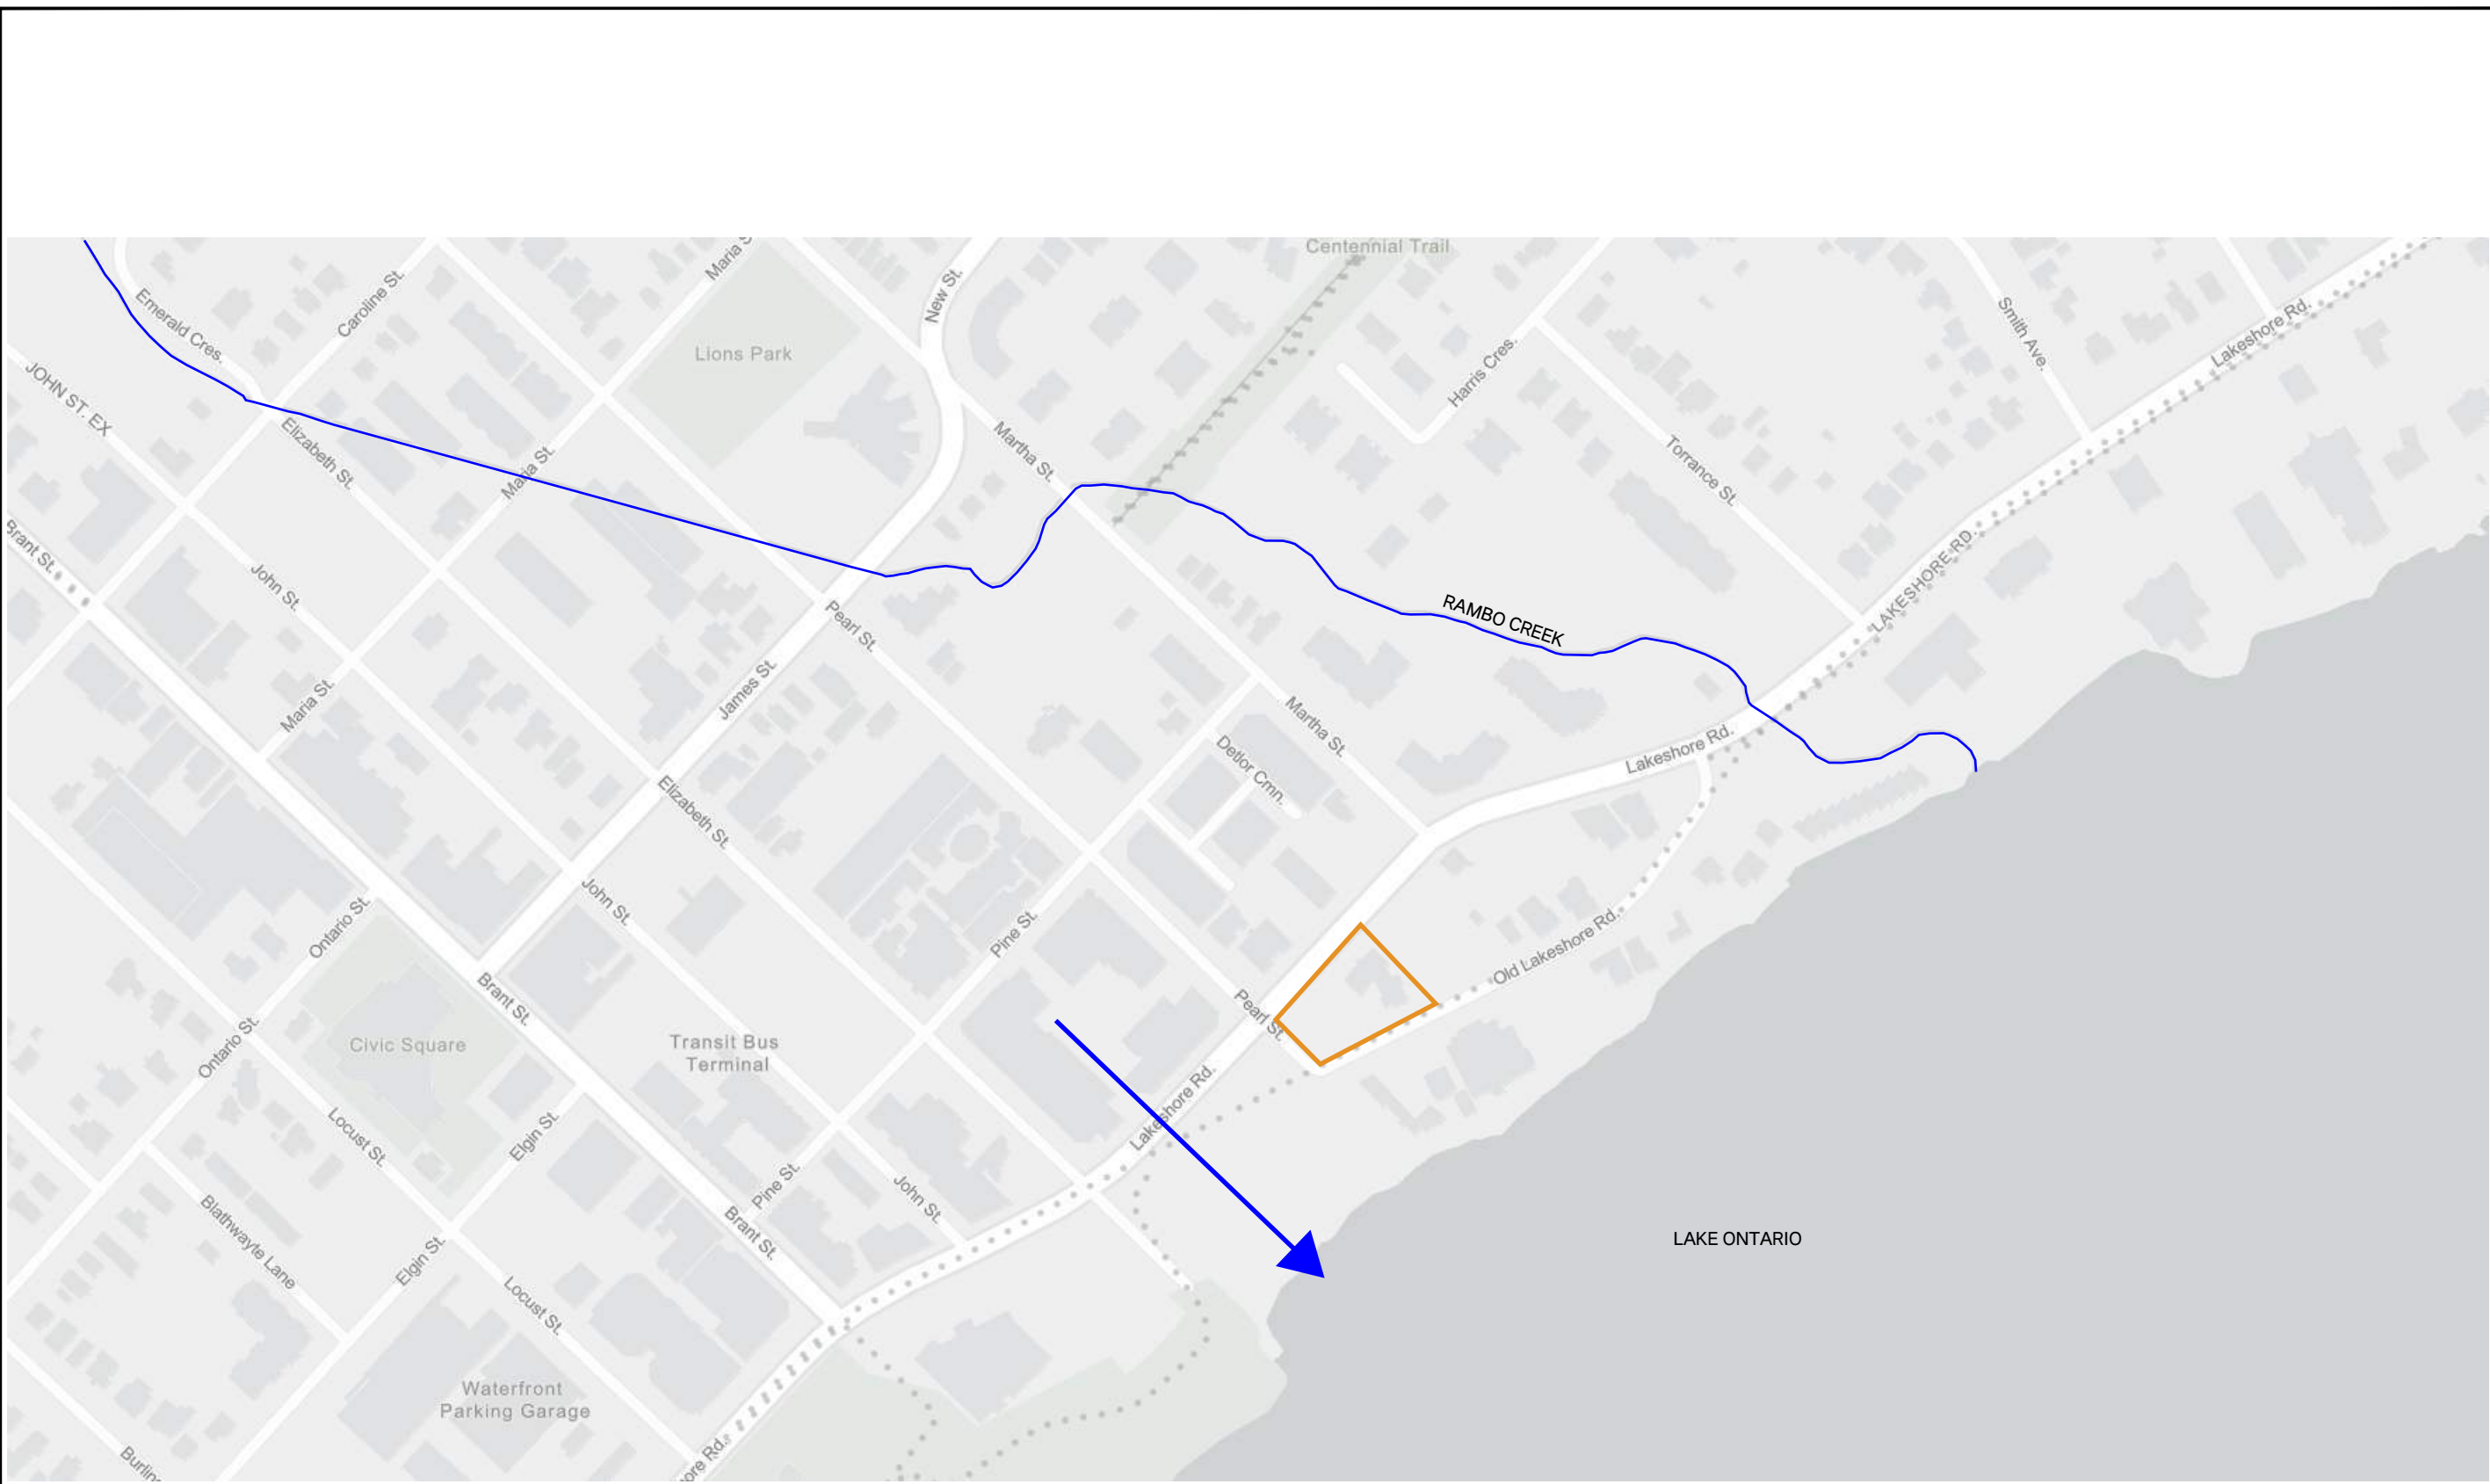



**GROUND
ENGINEERING**

1 BANIGAN DRIVE, TORONTO, ONT., M4H 1G3
www.groundedeng.ca

LEGEND

— PROPERTY BOUNDARY

➡ INFERRED GROUNDWATER FLOW DIRECTION

Note

Reference

ArcGIS Map


Project

**2072 LAKESHORE ROAD,
BURLINGTON, ONTARIO**

Figure Title

SITE LOCATION PLAN

North

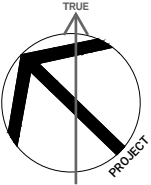

Date

MARCH 2023

Scale

AS INDICATED

Job No

22-282

Figure No

FIGURE 1



GROUND
ENGINEERING

1 BANIGAN DRIVE, TORONTO, ONT., M4H 1G3
www.groundedeng.ca

LEGEND

- PROPERTY BOUNDARY
- EXISTING BUILDING STRUCTURE
- FORMER BUILDING STRUCTURE
- MONITORING WELL/BOREHOLE BY OTHERS
- GAS
- ELECTRICAL
- BURIED HYDRO
- WATER
- COMMUNICATION
- MANHOLE
- CATCH BASIN

Note

Reference

Survey Drawing no. 35165.
Certificate date: November 21, 2016.
Prepared by A.T. McLaren Limited.
Received on April 13, 2022.


Project

**2072 LAKESHORE ROAD
BURLINGTON, ONTARIO,**

Figure Title

PHASE ONE PROPERTY

North

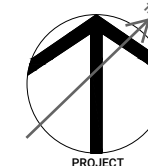

Date

MARCH 2023

Scale


AS INDICATED

Job No

22-282

Figure No

FIGURE 2

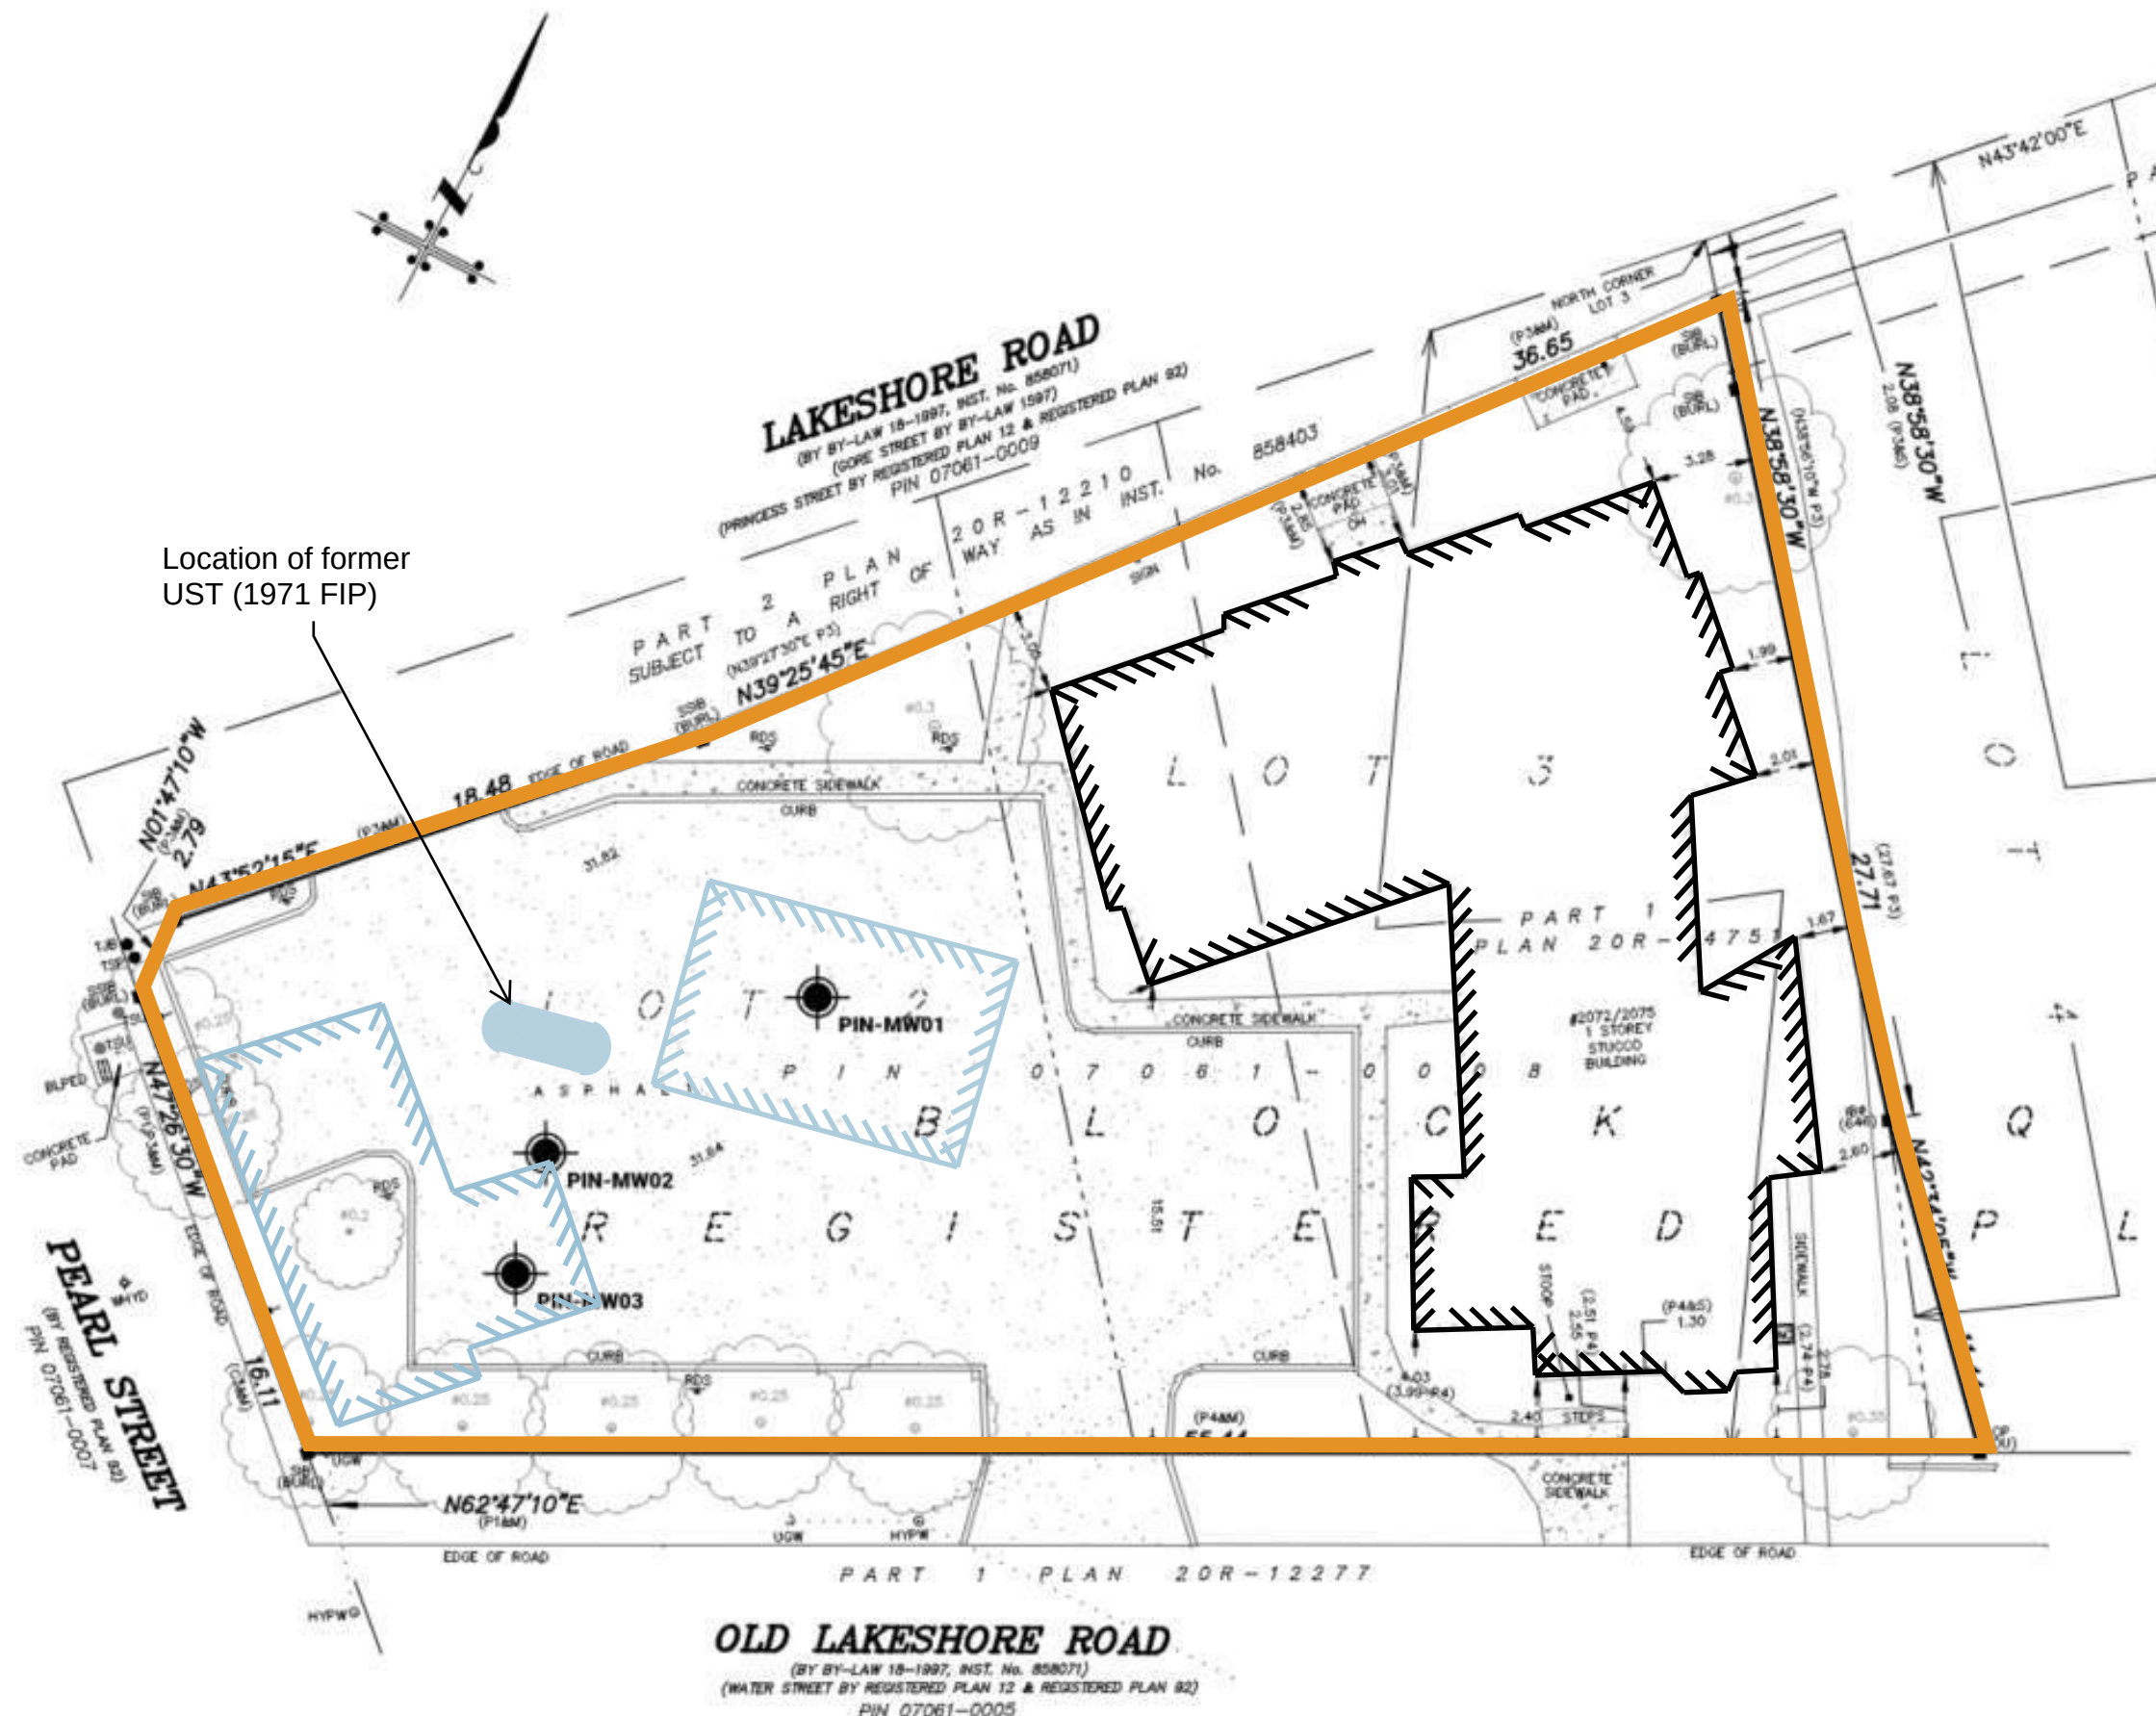

0 m 5 m 10 m





GROUND
ENGINEERING

1 BANIGAN DRIVE, TORONTO, ONT., M4H 1G3
www.groundedeng.ca

LEGEND

- PROPERTY BOUNDARY
- STUDY AREA (250 m RADIUS)
- AGRICULTURAL OR OTHER LAND USE
- COMMERCIAL LAND USE
- COMMUNITY LAND USE
- INDUSTRIAL LAND USE
- RESIDENTIAL, PARKLAND, AND INSTITUTIONAL LAND USE

Note

Reference

ArcGIS Map

Project

**2072 LAKESHORE ROAD,
BURLINGTON, ONTARIO**

Figure Title

**PHASE ONE STUDY
AREA**

North



Date

MARCH 2023

Scale

AS INDICATED

Job No

22-282

Figure No

FIGURE 3



GROUND
ENGINEERING

1 BANIGAN DRIVE, TORONTO, ONT., M4H 1G3
www.groundedeng.ca

LEGEND

- PROPERTY BOUNDARY
- STUDY AREA (250 m RADIUS)
- #10 – Commercial Autobody Shops
- #18 – Electricity Generation, Transformation and Power Stations
- #28 – Gasoline and Associated Products Storage in Fixed Tanks
- #30 – Importation of Fill Material of Unknown Quality
- #34 – Metal Fabrication
- #59 – Wood Treating and Preservative Facility and Bulk Storage of Treated and Preserved Wood Products
- #01 – De-icing Activities
- #02 – Coal Storage
- #03 – Ontario Spills


- PROPERTY/BUILDING OUTLINE WHERE APEC-CAUSING PCA OCCURRED
- UNDERGROUND FUEL STORAGE TANK - Historic

Note
GREEN - PCA NOT CAUSING APEC
RED - PCA CAUSING APEC

Reference
ArcGIS Map

Project
**2072 LAKESHORE ROAD,
BURLINGTON, ONTARIO**

Figure Title
PCA LOCATIONS

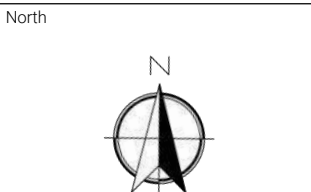


Date
FEBRUARY 2023

Scale
AS INDICATED

Job No
22-282

Figure No
FIGURE 4

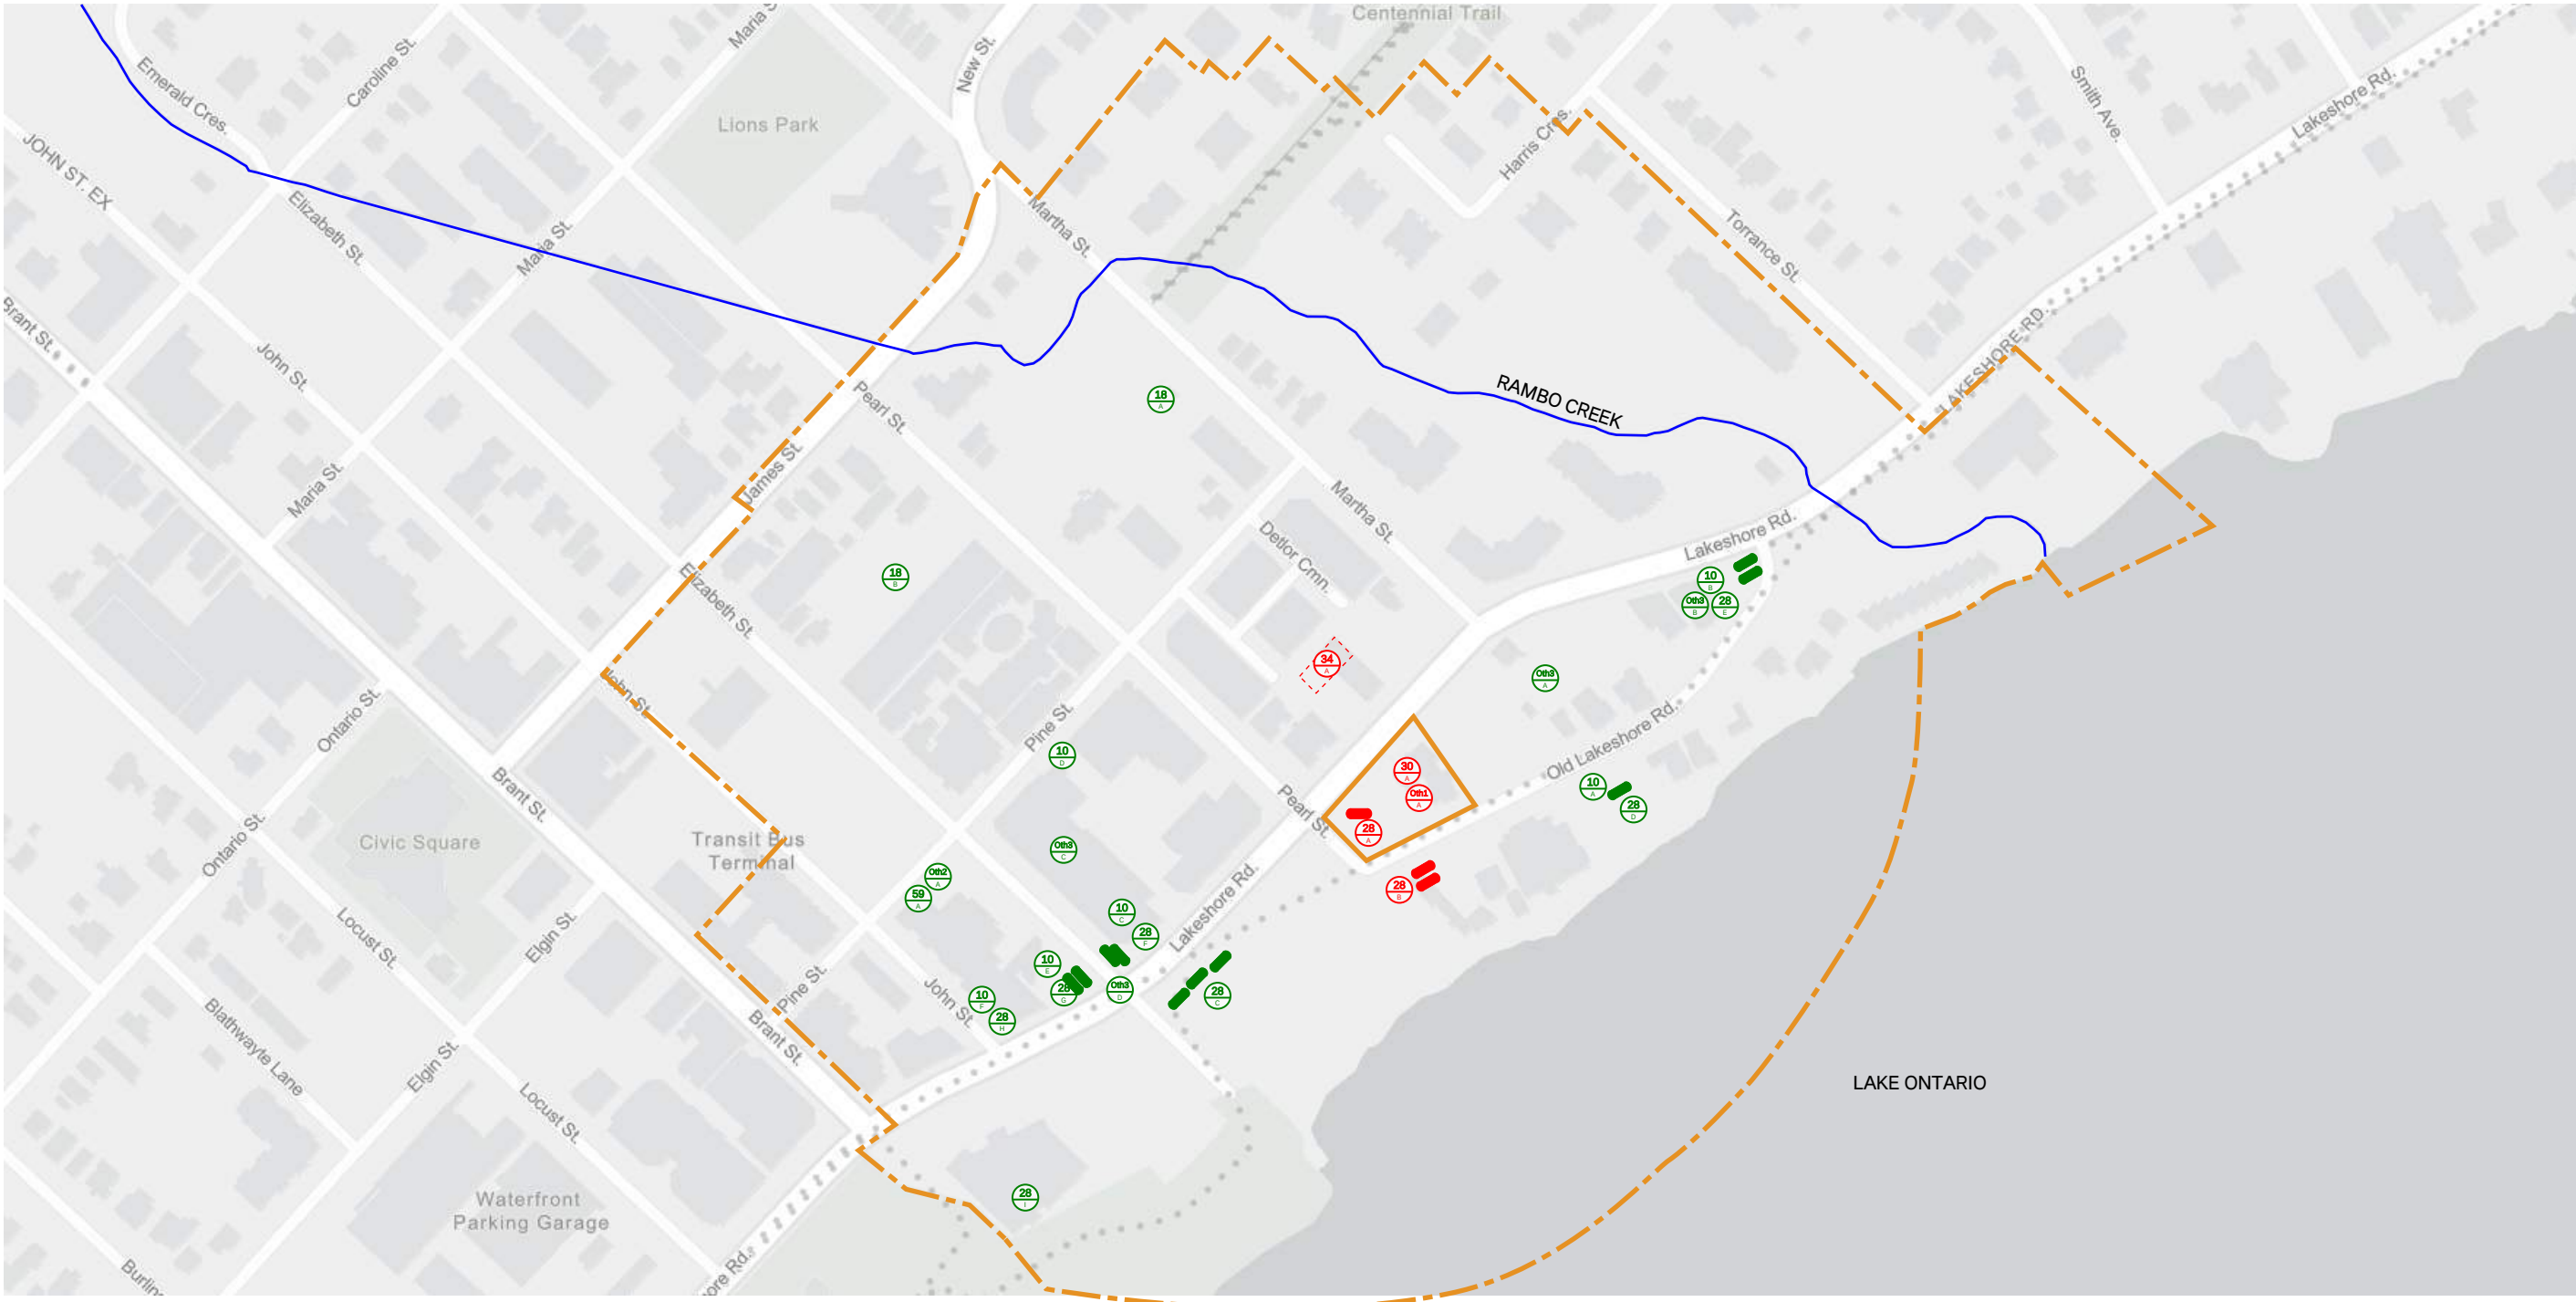



GROUND
ENGINEERING

1 BANIGAN DRIVE, TORONTO, ONT., M4H 1G3
www.groundedeng.ca

LEGEND

- PROPERTY BOUNDARY
- EXISTING BUILDING STRUCTURE
- MONITORING WELL/BOREHOLE BY OTHERS
- APEC 1
- APEC 2 & 3
- APEC 4
- APEC 5
- FORMER BUILDING STRUCTURE

Note

Reference

Survey Drawing no. 35165.
Certificate date: November 21, 2016.
Prepared by A.T. McLaren Limited.
Received on April 13, 2022.

Project

**2072 LAKESHORE ROAD,
BURLINGTON, ONTARIO**

Figure Title

APEC LOCATIONS

North



Date

MARCH 2023

Scale


AS INDICATED

Job No

22-282

Figure No

FIGURE 5

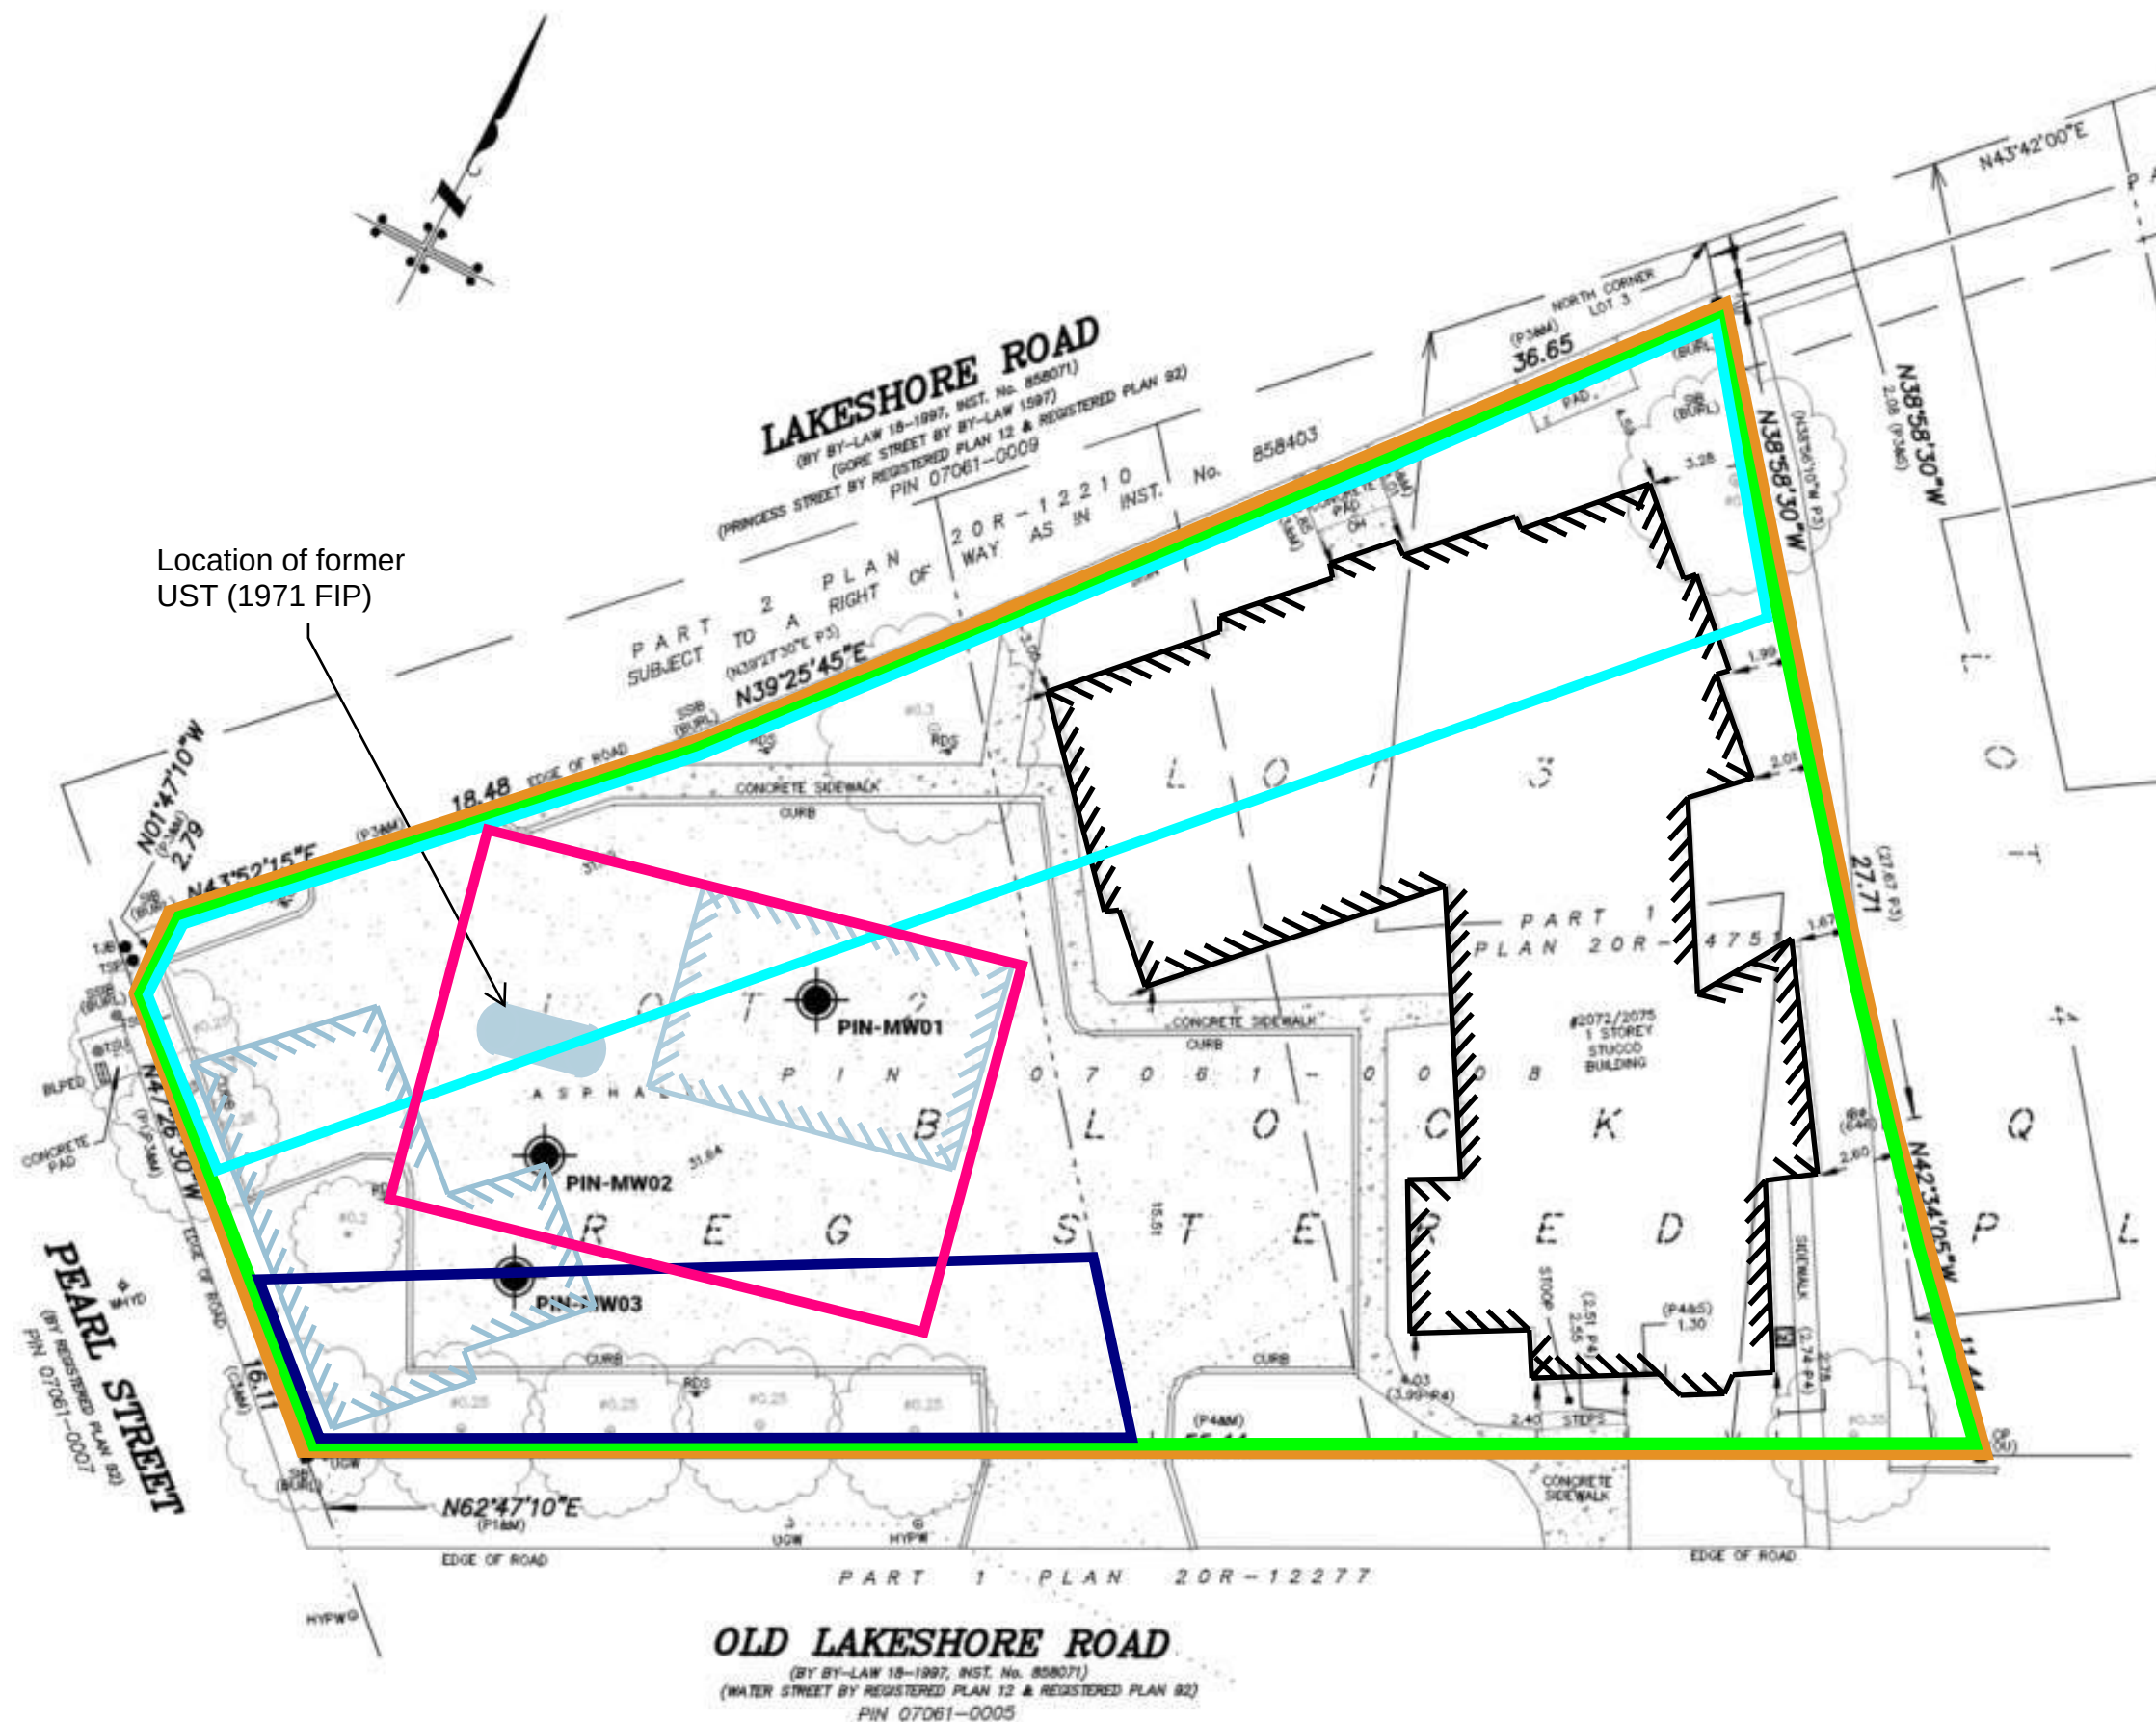

0 m 5 m 10 m

TABLE 1



TABLE 1:
TABLE OF CURRENT AND PAST USES OF THE PHASE ONE PROPERTY
(Refer to clause 16(2)(b), Schedule D, O. Reg. 153/04)
2072 Lakeshore Road, Burlington

(Lot 2), Pin 07061-0008 (LT)					
Year	Name of Owner	Description of Property Use	Property Use	Other Observations from Aerial Photographs, Fire Insurance Plans, Etc.	
March 2023 to Present	Acamar Dwelling Corp.	Real Estate Offices	Commercial	2021 SI: No significant changes	
2019 - March 2023	Peter John Gerard Landry, Joann Katherine Landry			2017 SI: No significant changes	
2002 - 2019	David Paul Landry Peter John Gerard Landry			2008 SI: No significant changes	
1986 - 2002	Royal LePage Real Estate Services Ltd.			1998 AP: Property appears to be developed with present day structures.	
1980 - 1986	A.E. LePage Real Estate Services Limited			No other observations	
1977 - 1980	Doug French Holdings Inc.	1978 CD: Auto Service Station			
1954 - 1977	Sun Oil Company Limited	Auto Service Station		1971 FIP: Occupied by an auto service station 1968 CD: Occupied by an auto service station 1963 CD: Occupied by an auto service station 1959 AP: Property developed with undetermined structures	
1944 - 1954	Howard S. Ditmars & Mary E. Ditmars	Residential		Residential	No other observations
1932 - 1944	Norah Kathleen Wright				No other observations
1926 - 1932	Thomas Mortimer				No other observations
1921 - 1926	Alice Mortimer		No other observations		
1920 - 1921	Thomas Atkinson		No other observations		
1885 - 1920	Mary Atkinson - Estate		1910 FIP: Property was developed with two residential structures		
1883 - 1885	Frederick Ball		Presumably agricultural land, possibly developed for residential purposes	Agriculture or Other	No other observations
1881 - 1883	The Hamilton Provident and Loan Society				No other observations
1881 - 1881	Catherine Agnes Greene & Thomas Greene				No other observations
1876 - 1881	John White				No other observations
1774 - 1876	John McGildouney Boyd				No other observations
1866 - 1874	John Waldie				No other observations
1864 - 1866	John R. Minkirknick				No other observations
1853 - 1864	Thomas Baxter				No other observations
1844 - 1853	William Chapman				No other observations
1829 - 1844	Andrew Gage				No other observations
1798 - 1829	Capt. Joseph Brant				No other observations
Pre-1798	Crown				No other observations

(Lot 3), Pin 07061-0008 (LT)				
Year	Name of Owner	Description of Property Use	Property Use	Other Observations from Aerial Photographs, Fire Insurance Plans, Etc.
March 2023 to Present	Acamar Dwelling Corp.	Real Estate Offices	Commercial	2021 SI: No significant changes
2019 - March 2023	Peter John Gerard Landry, Joann Katherine Landry			
2002 - 2019	David Paul Landry, Peter John Gerard Landry			
1986 - 2002	Royal LePage Real Estate Services Limited			
1980 - 1986	A. E. LePage Real Estate Services Limited	Auto Service Station		2017 SI: No significant changes 2008 SI: No significant changes 1998 AP: Property appears to be developed with present day structures.
1973 - 1980	Brian Cooper Limited			No other observations
1973 - 1973	The Estaminet Investments Limited			1978 CD: Auto Service Station
1960 - 1973	The Estaminet Limited			No other observations 1971 FIP: Occupied by an auto service station 1968 CD: Occupied by an auto service station 1963 CD: Occupied by an auto service station
1957 - 1960	I. B. & J. Investments Limited Long Acres Properties Limited	Residential		Residential
1954 - 1957	Long Acres Properties Limited		No other observations	
1954 - 1954	Howard S. Ditmars, Mary E. Ditmars		No other observations	
1954 - 1954	Sun Oil Company Limited		No other observations	
1902 - 1954	Henry Ghent		1910 FIP: Property was developed with two residential structures	
1884 - 1902	Kate Jane Emma Greene	Presumably agricultural land, possibly developed for residential purposes	Agriculture or Other	No other observations
1866 - 1884	John Waldie			No other observations
1864 - 1866	John R. Minkirknick			No other observations
1853 - 1864	Thomas Baxter			No other observations
1848 - 1853	Daniel Torrance			No other observations
1829 - 1848	Andrew Gage			No other observations
1798 - 1829	Capt. Joseph Brant			No other observations
Pre-1798	Crown			No other observations

(Lot 4), Pin 07061-0008 (LT)				
Year	Name of Owner	Description of Property Use	Property Use	Other Observations from Aerial Photographs, Fire Insurance Plans, Etc.
March 2023 to Present	Acamar Dwelling Corp.	Real Estate Offices	Commercial	2021 SI: No significant changes
2019 - March 2023	Peter John Gerard Landry, Joann Katherine Landry			
2002 - 2019	David Paul Landry, Peter John Gerard Landry			2017 SI: No significant changes 2008 SI: No significant changes
1986 - 2002	Royal LePage Real Estate Services Limited			1998 AP: Property appears to be developed with present day structures.
1980 - 1986	A. E. LePage Real Estate Services Limited	Auto Service Station		No other observations
1973 - 1980	Brian Cooper Limited			1978 CD: Auto Service Station
1973 - 1973	The Estaminet Investments Limited			No other observations
1960 - 1973	The Estaminet Limited			1971 FIP: Occupied by an auto service station 1968 CD: Occupied by an auto service station 1963 CD: Occupied by an auto service station
1957 - 1960	I. B. & J Investments Limited, Long Acres Properties Limited	Residential	Residential	1959 AP: Property developed with undetermined structures
1955 - 1957	Long Acres Properties Limited			No other observations
1954 - 1955	The Estaminet Limited			No other observations
1953 - 1954	Christopher Tiporilaw			No other observations
1942 - 1953	Nora Irene Klainka			No other observations
1911 - 1942	Robert N. Procter			No other observations
1906 - 1911	Thomas Atkinson			1910 FIP: Property was developed with two residential structures
1901 - 1906	David Ackland	Presumably agricultural land, possibly developed for residential purposes	Agriculture or Other	No other observations
1894 - 1901	James Walter Dalton			1898 FIP: Property not covered.
1871 - 1894	William Dalton			No other observations
1867 - 1871	Titus G. Cummins			No other observations
1866 - 1867	Mark G. Cummins			No other observations
1855 - 1866	John Crysler			No other observations
1848 - 1855	Peter Fisher			No other observations
1845 - 1848	Daniel Torrance			No other observations
1829 - 1845	Andrew Gage			No other observations
1978 - 1829	Capt. Joseph Brant			No other observations
Pre-1978	Crown			No other observations

Notes:

SI is satellite imagery

AP is aerial photograph

CD is city directory

FIP is fire insurance plan

HM is Historic Map

OBM is Ontario Base Map

For each owner, specify one of the following types of Property Use (as defined in O.Reg. 153/04) that applies:

Agriculture or Other, Commercial, Community, Industrial, Institutional, Parkland, Residential

TABLE 2



TABLE 2:
TABLE OF AREAS OF POTENTIAL ENVIRONMENTAL CONCERN
(Refer to clause 16(2)(a), Schedule D, O. Reg. 153/04)

Area of Potential Environmental Concern	Location of Area of Potential Environmental Concern on Phase One Property	Potentially Contaminating Activity	Location of PCA (on-site or off-site)	Contaminants of Potential Concern	Media Potentially Impacted (Groundwater, soil and/or sediment)
APEC 1	Central portion of the Phase One Property	#28 _A – Gasoline and Associated Products Storage in Fixed Tanks	On-site	PHCs BTEX PAHs	Soil & Groundwater
APEC 2	Entire Phase One Property	#30 _A - Importation of Fill Material of Unknown Quality	On-site	Metals As, Sb, Se B-HWS CN- Hg Cr(VI) Low or High pH PAHs PHCs VOCs BTEX	Soil & Groundwater Soil & Groundwater Soil Soil & Groundwater Soil & Groundwater Soil & Groundwater Soil & Groundwater Soil & Groundwater Soil & Groundwater Soil & Groundwater
APEC 3	Exterior Portions of Phase One Property	#Other1 _A - De-icing Activities	On-site	EC SAR Cl Na	Soil Soil Groundwater Groundwater
APEC 4	North Portion of the Phase One Property	#34 _A – Metal Fabrication	Off-Site	Metals As, Sb, Se, Hg Cr(VI) PHCs VOCs BTEX	Groundwater
APEC 5	Southwestern Portion of the Phase One Property	#28 _C – Gasoline and Associated Products Storage in Fixed Tanks	Off-Site	PHCs BTEX PAHs	Groundwater

Notes:

1 - Area of Potential Environmental Concern means the area on, in or under a phase one property where one or more contaminants are potentially present, as determined through the phase one environmental site assessment, including through,

- (a) identification of past or present uses on, in or under the phase one property, and
- (b) identification of potentially contaminating activity.

2 - Potentially Contaminating Activity means a use or activity set out in Column A of Table 2 of Schedule D that is occurring or has occurred in a phase one study area


3 - when completing this column, identify all contaminants of potential concern using the Method Groups as identified in the

Protocol for in the Assessment of Properties under Part XV.1 of the Environmental Protection Act, March 9, 2004, amended as of July 1, 2011, as specified below:

ABNs	Metals
CPs	As, Sb, Se
1,4-Dioxane	Na
Dioxins/Furans, PCDDs/PCDFs	B-HWS
OCs	Cl-
PHCs	CN-
PCBs	Electrical Conductivity
PAHs	Cr (VI)
THMs	Hg
VOCs	Methyl Mercury
BTEX	Low or high pH,
Ca, Mg	SAR

APPENDIX A



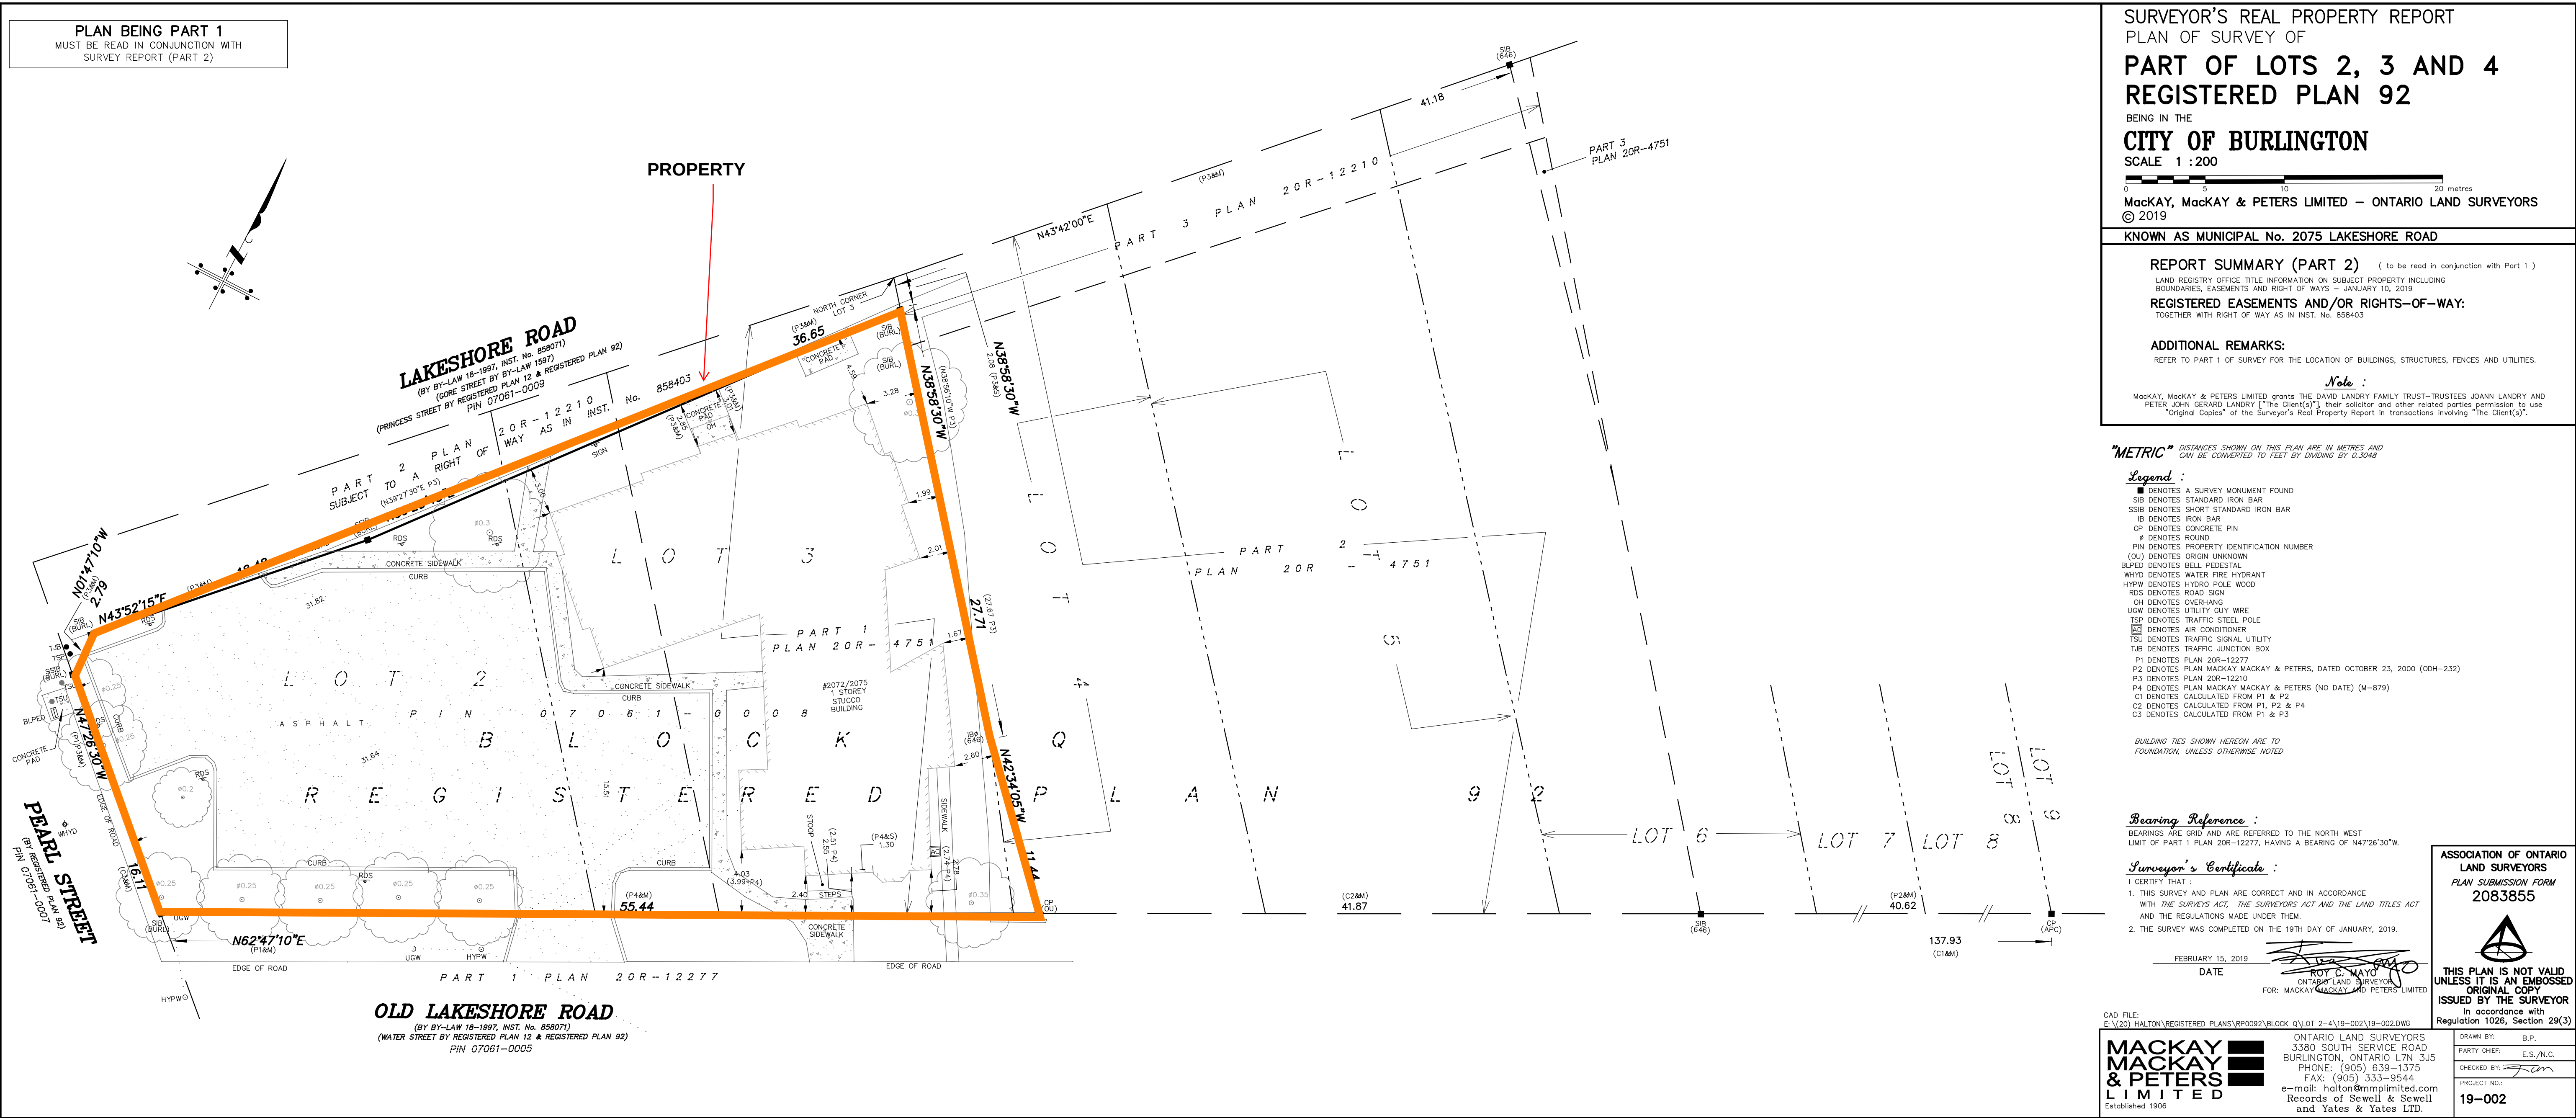

APPENDIX B





enviroscan



An SCM Company

175 Commerce Valley Drive W
Markham, Ontario L3T 7Z3

T: 905-882-6300
W: www.optaintel.ca

Report Completed By:

Midori

Site Address:

2069 Lakeshore Road, Burlington, ON

Project No:

22040800543

Opta Order ID:


107756

Requested by:

Eleanor Goolab
ERIS

Date Completed:

4/20/2022 6:21:00 AM

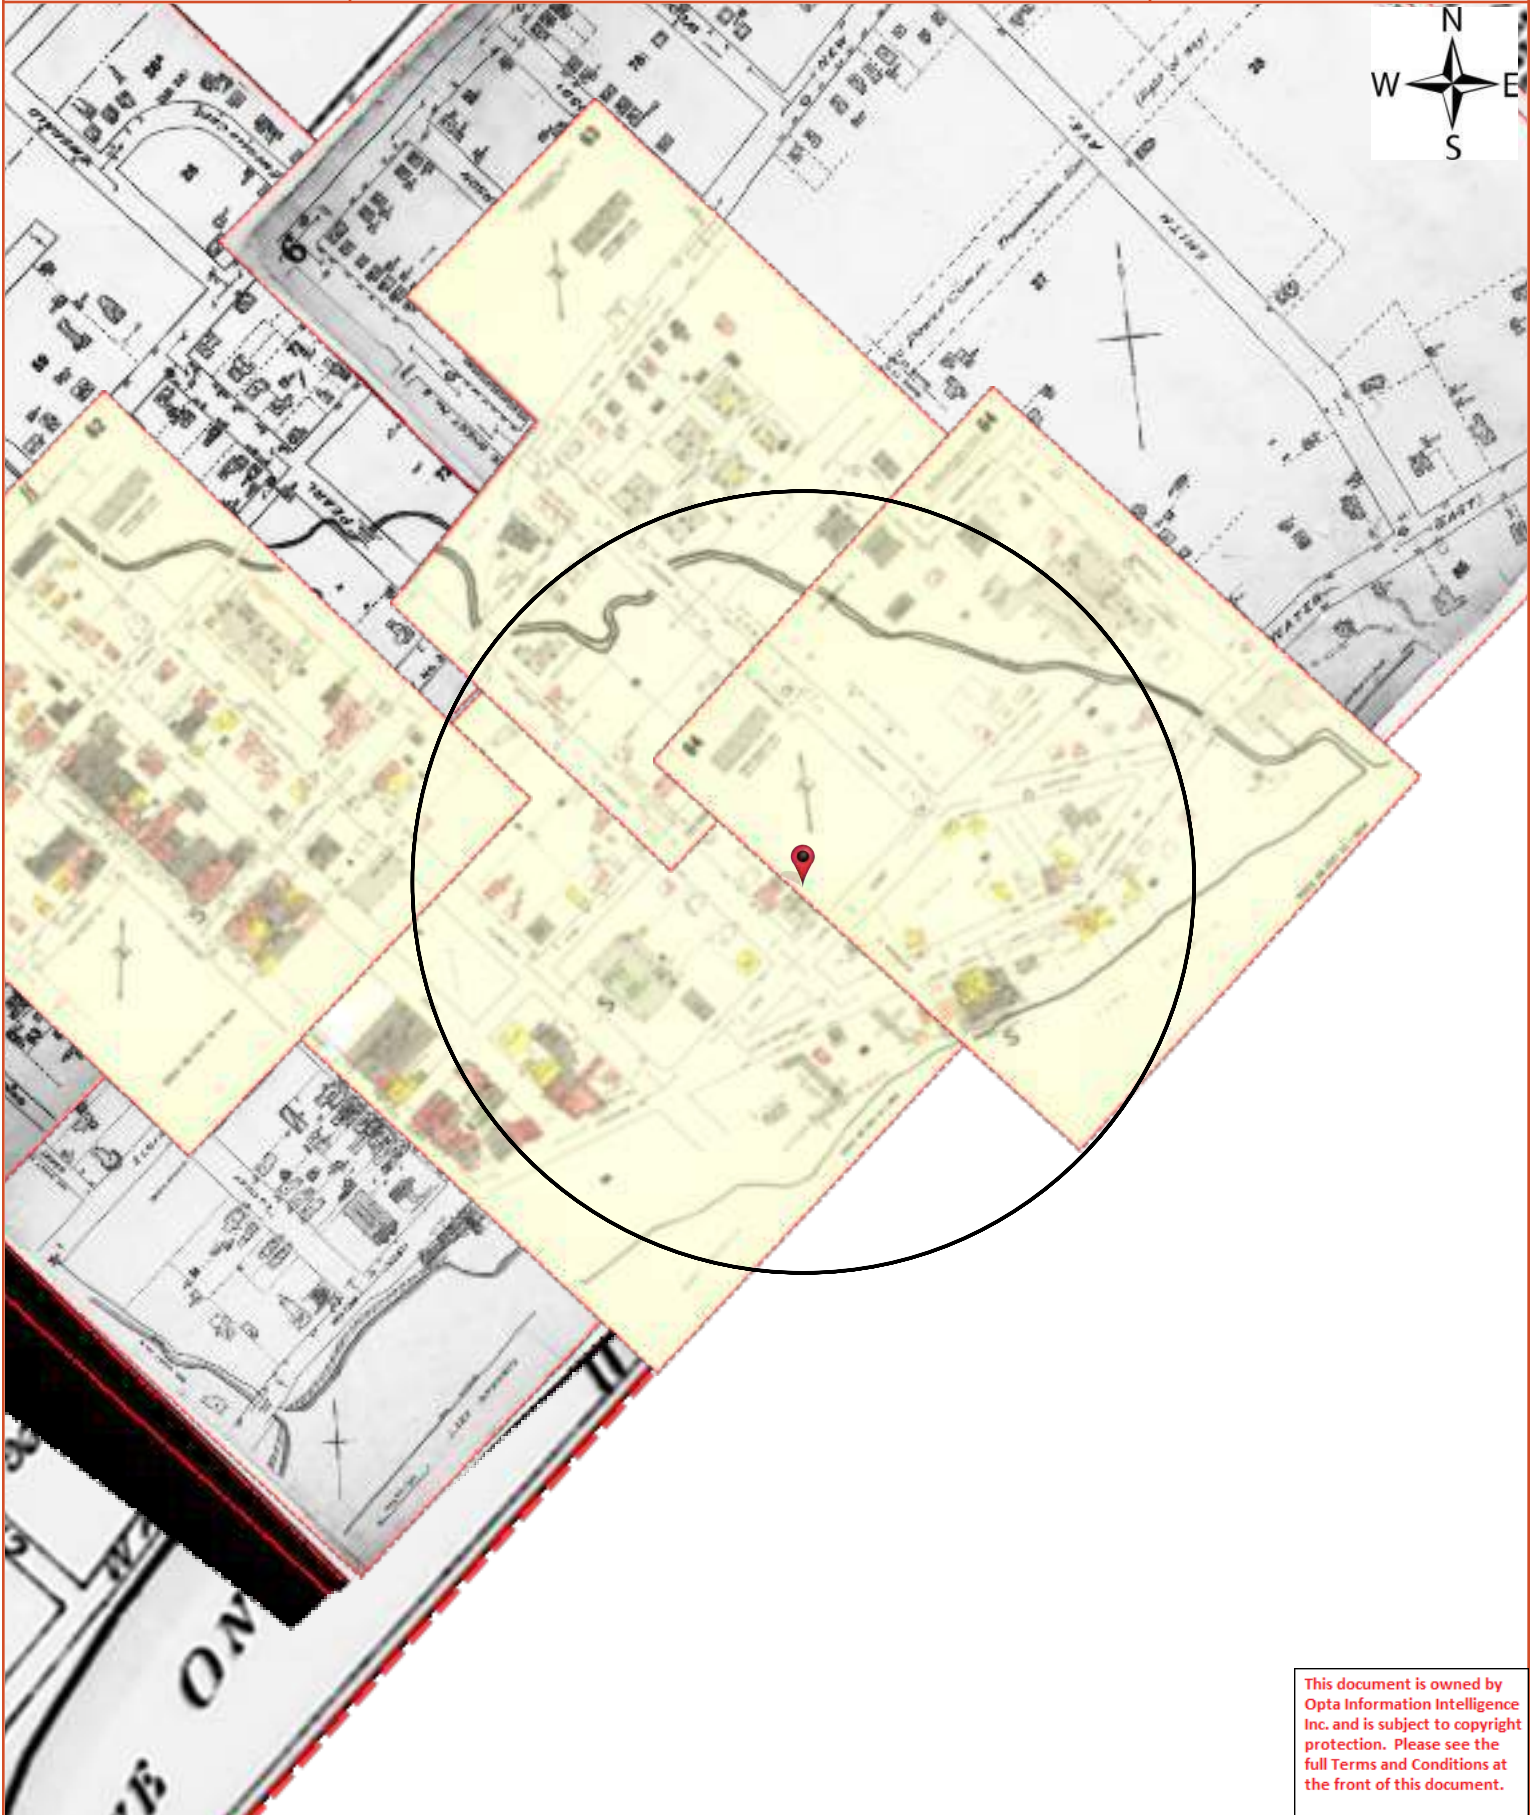

Opta Historical Environmental Services EnviroscanTM Terms and Conditions

Report

The documents (hereinafter referred to as the "Documents") to be released as part of the report (hereinafter referred to as the "Report") to be delivered to the purchaser as set out above are documents in Opta's records relating to the described property (hereinafter referred to as the "Property"). Opta makes no representations or warranties respecting the Documents whatsoever, including, without limitation, with respect to the completeness, accuracy or usefulness of the Documents, and does not represent or warrant that these are the only plans and reports prepared in association with the Property or in Opta's possession at the time of Report delivery to the purchaser. The Documents are current as of the date(s) indicated on them. Interpretation of the Documents, if any, is by inference based upon the information which is apparent and obvious on the face of the Documents only. Opta does not represent, warrant or guarantee that interpretations other than those referred to do not exist from other sources. The Report will be prepared for use by the purchaser of the services as shown above hereof only.

Disclaimer

Opta disclaims responsibility for any losses or damages of any kind whatsoever, whether consequential or other, however caused, incurred or suffered, arising directly or indirectly as a result of the services (which services include, but are not limited to, the preparation of the Report provided hereunder), including but not limited to, any losses or damages arising directly or indirectly from any breach of contract, fundamental or otherwise, from reliance on Opta Reports or from any tortious acts or omissions of Opta's agents, employees or representatives.

Entire Agreement

The parties hereto acknowledge and agree to be bound by the terms and conditions hereof. The request form constitutes the entire agreement between the parties pertaining to the subject matter hereof and supersedes all prior and contemporaneous agreements, negotiations and discussions, whether oral or written, and there are no representations or warranties, or other agreements between the parties in connection with the subject matter hereof except as specifically set forth herein. No supplement, modification, waiver, or termination of the request shall be binding, unless confirmed in writing by the parties hereto.

Governing Document

In the event of any conflicts or inconsistencies between the provisions hereof and the Reports, the rights and obligations of the parties shall be deemed to be governed by the request form, which shall be the paramount document.

Law

This agreement shall be governed by and construed in accordance with the laws of the Province of Ontario and the laws of Canada applicable therein.

Report Index**Requested by:**
Eleanor Goolab

Date Completed: 04/20/2022 06:21:00



OPTA INFORMATION INTELLIGENCE

Page Report Title


6	(1910) Volume: Ontario Miscellaneous Firemap: 1
8	(1910) Volume: Ontario Firemap: 2
10	(1910) Volume: Ontario Firemap: 3
12	(1932) Volume: Ontario Firemap: 2
14	(1932) Volume: Ontario Firemap: 2
16	(1932) Volume: Ontario Firemap: 3
18	(1932) Volume: Ontario Firemap: 3
20	(1932) Volume: Ontario Firemap: 5
22	(1932) Volume: Ontario Firemap: 5
24	(1932) Volume: Ontario Firemap: 6
26	(1932) Volume: Ontario Firemap: 6
28	(1971) Volume: Burlington Firemap: 61
30	(1971) Volume: Burlington Firemap: 62
32	(1971) Volume: Burlington Firemap: 63
34	(1971) Volume: Burlington Firemap: 64



FIP Locator Map

The detailed FIP is on the following page



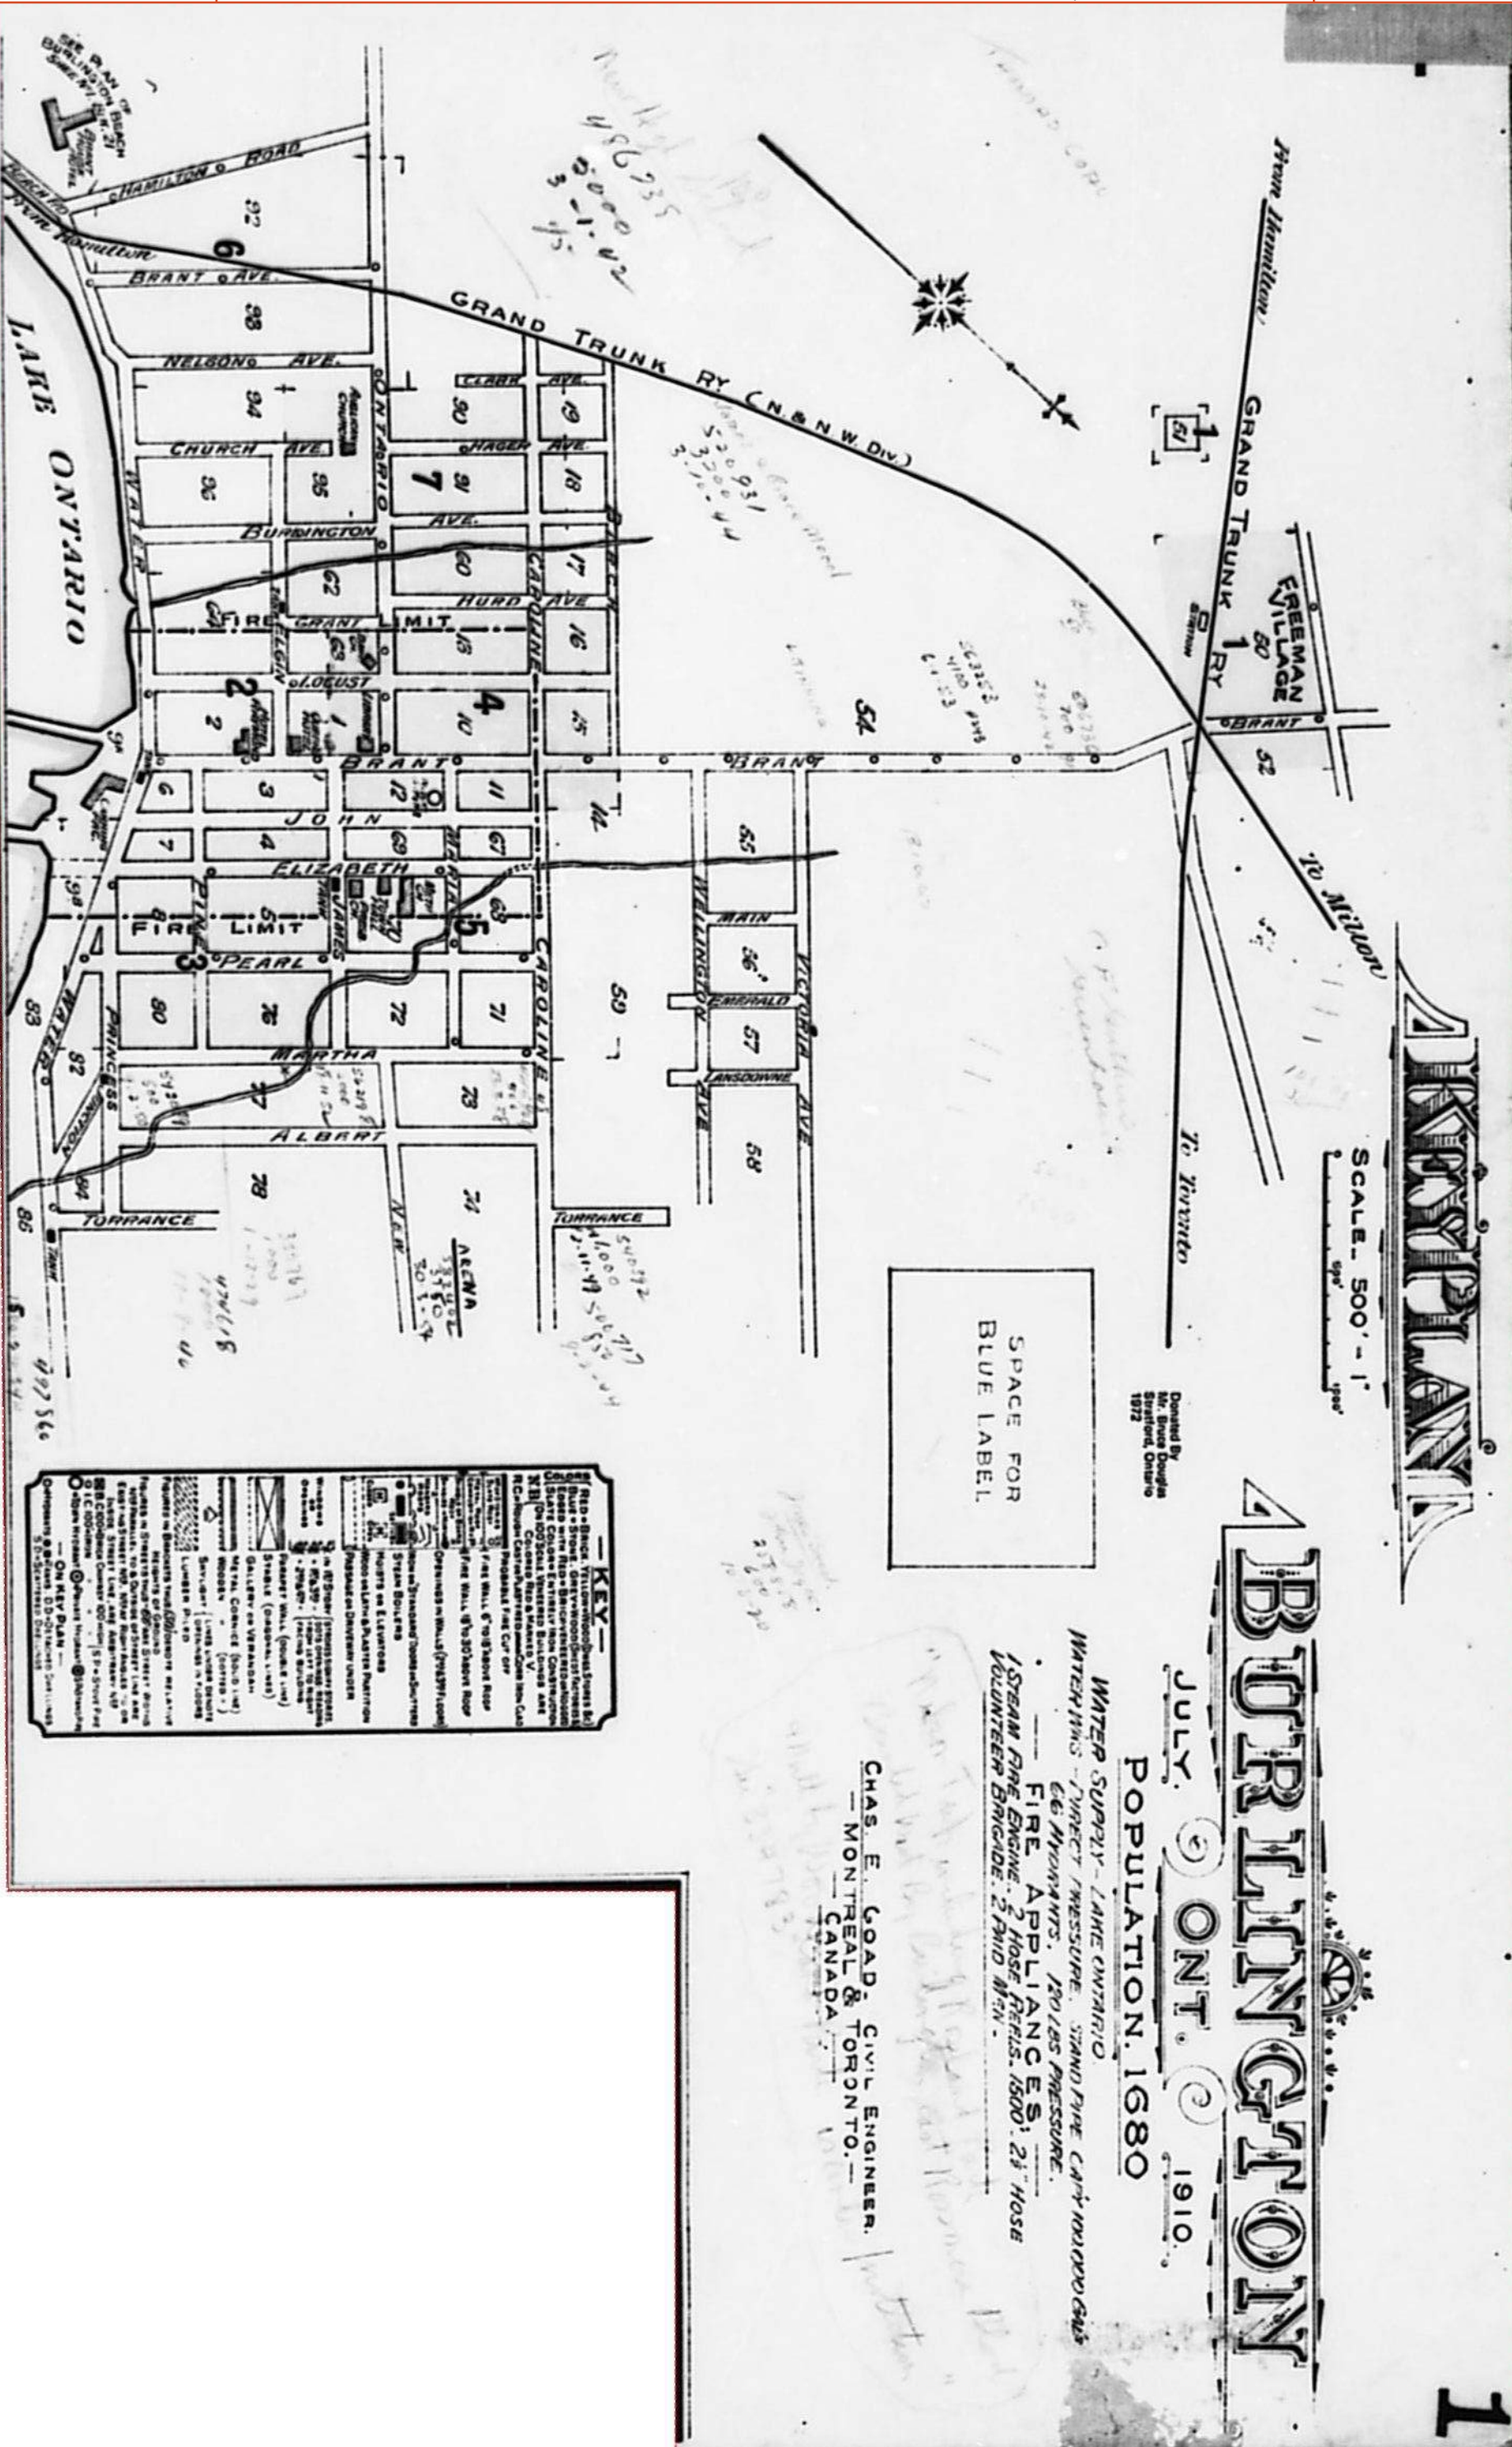


FIP Locator Map

The detailed FIP is on the following page

This document is owned by Opta Information Intelligence Inc. and is subject to copyright protection. Please see the full Terms and Conditions at the front of this document.




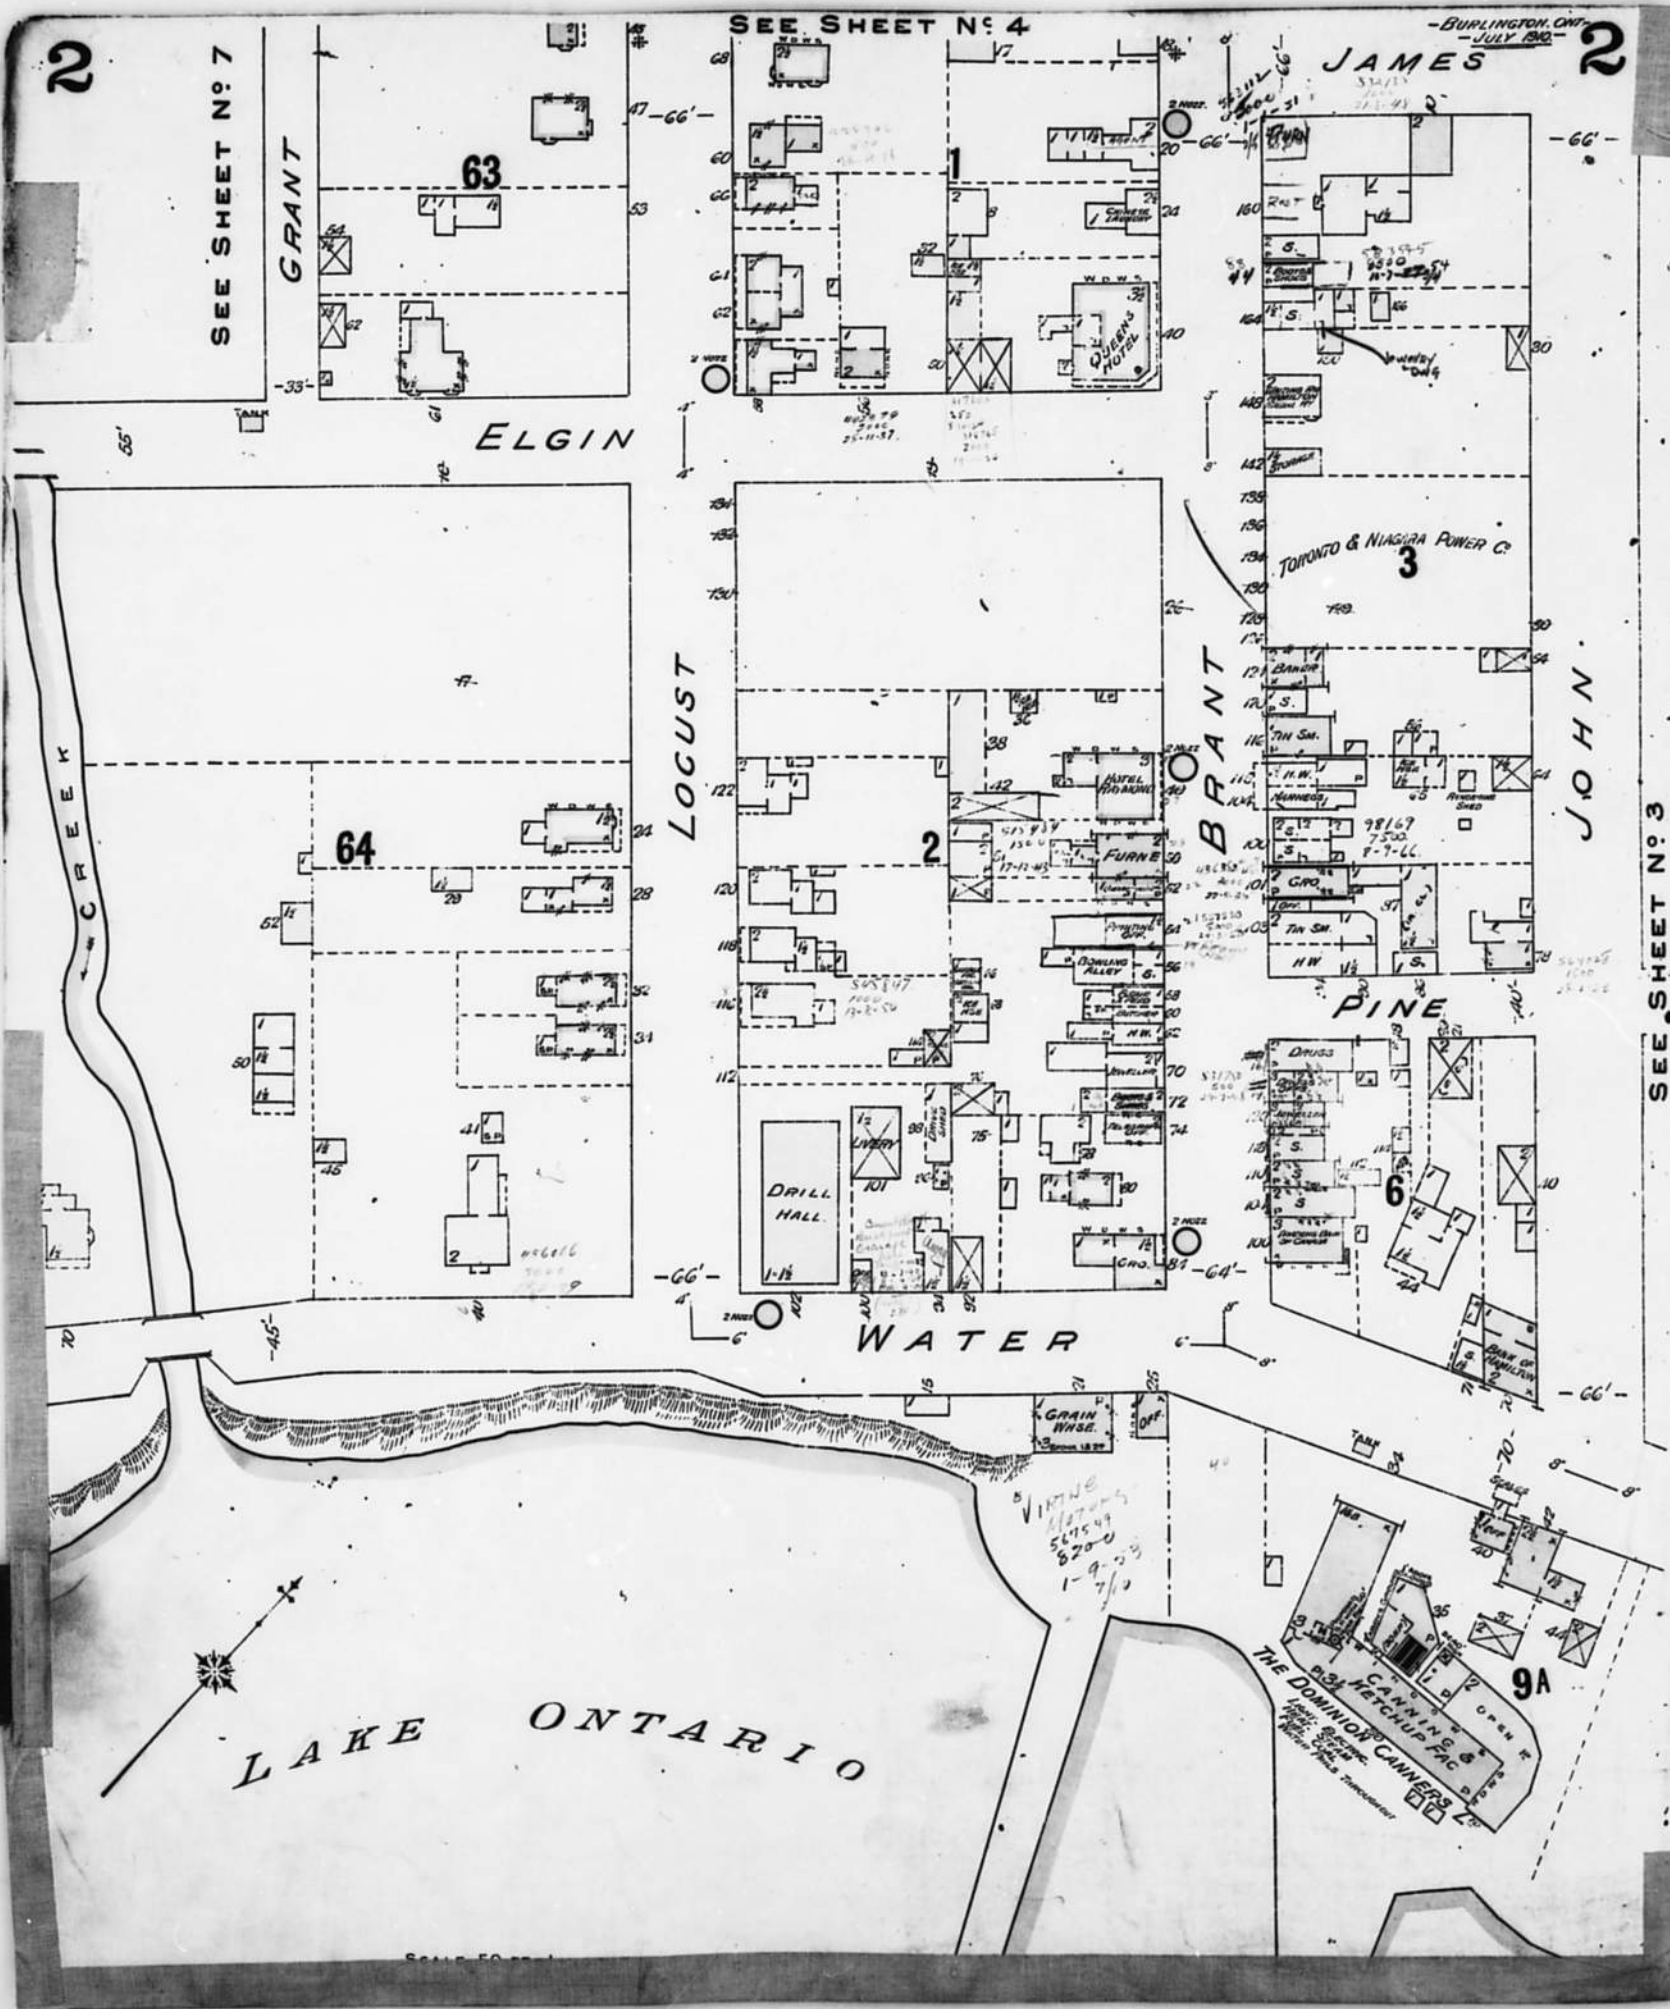

FIP Locator Map

The detailed FIP is on the following page



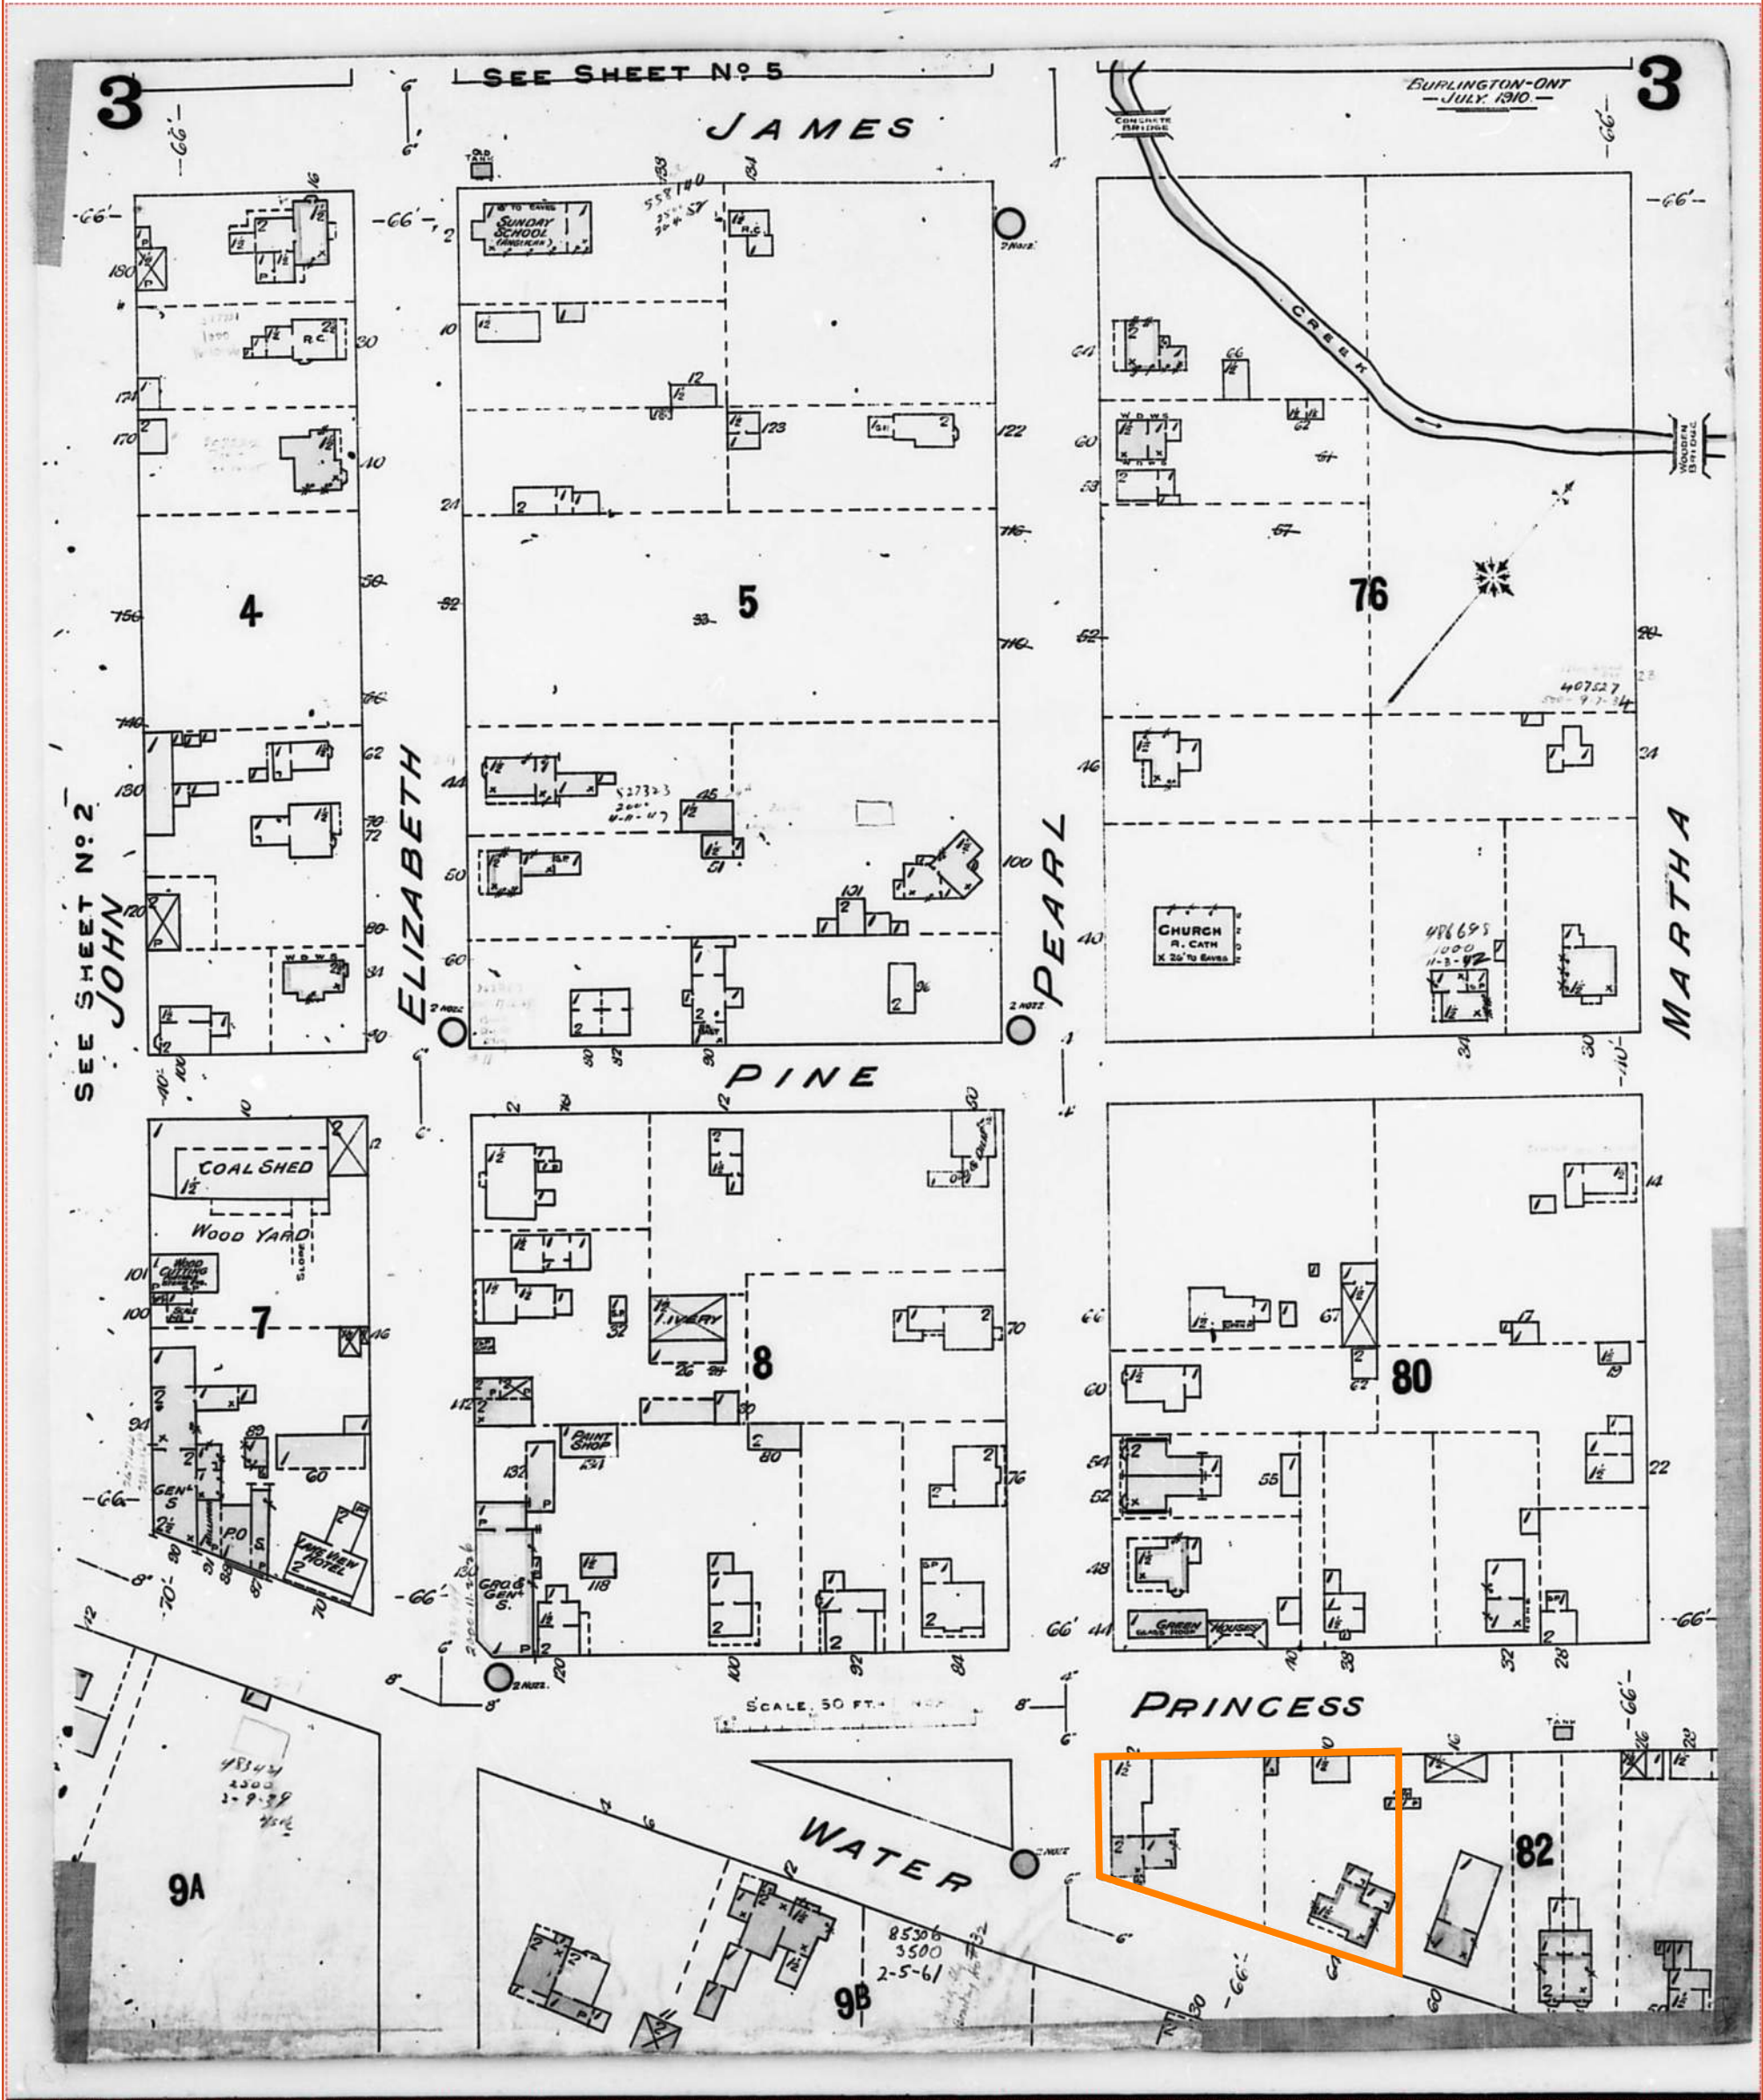


FIP Locator Map

The detailed FIP is on the following page

This document is owned by Opta Information Intelligence Inc. and is subject to copyright protection. Please see the full Terms and Conditions at the front of this document.




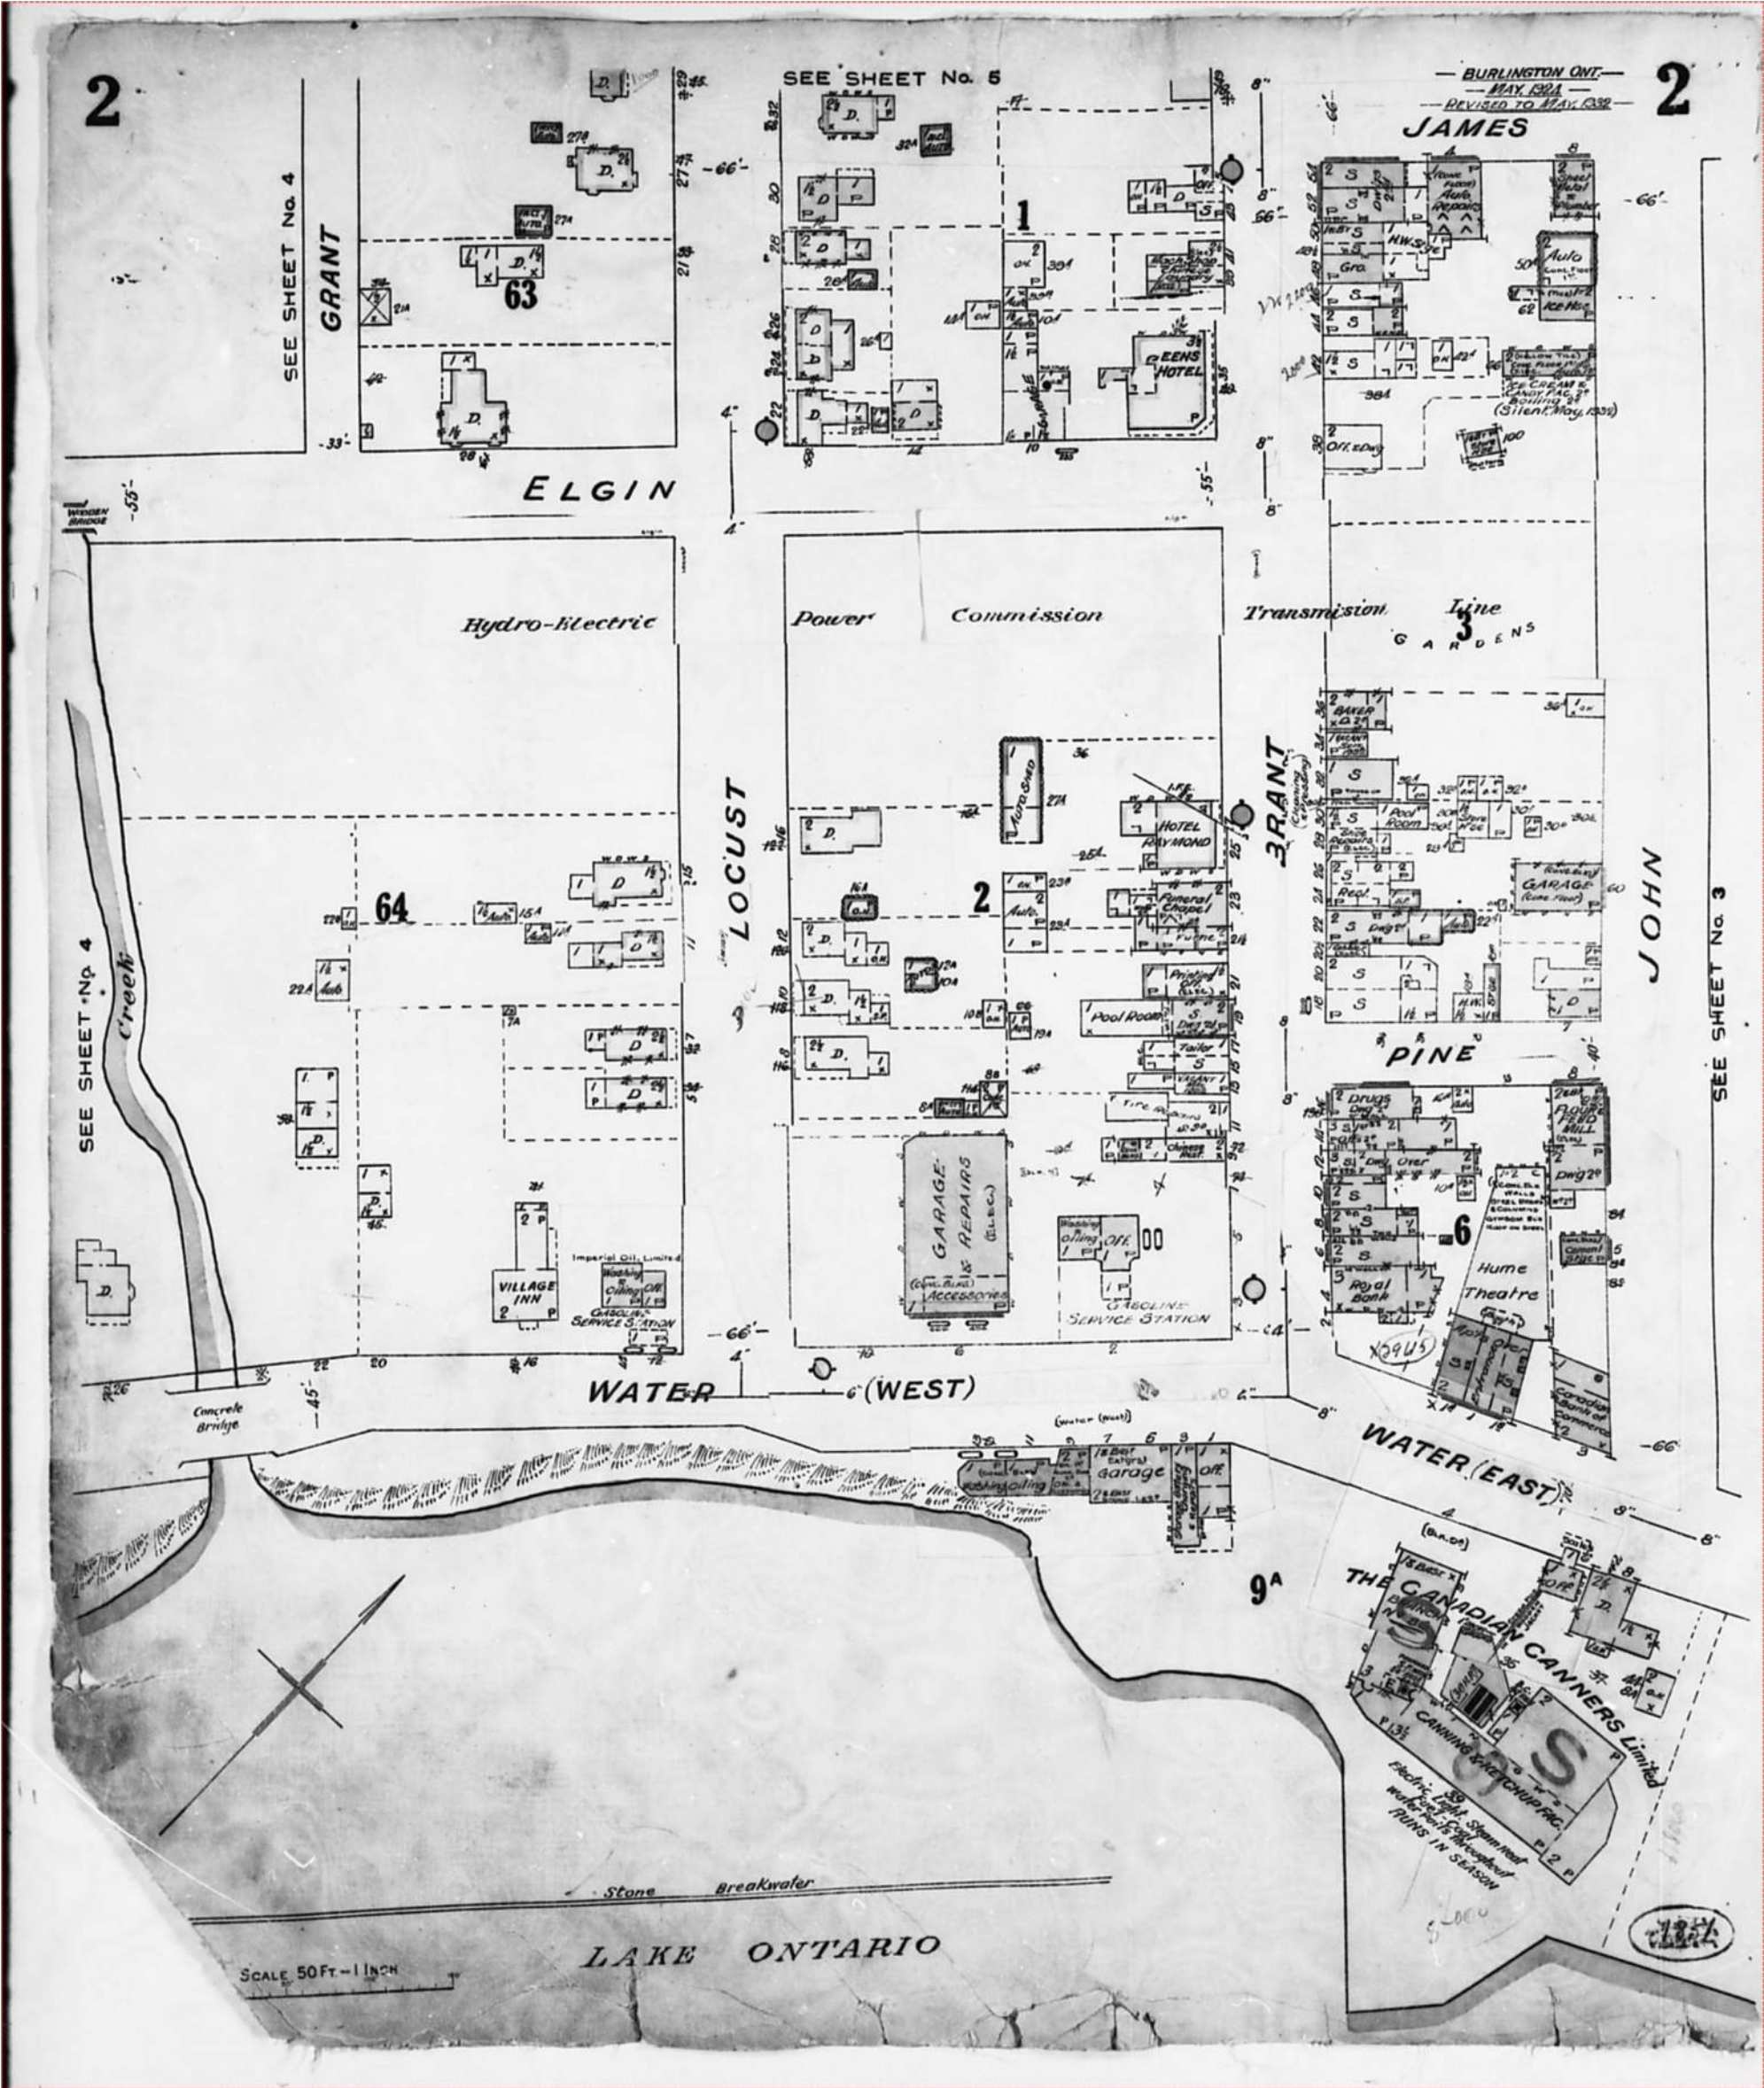


FIP Locator Map

The detailed FIP is on the following page

This document is owned by Opta Information Intelligence Inc. and is subject to copyright protection. Please see the full Terms and Conditions at the front of this document.

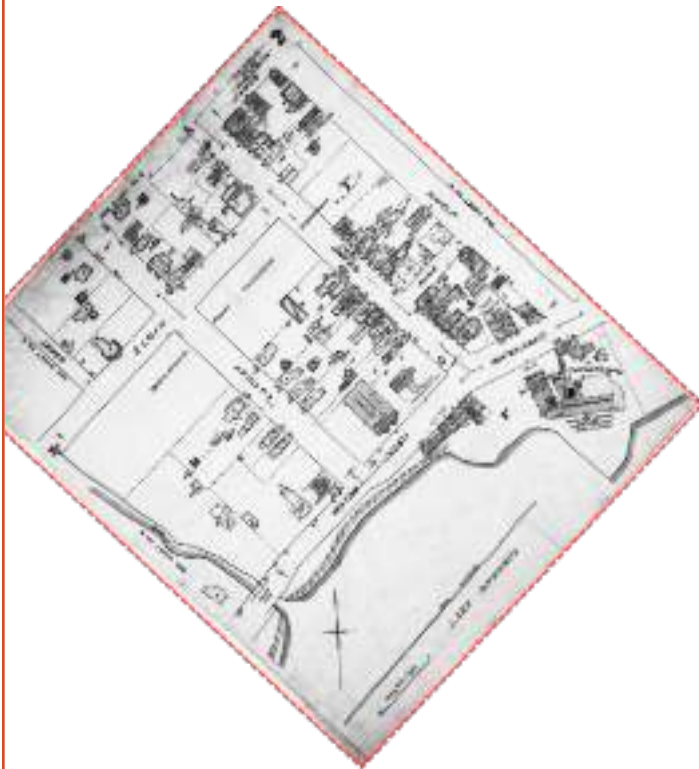


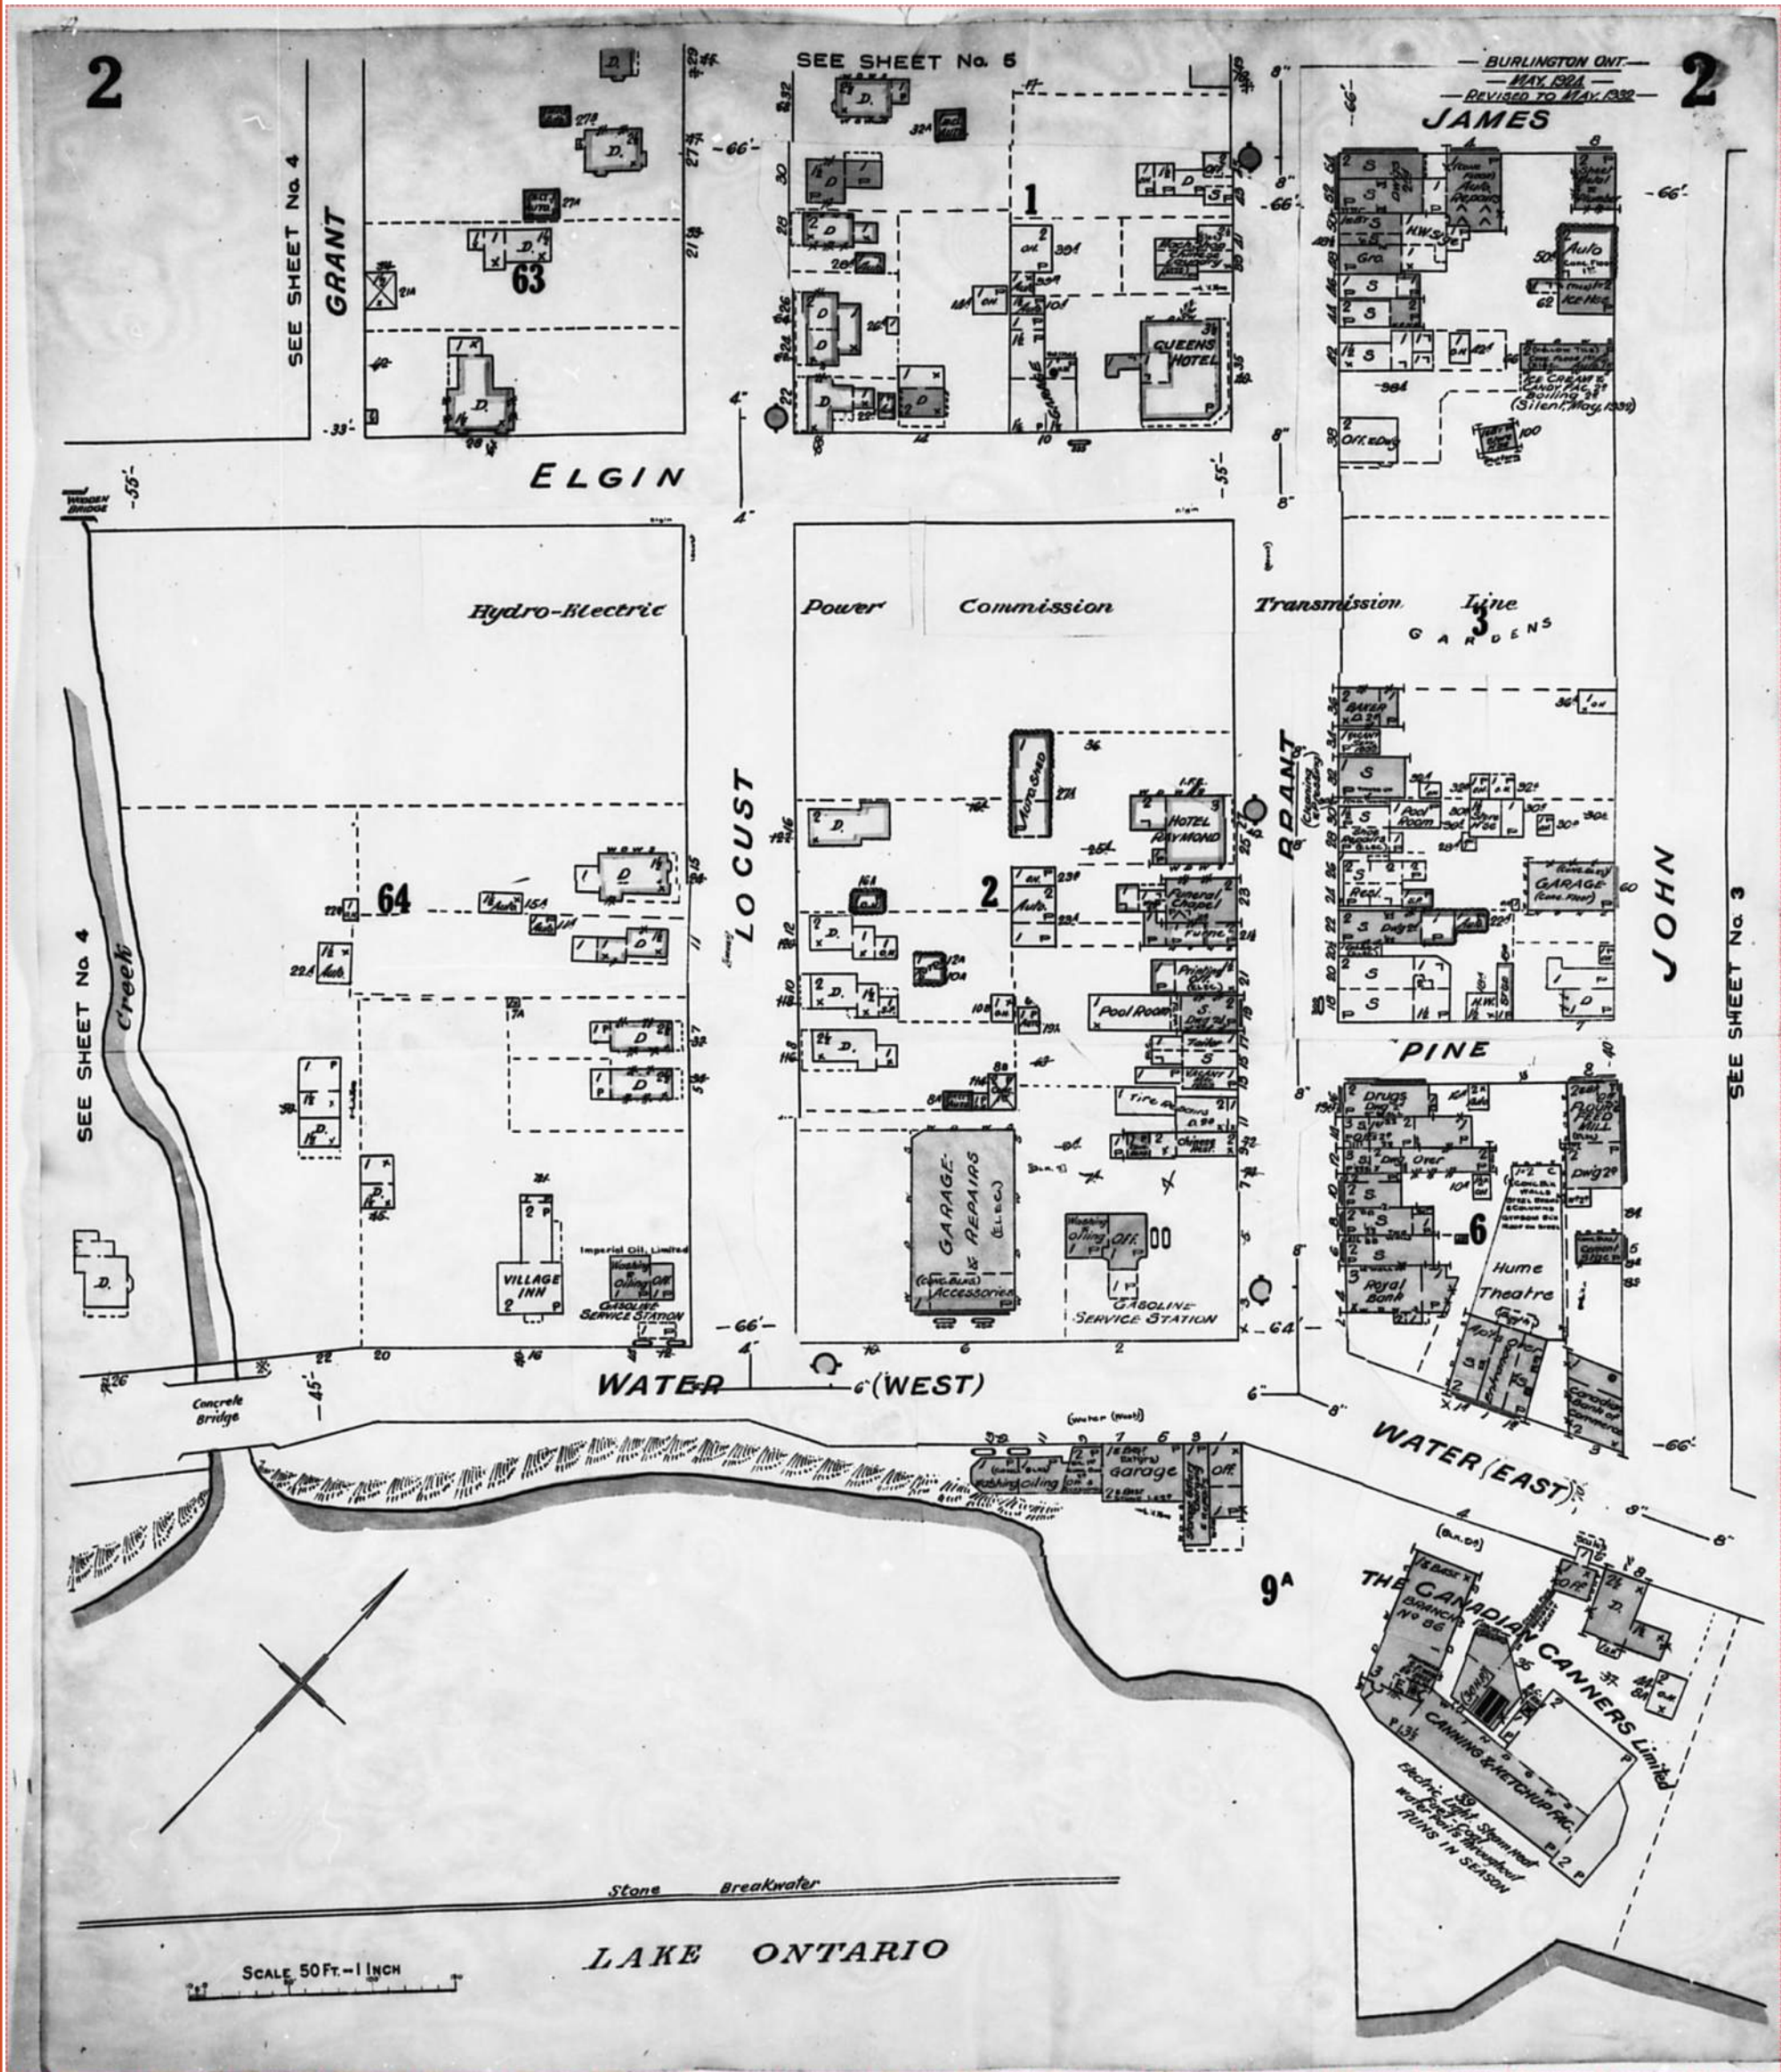

FIP Locator Map

The detailed FIP is on the following page




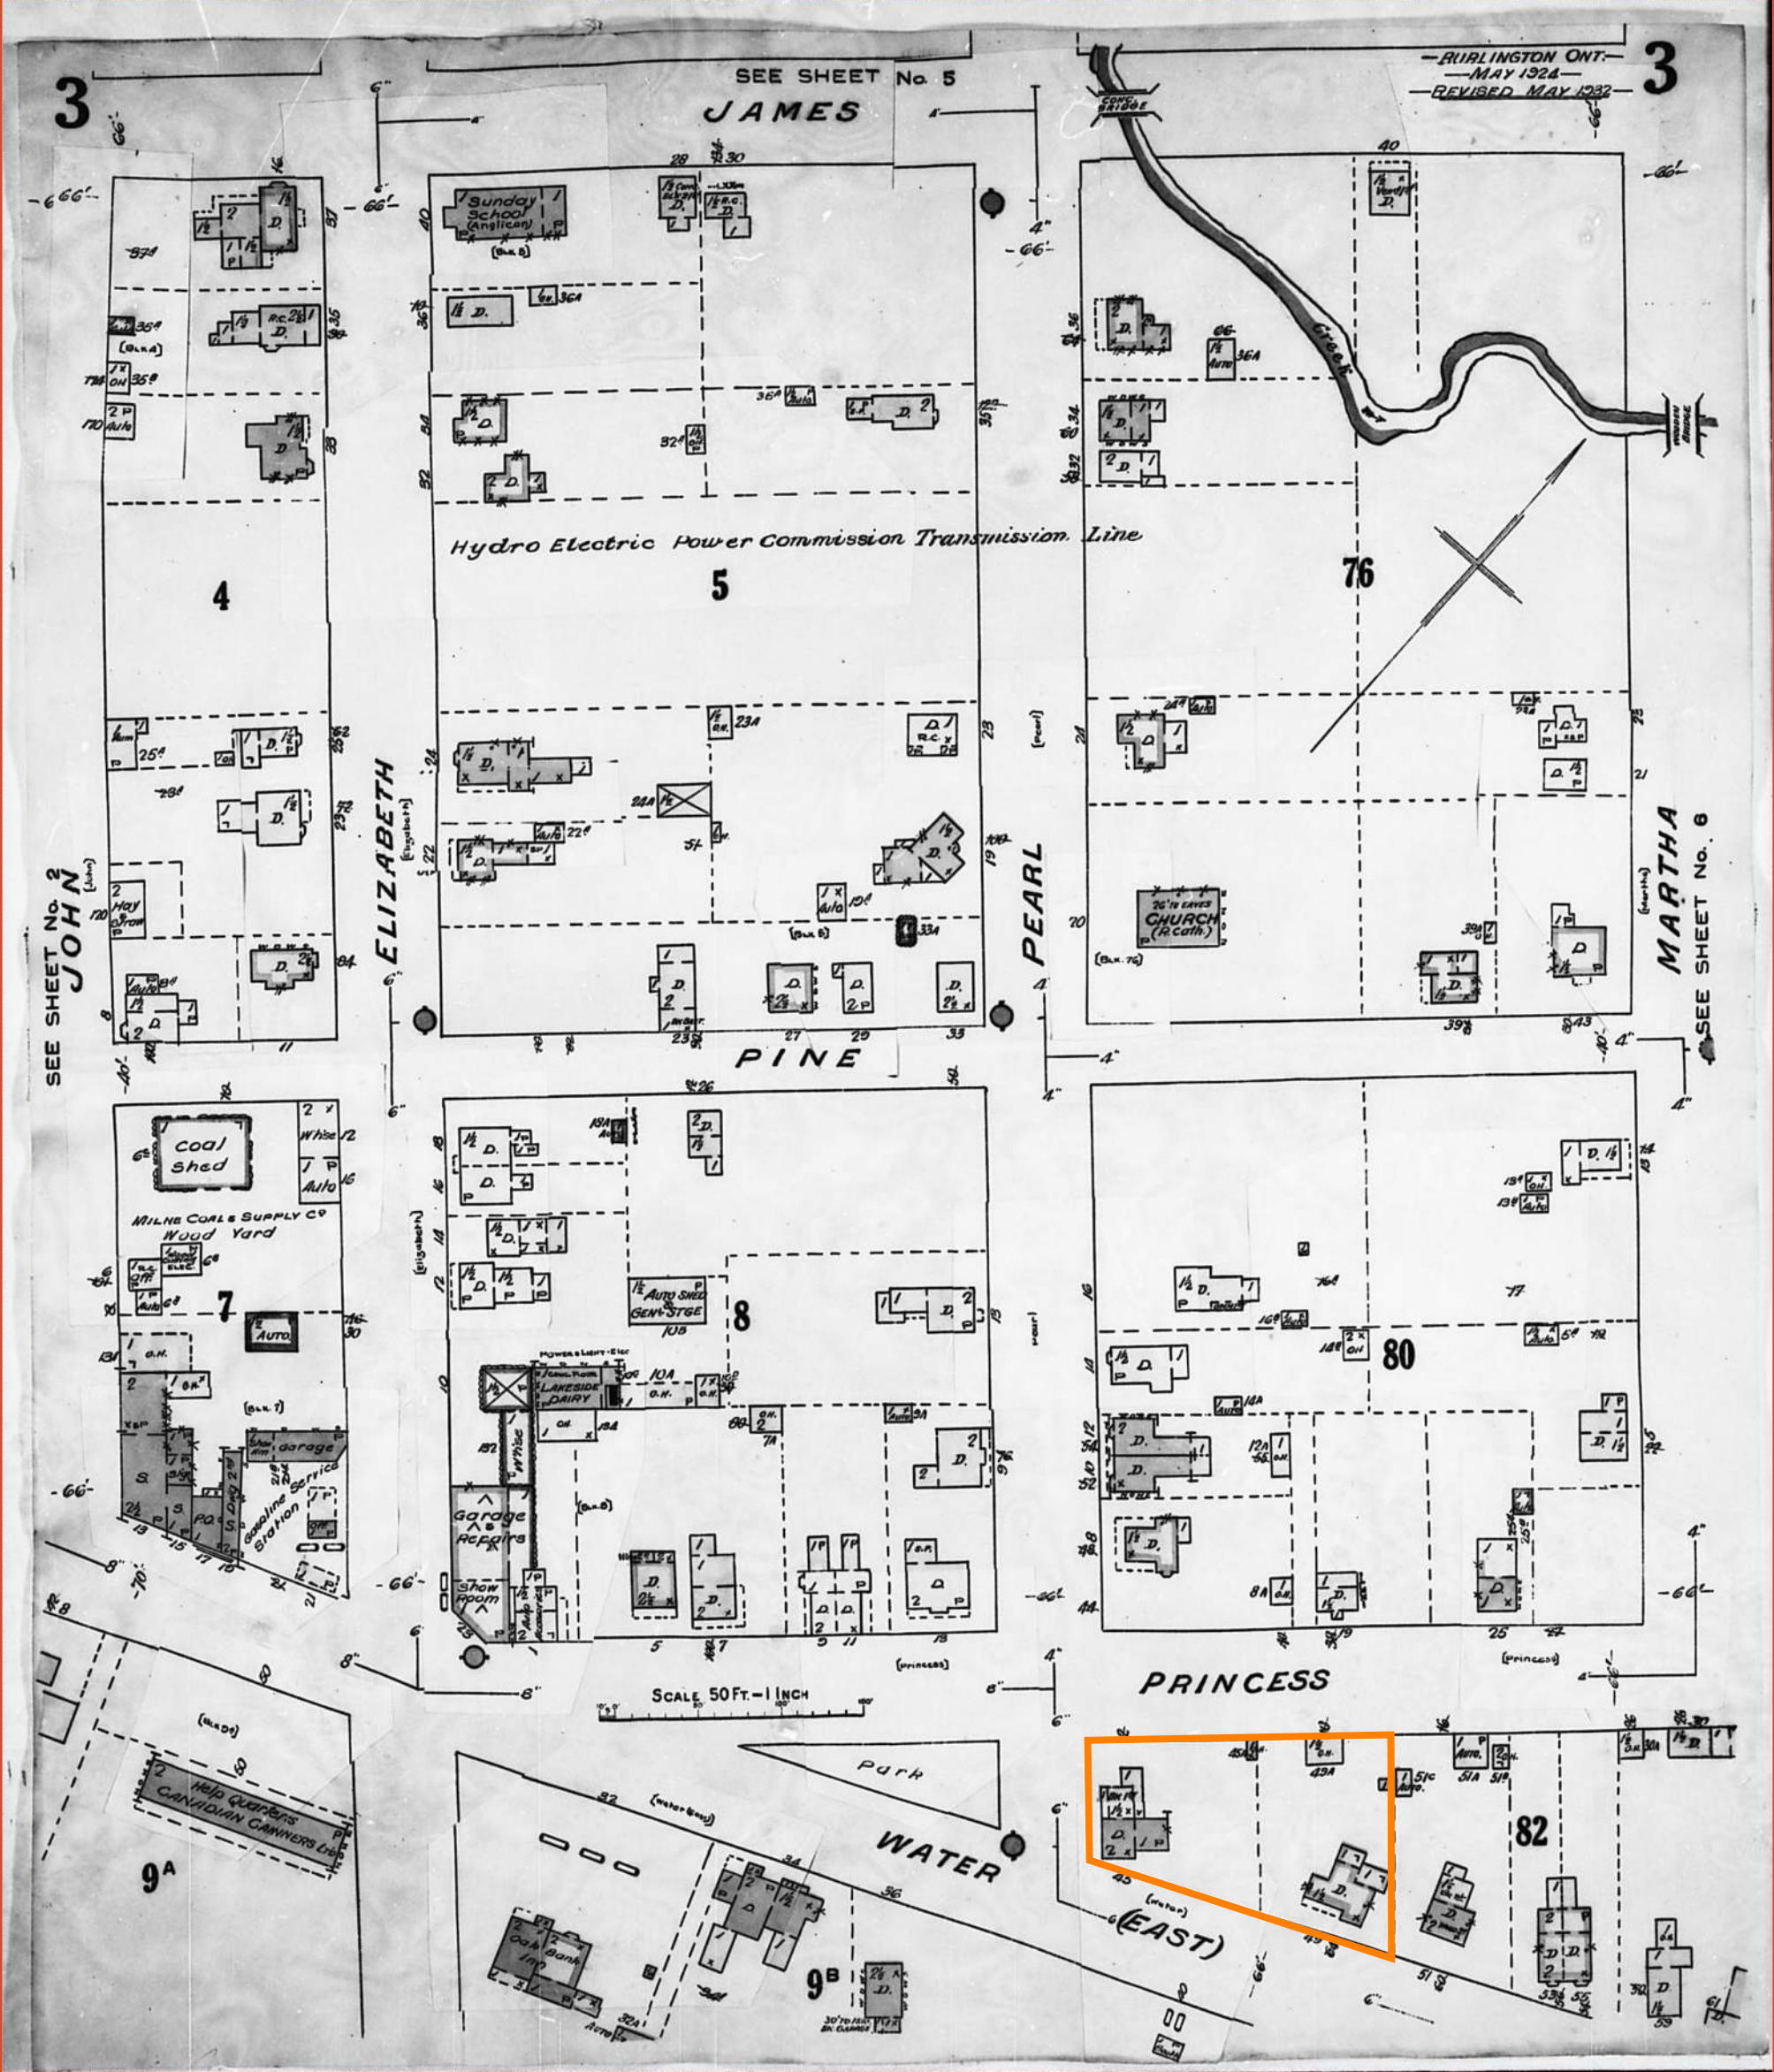


FIP Locator Map

The detailed FIP is on the following page



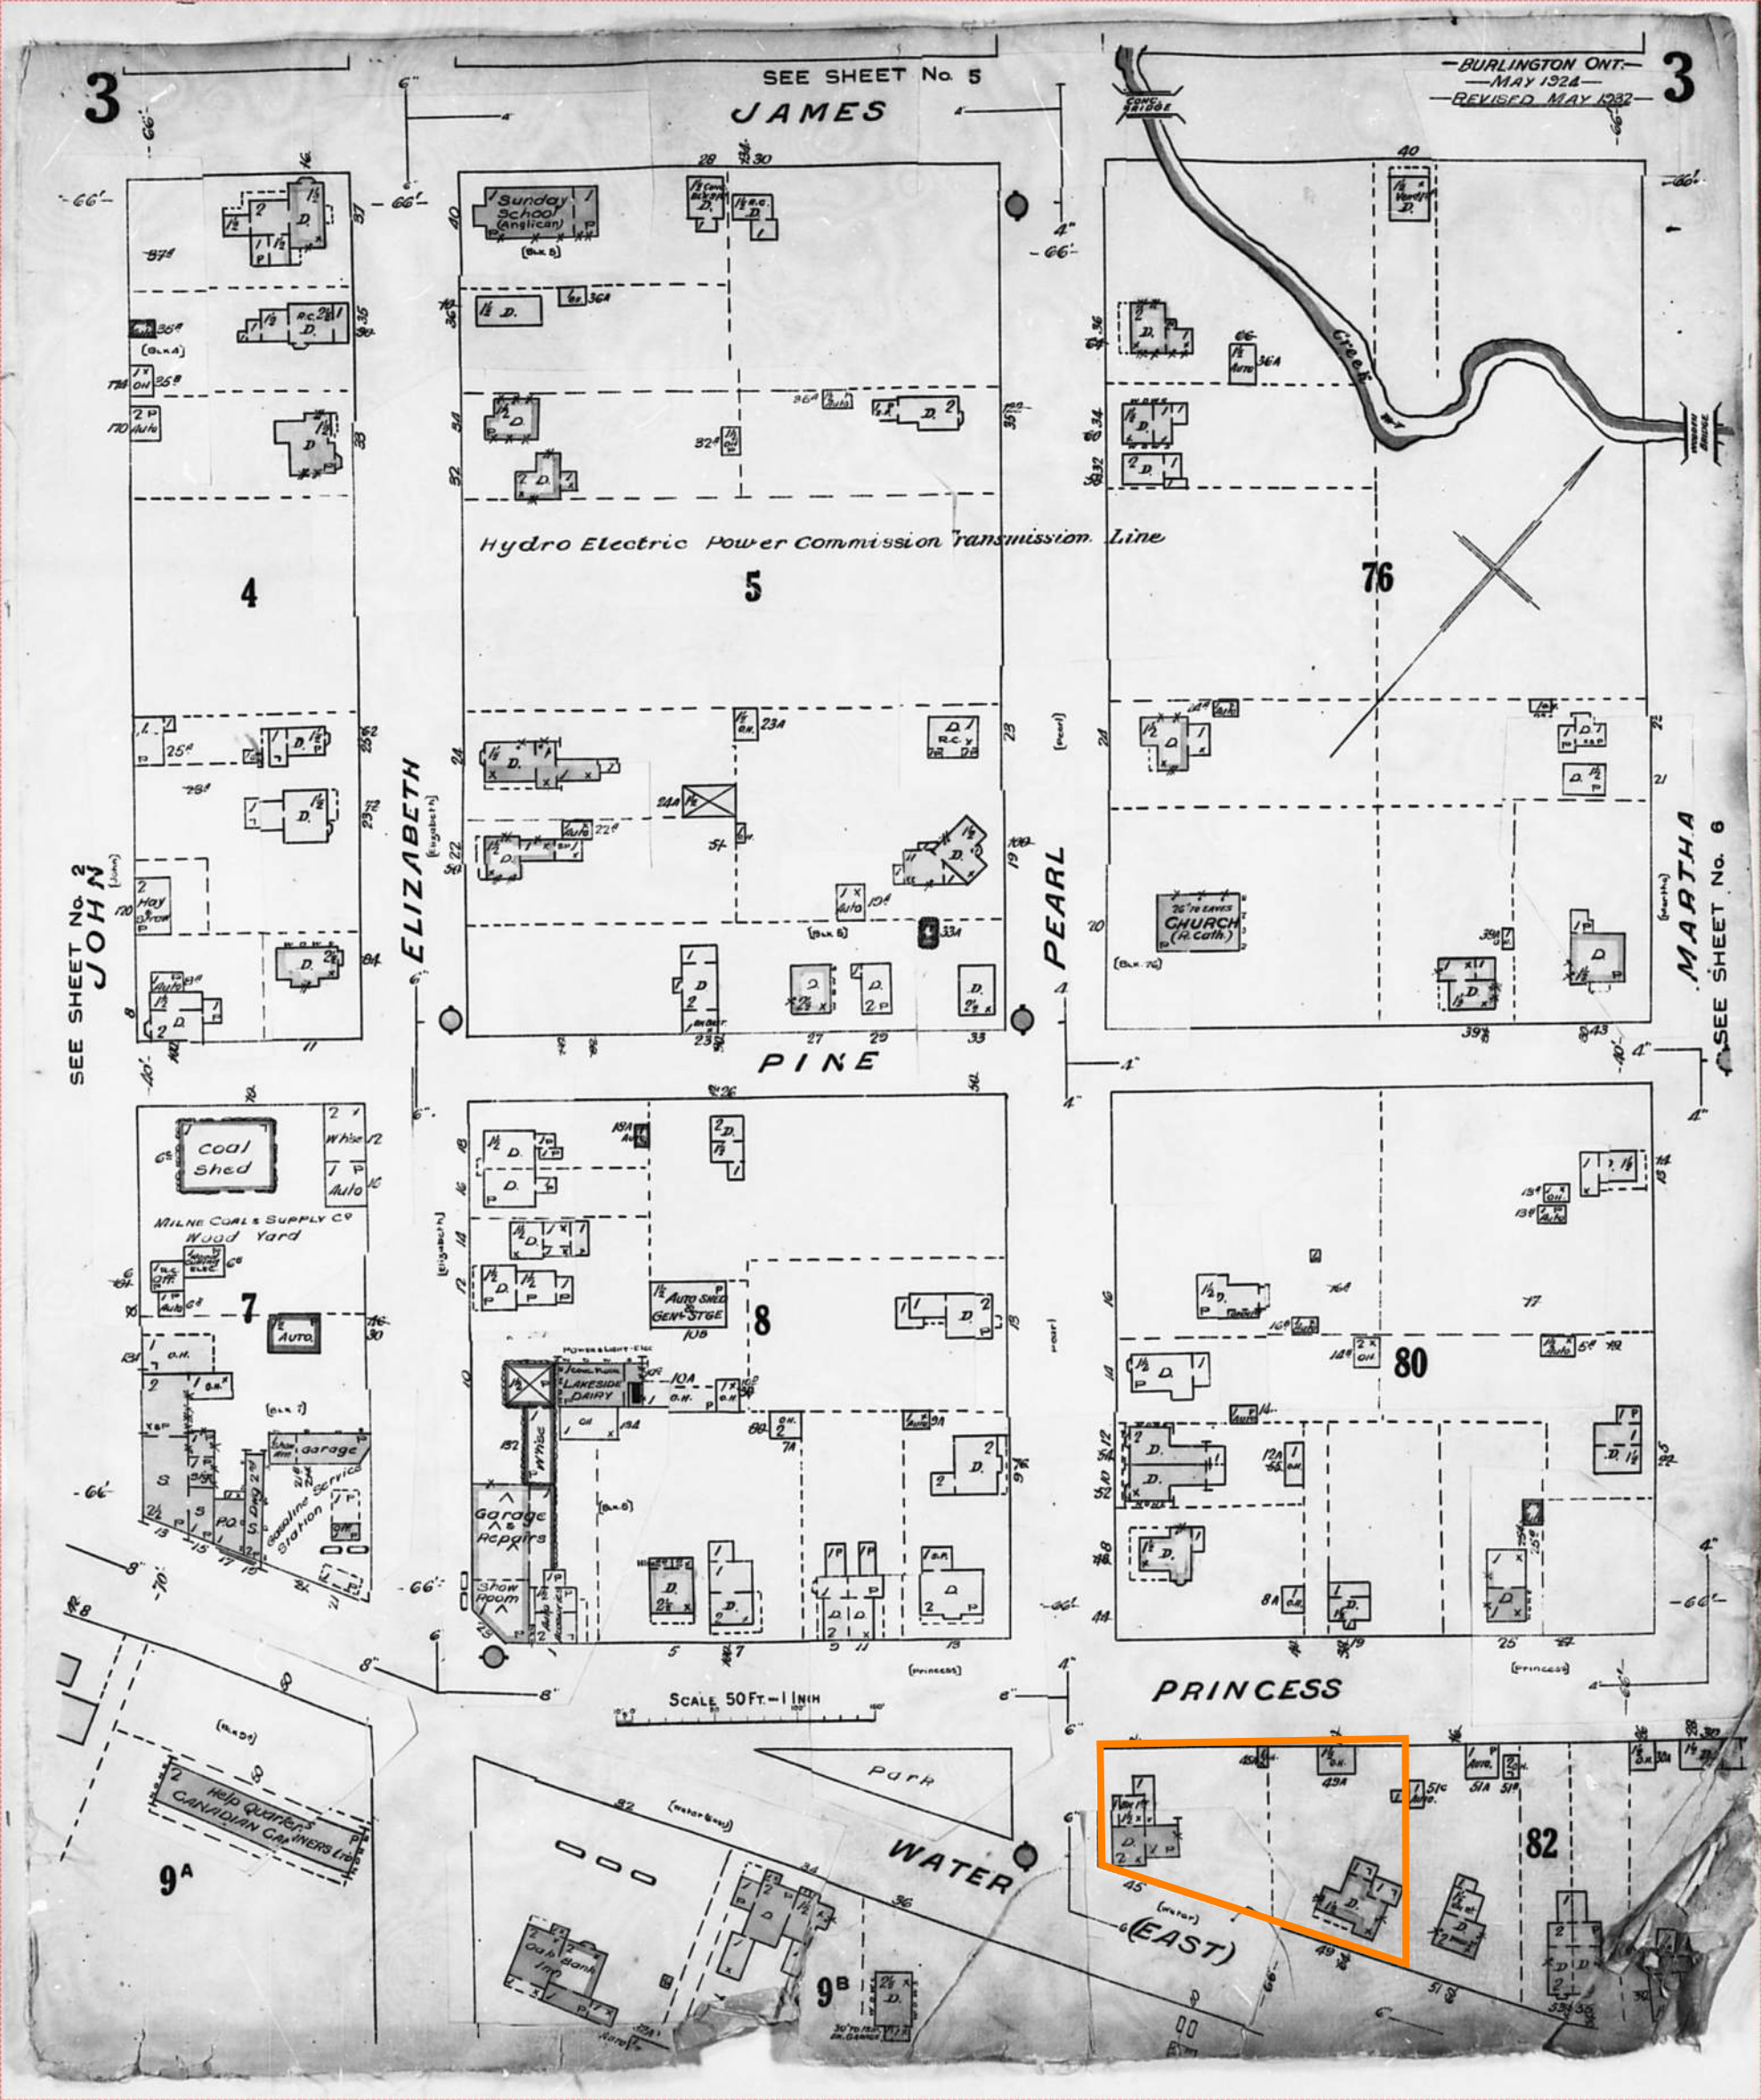


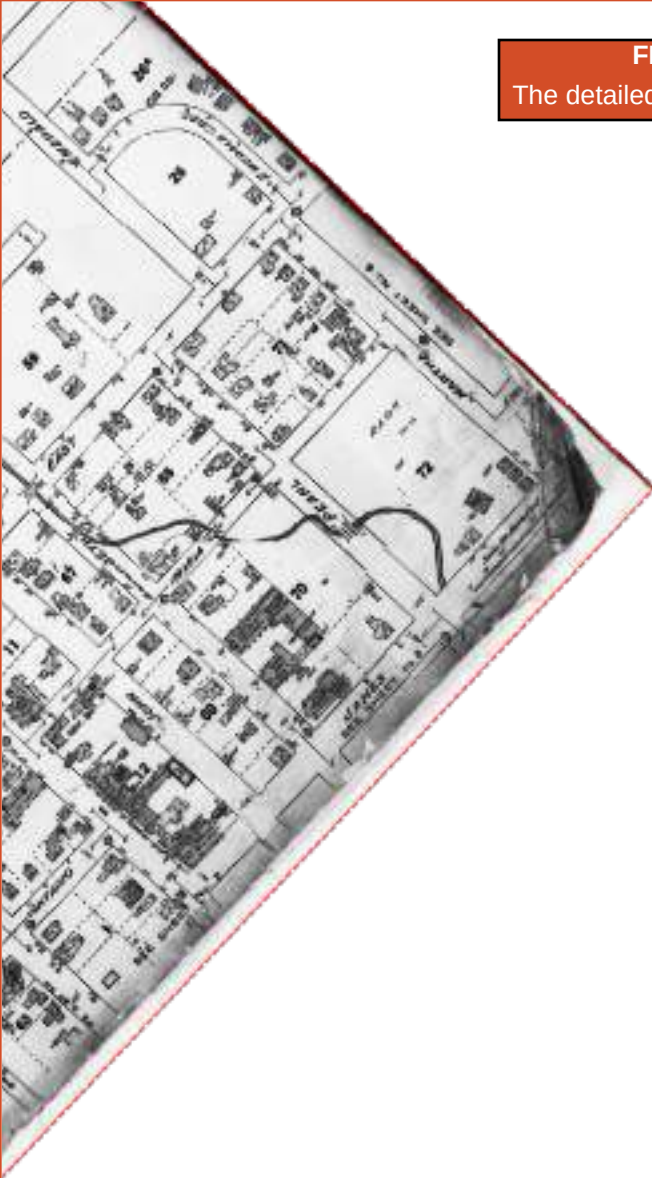

FIP Locator Map

The detailed FIP is on the following page



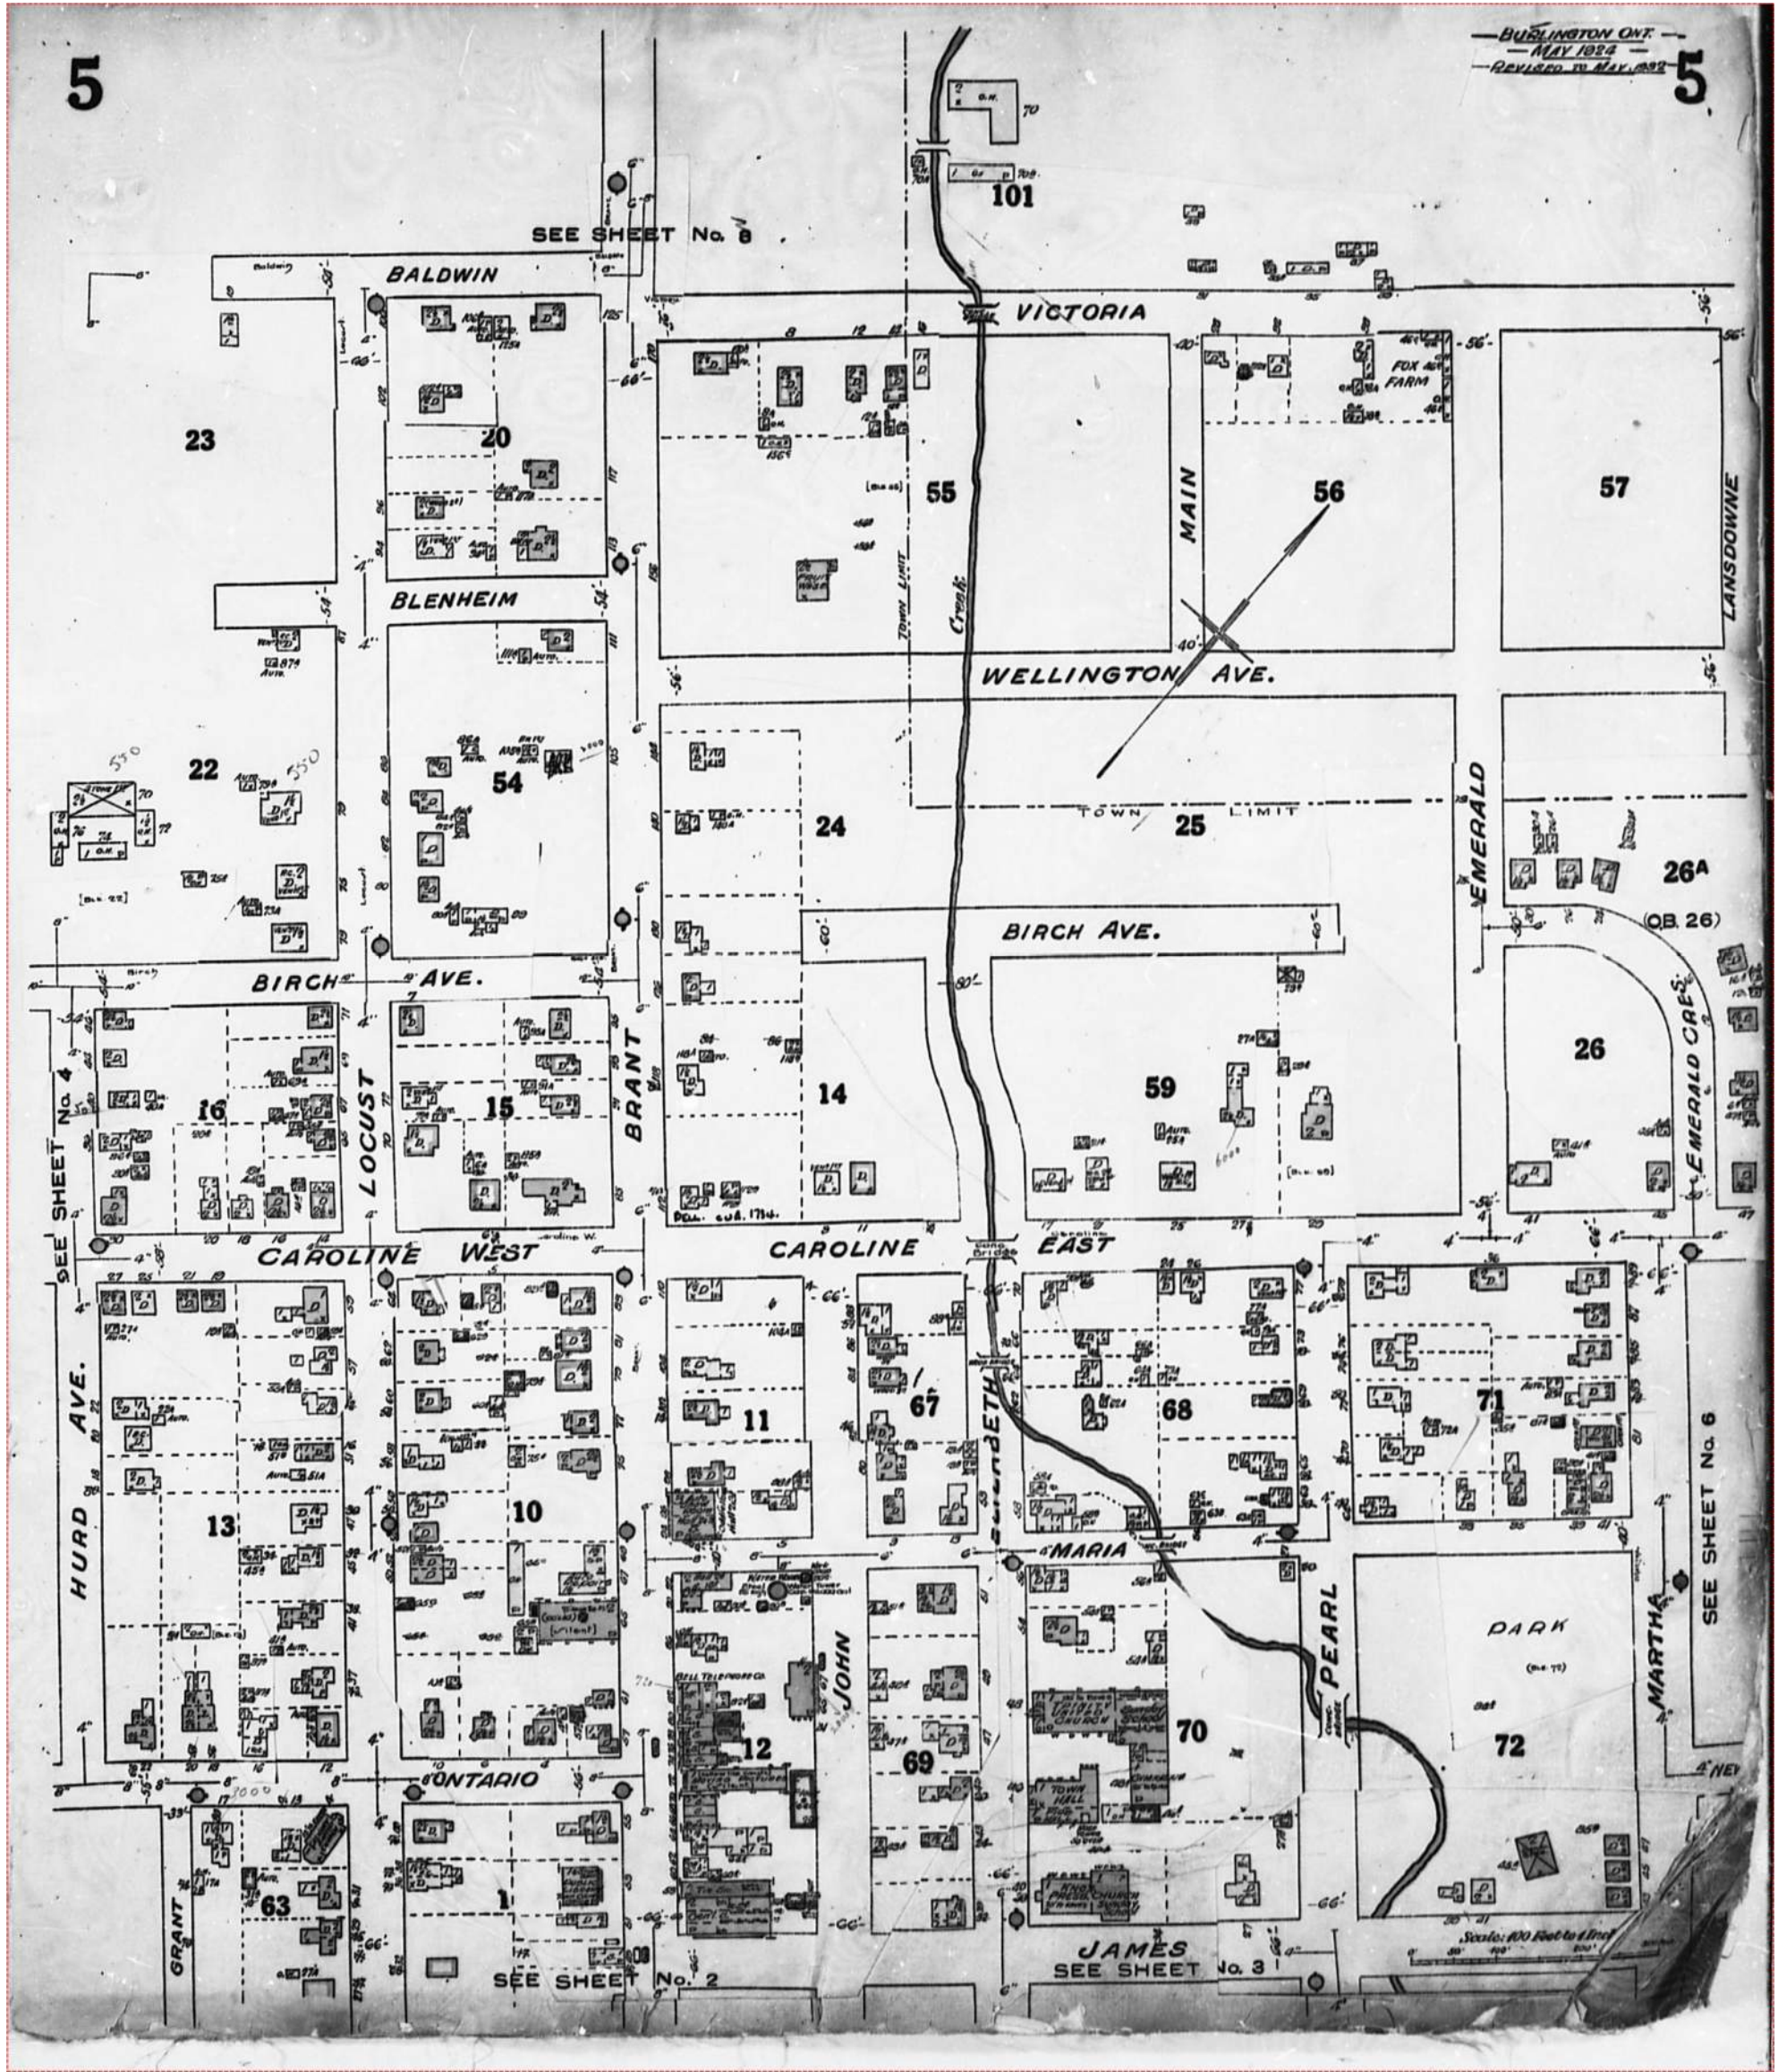




FIP Locator Map

The detailed FIP is on the following page




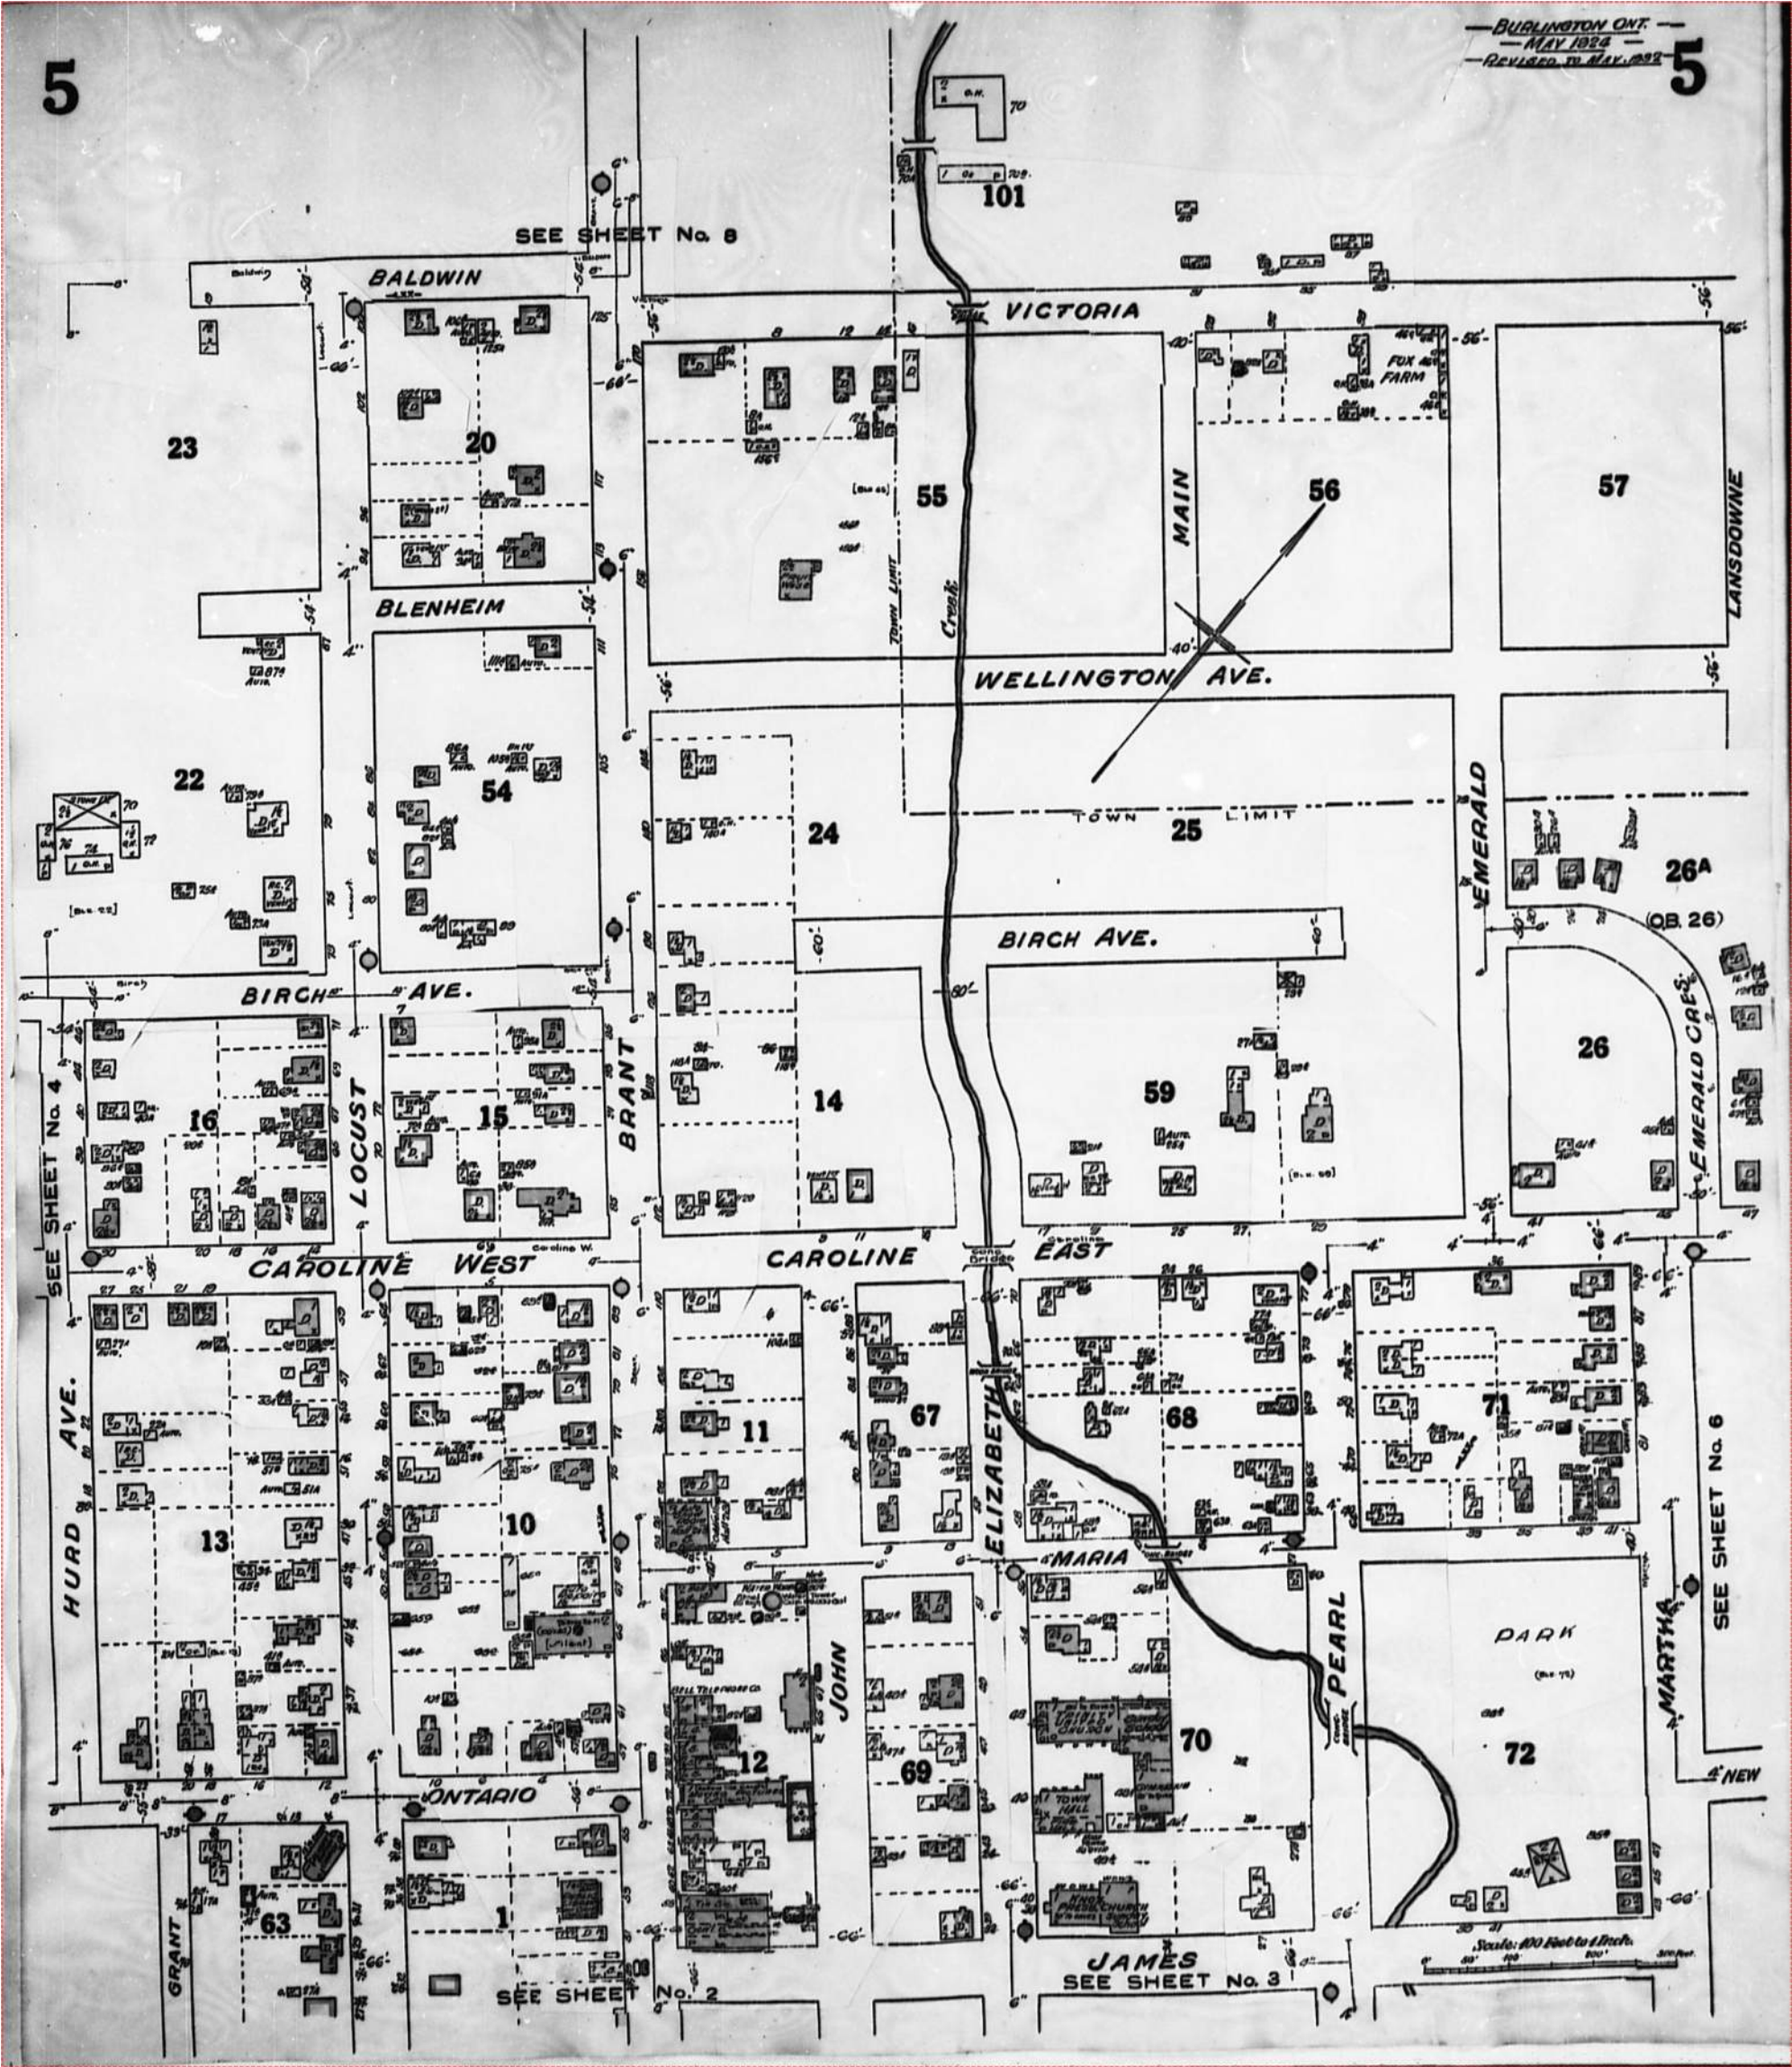

FIP Locator Map

The detailed FIP is on the following page




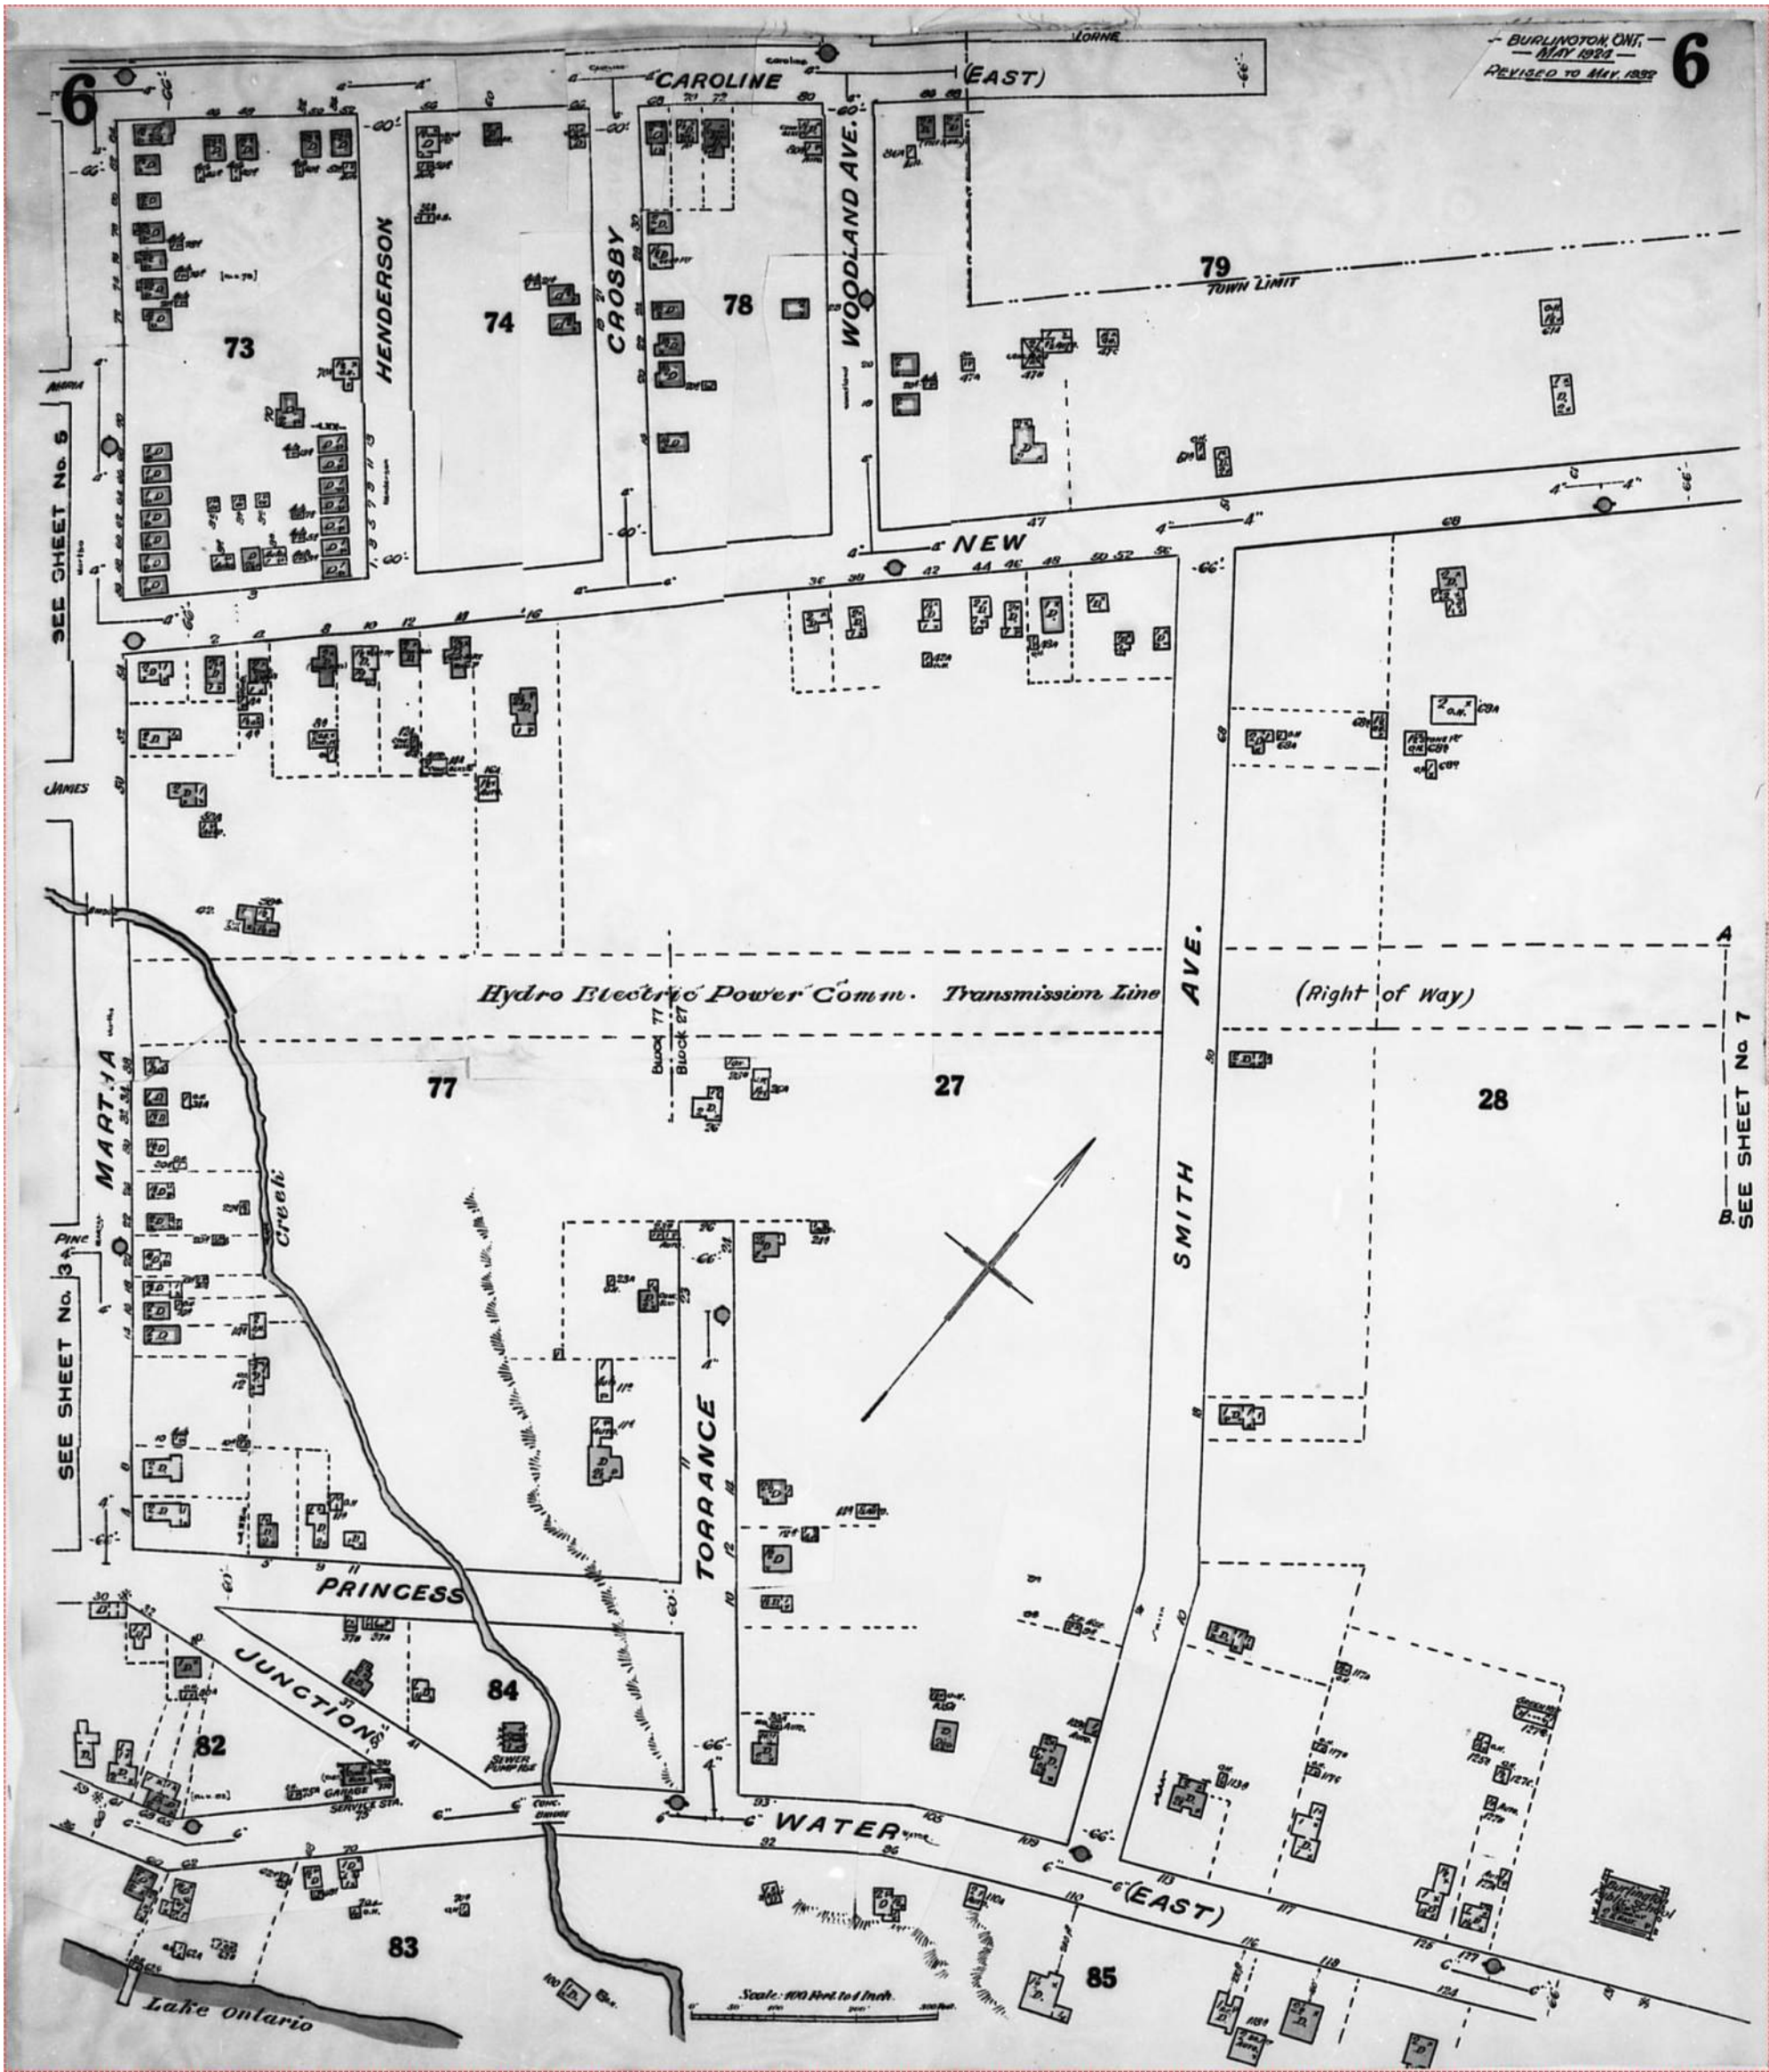

FIP Locator Map

The detailed FIP is on the following page




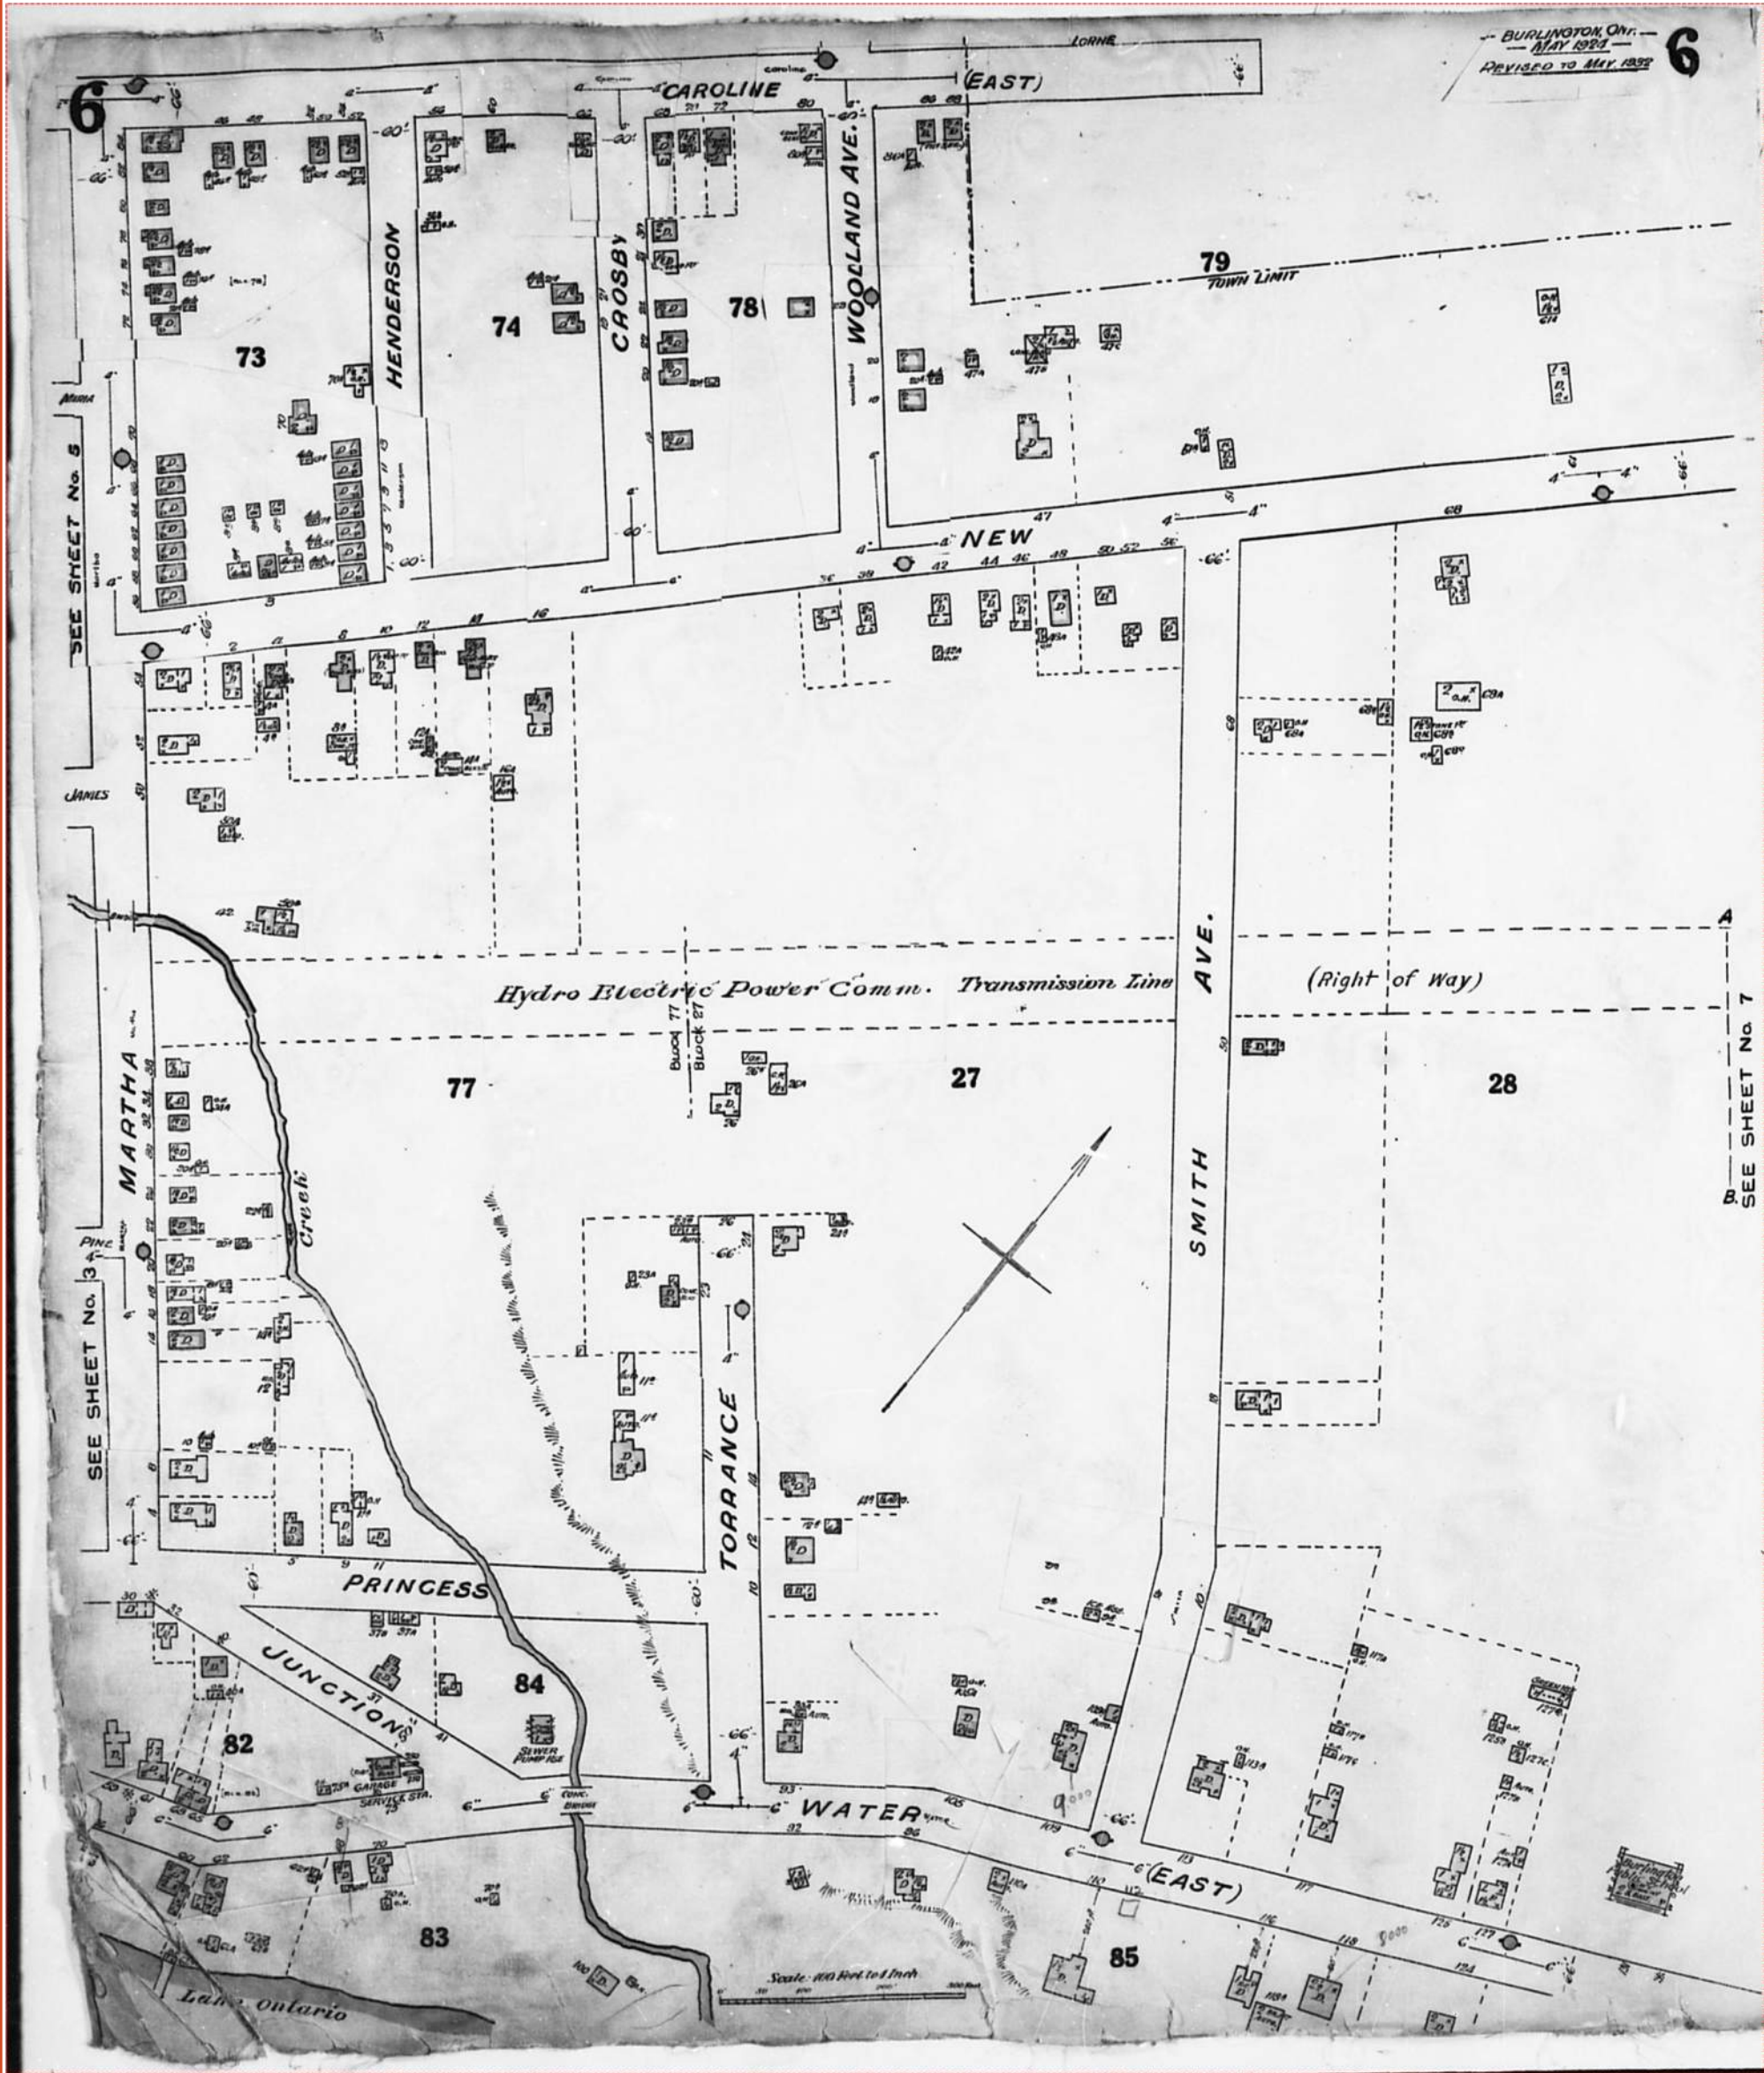

FIP Locator Map

The detailed FIP is on the following page




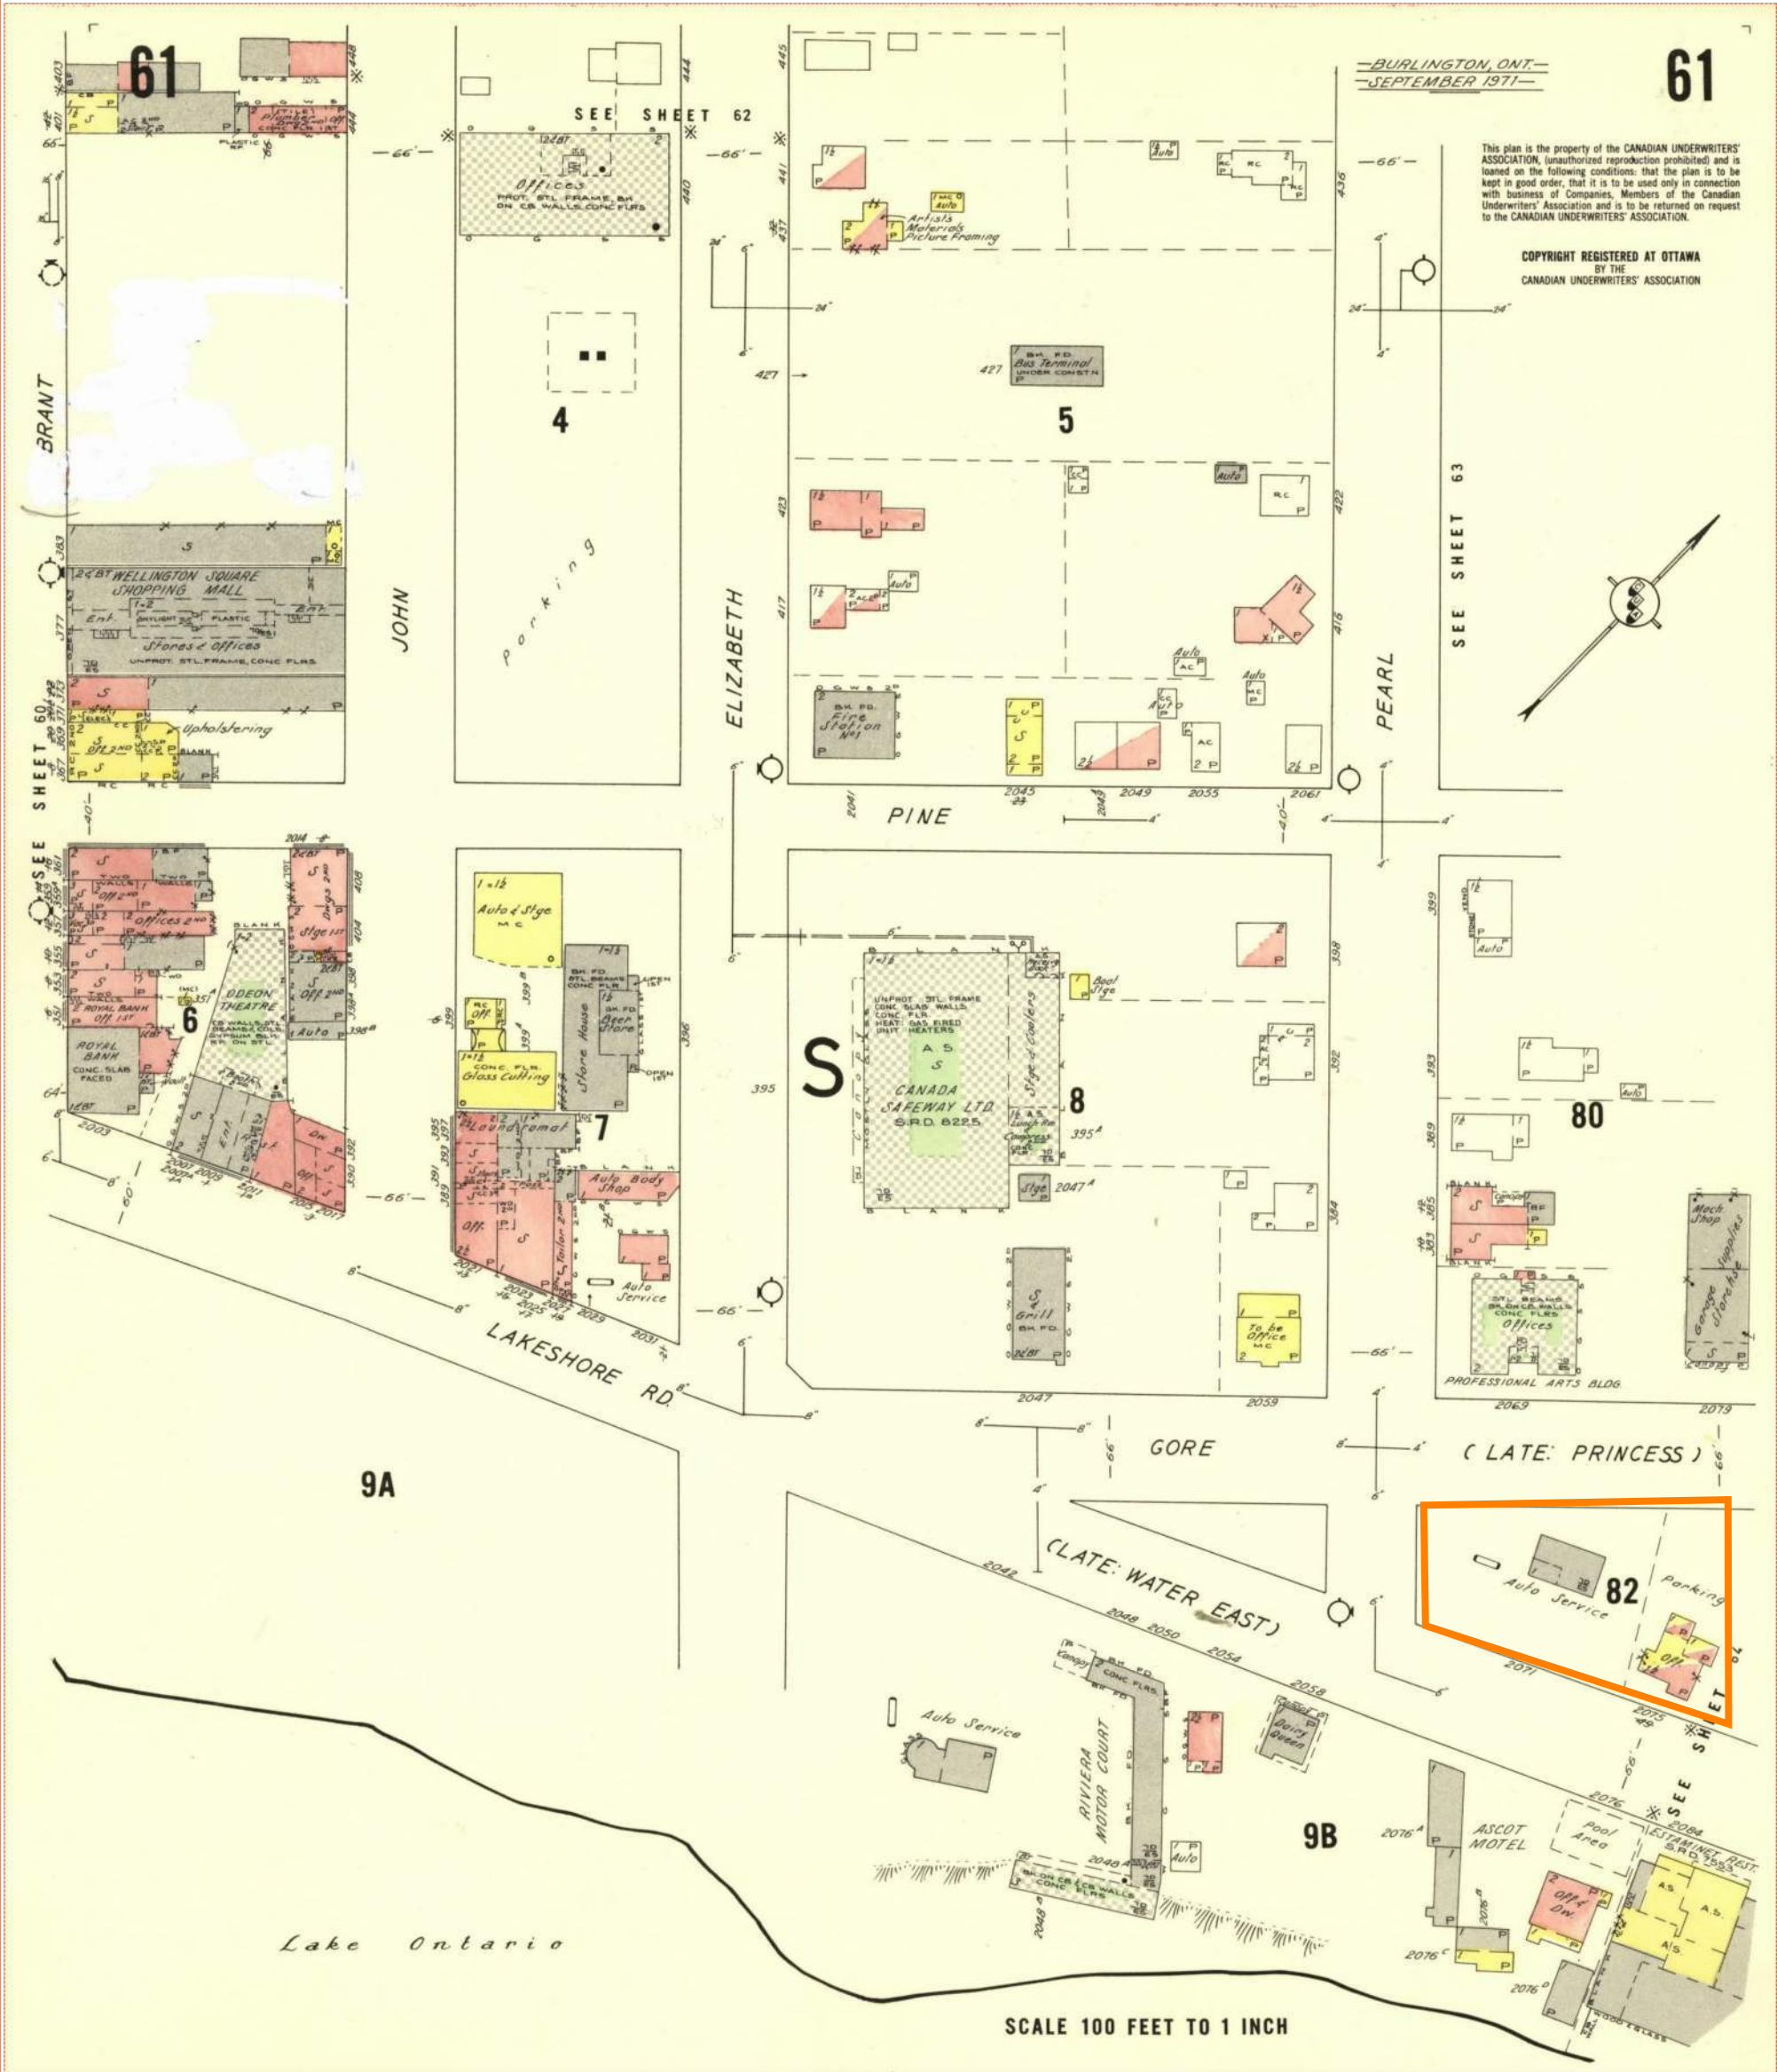

FIP Locator Map

The detailed FIP is on the following page




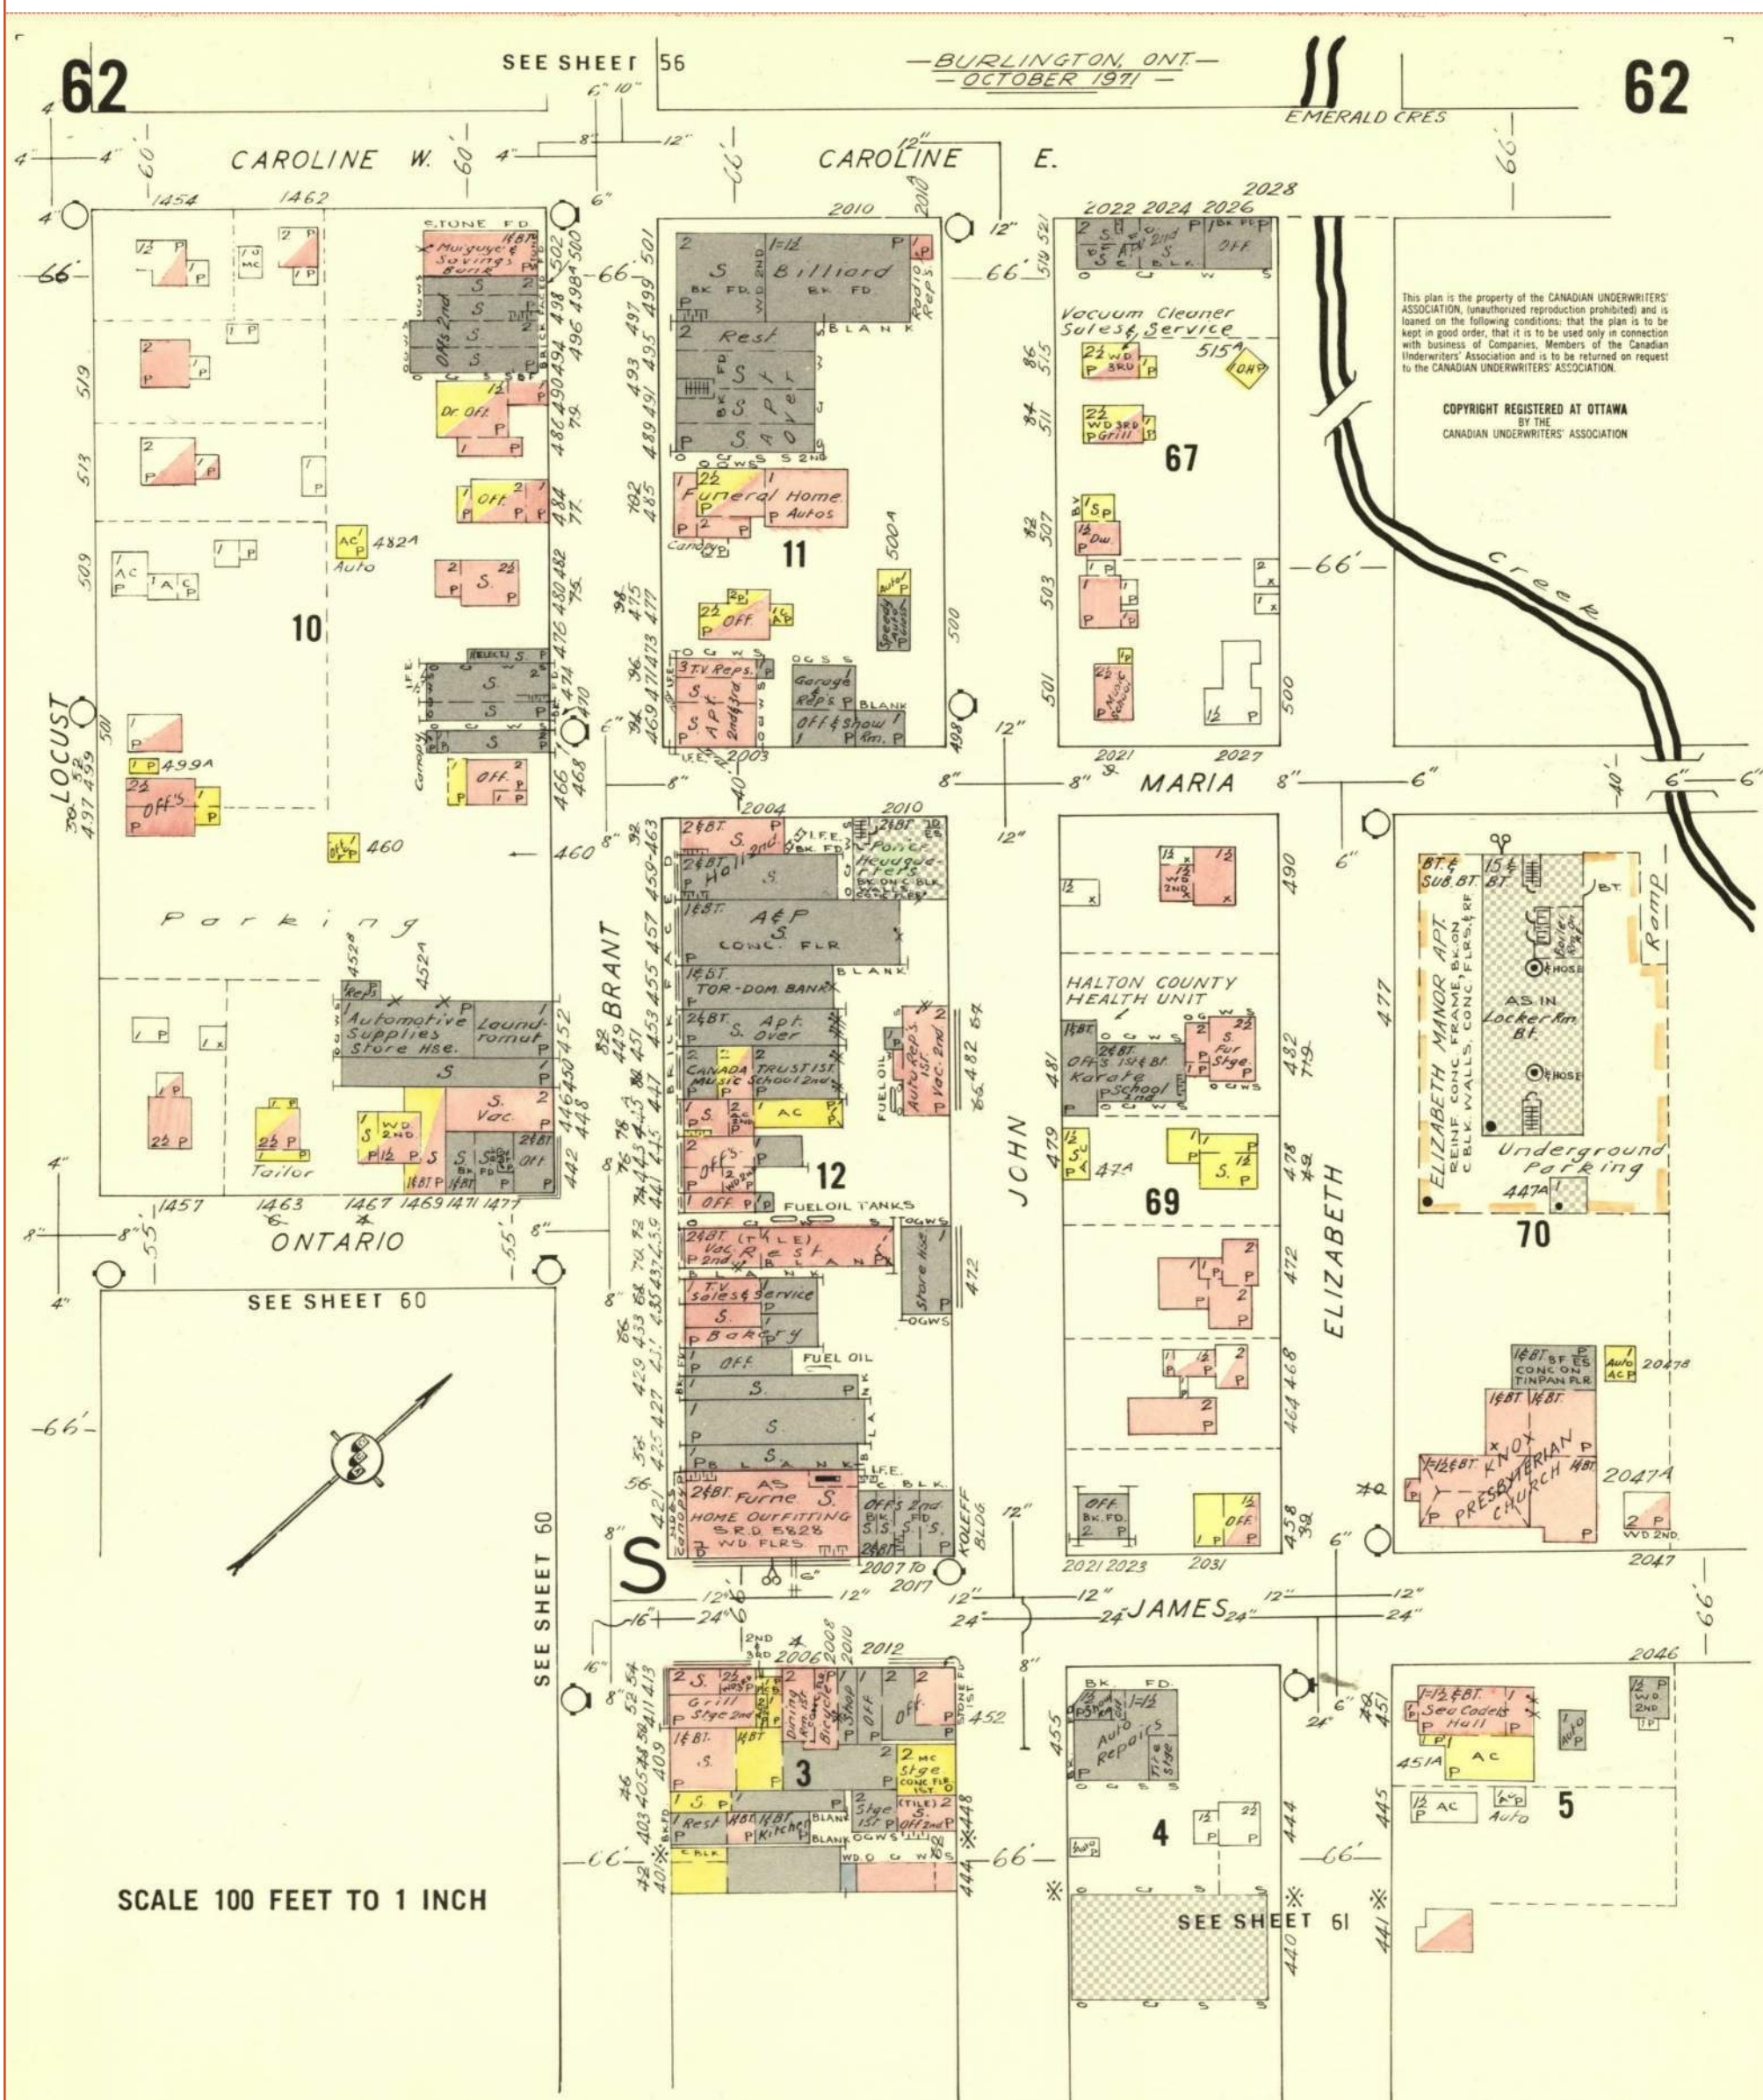

FIP Locator Map

The detailed FIP is on the following page




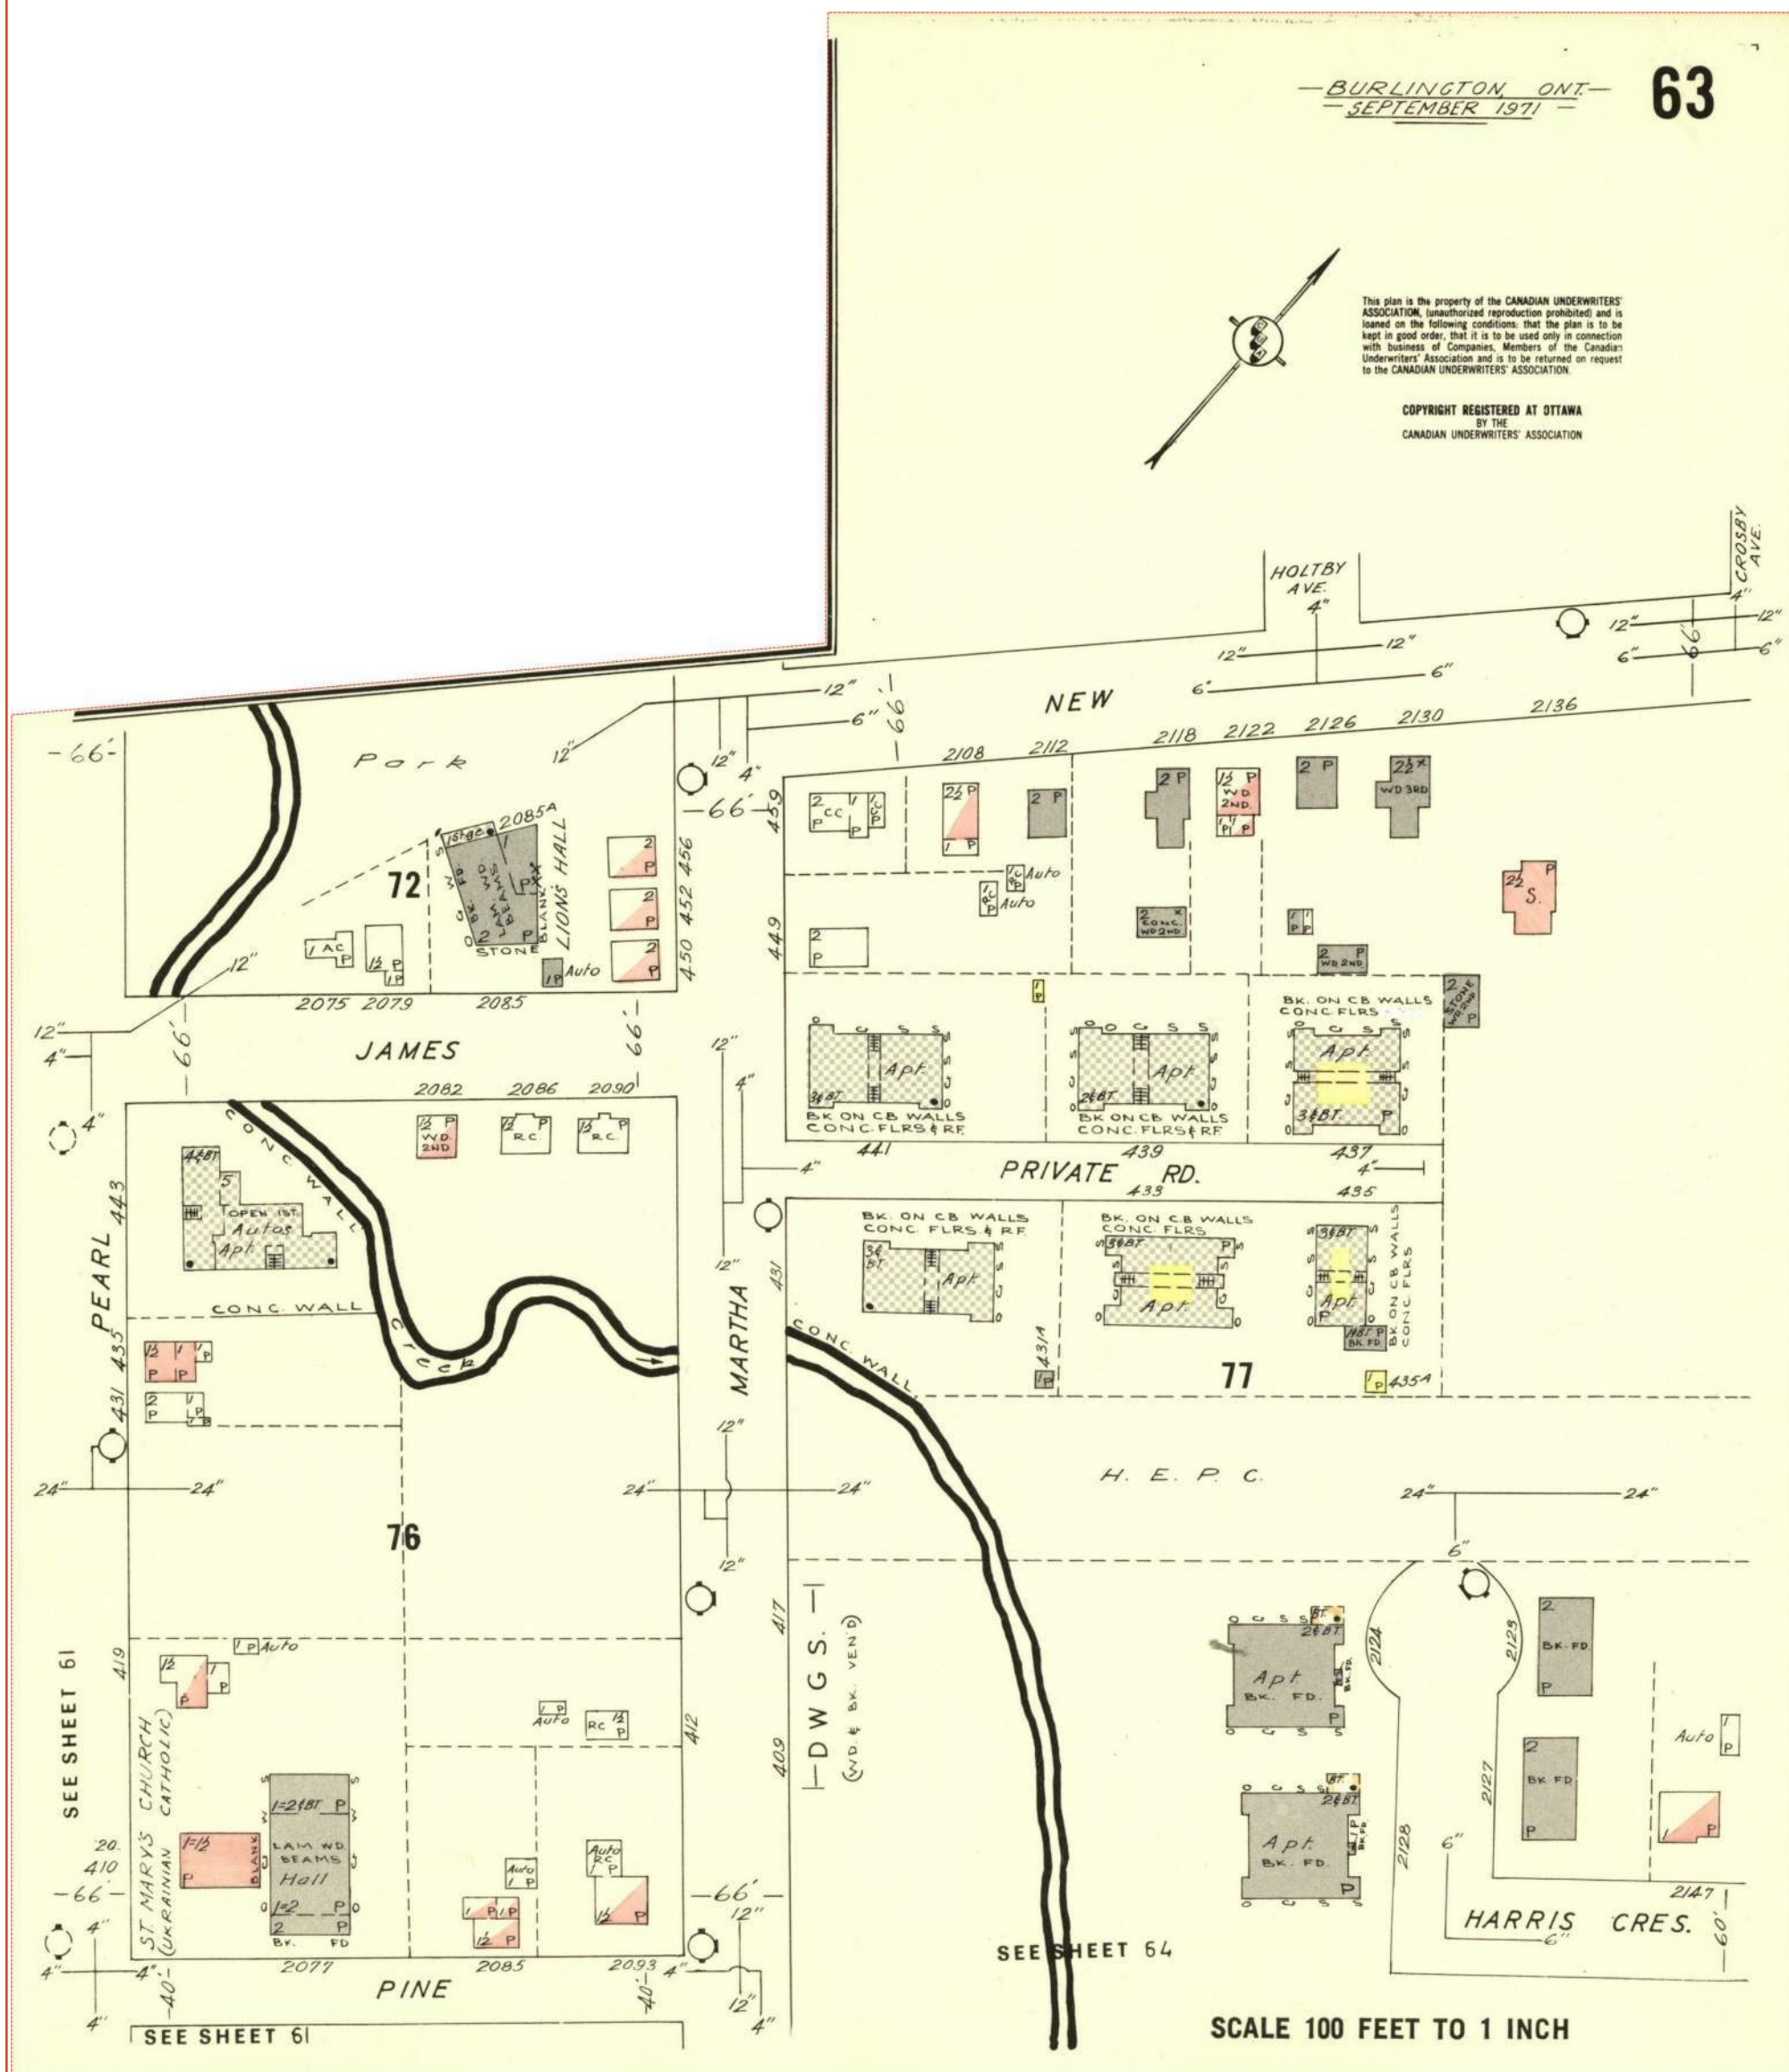

FIP Locator Map

The detailed FIP is on the following page



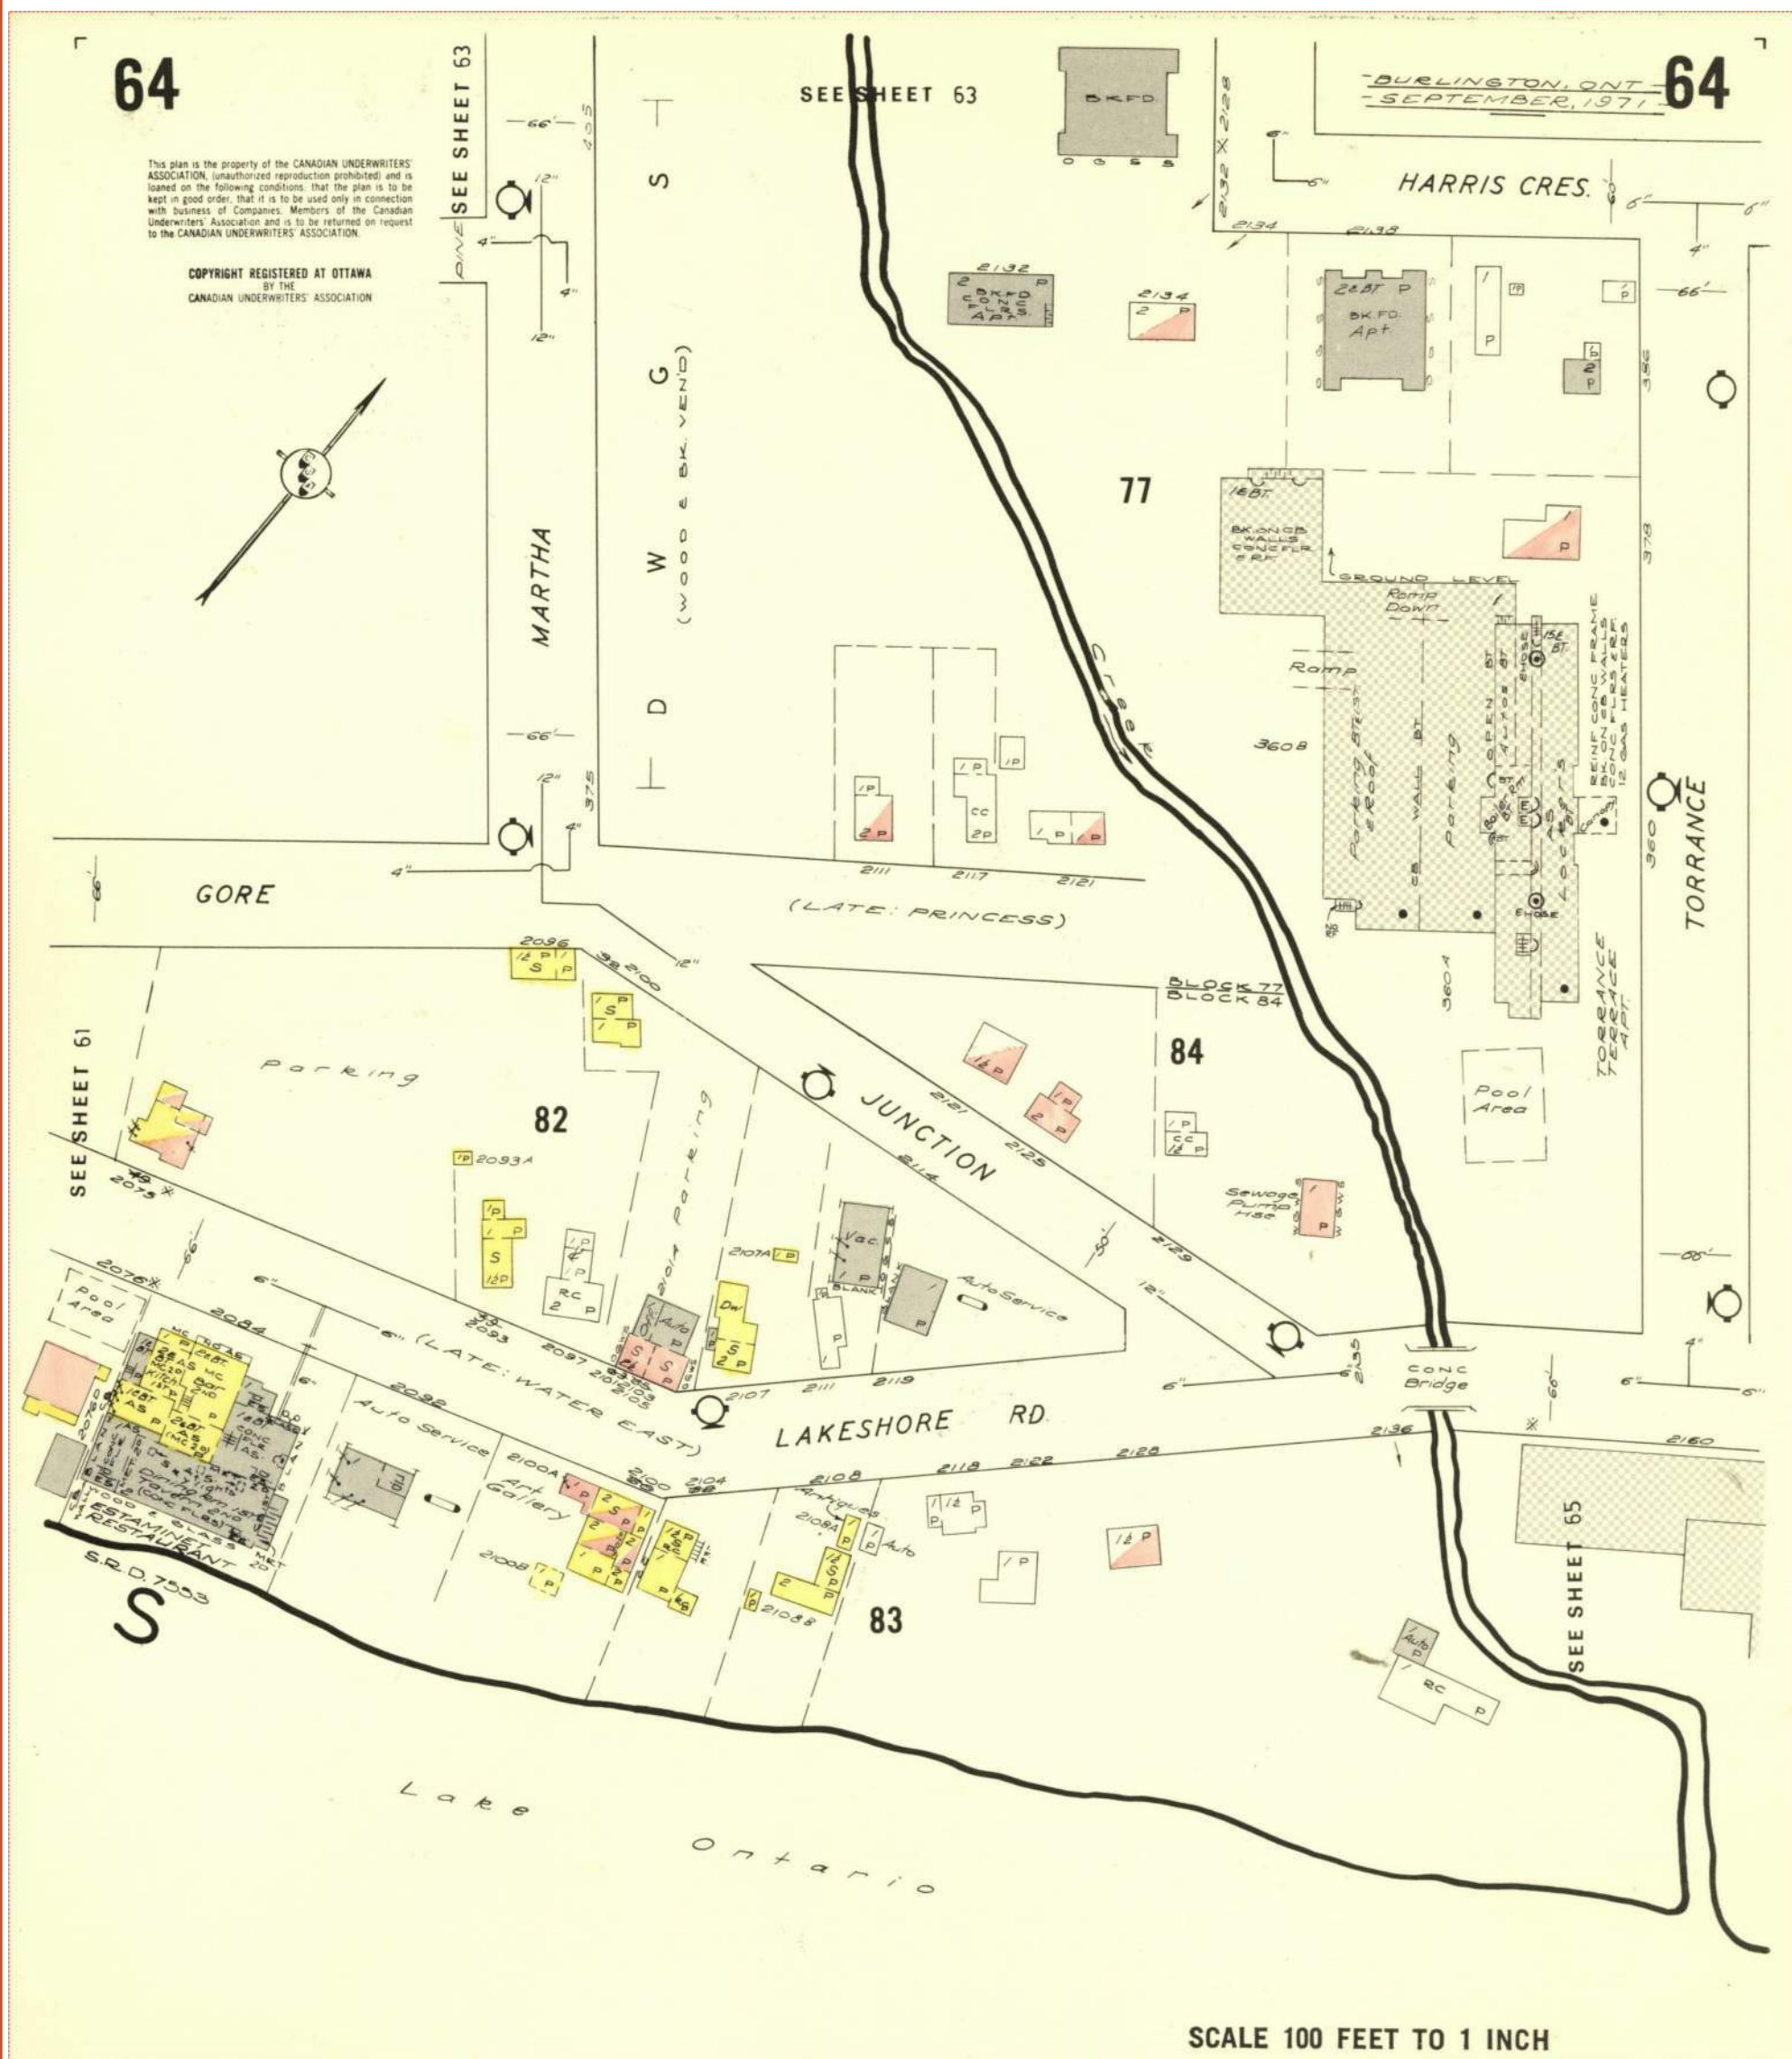



Conditions d'utilisation et droit d'auteur

Les reproductions fournies par BAC sont réservées à des fins de recherche ou d'études privées. Il incombe aux utilisateurs qui souhaitent utiliser ces reproductions pour toutes autres fins d'obtenir la permission écrite du titulaire du droit d'auteur. Le récipiendaire sera tenu responsable de toute infraction au droit de propriété de cette copie numérique.

BAC possède une vaste quantité de documents pour lesquels la propriété et le statut du droit d'auteur peuvent être difficiles à établir, soit en raison d'information insuffisante, soit à cause de leur origine mixte, c'est-à-dire publique et privée, ou encore parce qu'il s'agit de documents en partie publiés et en partie inédits. On suggère aux utilisateurs de consulter la *Loi sur le droit d'auteur* et d'obtenir un avis juridique lorsque l'interprétation du droit d'auteur soulève des questions. BAC n'a pas le mandat d'interpréter la *Loi sur le droit d'auteur* pour le bénéfice des utilisateurs, et il incombe à ces derniers de connaître les obligations que comportent les droits d'auteur.


Pour en savoir davantage, consultez la page « Avis » du site Web de BAC : <http://www.bac-lac.gc.ca/fra/Pages/avis.aspx>

Terms of use and Copyright

Any copy provided by LAC is restricted to research purposes or private study. Users wishing to use the copies for any other purpose should obtain written permission of the copyright owner. Responsibility regarding questions of copyright that may arise in the use of this digital copy is assumed by the recipient.

LAC holds enormous quantities of records for which the ownership and copyright status may be uncertain, either because of insufficient information or because of a mixture of public and private material, or of published and unpublished works. Users are urged to consult the *Copyright Act* and to seek legal advice when the interpretation of copyright raises questions. It is not the role of LAC to interpret the *Copyright Act* for users but rather it is up to the users to be aware of copyright issues.

For more information please consult the LAC, "Terms and Conditions" page: :
<http://www.bac-lac.gc.ca/eng/Pages/terms-and-conditions.aspx>

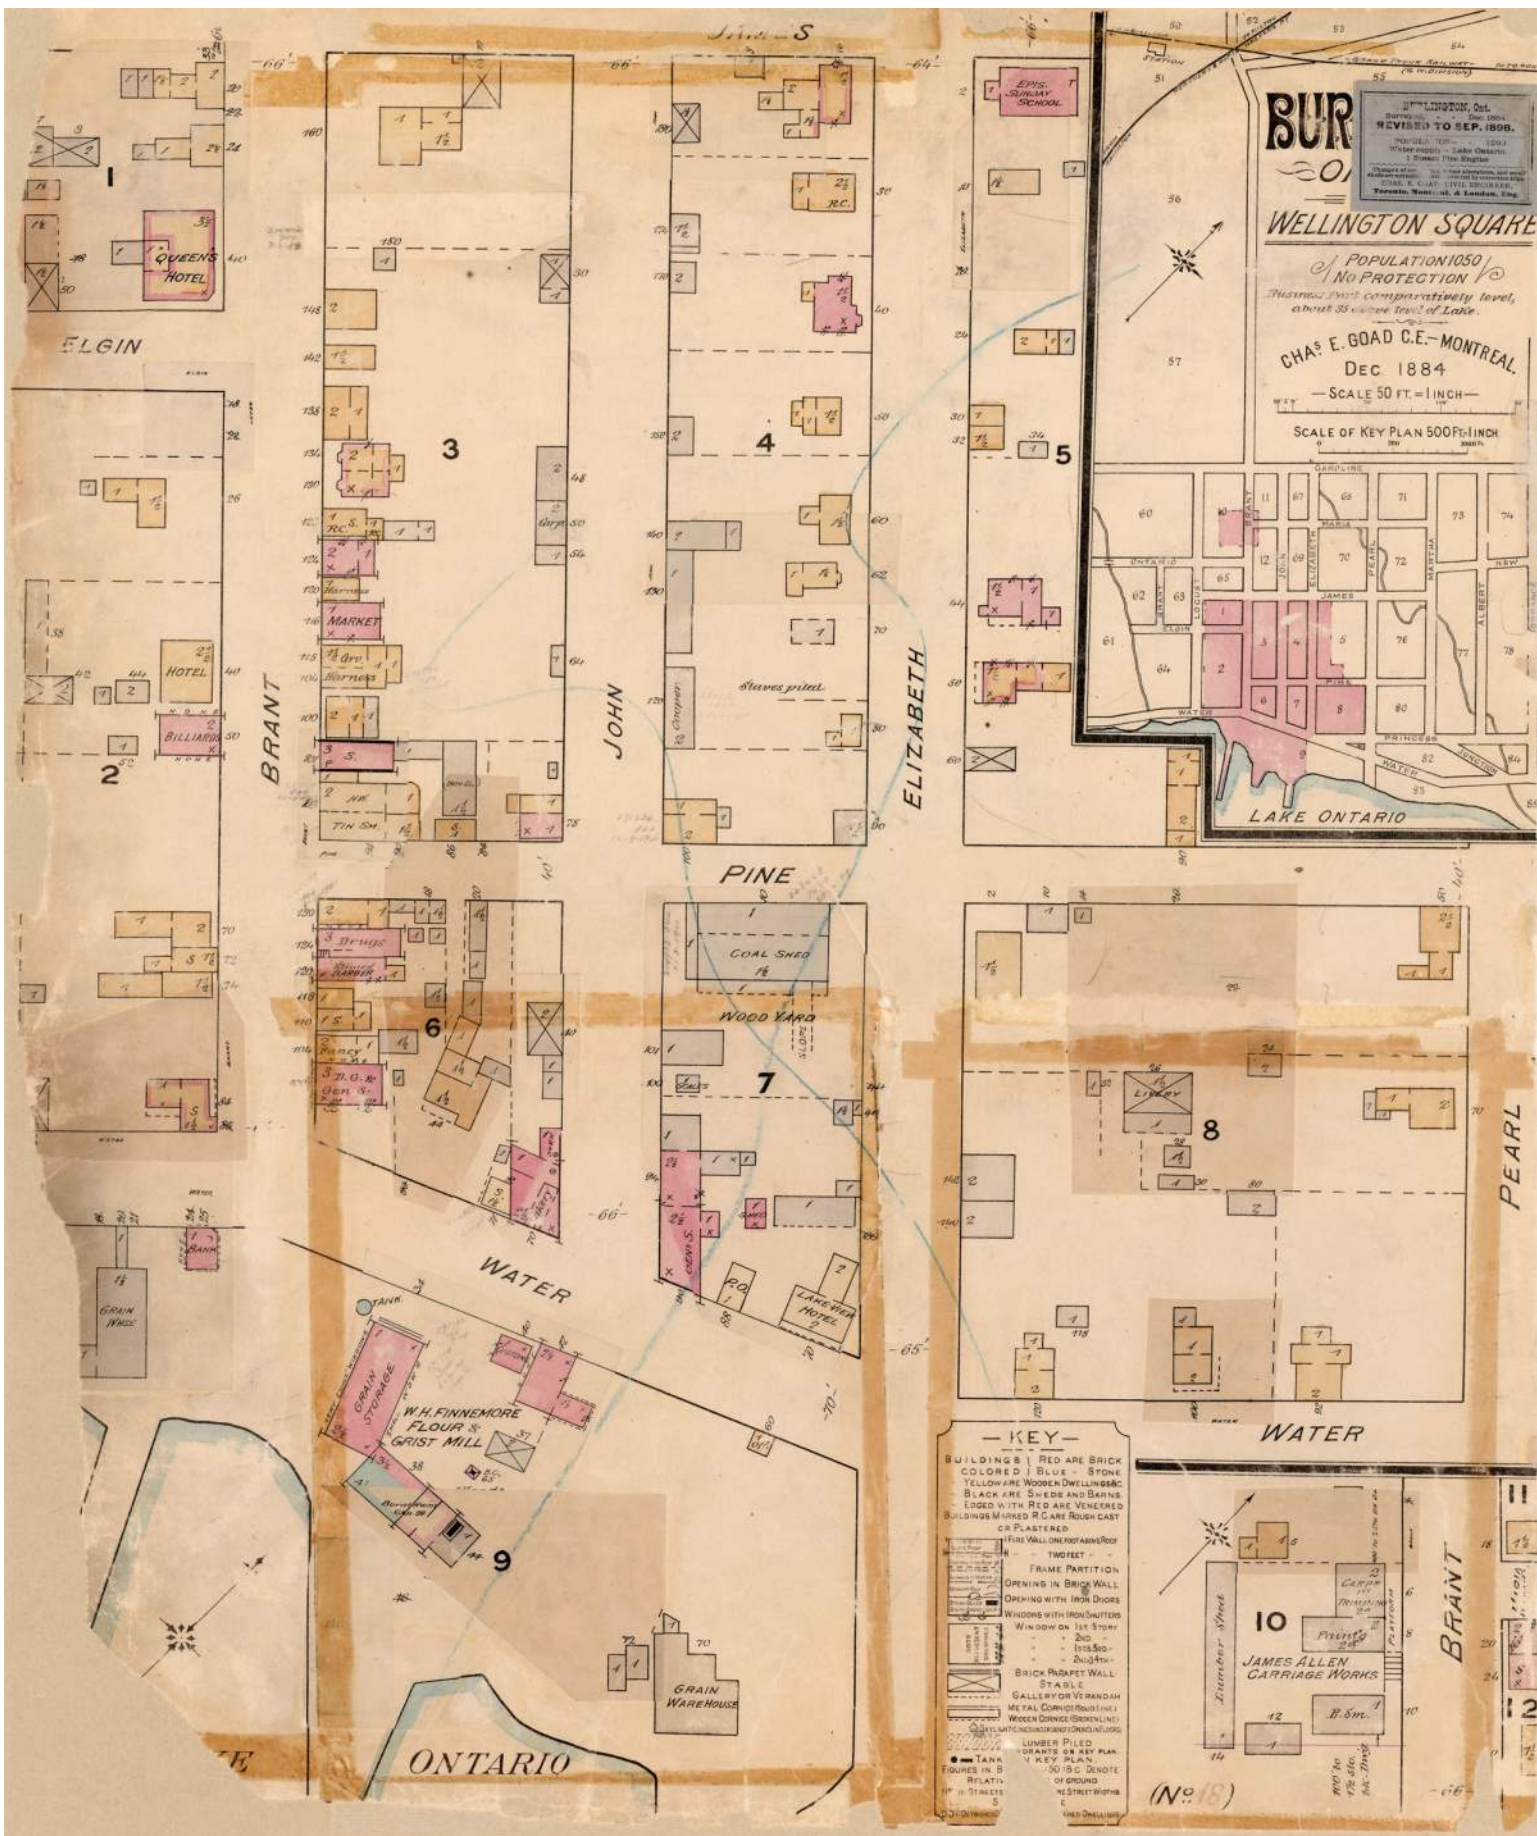

3

SEE SHEET No 5

JAMES


BURLINGTON ONT

MAY 1921

3




4

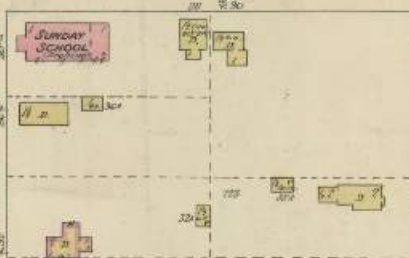

Toronto and Niagara Power Co Transmission Line

5

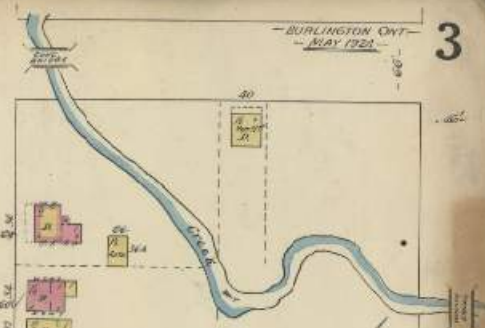

76


SEE SHEET No 2

JOHN

ELIZABETH



7

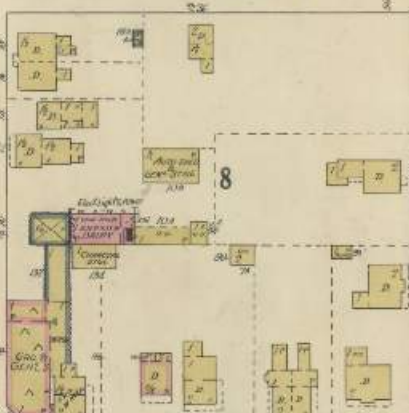

8


PEARL

PINE



SEE SHEET No 6

MARTHA

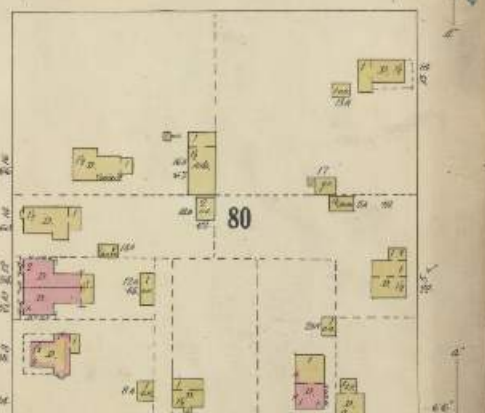

80

SCALE 50 FT = 1 INCH

PRINCESS

9A

WATER



82

(EAST)

9B

APPENDIX C



CHAIN OF TITLE REPORT

Project #: 22-282
Address: 2072 Lakeshore Road, Burlington
Legal: Lots 2 & 3, Pt Lot 4 Block Q Plan 92
Description: Part 1, 20R4751, as in 642260
Ex. Part 2, 20R12210
PIN #: 07061-0008 (LT)

Searched at: Milton
LRO #: 20

Page 1

**Pertains to Lot 2 Blk Q Plan 92 **

INSTR #	DOC. TYPE	REG. DATE	PARTY FROM	PARTY TO
	Patent	14 02 1798	Crown	Capt. Joseph BRANT
81	Deed	27 11 1829	Capt. Joseph Brant	Andrew GAGE
529	Deed	26 07 1844	Andrew Gage	William CHAPMAN
566	Deed	17 01 1853	William Chapman	Thomas BAXTER
711	Deed	05 04 1864	Thomas Baxter	John R. MINKIRKNICK
261	Deed	19 06 1866	John R. Minkirknick	John WALDIE
46	Deed	31 10 1874	John Waldie	John McGildouney BOYD
124	Deed	08 01 1876	John McGildouney Boyd	John WHITE
445	Deed	12 03 1881	John White	Catherine Agnes GREENE Thomas GREENE

Cont'd on Page 2

CHAIN OF TITLE REPORT

Project #: 22-282
Address: 2072 Lakeshore Road, Burlington
Legal: Lots 2 & 3, Pt Lot 4 Block Q Plan 92
Description: Part 1, 20R4751, as in 642260
Ex. Part 2, 20R12210
PIN #: 07061-0008 (LT)

Searched at: Milton
LRO #: 20

Page 2

Pertains to Lot 2 Blk Q Plan 92

INSTR #	DOC. TYPE	REG. DATE	PARTY FROM	PARTY TO
443	Mortgage	12 03 1881	Catherine Agnes Greene & Thomas Greene	The Hamilton Provident and Loan Society (Mortgagee)
640	Deed (Power of Sale)	01 06 1883	The Hamilton Provident and Loan Society (Catherine Agnes Greene & Thomas Greene defaulted in Mtg)	Frederick BALL
518	Deed	06 02 1885	Frederick Ball	Mary ATKINSON
5356	Deed	17 05 1920	Mary Atkinson - Estate	Thomas ATKINSON
5891	Deed	20 08 1921	Thomas Atkinson	Alice MORTIMER
7531	Deed	04 09 1926	Alice Mortimer - Estate	Thomas MORTIMER
8821	Deed	10 06 1932	Thomas Mortimer	William Harold WRIGHT Norah Kathleen WRIGHT
11537	Deed	27 07 1944	Norah Kathleen Wright (Surviving Joint Tenant)	Howard S. DITMARS & Mary E. DITMARS
18173	Deed	27 08 1954	Howard S. Ditmars & Mary E. Ditmars	Sun Oil Company Limited

Cont'd on Page 3

CHAIN OF TITLE REPORT

Project #: 22-282
Address: 2072 Lakeshore Road, Burlington
Legal: Lots 2 & 3, Pt Lot 4 Block Q Plan 92
Description: Part 1, 20R4751, as in 642260
Ex. Part 2, 20R12210
PIN #: 07061-0008 (LT)

Searched at: Milton
LRO #: 20
Page 3
**Pertains to Lot 2 Blk Q Plan 92 **
Updated Search May 3/2023

INSTR #	DOC. TYPE	REG. DATE	PARTY FROM	PARTY TO
458452	Deed	27 06 1977	Sun Oil Company Limited	Doug French Holdings Inc.
526891	Deed	27 08 1980	Doug French Holdings Inc.	A. E. LePage Real Estate Services Limited
642260	Deed	06 06 1986	A. E. LePage Real Estate Services Limited	Royal LePage Real Estate Services Ltd.
HR163848	Deed	02 12 2002	Royal LePage Real Estate Services Ltd.	David Paul LANDRY Peter John Gerard LANDRY
HR1634723	Deed	12 07 2019	David Paul Landry Peter John Gerard Landry	Peter John Gerard LANDRY Joann Katherine LANDRY
HR1956255	Deed (Present Owner)	31 03 2023	Peter John Gerard Landry Joann Katherine Landry	Acamar Dwelling Corp.

CHAIN OF TITLE REPORT

Project #: 22-282
Address: 2072 Lakeshore Road, Burlington
Legal: Lots 2 & 3, Pt Lot 4 Block Q Plan 92
Description: Part 1, 20R4751, as in 642260
Ex. Part 2, 20R12210
PIN #: 07061-0008 (LT)

Searched at: Milton
LRQ #: 20

Page 1

Pertains to Pt Lot 3 Blk Q Plan 92 Pt 1, 20R4751

INSTR #	DOC. TYPE	REG. DATE	PARTY FROM	PARTY TO
	Patent	14 02 1798	Crown	Capt. Joseph BRANT
81	Deed	27 11 1829	Capt. Joseph Brant	Andrew GAGE
749	Mortgage	10 02 1848	Andrew Gage	Daniel TORRANCE (Mortgagee)
85	Deed (Power of Sale)	26 12 1853	Daniel Torrance (Andrew Gage defaulted in Mtg)	Thomas BAXTER
711	Deed	05 04 1864	Thomas Baxter	John R. MINKIRKNICK
261	Deed	19 06 1866	John R. Minkirknick	John WALDIE
426	Deed	10 03 1884	John Waldie	Kate Jane Emma GREENE
2178	Deed	01 06 1902	Kate Jane Emma Greene - Estate	Henry GHENT
18174	Deed	27 08 1954	Henry Ghent - Estate	Sun Oil Company Limited

Cont'd on Page 2

CHAIN OF TITLE REPORT

Project #: 22-282
Address: 2072 Lakeshore Road, Burlington
Legal: Lots 2 & 3, Pt Lot 4 Block Q Plan 92
Description: Part 1, 20R4751, as in 642260
Ex. Part 2, 20R12210
PIN #: 07061-0008 (LT)

Searched at: Milton
LRO #: 20

Page 2

Pertains to Pt Lot 3 Blk Q Plan 92 Pt 1, 20R4751

INSTR #	DOC. TYPE	REG. DATE	PARTY FROM	PARTY TO
18211	Deed	10 09 1954	Sun Oil Company Limited	Howard S. DITMARS Mary E. DITMARS
18425	Deed	03 12 1954	Howard S. Ditmars Mary E. Ditmars	Long Acres Properties Limited
62889	Deed	03 04 1957	Long Acres Properties Limited	I. B. & J. Investments Limited
116056	Deed	05 10 1960	I. B. & J. Investments Limited Long Acres Properties Limited	The Estaminet Limited
356950	Deed	12 03 1973	The Estaminet Limited	The Estaminet Investments Limited
416649	Mortgage	25 05 1973	The Estaminet Investments Limited	Brian Cooper Limited (Mortgagee)
520616	Deed (Power of Sale)	18 04 1980	Brian Cooper Limited (The Estaminet Investments Limited defaulted in Mtg)	A. E. LePage Limited
642257	Deed	06 06 1986	A. E. LePage Real Estate Services Limited (Fmly A. E. LePage Limited)	Royal LePage Real Estate Services Limited
HR163848	Deed	02 12 2002	Royal LePage Real Estate Services Limited	David Paul LANDRY Peter John Gerard LANDRY

Cont'd on Page 3

CHAIN OF TITLE REPORT

Project #: 22-282
Address: 2072 Lakeshore Road, Burlington
Legal: Lots 2 & 3, Pt Lot 4 Block Q Plan 92
Description: Part 1, 20R4751, as in 642260
Ex. Part 2, 20R12210
PIN #: 07061-0008 (LT)

Searched at: Milton
LRO #: 20

Page 3

Pertains to Pt Lot 3 Blk Q Plan 92 Pt 1, 20R4751

Updated Search May 3/2023

INSTR #	DOC. TYPE	REG. DATE	PARTY FROM	PARTY TO
HR1634723	Deed	12 07 2019	David Paul Landry Peter John Gerard Landry	Peter John Gerard LANDRY Joann Katherine LANDRY
HR1956255	Deed (Present Owner)	31 03 2023	Peter John Gerard Landry Joann Katherine Landry	Acamar Dwelling Corp.

CHAIN OF TITLE REPORT

Project #: 22-282
Address: 2072 Lakeshore Road, Burlington
Legal Description: Lots 2 & 3, Pt Lot 4 Block Q Plan 92
Part 1, 20R4751, as in 642260
Ex. Part 2, 20R12210
PIN #: 07061-0008 (LT)

Searched at: Milton
LRO #: 20

Page 1

**Pertains to Part Lot 4 Plan 92 **

INSTR #	DOC. TYPE	REG. DATE	PARTY FROM	PARTY TO
	Patent	14 02 1798	Crown	Capt. Joseph BRANT
81	Deed	27 11 1829	Capt. Joseph Brant	Andrew GAGE
749	Mortgage	10 02 1845	Andrew Gage	Daniel TORRANCE (Mortgagee)
78	Deed (Power of Sale)	16 09 1848	Daniel Torrance (Andrew Gage defaulted in Mtg)	Peter FISHER
343	Deed	05 04 1855	Peter Fisher	John CRYSLER
198	Deed	16 02 1866	John Crysler	Mark G. CUMMINS
330	Deed	06 02 1867	Mark G. Cummins	Titus G. CUMMINS
662	Deed	11 07 1871	Titus G. Cummins	William DALTON
1552	Deed	12 04 1894	William Dalton - Estate	William M. DALTON James Walter DALTON

Cont'd on Page 2

CHAIN OF TITLE REPORT

Project #: 22-282
Address: 2072 Lakeshore Road, Burlington
Legal Description: Lots 2 & 3, Pt Lot 4 Block Q Plan 92
Part 1, 20R4751, as in 642260
Ex. Part 2, 20R12210
PIN #: 07061-0008 (LT)

Searched at: Milton
LRO #: 20

**Pertains to Part Lot 4 Plan 92 **

INSTR #	DOC. TYPE	REG. DATE	PARTY FROM	PARTY TO
2087	Deed	18 06 1901	William Dalton James Walter Dalton - Estate	David ACKLAND
2707	Deed	04 06 1906	David Ackland	Thomas ATKINSON
3399	Deed	18 04 1911	Thomas Atkinson	Robert N. PROCTER
10988	Deed	10 08 1942	Robert N. Procter - Estate	Charles A. KLAINKA Nora Irene KLAINKA
17466	Deed	18 12 1953	Nora Irene KLAINKA (Surviving Joint Tenant)	Christopher TIPORILAW
17813	Deed	07 05 1954	Christopher Tiporilaw	The Estaminet Limited
18640	Deed	24 02 1955	The Estaminet Limited	Long Acres Properties Limited
62889	Deed	03 04 1957	Long Acres Properties Limited	I. B. & J. Investments Limited
116056	Deed	05 10 1960	I. B. & J. Investments Limited Long Acres Properties Limited	The Estaminet Limited

CHAIN OF TITLE REPORT

Project #: 22-282
 Address: 2072 Lakeshore Road, Burlington
 Legal: Lots 2 & 3, Pt Lot 4 Block Q Plan 92
 Description: Part 1, 20R4751, as in 642260
 Ex. Part 2, 20R12210
 PIN #: 07061-0008 (LT)

Searched at: Milton
 LRO #: 20

Page 3

**Pertains to Part Lot 4 Plan 92 **

** Updated Search May 3/2023**

INSTR #	DOC. TYPE	REG. DATE	PARTY FROM	PARTY TO
356950	Deed	12 03 1973	The Estaminet Limited	The Estaminet Investments Limited
416649	Mortgage	25 05 1973	The Estaminet Investments Limited	Brian Cooper Limited (Mortgagee)
520616	Deed (Power of Sale)	18 04 1980	Brian Cooper Limited (The Estaminet Investments Limited defaulted in Mtg)	A. E. LePage Limited
642257	Deed	06 06 1986	A. E. LePage Real Estate Services Limited (Fmly A. E. LePage Limited)	Royal LePage Real Estate Services Limited
HR163848	Deed	02 12 2002	Royal LePage Real Estate Services Limited	David Paul LANDRY Peter John Gerard LANDRY
HR1634723	Deed	12 07 2019	David Paul Landry Peter John Gerard Landry	Peter John Gerard LANDRY Joann Katherine LANDRY
HR1956255	Deed (Present Owner)	31 03 2023	Peter John Gerard Landry Joann Katherine Landry	Acamar Dwelling Corp.

LAND
REGISTRY
OFFICE #20

07061-0008 (LT)

PAGE 1 OF 3
PREPARED FOR bertucci
ON 2023/05/03 AT 10:51:17

* CERTIFIED IN ACCORDANCE WITH THE LAND TITLES ACT * SUBJECT TO RESERVATIONS IN CROWN GRANT *

PROPERTY DESCRIPTION: LT 2 BLK Q , COMPILED PLAN PL92 , LT 3 BLK Q , COMPILED PLAN PL92 , PT LT 4 BLK Q , COMPILED PLAN PL92 , PT 1, 20R4751 & AS IN 642260 EXCEPT PT 2, 20R12210; T/W 858403 ; BURLINGTON

PROPERTY REMARKS:

ESTATE/QUALIFIER:

FEE SIMPLE
LT CONVERSION QUALIFIED

RECENTLY:

FIRST CONVERSION FROM BOOK

PIN CREATION DATE:

1997/06/18

OWNERS' NAMES

ACAMAR DWELLING CORP.

CAPACITY SHARE

REG. NUM.	DATE	INSTRUMENT TYPE	AMOUNT	PARTIES FROM	PARTIES TO	CERT/ CHKD
EFFECTIVE 2000/07/29 THE NOTATION OF THE "BLOCK IMPLEMENTATION DATE" OF 1997/06/18 ON THIS PIN						
WAS REPLACED WITH THE "PIN CREATION DATE" OF 1997/06/18						
** PRINTOUT INCLUDES ALL DOCUMENT TYPES AND DELETED INSTRUMENTS SINCE 1997/06/17 **						
**SUBJECT, ON FIRST REGISTRATION UNDER THE LAND TITLES ACT, TO:						
** SUBSECTION 44(1) OF THE LAND TITLES ACT, EXCEPT PARAGRAPH 11, PARAGRAPH 14, PROVINCIAL SUCCESSION DUTIES *						
** AND ESCHEATS OR FORFEITURE TO THE CROWN.						
** THE RIGHTS OF ANY PERSON WHO WOULD, BUT FOR THE LAND TITLES ACT, BE ENTITLED TO THE LAND OR ANY PART OF						
** IT THROUGH LENGTH OF ADVERSE POSSESSION, PRESCRIPTION, MISDESCRIPTION OR BOUNDARIES SETTLED BY						
** CONVENTION.						
** ANY LEASE TO WHICH THE SUBSECTION 70(2) OF THE REGISTRY ACT APPLIES.						
**DATE OF CONVERSION TO LAND TITLES: 1997/06/18 **						
119980	1961/01/25	BYLAW				C
458455	1977/06/27	AGREEMENT				C
20R4751	1980/04/17	PLAN REFERENCE				C
524480	1980/07/10	AGREEMENT			THE CORPORATION OF THE CITY OF BURLINGTON	C
524481	1980/07/10	AGREEMENT			THE CORPORATION OF THE CITY OF BURLINGTON	C
592076	1983/12/21	ASSIGNMENT LEASE		*** COMPLETELY DELETED ***		
642257	1986/06/06	TRANSFER		*** COMPLETELY DELETED ***		
					ROYAL LEPAGE REAL ESTATE SERVICES LTD.	

NOTE: ADJOINING PROPERTIES SHOULD BE INVESTIGATED TO ASCERTAIN DESCRIPTIVE INCONSISTENCIES, IF ANY, WITH DESCRIPTION REPRESENTED FOR THIS PROPERTY.
NOTE: ENSURE THAT YOUR PRINTOUT STATES THE TOTAL NUMBER OF PAGES AND THAT YOU HAVE PICKED THEM ALL UP.

LAND
REGISTRY
OFFICE #20

07061-0008 (LT)

PAGE 2 OF 3
PREPARED FOR bertucci
ON 2023/05/03 AT 10:51:17

* CERTIFIED IN ACCORDANCE WITH THE LAND TITLES ACT * SUBJECT TO RESERVATIONS IN CROWN GRANT *

REG. NUM.	DATE	INSTRUMENT TYPE	AMOUNT	PARTIES FROM	PARTIES TO	CERT/ CHKD
642260	1986/06/06	TRANSFER		*** COMPLETELY DELETED ***	ROYAL LEPAGE REAL ESTATE SERVICES LTD.	
HR163848	2002/12/02	TRANSFER		*** COMPLETELY DELETED *** ROYAL LEPAGE REAL ESTATE SERVICES LTD.	LANDRY, DAVID PAUL LANDRY, PETER JOHN GERARD	
REMARKS: PLANNING ACT STATEMENTS						
HR163852	2002/12/02	CHARGE		*** COMPLETELY DELETED *** LANDRY, DAVID PAUL LANDRY, PETER JOHN GERARD	ROYAL LEPAGE REAL ESTATE SERVICES LTD.	
HR1133212	2013/09/16	DISCH OF CHARGE		*** COMPLETELY DELETED *** ROYAL LEPAGE REAL ESTATE SERVICES LTD.		
REMARKS: HR163852.						
HR1139629	2013/10/10	CHARGE		*** COMPLETELY DELETED *** LANDRY, DAVID PAUL LANDRY, PETER JOHN GERARD	LANDRY, MARY-HELEN	
HR1139631	2013/10/10	NO ASSGN RENT GEN		*** COMPLETELY DELETED *** LANDRY, DAVID PAUL LANDRY, PETER JOHN GERARD	LANDRY, MARY-HELEN	
REMARKS: RENTS - HR1139629						
HR1634723	2019/07/12	TRANSFER		*** COMPLETELY DELETED *** LANDRY, DAVID PAUL LANDRY, PETER JOHN GERARD	LANDRY, JOANN KATHERINE LANDRY, PETER JOHN GERARD	
HR1955004	2023/03/24	APL ANNEX REST COV		*** COMPLETELY DELETED *** LANDRY, JOANN KATHERINE LANDRY, PETER JOHN GERARD		
HR1955816	2023/03/30	APL DELETE REST		*** COMPLETELY DELETED *** LANDRY, JOANN KATHERINE LANDRY, PETER JOHN GERARD		
REMARKS: HR1955004.						
HR1955817	2023/03/30	APL ANNEX REST COV		LANDRY, JOANN KATHERINE LANDRY, PETER JOHN GERARD		C
HR1956255	2023/03/31	TRANSFER	\$9,500,000	LANDRY, JOANN KATHERINE	ACAMAR DWELLING CORP.	C

NOTE: ADJOINING PROPERTIES SHOULD BE INVESTIGATED TO ASCERTAIN DESCRIPTIVE INCONSISTENCIES, IF ANY, WITH DESCRIPTION REPRESENTED FOR THIS PROPERTY.
NOTE: ENSURE THAT YOUR PRINTOUT STATES THE TOTAL NUMBER OF PAGES AND THAT YOU HAVE PICKED THEM ALL UP.

REG. NUM.	DATE	INSTRUMENT TYPE	AMOUNT	PARTIES FROM	PARTIES TO	CERT/ CHKD
		REMARKS: PLANNING ACT STATEMENTS.		LANDRY, PETER JOHN GERARD		
HR1956256	2023/03/31	CHARGE	\$10,000,000	ACAMAR DWELLING CORP.	ROYAL BANK OF CANADA	C
HR1956282	2023/03/31	NO ASSGN RENT GEN REMARKS: HR1956256		ACAMAR DWELLING CORP.	ROYAL BANK OF CANADA	C
HR1956283	2023/03/31	DISCH OF CHARGE		*** COMPLETELY DELETED *** LANDRY, MARY-HELEN		
		REMARKS: HR1139629.				

NOTE: ADJOINING PROPERTIES SHOULD BE INVESTIGATED TO ASCERTAIN DESCRIPTIVE INCONSISTENCIES, IF ANY, WITH DESCRIPTION REPRESENTED FOR THIS PROPERTY.
NOTE: ENSURE THAT YOUR PRINTOUT STATES THE TOTAL NUMBER OF PAGES AND THAT YOU HAVE PICKED THEM ALL UP.

APPENDIX D



ERIS
ENVIRONMENTAL RISK INFORMATION SERVICES



CITY
DIRECTORY

Project Property:	<i>2069 Lakeshore Road, Burlington, Ontario</i>
Report Type:	<i>City Directory</i>
Order No:	<i>22040800543</i>
Information Source:	<i>Vernon's Burlington and Hamilton Suburban City Directory</i>
Date Completed:	<i>2022/04/26</i>

City Directory Information Source
Vernon's Burlington and Hamilton Suburban City Directory

PROJECT NUMBER: 22040800543	
Site Address:	2069 Lakeshore Road, Burlington, Ontario
Year: 2013	
Site Listing:	-Lakeshore Professional Arts Building -Doctors Office
Adjacent Properties:	
Lakeshore Road (1477-2165 odd)	1477-Apartments 2003-Girgenti Custom Window Treatments Inc -Molinaro Group 2007-Lakeshore Coffee House 2009-Residential (1 Tenant) 2011-Sylvia's Hair Design 2013-R C's Boardwalk Fries & Ice Creamparlour 2015-Pita Pit The 2017-Baraiatric Nutrition Solution 2025-Kenora Aveda Salon Spa & Boutique

	2027-Just Nails 2031-Burlington Charcoal Pit -Gore Variety & Gifts 2079-Aviva Medical Diagnostics -McOrp Technologies Inc -South Mount Physio -Wharton Medical Clinic 2097-Residential (1 Tenant) 2109-Martha's Landing 2119-BMO Nesbitt Burns 2121-Apartments 2159-Lakeshore Chiropractic Clinic 2165-Quorum Communications -Residential (1 Tenant)
Lakeshore Road (2020-2160 even)	2020-Dana's Doors -L E C C -Beaver & Bulldog -Marquis Gardens -Travelodge-On-the Lake Catering & Special Events -Waterfront Hotel Downtown Burlington 2048-Riviera On The Lake 2058-Emma's Freeze & Fries 2072-Mortgage Intelligence -Royal LePage Real Estate Services 2096-Charms Bistro Café

	-Residential (1 Tenant) 2108-Hawken Wm C QC 2114-Creative Burlington 2118-Lawyer's Office 2136-Lakefront Townhouses 2160-Burlington Place Apartments
Almas Common (All)	-All Residential 390-Progressive Systems & Packaging
Bates Common (All)	-All Residential 2095-Smartlock & Security Surveillance Inc 2096-Technokids Inc 2097-Technokids Inc
Brant Street (353-390)	355-Lugano 2 for 1 Pizza -Viva Unisex Hair And Nails Salon 357-Sweetness Bakery Inc 359-Buzz For Men The -Residential (1 Tenant) 361-Lakeview Pastry & Chocolates 375-Bush Orman G Ltd -Tweed 7 Hickory 389-Dolce Salon & Spa -Poise Boutique -Forever Summer Swimsuits & Beachwear Inc

	-Saltridges -Scrivener's Men's Apparel 368-Casteleyn Belgian Chocolatiers 370-Rude Native Bistro & Lounge 374-Residential (1 Tenant) 380-Landmark Steakhouse The -S B Prime 390-Sims Square
Detlor Common (All)	-All Residential 399-Kusch C the Trade Show Company
Elizabeth Street (1-470)	399-Condominium 415-Malgosia Spa -Mikado Japanese Restaurant -Audacious Hair -Hairitage House -Personality Traits 423-Underdog Communications -The Charles Dickens Restaurant -Wedding Cakes by Design 437-Martini House The 441-Downtown Bistro 445-Ninco Construction Ltd -Ontario 1612700

	-Porter & Best -La Petite Spa -Residential (Multi Tenant) 451-Royal Canadian Sea Cadets Corps (Iron Duke) 461-Knox Presbyterian 396-Beer Store The -TD Merchant Services 416-Liquor Control Board Of Ontario 440-Community Care Access Centre of Halton -Express Personnel Services -Tripemco Burlington Insurance Group Limited -Doctors Office 464-Apartments 468-Residential (2 Tenants)
Harris Crescent (2123-2163)	-All Residential
James Street (2031-2079 odd)	2031-Heron Instruments 2053-Residential (1 Tenant) 2055-Residential (1 Tenant)
James Street (2046-2090 even)	2046-Residential (1 Tenant) 2050-Residential (2 Tenants) 2054-Body Works -M'Lord & M'Lady's Hair & Spa Inc

	-Residential (1 Tenant) 2082-Kate's Hair Expressions 2090-Residential (1 Tenant)
John Street (390-455)	389-Bouwman John Clock Maker 393-My Girlfriend's Closet 395-District Ski Snowboard Lifestyle -Pure Organic Pure Boutique 399-Brownstone Luxury Condominiums 398-Red Canoe Bistro 404-PK 1 Studio & Gallery 408-JJ Orr Designer Collection 410-Wellington Terrace Apartments 430-Greyhound Canada 444-Residential (1 Tenant) 448-State Farm Insurance -Village Perk -Residential (1 Tenant) 450-Dunsmith International(1986)inc
Martha Street (395-441 odd)	395-Martha Terrace Apartments 405-Gagnon Heating & Cooling Inc -Branon Mechanical 411-Residential (1 Tenant) 431-439-Martha Apartments

	441-Parkside Apartments
Martha Street (374-420 even)	380-Residential (1 Tenant) 390-Don Deez Clothing Ltd -My Closet 392-Residential (1 Tenant) 394-State Farm Insurance 396-Skinsation Spa 398-Duke Marine Technical Services -Top To Bottom Design 400-Visionarea 402-Residential (1 Tenant) 404-Halton Region -Residential (1 Tenant) 406-Residential (1 Tenant) 408-Residential (1 Tenant) 420-Burlington Hydro
Old Lakeshore Road (All)	2076-The Ascot Motel 2084-Emma's Back Porch -Water Street Cooker 2093-Residential (1 Tenant) 2097-Eclipse Salon 2100-Flow Hair Studio -Bay West Group -Escape Esthetics

	-Optimum Vitality -Serendipity Salon -Residential (1 Tenant) 2101-The Carriage House Restaurant 2104-Medical Offices -Carling Chambers 2108-Spergel Trustee In Bankruptcy -Debtor Consulting Services Limited -Gordon Todd Real Estate -Progressive Graphics -Todd S Real Estate Ltd Realtor Broker -Lawyer's Office 2121-Residential (1 Tenant) 2122-Lakeshore Law Chambers 2128-J M Edwards & Associates Inc
Pearl Street (360-480)	383-Duff John Advertising Ltd -Pearl Street Café -Celli's -College Green Marketing 389-Mia Boutique -Residential (1 Tenant) 391-The Black Pearl Lingerie Boutique 395-T Zone Burlington 397-Tresses Gino Reda & Associates Inc -Luminescence Spa

	399-Barclay & Knap Educational Services -Edgar Family Chiropractic On Pearl 401-Mia Fine Imported Shoes -Pearl Street Fine Shoes 403-Manhattan Hair Spa Inc -Amp Salon 405-Doctors Office 419-Holy Protection of B V M Ukrainian Catholic Church 431-Stylistics 435-Residential (2 Tenants) 443-Apartments 471-Burlington Central Lion's Club -Reach Out Centre For Kids-Roc 360-360 Pearl Apts 390-Mia Fine Lingerie 392-Christopher Court Retirement Home 414-Laurie's Spa At The Village -Salon Red -Specs On Pearl Inc 420-Rayhoon Persian Eatery -Sutton Group Innovative Realty 422-Village Square 430-Apartments 436-Poacher Restaurant The 440-Four Forty Fitness For Women

	460-Oyster The 464-Residential (1 Tenant) 466-Residential (1 Tenant) 478-Wellington Place Apartments
Pine Street (All)	3037-Easy Office Phone 2041-Paradiso Restaurant -Cibc Advantex 2045-Artist's Walk Village Square -Banquet Hall Village Square -Pro Home Health Services -Originals by Linda -Village Square 2049-Village Square 2077-Dancescape -Ukrainian Banquet Hall 2085-Residential (1 Tenant) 2076-Rc Embroidery 2078-Kinetic Physiotherapy -Lorna's Esthetics -Piece A'Cake -Pine Street Cakes 2080-T X Window Fashions 2082-New York Mens Grooming Lounge 2084-Burlington Blooms

	2086-Booker & Associates Inc -Invitations by Sansheira's
Torrance Street (All)	-All Residential 360-Torrance Terrace Apartments 385-Clarity Consulting
Waterfront Trail	-No Civic Addresses Within Desired Radius

PROJECT NUMBER: 22040800543	
Site Address:	2069 Lakeshore Road, Burlington, Ontario
Year: 2008	
Site Listing:	-Lakeshore Professional Arts Building
Adjacent Properties:	
Lakeshore Road (1477-2165 odd)	1477-Apartments 2003-RBC Royal Bank 2007-Lakeshore Coffee House 2009-Residential (2 Tenants) 2011-Sylvia's Hair Design 2013-R C's Boardwalk Fries & Ice Creamparlour 2015-Doctors Office 2017-Big Sweet Candy Store

	2025-Kenora Aveda Salon Spa & Boutique 2027-Just Nails 2031-Burlington Charcoal Pit -Gore Variety & Gifts 2059-Triffit 2079-Skinworks For You Inc -Skinsation Spa 2097-Eclipse Salon 2107-G T Worldwide Limited -Essence Of Asia By Lawrence 2109-Martha's Landing -Residential (1 Tenant) 2119-BMO Nesbitt Burns 2121-Apartments 2125-Residential (1 Tenant) 2159-Lakeshore Chiropractic Clinic 2165-Quorum Communications -Residential (1 Tenant)
Lakeshore Road (2020-2160 even)	2020-Travelodge Hotel Burlington On The Lake -Twenty Twenty Lakeside Restaurant & Bar -Dana's Doors -L E C C 2048-Riviera On The Lake -Residential (1 Tenant) 2058-Emma's Freeze & Fries

	2072-Mortgage Intelligence -Royal LePage Burloak Real Estate Services 2096-Charms Bistro Café 2100-Gauthier's Electric 2104-Doctors Office 2108-Hawken Wm C QC 2114-Cr B S Property Management Inc 2118-Residential (1 Tenant) 2122-Residential (2 Tenants) 2128-Lakeshore Chiropractic Clinic 2136-Lakefront Townhouses 2160-Burlington Place Apartments
Almas Common (All)	-All Residential
Bates Common (All)	2077-Residential (1 Tenant) 2079-Residential (1 Tenant) 2087-Residential (2 Tenants)
Brant Street (353-390)	355-Lugano 2 for 1 Pizza -Viva Unisex Hair And Nails Salon 357-Natural Bead The -Residential (2 Tenants) 359-Residential (2 Tenants) 361-Lakeview Pastry & Chocolates 375-Bush Orman G Ltd

	-Tweed & Hickory 387-Torsney Paddy MP (Constituency Office) 389-Fackleton's For Men -Georgie Girl -Dolce Salon & Spa -Poise Boutique 368-Casteleyn Belgian Chocolatiers 370-Rude Native Bistro & Lounge 372-Makes Scents 374-Residential (1 Tenant) 380-Landmark Steakhouse The 390-Sims Square
Detlor Common (All)	389-Residential (1 Tenant) 401-Residential (1 Tenant)
Elizabeth Street (1-470)	399-Condominium 401-Bunton's Wharf Inc 415-Malgosia Spa -Hairitage House -Mikado Japanese Restaurant 417-Mantra Indian Restaurant -Domaz European Cuisine 423-Elysium -Dickens Restaurant

	-Platinum Edge Recruitment Inc 429-Brickworks Communications Inc 437-Martini House The 441-Ivanka's Bistro 445-Ninco Construction Ltd 451-Royal Canadian Sea Cadets Corps (Iron Duke) 461-Knox Presbyterian Church 396-Beer Store The -TD Merchant Services 416-Liquor Control Board Of Ontario 440-Community Care Access Centre of Halton -Express Personnel Services -Tripemco Burlington Insurance Group Limited -Doctors Office 464-Apartments 468-Residential (1 Tenant)
Harris Crescent (2123-2163)	-All Residential
James Street (2031-2079 odd)	2031-Heron Instruments 2051-Residential (1 Tenant) 2053-Residential (1 Tenant) 2055-Residential (1 Tenant)
James Street (2046-2090 even)	2046-Residential (1 Tenant)

	2050-Residential (2 Tenants) 2054-Body Works -M'Lord & M'Lady's Hair & Spa Inc -Residential (Multi Tenant) 2082-Kate's Hair Expressions 2086-Residential (1 Tenant) 2090-Residential (2 Tenants)
John Street (390-455)	389-Bouwman John Clock Maker 393-Happy Heart The 395-Mia Boutique -Zazzies 399-Brownstone Luxury Condominiums -M C Phiver 390-Dianna's Hair Design 392-Bartimaeus Inc -Zazzies 398-Dante's Trattoria Italian Restaurant -Dante's Catering & Banquet Facilities 404-PK 1 Studio & Gallery -Residential (1 Tenant) 408-Renaissance Of Fashion 424-Burlington Bus Termianal 430-Greyhound Canada 444-Residential (1 Tenant)

	448-State Farm Insurance 450-Dunsmith International(1986)inc -Coco Cat The
Martha Street (395-441 odd)	395-Martha Terrace Apartments 401-Residential (2 Tenants) 405-Residential (1 Tenant) 411-Residential (1 Tenant) 413-Residential (1 Tenant) 417-Residential (1 Tenant) 431-439-Martha Apartments 441-Parkside Apartments
Martha Street (374-420 even)	380-Residential (1 Tenant) 388-Doctors Office 390-Don Deez Clothing Ltd -My Closet 394-Doctors Office 402-Residential (1 Tenant) 404-Residential (1 Tenant) 406-Residential (1 Tenant) 408-Residential (1 Tenant) 410-Glazier Clinic The 420-Burlington Hydro
Old Lakeshore Road (All)	2076-Ascot Motel

	-Residential (1 Tenant) 2084-Emma's Back Porch -Water Street Cooker 2093-Corbett Family Chiropractic -Residential (1 Tenant) 2097-Eclipse Salon -Residential (1 Tenant) 2100-Ascent Incorporated -Hypnosis Works -Ldrel@bell.ca -Flow Hair Studio -Davies Linda Real Estate Ltd -Ascent Inc -Burlington Healing Centre -Anthony DiMarco Ltd 2101-The Carriage House Restaurant -Asti's Ristorante 2104-Medical Offices 2107-Carriage Gate Development -Beautiful You 2108-A Spergel Trustee In Bankruptcy -Debtor Consulting Services Limited -Gordon Todd Real Estate -Progressive Graphics -Mandelbaum Spergel Inc 2111-Residential (1 Tenant)

	2121-Residential (3 Tenants) 2122-Lakeshore Law Chambers 2128-Canada Steamship Lines Inc -JM Edwards & Associates Inc
Pearl Street (360-480)	383-Duff John C Advertising Ltd -Pearl Street Café -Mia Boutique -Residential (2 Tenants) 393-Pearl St Health & Wellness Centre 399-Barclay & Knap Educational Services -Nexus Group International Inc 403-Manhattan Hair Spa Inc 419-Holy Protection of B V M Ukrainian Catholic Church 431-Le Chef Complet -Le Petit Papier -My Back Shed Too -Trinity Avalon Hair Salon 435-Residential (2 Tenants) 443-Apartments 471-Burlington Central Lion's Club -Halton Child And Youth Services 384-My-Thai By The Lake 392-Christopher Court Retirement Home 398-California Hair Works

	-Dagmer's 414-Laurie's Spa At The Village -Salon Red -Specs On Pearl Inc 418-Johanna Alterations -Silk Endz Hair Studio -Pete's Pepper Palace 420-Rude Native Bistro The 422-Village Square 430-Apartments 436-Poacher Restaurant The 440-Four Forty Fitness For Women 442-Feathered Bed The 444-Residential (2 Tenants) 446-In House 460-Oyster The 464-Residential (1 Tenant) 466-Residential (1 Tenant) 468-Residential (1 Tenant) 478-Wellington Place Apartments
Pine Street (All)	3037-State Farm Insurance -WSCG Inc 2041-Paradiso Restaurant 2045-Pro Home Health Services -Artist's Walk Village Square

	-Bella Boutique -Banquet Hall Village Square -Pro Home Health Services -Johanna Alterations -Village Square 2049-Village Square-Phase 3 2077-Dancescape -Ukrainian Banquet Hall -Residential (3 Tenants) 2085-Residential (1 Tenant) 2076-Rc Embroidery 2078-Kerr & Hawken -Hawken Wm C QC -Lorna's Esthetics -Piece A'Cake -Residential (1 Tenant) 2082-Residential (1 Tenat)
Torrance Street (All)	-All Residential 360-Torrance Terrace Apartments
Waterfront Trail	-No Civic Addresses Within Desired Radius

PROJECT NUMBER: 22040800543	
Site Address:	2069 Lakeshore Road, Burlington, Ontario

Year: 2003	
Site Listing:	-Lakeshore Professional Arts Building
Adjacent Properties:	
Lakeshore Road (1477-2165 odd)	2003-Royal Bank of Canada 2007-My Back Shed 2011-Residential (Multi Tenant) 2013-R C's Boardwalk Fries & Ice Creamparlour 2015-Women's Health Clinic The 2017-Big Sweet Candy Store 2025-Kenora Aveda Salon Spa & Boutique 2027-Just Nails -Residential (1 Tenant) 2031-Burlington Charcoal Pit -Donut Delight 2047-Gore Variety & Gifts -Residential (1 Tenant) 2059-Robertson Daniel Advertisting -DeCarri & Moser Co 2079-Dependable I.T. 2109-Martha's Landing -New Image Salon 2119-BMO Nesbitt Burns

	2121-Apartments 2159-Lakeshore Chiropractic Clinic 2165-Residential (2 Tenants)
Lakeshore Road (2020-2160 even)	2020-Travelodge Hotel Burlington On The Lake -Inpiazza Catering -Inpiazza Takeout -L E C C -Dakotas 2048-Riviera On The Lake 2058-Emma's Freeze & Fries 2072-Mortgage Intelligence -Royal LePage Burloak Real Estate Services 2096-Residential (1 Tenant) 2100-Gauthier's Electric 2114-Advanced Images 2136-Lakefront Townhouses 2160-Burlington Place Apartments
Almas Common (All)	-Street Not Listed
Bates Common (All)	-Street Not Listed
Brant Street (353-390)	355-Lugano 2 for 1 Pizza -Residential (1 Tenant) 357-Financial Shop

	-H & R Block 359-Discount Emporium 361-Lakeview Pastry & Chocolates 375-Bush Orman G Ltd -Tweed & Hickory 387-Torsney Paddy MP (Constituency Office) 389-Frackleton's For Men -It's You Casual & Denim -C Georgie Girl 368-Casteleyn Belgian Chocolatiers 370-Sonzi 372-Altered Images Hair Design 374-Residential (1 Tenant) 380-Coronation Sports Bar & Grill -Residential (1 Tenant) 390-Sims Square
Detlor Common (All)	-Street Not Listed
Elizabeth Street (1-470)	415-Malgosia Spa -Hairitage House -Hoya Korean & Japanese Cuisine 417-Domaz European Cuisine 423-Dickens Restaurant -CDR Management

	429-Brickworks Communications Inc 437-Martini House The 441-Thai House The 451-Royal Canadian Sea Cadets Corps (Iron Duke) -Navy League of Canada The (Burl Br) -Professional Answering Service Ltd 461-Knox Presbyterian Church 396-Beer Store The 416-Liquor Control Board Of Ontario 440-Community Care Access Centre of Halton -Express Personnel Services -Ontario Disability Support Program -Burlington Human Resources Development Canada -Doctors Office 464-Apartments 468-Residential (1 Tenant)
Harris Crescent (2123-2163)	-All Residential
James Street (2031-2079 odd)	2031-Heron Instruments 2047-Residential (1 Tenant) 2051-Residential (1 Tenant) 2053-Residential (1 Tenant) 2055-Residential (1 Tenant)

James Street (2046-2090 even)	2046-Residential (1 Tenant) 2050-Doctors Office 2054-M'Lord & M'Lady's Hair & Spa Inc 2082-Kate's Hair Expressions -Residential (1 Tenant) 2086-Residential (1 Tenant) 2090-Doctors Office
John Street (390-455)	389-Bouwman John Clock Maker 391-Residential (1 Tenant) 393-Zazzies 395-John Street Coin Laundry 399-Brownstone Luxury Condominiums -Mizunas -M C Phiver 390-Dianna's Hair Design 392-Bartimaeus Inc -Deep Impact Human Services 398-Dante's Trattoria Italian Restaurant -Dante's Catering & Banquet Facilities 404-Renaissance Of Fashion -Residential (1 Tenant) 410-Wellington Terrace Apartments 424-Burlington Bus Terminal 444-Residential (2 Tenants)

	448-State Farm Insurance 450-Residential (1 Tenant)
Martha Street (395-441 odd)	395-Martha Terrace Apartments 401-Residential (2 Tenants) 405-Residential (1 Tenant) 411-Residential (1 Tenant) 413-Residential (1 Tenant) 417-Residential (1 Tenant) 431-439-Martha Apartments 441-Parkside Apartments
Martha Street (374-420 even)	380-Residential (1 Tenant) 388-Doctors Office -Residential (2 Tenants) 394-Doctors Office
Old Lakeshore Road (All)	2076-Ascot Motel 2084-Emma's Back Porch -Water Street Cooker 2093-Corbett Family Chiropractic 2097-Eclipse Salon 2100-Ascent Inc -Davies Linda Real Estate Ltd -Burlington Healing Centre -Anthony DiMarco Ltd

	2101-Asti's Ristorante 2104-Medical Offices 2107-Beautiful You 2108-Todd, S, Real Estate Ltd -Progressive Graphics 2122-Lakeshore Law Chambers 2128-Canada Steamship Lines Inc
Pearl Street (360-480)	383-Duff John C Advertising Ltd -Pearl Street Café 389-Hang Ups Custom Framing -Residential (1 Tenant) 393-Pearl St Health & Wellness Centre 399-Nexus Group International Inc 419-Holy Protection of B V M Ukrainian Catholic Church 431-Le Chef Complet 435-Residential (2 Tenants) 443-Apartments 471-Burlington Central Lion's Club -Childrens Assessment & Treatment Centre -Preschool Assessment and Training in Halton 392-Christopher Court Retirement Home 398-California Hair Works -Dagmer's 414-Laurie's Spa At The Village

	418-Johanna Alterations 420-Rude Native Bistro The 422-Village Square 430-Apartments 436-Poacher Restaurant The 440-Four Forty Fitness For Women 442-Feathered Bed The 444-Residential (2 Tenants) 446-In House 460-Oyster The 464-Residential (1 Tenant) 466-Residential (2 Tenants) 468-Residential (1 Tenant) 478-Wellington Place Apartments
Pine Street (All)	2045-Pro Home Health Services 2049-Village Square - Phase 3 2077-Ukrainian Hall 2078-Kerr & Hawken -Hawken Wm C QC -Lorna's Esthetics -Residential (1 Tenant) 2082-Residential (1 Tenat)
Torrance Street (All)	-All Residential

	360-Torrance Terrace Apartments
Waterfront Trail	-No Civic Addresses Within Desired Radius

PROJECT NUMBER: 22040800543	
Site Address:	2069 Lakeshore Road, Burlington, Ontario
Year: 1998	
Site Listing:	-Lakeshore Professional Arts Building
Adjacent Properties:	
Lakeshore Road (1477-2165 odd)	2003-Royal Bank of Canada 2011-Residential (1 Tenant) 2013-R C's Boardwalk Fries & Ice Creamparlour 2015-Doctors Office 2017-Coach's Corner 2021-Envoy Business Services -Americanada -Ceiling Doctor -3 F F F Paving Co Ltd 2025-Toppers Aesthetics & Beauty Salon -Just Nails 2027-Especially 4 U Upholstery & Antiques -Residential (1 Tenant)

	2031-Burlington Charcoal Broil -Donut Delight 2047-Gore Variety & Gifts -Residential (1 Tenant) 2059-Northnet Research Inc -Grandma Lee's Inc 2079-Dingle Charlebois & Swybrous 2114-Advanced Images 2121-Apartments 2159-Lakeshore Chiropractic Clinic 2165-Residential (2 Tenants)
Lakeshore Road (2020-2160 even)	2020-Venture Inn Burlington Hotel -Dakotas -Prime Catering Services 2072-Royal LePage Real Estate Services Ltd -Residential (3 Tenants) 2100-Ascent Incorporated 2119-Nesbitt Burns 2136-Lakefront Townhouses 2160-Burlington Place Apartments
Almas Common (All)	-Street Not Listed
Bates Common (All)	-Street Not Listed

Brant Street (353-390)	353-2 Mai V 355-Lugano 2 for 1 Pizza -Orr J J Designer Collection 357-Residential (1 Tenant) 361-Lakeview Pastry & Chocolates 375-Bush Orman G Ltd -Village Sportique Ltd 387-Torsney Paddy MP (Constituency Office) 389-Garvey's Men's Shop -It's You Casual & Denim -C Georgie Girl 366-Burlington Dry Cleaners 368-Collet's Cafe Catering 370-Sonzi 372-Altered Images Hair Design 374-Residential (1 Tenant) 380-Coronation Sports Bar & Grill -Residential (2 Tenants) 390-Sims Square
Detlor Common (All)	-Street Not Listed
Elizabeth Street (1-470)	399-I G A Foodstores 413-Espresso Bar Roastery & Dessert House Ltd 417-Reverend's Retreat Bistro

	423-Dickens Restaurant -CDR Management -Sabrina Couture (shoes) -Village Runner 429-National Bank of Canada 431-Condominiums (under constr) 437-Just Desserts 445-Residential (1 Tenant) 451-Royal Canadian Sea Cadets Corps (Iron Duke) -Navy League of Canada The (Burl Br) -Professional Answering Service Ltd -Password Communications 461-Knox Presbyterian Church 396-Beer Store The 440-Canadian Trades Co-Operative Inc -Elizabeth St Holding Ltd -A & E Delivery -Express Personnel Services -Ministry of Community & Social Services -Home Health Care -Human Resources Development Canada 458-Brightside Financial Services-Ross Hopmans C F P -Brant Technologies Inc 464-Apartments 468-Burlington Federal Liberal Assoc

	-Residential (2 Tenants)
Harris Crescent (2123-2163)	-All Residential
James Street (2031-2079 odd)	2031-Residential (2 Tenants) 2047-Residential (1 Tenant) 2051-Residential (1 Tenant) 2053-Residential (1 Tenant) 2055-Residential (1 Tenant)
James Street (2046-2090 even)	2046-Residential (1 Tenant) 2050-Doctors Office 2054-M'Lord & M'Lady's Hair & Spa Inc -Body Language Esthetics -Residential (2 Tenants) 2082-Design Plus Advertising Artists Ltd 2086-Residential (1 Tenant) 2090-Doctors Office
John Street (390-455)	389-Bouwman John Clock Maker -Varga Jewellers 391-Residential (3 Tenants) 393-Joelle's 395-John Street Coin Laundry 397-Residential (1 Tenant) 399-Brownstone Luxury Condominiums

	-Moksha -Rude Native Bistro The 455-Taylor John Lubrication Ltd (Garage) 390-Dianna's Hair Design 392-Let's Face It Esthetics -Peak Performance Institute -Residential (1 Tenant) 398-Dante's Trattoria Italian Restaurant -Dante's Cucina 404-Renaissance Of Fashion -Residential (1 Tenant) 408-Kate's Hair Expression 410-Wellington Terrace Apartments 424-Burlington Bus Terminal 444-Residential (2 Tenants) 448-State Farm Insurance 450-Halton Pro-Life -Direct Dispatch Transportation Inc
Martha Street (395-441 odd)	395-Martha Terrace Apartments 401-Residential (1 Tenant) 405-Residential (1 Tenant) 411-Residential (1 Tenant) 413-Residential (1 Tenant) 417-Residential (1 Tenant)

	431-439-Martha Apartments 441-Parkside Apartments
Martha Street (374-420 even)	380-Residential (1 Tenant) 384-Ukrainian Cathlic Church of Holy Protection -Residential (1 Tenant) 388-Doctors Office -Residential (2 Tenants) 394-Doctors Office
Old Lakeshore Road (All)	2048-Burlington Riviera Motor Court 2058-Wallabees Famous Frozen Custard & Yogurt 2076-Ascot Motel 2084-Emma's Back Porch -Water Street Cooker 2093-Ivey's Interiors Inc -Residential (1 Tenant) 2097-Perfect Hair & Body Care 2100-Davies Linda Real Estate Ltd -Fox 40 Whistle-For-Safety's Sake 2101-Asti's Ristorante 2104-Medical Offices 2108-Todd, S, Real Estate Ltd -Progressive Graphics 2111-Residential (1 Tenant) 2122-Law Chambers

	2128-Residential (1 Tenant)
Pearl Street (360-480)	383-Duff John C Advertising Ltd -Pearl Street Café 385-Austin Charles Shoes 389-Residential (1 Tenant) 393-Hairitage House -Malgosia Spa 399-Wakeham Shipping Ltd 419-St Mary's Ukrainian Catholic Church 431-Complexion-Care & Nails By Dee 435-Residential (2 Tenants) 443-Apartments 471-Burlington Central Lion's Club -Childrens Assessment & Treatment Centre -Preschool Assessment and Training in Halton -Burlington Bereavement Resource Council -Youth Aiding Youth -Ontario Friends of Schizophrenics 392-Christopher Court Retirement Home 398-California Hair Works -Dagmer's 414-Laurie's Spa At The Village 416-McPhiver 418-Village Square

	420-Inpiazza 422-Village Square 430-Rosella's Fashion Depot -Apartments 436-Poacher Restaurant The -New Wave Amusements 440-Ferdinand Collection 444-Johanna Alterations -Residential (Multi Tenant) 460-Oyster The 464-Residential (1 Tenant) 466-Residential (1 Tenant) 468-Residential (1 Tenant) 478-Wellington Place Apartments
Pine Street (All)	2037-Atlantic Systems Group Inc 2045-Village Square Management Office 2049-Village Square-Phase 3 2077-Holy Protection Of B V M Ukrainian Catholic Church -Residential (1 Tenant) 2093-Masotti Edward B Real Estate Ltd 2004-Residential (1 Tenant) 2014-Residential (1 Tenant) 2078-Doctors Office 2082-Residential (1 Tenant)

Torrance Street (All)	-All Residential 360-Torrance Terrace Apartments 385-Clarity Consulting
Waterfront Trail	-No Civic Addresses Within Desired Radius

PROJECT NUMBER: 22040800543	
Site Address:	2069 Lakeshore Road, Burlington, Ontario
Year: 1993	
Site Listing:	-Site Not Listed
Adjacent Properties:	
Lakeshore Road (1477-2165 odd)	2003-Royal Bank of Canada 2007-Petersen's Golf Shop -Apartments 2011-Dream Wheels -Residential (1 Tenant) 2013-H & W Antiques & Consignments 2015-Doctors Office 2017-Coach's Corner 2021-Maclean Hunter Communications Inc -Arrowhead Paving Co Ltd

	-3 F F F Paving Co Ltd 2025-Toppers Hair & Beauty Salon -Stained Glass Overlay of Burlington Oakville 2027-Curtain Call Dance & Theatre Supplies Inc -Residential (1 Tenant) 2031-Burlington Charcoal Broil -Donut Delight 2075-Royal LePage Real Estate Services Ltd 2093-Ivey's Interiors Inc -Residential (1 Tenant) 2097-Residential (1 Tenant) 2101-Asti's Ristorante 2107-The Chandelier Antiques -Residential (1 Tenant) 2111-Residential (1 Tenant) 2119-Raphael-Mack Inc 2159-Residential (1 Tenant) 2165-Residential (3 Tenants)
Lakeshore Road (2020-2160 even)	2020-Venture Inn Burlington Hotel -Bonefish Louie's 2048-Burlington Riviera Motor Court 2058-Wallabees Fabulous Frozen Custard & Yogurt 2076-Ascot Motel -Residential (1 Tenant) 2084-Emma's Back Porch

	-Water Street Cooker 2100-Radeke Industries -Ascent Incorporates -Peter Lee Travel Services -Davies Linda Real Estate 2104-Medical Offices -Residential (1 Tenant) 2108-Progressive Graphics -Phoenix Metal Corp -Todd S Real Estate Limited Realtor -Para-Med Health Services 2118-Ontario Trial Lawyers Association 2122-Law Office 2136-Lakefront Townhouses 2160-Burlington Place Apartments
Almas Common (All)	-Street Not Listed
Bates Common (All)	-Street Not Listed
Brant Street (353-390)	353-Residential (1 Tenant) 357-Residential (1 Tenant) 359-Cake Craft Ltd -Residential (1 Tenant) 361-Lakeview Pastry & Tea Room 371-Bizyk Wm Furrier

	387-Green Gables Framing 389-Garvey's Men's Shop -Charisma Boutique -Elena's Doll Houses & Miniatures 358-362-Lum's Restaurant & Tavern 358-Residential (1 Tenant) 366-Burlington Dry Cleaners -Genart Holdings 368-Collet's Cupboard -Residential (1 Tenant) 370-Smart Shopper The 374-H & R Block Canada Inc 380-Coronation House Burlington Ltd -Residential (2 Tenants) 390-Sims Square Building (Commercial)
Detlor Common (All)	-Street Not Listed
Elizabeth Street (1-470)	399-I G A Foodstores 415-427-Village Square 423-Dickens Restaurant -Sabrina Couture -Village Sportique 429-National Bank of Canada 431-Condominiums (under constr)

	437-Jeunesse 445-Residential (1 Tenant) 451-Royal Canadian Sea Cadets Corps (Iron Duke) -Navy League of Canada The (Burl Br) 461-Pine School -Knox Presbyterian Church 396-Brewers' Retail Store 440-Password Communications Administration -Aqua Concrete -Paul Revere Life Insurance Company -Doctors Office 464-Apartments 468-Residential (3 Tenants)
Harris Crescent (2123-2163)	-All Residential 2180-Upper Canada Antiques
James Street (2031-2079 odd)	-All Residential 2031-Canadian Mental Health Association 2055-Fawcett-Langton Gallery
James Street (2046-2090 even)	2046-Residential (1 Tenant) 2050-Doctors Office 2054-M'Lord & M'Lady's Hair & Spa Inc -Advanced Integrated Resource Inc

	2082-Design Plus Advertising Artists Ltd 2086-Langfred House 2090-Doctors Office
John Street (390-455)	389-Antique & Modern Clock & Watch Repairs -Varga Jewellers 391-Apartments 393-Schmid Albt L Jeweller 395-John Street Coin Laundry 397-Residential (1 Tenant) 399-Brownstone Luxury Condominiums 455-Taylor John Lubrication Ltd (Garage) -Associated Town & Country Muffler Centres 390-Dianna's Hair Design 392-Million Dollar Concepts 398-Dante's Trattoria Italian Restaurant 404-Residential (1 Tenant) 424-Burlington Bus Terminal 444-Altered Images Hair Design -Residential (1 Tenant) 448-State Farm Insurance -Potticary Roy Insurance 450-Halton Pro-Life -Tele-Partners Communications

Martha Street (395-441 odd)	-All Residential 395-Martha Terrace Apartments
Martha Street (374-420 even)	-All Residential 384-Ukrainian Cathlic Church of Holy Protection 388-Doctors Office 394-Doctors Office
Old Lakeshore Road (All)	-Street Not Listed
Pearl Street (360-480)	383-Duff John C Advertising Ltd -Pearl Street Café 389-Austin Charles Shoes -Residential (1 Tenant) 393-Decorators Unlimited 399-The Oyster Ltd -Residential (1 Tenant) 419-St Mary's Ukrainian Catholic Church 431-Complexion-Care & Nails By Dee 435-Bocana 443-Apartments 471-Burlington Central Lion's Club -Childrens Assessment & Treatment Centre -Preschool Assessment and Training in Halton -Burlington Bereavement Resource Council -Youth Aiding Youth

	-Ontario Friends of Schizophrenics 384-Inside Out 392-Christopher Court Retirement Home 398-California Hair Works -Lisa's Cosmetic Bar 414-Laurie's Spa At The Village -It's You 416-Panacherie 418-Village Square 420-Coffee Emporium 422-Village Square 430-Scrivener's Women's Collection -Scrivener's Gentlemen's Clothier Ltd -Apartments 436-Poacher Restaurant The 442-Body Language Esthetics 444-Johanna Alterations -Impressions -Residential (Multi Tenant) 464-Residential (1 Tenant) 466-Residential (1 Tenant) 468-Residential (1 Tenant) 478-Wellington Place Apartments
Pine Street (All)	2041-Anne Barbu Fashion Boutique

	2045-Village Square Management Office -Banquet Hall Village Square 2049-Village Square-Phase 3 -Units 2077-St Mary's Ukrainian Parish Hall 2093-Masotti Edward B Real Estate Ltd 2004-Residential (1 Tenant) 2014-Residential (1 Tenant) 2078-Doctors Office 2082-Doctors Office
Torrance Street (All) (360-390 even)	-All Residential 360-Torrance Terrace Apartments 385-Pym & Company Consulting
Waterfront Trail	-No Civic Addresses Within Desired Radius

PROJECT NUMBER: 22040800543	
Site Address:	2069 Lakeshore Road, Burlington, Ontario
Year: 1988	
Site Listing:	-Site Not Listed
Adjacent Properties:	

Lakeshore Road (1477-2165 odd)	2003-Royal Bank of Canada 2007-Petersen's Golf Shop -Apartments 2011-Murphy P M and Company -Scottsdale Yachting 2013-Old Things Antiques 2015-Doctors Office 2017-Cruise Selection 2021-Stained Glass Overlay of Burlington Oakville 2025-Hector's Fine Men's Wear -Residential (1 Tenant) 2027-Sportsworld Travel -Burlington School of Travel -Residential (1 Tenant) 2029-Burlington Charcoal Broil 2031-Donut Delight 2075-Royal LePage Real Estate Services Ltd 2083-Estaminet Parking Lot 2093-Residential (1 Tenant) 2097-His & Her Hair Styling -Residential (1 Tenant) 2101-Asti's Ristorante 2107-The Chandelier Antiques -Residential (1 Tenant) 2111-Residential (1 Tenant)

	2159-Physician's Office -Residential (1 Tenant) 2165-Creative Impressions Interiors -Residential (2 Tenants)
Lakeshore Road (2020-2160 even)	2020-Venture Inn Burlington Hotel 2042-Petro-Canada 2048-Burlington Riviera Motor Court -Residential (3 Tenants) 2058-Lakeshore Investment Dairy Ltd 2076-Ascot Motel -Residential (2 Tenants) 2084-Sharkey's On The Water 2100-Lakeshore Chiropractic Clinic -Peter Lee Travel Services Inc -Residential (1 Tenant) 2104-Medical Offices -Residential (2 Tenants) 2108-Peacock Seldon Insurance Brokers Ltd -Todd C Gordon Real Estate -Abstainers Insurance Co 2118-Residential (1 Tenant) 2120-Residential (1 Tenant) 2122-Law Office 2126-Residential (1 Tenant) 2136-Lakefront Townhouses

	2160-Burlington Place Apartments
Almas Common (All)	-Street Not Listed
Bates Common (All)	-Street Not Listed
Brant Street (353-390)	353-Subway Sandwiches & Salads 355-Gordon & de Bruyn Photographers 357-Records On Wheels -Residential (1 Tenant) 359-Cake Craft Ltd 361-Lakeview Pastry & Tea Room 367-Look-Up The 369-Western Inventory Service Ltd 371-Residential (1 Tenant) 373-Bush Orman G Ltd 377-Welington Square Mall 383-Brant Cycle & Sports 389-Garvey's Men's Shop -Charisma Boutique -Plum Tree Gift Shop -Green River Clothiers 358-362-Lum's Restaurant & Tavern 366-Burlington Dry Cleaners 368-Collet's Cupboard

	370-Kiti 372-Pro Building Products 374-Boathouse The 380-Coronation House Burlington Ltd
Detlor Common (All)	-Street Not Listed
Elizabeth Street (1-470)	399-I G A Foodstores 415-427-Village Square 417-Lehar Restuarant 419-Kadlick & Williams 423-Quilts & Other Comforts -Hendry's Sabrina Shoes For Women -Village Sportique -La Boheme French Cuisine 431-Burlington Bus Terminal -Canada Coach Lines -Gray Coach Lines -Hamilton Street Railway 437-Elizabeth Interior 441-Residential (1 Tenant) 445-Residential (1 Tenant) 451-Royal Canadian Sea Cadets Corps (Iron Duke) -Navy League of Canada The (Burl Br) 461-Pine School -Knox Presbyterian Church

	396-Brewers' Retail Store 420-Municipal Parking Lot No 4 440-Richardson Greenshields of Canada Ltd -Manpower Temporary Services -Roto-Static Restorations -Provincial Probation & Parole Services (Ministry of Correctional) -Burlington Motor Vehicle Licenses Bureau -Williams Trading Inc -Edgehill Margaret Real Estate & Property Management -Password Communications Inc -Foxy Pools of Burlington -Leon's Asphalt -Canteen of Canada Ltd -Paul Revere Life Insurance Company -Carson Centre For Professional Hypnosis -Law Office -Doctors Office 464-Apartments 468-Law Office
Harris Crescent (2123-2163)	-All Residential
James Street (2031-2079 odd)	-All Residential 2031-Mercantile Credit Services Limited

	2055-Diana Lee Fashions 2057-Rahe Associates
James Street (2046-2090 even)	2046-Residential (1 Tenant) 2050-Residential (1 Tenant) 2082-Design Plus Advertising Artists Ltd 2086-Langfred House 2090-Dentist Office
John Street (390-455)	389-Antique & Modern Clock & Watch Repairs -Varga Jewellers 391-Apartments 393-Schmid Albt L Jeweller 395-Coin Laundry 397-Residential (2 Tenants) 399-Brownstone Luxury Condominiums -Delight's Cafe -Topper's Haircutting 455-Taylor John Lubrication Ltd (Garage) -Associated Town & Country Muffler Centres 390-Dianna's Hair Design 392-Fulcher Eleanor Ltd -Doctors Office 398-La Trattoria Italian Restaurant 404-408-Proposal Bridal Salon The

	444-Altered Images Hair Design -Residential (1 Tenant) 448-State Farm Insurance -Potticary Roy Ins 450-Halton Pro-Life -Playback Productions
Martha Street (395-441 odd)	-All Residential 395-Martha Terrace Apartments
Martha Street (374-420 even)	-All Residential 388-Burlington General Practitioners Association 394-Doctors Office
Old Lakeshore Road (All)	-Street Not Listed
Pearl Street (360-480)	383-Duff John C Advertising Ltd -Pearl Street Café 385-Austin Charles Shoes -Residential (1 Tenant) 389-Wooden Pump The -Residential (1 Tenant) 393-Downtown Burlington Business Improvement Area -Right At Home 399-The Oyster Ltd -Residential (1 Tenant)

	409-St Mary's Ukrainian Catholic Church
	431-Complexion-Care
	435-Colorline Boutique
	443-Apartments
	384-Inside Out
	-Residential (1 Tenant)
	392-Christopher Court Retirement Home
	398-California Hair Works
	-Lisa's Cosmetic Bar
	414-Laurie's Skin & Beauty Concept
	-Scrivener's Women's Collection
	-Sport-A-Tan
	-Soula's Electrolysis Inc
	416-Colours & Your Styles
	418-Stores
	420-Grandma Lee's Bakery & Eating Place
	-Berruti Flowers & Pottery Ltd
	422-Village Square
	436-Poacher Restaurant The
	440-Vacation Bound Inc
	442-Pumpkin Patch
	444-Johanna Alterations
	-Residential (3 Tenants)
	446-California Coast Clothing Store
	464-Residential (1 Tenant)

	468-Residential (1 Tenant) 478-Wellington Place Apartments
Pine Street (All)	2037-Casablanco John Modeling Personal Development Center 2039-Newport Clothiers 2045-Citiplan Financial Advisors 2049-Village Square-Phase 3 -Units 2077-St Mary's Ukrainian Parish Hall 2085-Way We Were The -Residential (1 Tenant) 2093-Overell Wm Real Estate Limited 2004-Residential (1 Tenant) 2014-Residential (1 Tenant) 2078-Doctors Office -Law Office 2082-Residential (2 Tenants)
Torrance Street (All)	-All Residential 360-Torrance Terrace Apartments
Waterfront Trail	-No Civic Addresses Within Desired Radius

PROJECT NUMBER: 22040800543	



Site Address:	2069 Lakeshore Road, Burlington, Ontario
Year: 1983	
Site Listing:	-Site Not Listed
Adjacent Properties:	
Lakeshore Road (1477-2165 odd)	2003-Wray Hawke mgr 2007-Why Not Shoppe The -Apartments 2013-Appleby-Smith Ltd 2015-Doctors Office 2017-Carriage Trade Uniform Centre 2021-Sportsworld Travel Ltd 2023-2025-Bamboo Wicker House 2027-Farrauto Custom Tailers -Residential (1 Tenant) 2029-Burlington Charcoal -Donut Delight 2031-Fire Pit Restaurant 2075-Royal LePage Real Estate Services Ltd 2083-Estaminet Parking Lot 2093-Bayley MacLean Real Estate Limited 2097-His & Her Hair Styling 2101-2707-Janine

	2107-The Chandelier Antiques -Residential (1 Tenant) 2111-The Jerry Bath Boutique 2159-Physician's Office 2165-Residential (1 Tenant)
Lakeshore Road (2020-2160 even)	2042-Petro-Canada 2048-Burlington Riviera Motor Court -Residential (1 Tenant) 2058-Lakeshore Investment Dairy Ltd 2076-Ascot Motel 2084-Houlahan's Banquet Hall 2100-Peck Alice Gallery The -The Treasury, handicrafts & picture framing -Residential (2 Tenants) 2104-Medical Offices 2108-Peacock Seldon Insurance Brokers Ltd -Todd C Gordon Real Estate 2118-Residential (1 Tenant) 2122-Law Office -Lakeshore Lookout 2128-Residential (1 Tenant) 2160-Burlington Place Apartments
Almas Common (All)	-Street Not Listed

Bates Common (All)	-Street Not Listed
Brant Street (353-390)	353-Nikathel Corpn Ltd -Submarines & Other Things -Residential (1 Tenant) 355-Gordon & de Bruyn Photographers 357-Records On Wheels 359-Cake Craft Ltd 361-Lakeview Pastry & Tea Room 369-Scott Batenchuk Hutchings & McKeon chart accounts -Pichelli P bankruptcy trustee 373-Bush Orman G Ltd 377-Welington Square Mall -Offices 383-Home Billiards Sales & Service 387-Book Nook Inc The 358-362-Lum's Restaurant & Tavern 366-Burlington Dry Cleaners 370-Career School of Hairstyling 372-Investment Safe & Lock Co 374-Brant Fish & Chips 380-Coronation House Burlington Ltd
Detlor Common (All)	-Street Not Listed

Elizabeth Street (1-470)	399-Canada Safeway Ltd 415-Sir Walter's Choice tobaconist -Eva Skin & Beauty Centre Limited -Michel Jewellers -Kettle Creek Canvas Co -Golden Lantern -Faubourg Saint-Honore 417-Stinson House restr 423-Quilts & Other Comforts -Sabrina Shoes -Village Sportique -D's Fashions -Duke of Buckingham Restaurant The 431-Burlington Bus Terminal -Canada Coach Lines -Gray Coach Lines -Hamilton Street Railway -Burlington City Transit 437-Elizabeth Interiors 441-Residential (1 Tenant) 445-Residential (1 Tenant) 451-Royal Canadian Sea Cadets Corps (Iron Duke) -Navy League of Canada The (Burl Br) 461-Knox Presbyterian Church 396-Brewers' Retail Store

	420-Municipal Parking Lot No 4 440-Richardson Greenshields of Canada Ltd -Provincial Probation & Parole Services (Ministry of Correctional) -Motor Vehicle Licenses Bureau -Williams Trading Inc -Fast R chart acct -Password Communications Inc -Correctional Services-Community Programmes -Canada Employment Centre -Revere Paul Administration -Paul Revere Life Insurance Company -Insurance Office -Law Office 464-Apartments 466-Residential (1 Tenant) 468-Law Office
Harris Crescent (2123-2163)	-All Residential
James Street (2031-2079 odd)	-All Residential 2031-Murray Alex Real Estate Co Ltd 2055-Charter Masters Inc -Connections
James Street (2046-2090 even)	-All Residential

	2090-Dentist Office
John Street (390-455)	389-Antique & Modern Clock & Watch Repairs -Varga Jewellers 391-Apartments 393-Schmid Albt L Jeweller 395-Cleantex Services 397-Brownstone Luxury Condominiums 455-Taylor John Lubrication Ltd (Garage) 398-La Trattoria Italian Restaurant 404-Residential (1 Tenant) 408-Burlington Martial Arts 418-Residential (1 Tenant) 420-Side Street Ladies' Wear -Bush Orman G Ltd 424-Windsport & Ski Ltd 444-Elle Tease Shop The 448-State Farm Insurance -Parking Meter Service City of Burlington 450-Attic Insulation -Four Phase Systems Ltd 452-Western Inventory Service Ltd
Martha Street (395-441 odd)	-All Residential 395-Martha Terrace Apartments

Martha Street (374-420 even)	-All Residential 394-Brant Haven Homes
Old Lakeshore Road (All)	-Street Not Listed
Pearl Street (360-480)	383-The Muffin Tearoom 385-Austin Charles Shoes -Residential (2 Tenants) 389-The Wooden Pump, ladies' fashions -Residential (1 Tenant) 399-The Oyster Couture Ltd, ladies' fashions 409-St Mary's Ukrainian Catholic Church 431-Harvest House hith fds 435-Fashion Klozette Ltd 443-Apartments 384-Hendry's Turns Inside Out 392-Christopher Court Retirement Home 398-California Hair Works 414-Scrivener's Women's Collection 416-Nettle Creek Shop 418-Stores 420-Grandma Lee's Bakery & Eating Place 422-Village Square 436-Durty Nelly's restr

	442-Pumpkin Patch 444-Johanna Alterations -Residential (1 Tenant) 446-Bostt Building Corporation Limited 478-Wellington Place Apartments
Pine Street (All)	2037-Fire Department 2077-St Mary's Ukrainian Parish Hall 2085-Way We Were The, antiques & pottery -Residential (1 Tenant) 2093-Overell Wm Real Estate Limited 2078-Doctors Office -Law Office 2082-Residential (3 Tenants)
Torrance Street (All)	-All Residential 360-Torrance Terrace Apartments
Waterfront Trail	-No Civic Addresses Within Desired Radius

PROJECT NUMBER: 22040800543	
Site Address:	2069 Lakeshore Road, Burlington, Ontario
Year: 1978	

Site Listing:	-Site Not Listed
Adjacent Properties:	
Lakeshore Road (1477-2165 odd)	2003-Royal Bank of Canada The 2007-Why Not Shoppe The -Apartments 2009-Odeon Theatre 2013-Salvation Army Store The 2015-Doctors Office 2017-Heather House cosmetics & perfumes 2021-Cake Craft Ltd 2023-2025-Auckland Carpet Company 2027-Farrauto Custom Tailors 2029-Princess Do-nut 2031-Fire Pit Restaurant 2071-French Douglas Sunoco Service Station 2075-Le Page A E (Ontario) Limited 2083-Estaminet Parking Lot 2093-Residential (1 Tenant) 2097-His & Her Hair Styling 2101-Dowling Thomas Associates Ltd Realtor 2105-Residential (1 Tenant) 2107-The Chandelier Antiques -Residential (1 Tenant) 2111-Twenty One Eleven Shop

	2159-Physician's Office 2165-Residential (1 Tenant)
Lakeshore Road (2020-2160 even)	2042-Lakeshore Fina Service Centre 2048-Burlington Riviera Motor Court Ltd 2058-Lakeshore Investment Dairy Ltd 2076-Ascot Motel -Residential (1 Tenant) 2084-Estaminet The 2100-Peck Alice Gallery The -The Treasury -Residential (2 Tenants) 2108-Residential (1 Tenant) 2118-Residential (1 Tenant) 2122-Martin Dunlop Hillyer & Associates lawyers -Halton Investigation 2128-Residential (1 Tenant) 2160-Burlington Place Apartments
Almas Common (All)	-Street Not Listed
Bates Common (All)	-Street Not Listed
Brant Street (353-390)	353-Submarines & Other Things -Residential (1 Tenant) 355-Gordon & de Bruyn Photographers

	357-Records On Wheels -Logan Gordon F Realty 359-Howden Mel Shoes Ltd -Residential (1 Tenant) 361-Save Discount & Variety 369-Scott Batenchuk Hutchings & McKeon chart accts -Law Office 371-Pasquale's Italian Sandwiches 373-Bush Orman G Ltd 377-Welington Square Mall -Offices 383-Burlington Food Warehouse 387-Do Your Own Thing 358-362-Lum's Restaurant & Tavern 366-Burlington Dry Cleaners 368-Brant Street Signs -Burlington Print & Litho Co -Burlington Volunteer Bureau -Burlington Social Planning Council 370-Career School of Hairstyling 372-Now Look Hair Design 374-Brant Fish & Chips -Residential (1 Tenant) 380-Coronation House Burlington Ltd

Detlor Common (All)	-Street Not Listed
Elizabeth Street (1-470)	399-Canada Safeway Ltd 415-IRJA Fashion Accessories & Cosmetics -Deb 'N Heir -Hoots Limited 417-Georgie Girl 423-Smart Fashions -Hendry's Sabrina Shoes -Stone House Collection The -Duke of Buckingham Restaurant The 431-Burlington Bus Terminal -Canada Coach Lines -Gray Coach Lines -Hamilton Street Railway -Burlington City Transit 437-Pumpkin Patch The -Yellow Daisy Art Boutique The -Residential (1 Tenant) 441-Residential (1 Tenant) 445-Residential (1 Tenant) 451-Royal Canadian Sea Cadets Corps (Iron Duke) -Navy League of Canada The (Burl Br) 461-Knox Presbyterian Church 396-Brewers' Retail Store

	420-Municipal Parking Lot No 4 440-Niagara & Mid-Western Ontario Travel Association -Burlington Chamber of Commerce -Probation & After Care Services (Ministry of Comm & Soc Servs) -Ontario Probation & Parole Serv (Ministry of Correctional Servs) -Canada Manpower Centre (Dept of Manpower & Immig) -Canada Employment Centre -Paul Revere Life Insurance Company -Law Office 458-Bosley W H Real Estate 464-Apartments 466-Residential (1 Tenant) 468-Law Office
Harris Crescent (2123-2163)	-All Residential
James Street (2031-2079 odd)	2031-Bosley W H & Co Ltd Realtor 2047-Residential (1 Tenant) 2079-Residential (2 Tenants)
James Street (2046-2090 even)	2046-Residential (1 Tenant) 2050-Residential (1 Tenant) 2054-Residential (2 Tenants) 2082-A & C Home Repairs & Alterations

	-Residential (1 Tenant) 2086-Residential (1 Tenant) 2090-Dentist Office
John Street (390-455)	389-Antique & Modern Clock & Watch Repairs -Varga Jewellers 391-Apartments 393-Schmid A jwlr 395-Cleantex Services 397-Residential (1 Tenant) 399-Drapes 'n Spreads -K L B Interiors Incorporated 455-Douglas Vinyl Ltd -Golden Rent-A-Car 390-Lakeshore Barber Shop 392-Bridle & Bridle lawyers 398-La Trattoria Italian Restaurant & Pizzeria 404-Printer's Image Inc 408-Psychedelic Centre 424-Book Nook Inc 444-Elle Tease Hairdressers 448-Potticary Roy Insurance 452-Western Inventory Service Ltd
Martha Street (395-441 odd)	-All Residential

	395-Martha Terrace Apartments
Martha Street (374-420 even)	384-Residential (1 Tenant) 388-Residential (1 Tenant) 394-Brant Haven Homes 412-Residential (1 Tenant)
Old Lakeshore Road (All)	-Street Not Listed
Pearl Street (360-480)	383-The Muffin Tearoom 385-Collector's Choice -Residential (1 Tenant) 393-Family Tree The -Residential (1 Tenant) 399-The Oyster Couture Ltd 409-St Mary's Ukrainian Catholic Church 435-Fashion Klozette 443-Apartments 384-Terrace The 398-California Hair Works 418-Stores 420-Grandma Lee's Bakery & Eating Place 422-Village Square 478-Wellington Place Apartments

Pine Street (All)	2037-Fire Department 2045-Jetpress Printing & Publishing Ltd 2049-Apartments 2055-Anderson C Real Estate Limited Realtor 2059-Professional Answering Service 2061-Residential (2 Tenants) 2077-St Mary's Ukrainian Parish Hall 2085-Way We Were The antiques & pottery -Residential (1 Tenant) 2093-Overell Wm Real Estate Limited 2004-Eagle-Ridge Holdings Ltd 2014-Warehouse 2078-Residential (1 Tenant) 2082-Residential (1 Tenant)
Torrance Street (All) (360-390 even)	-All Residential 360-Torrance Terrace Apartments
Waterfront Trail	-No Civic Addresses Within Desired Radius

PROJECT NUMBER: 22040800543	
Site Address:	2069 Lakeshore Road, Burlington, Ontario
Year: 1973	

Site Listing:	-Site Not Listed
Adjacent Properties:	
Lakeshore Road (1477-2165 odd)	2003-Royal Bank of Canada 2007-Wayside Shop -Apartments 2009-Odeon Theatre 2011-Victoria Restr 2021-CIAG Ins 2023-Auckland-Anderson Carpets Ltd 2027-Farrauto Custom Tailors 2029-Lakeshore Auto Body 2031-Lakeshore Texaco Serv Stn 2071-Aston & Linden Sunoco 2075-Royal LePage Real Estate Services Ltd 2083-Estaminet Parking Lot 2093-Residential (1 Tenant) 2097-Residential (1 Tenant) 2101-The Hoover Shoppe, sls & serv 2103-Sefton House, books 2105-Residential (2 Tenants) 2107-The Chandelier Antiques -Residential (1 Tenant) 2119-Hall's Serv Stn 2159-Physician's Office

	2165-Residential (1 Tenant)
Lakeshore Road (2020-2160 even)	2042-Rolf's Fina Serv Stn 2048-Burlington Riviera Motor Court Ltd -Residential (1 Tenant) 2058-Dairy Queen Number 39 -Residential (1 Tenant) 2076-Ascot Motel -Residential (1 Tenant) 2084-The Estaminet Restaurant -Tree Top Lounge Liquor Lounge 2092-MacDonald, D B, B P Serv Stn 2100-Peck Alice Gallery The -The Treasury -Residential (2 Tenants) 2104-Mac's Milk, ofcs 2108-The Twig Antiques -Residential (1 Tenant) 2118-Residential (3 Tenants) 2122-Residential (1 Tenant) 2128-Residential (1 Tenant) 2136-Residential (1 Tenant) 2160-Burlington Place Apartments
Almas Common (All)	-Street Not Listed

Bates Common (All)	-Street Not Listed
Brant Street (353-390)	353-Wearhouse Men's Shop, The - Art Studio, The 355-de Bruyn of Burlington 357-Jewellery Boutique - Law Office 359-Howden Shoes Ltd - Residential (1 Tenant) 361-Save Discount & Variety 367-Dale's Hdwe 369-Burl Denture Clinic - Liberal Action Ofce Bedeir's Scandinavian Furn 371-Burl Shoe Repr 373-Bush Orman G Ltd 377-Welington Square Mall 383-Graham Hdwe 387-Hy-Way Shops 358-362-Lum's Restaurant & Tavern 366-Burlington Dry Cleaners 368-Sheers Co - Burlington Print & Litho Co 370-Community Carpet Mills Ltd 374-Now Look Hair Design

	-Brant Fish & Chips -Residential (1 Tenant) 380-Coronation House -Residential (1 Tenant)
Detlor Common (All)	-Street Not Listed
Elizabeth Street (1-470)	417-Residential (2 Tenants) 423-Strob's Hair Salon -Burlington Wool Boutique 431-Burlington Bus Terminal -Canada Coach Lines -Gray Coach Lines 437-Yellow Daisy Art Boutique -Residential (1 Tenant) 441-Residential (1 Tenant) 445-Residential (1 Tenant) 451-Royal Canadian Sea Cadets Corps (Iron Duke) -Navy League of Canada The (Burl Br) 461-Knox Presbyterian Church 396-Brewers' Retail Store 420-Municipal Parking Lot 440-Fuller Brush Co Ltd -Stl Co of Can Ltd (Mkt Development Br) -Shell Canada Ltd

	-Ont Provincial Probation Serv (Dept of Justice) -Ont Probation Serv, Ministry of Correctional Servs -F P E Pioneer Elect Ltd -Post, The, newsppr -Law Office 446-Parking Lot 458-Ins Adjstrs 464-Apartments 466-Residential (1 Tenant) 468-Residential (1 Tenant)
Harris Crescent (2123-2163)	-All Residential
James Street (2031-2079 odd)	2031-Buzza, G M, Rlty Ltd 2047-Residential (1 Tenant) 2057-Residential (1 Tenant) 2075-Residential (1 Tenant) 2079-Residential (2 Tenants)
James Street (2046-2090 even)	2046-Residential (1 Tenant) 2050-Residential (1 Tenant) 2054-Residential (1 Tenant) 2086-Residential (2 Tenants) 2090-Dentist Office -Residential (1 Tenant)

John Street (390-455)	389-Wycliffe Studios, interior decrs 391-Apartments -Hickling, W, Art Studio 393-Schmid, A L, jwlr 395-Lakeshore Laundromat 397-Daly, T P, photo 399-Clegg Glass Ltd 455-Kelly-Springfield Tire Serv Store 390-Lakeshore Barber Shop 392-Residential (1 Tenant) 398-Adam & Ben Hair Stylists -Residential (1 Tenant) 404-Brant Fine Art Sls 424-Do Your Own Thing 444-Imber Plmbg & Htg 448-Robson Fuels Ltd 450-Accountants Office -Insurance Office 452-Liberty Mutual Ins Co
Martha Street (395-441 odd)	-All Residential
Martha Street (374-420 even)	-All Residential
Old Lakeshore Road (All)	-Street Not Listed

Pearl Street (360-480)	383-Adjunct, lamp & home access boutique -Wilshire House, draperies, wallpaper & interior design -Residential (1 Tenant) 385-Follicle Beauty Salon -Residential (1 Tenant) 389-Mr. Chips, The Casual Shop, men's wear -Crafty Ladies -Residential (1 Tenant) 393-Residential (2 Tenants) 399-Residential (1 Tenant) 409-St Mary's Ukrainian Catholic Church 419-Residential (1 Tenant) 431-Residential (1 Tenant) 435-Residential (2 Tenants) 443-Apartments 384-Oyster Couture Ltd, ladies' fashion -Residential (1 Tenant) 392-Residential (1 Tenant) 398-Residential (1 Tenant) 416-Residential (1 Tenant) 422-Residential (1 Tenant) 436-Residential (2 Tenants) 444-Residential (2 Tenants) 478-Wellington Place Apartments

Pine Street (All)	-All Residential 2005-Dale's Hdwe 2037-Burl Fire Dept 2045-Wonderclock, The, antiques 2077-St Mary's Ukrainian Parish Hall
Torrance Street (All)	-All Residential 360-Torrance Terrace Apartments
Waterfront Trail	-No Civic Addresses Within Desired Radius

PROJECT NUMBER: 22040800543	
Site Address:	2069 Lakeshore Road, Burlington, Ontario
Year: 1968	
Site Listing:	-Site Not Listed
Adjacent Properties:	
Lakeshore Road (1477-2165 odd)	2003-Royal Bank of Canada 2007-State Farm Mutual Automobile Ins Co -Residential (1 Tenant) 2009-Odeon Theatre 2011-2013-Victoria Restr

	2015-Voortman, John & Assoc Ltd 2017-Burlington Bus Terminal -Grey Hound Coach Lines 2021-Music Village 2023 & 2025-Auckland Carpet Co 2027-Farrauto, J, tlr 2029-Russel's Auto Body 2031-Lakeshore Texaco 2037-McAlister Mtrs (Burl) Ltd 2071-Gore Park Sunoco Serv Stn 2075-Le Page Real Estate Services Ltd 2083-Estaminet Parking Lot 2093-Hill's Antiques -Residential (1 Tenant) 2097-Residential (1 Tenant) 2101-Hoover Shoppe, sls & serv 2103-Sefton House, books 2105-Residential (2 Tenants) 2107-The Chandelier Antiques 2111-Residential (1 Tenant) 2119-Hall's Serv Stn 2159-Residential (2 Tenants) 2165-Residential (1 Tenant)
Lakeshore Road (2020-2160 even)	2042-Emerson, S & Son, Fina Serv Stn -Emerson U Rent, trks & auto rentals

	2048-Burlington Riviera Motor Court Ltd 2058-Dairy Queen Frozen Prod (Can) Ltd 2076-Ascot Motel -Residential (1 Tenant) 2084-The Estaminet Restaurant -Residential (1 Tenant) 2092-Pell, Nelson, B P Serv Stn 2100-Peck Alice Gallery The -The Treasury -Residential (2 Tenants) 2104-David's Colonial Terrace Beauty Salon -Residential (1 Tenant) 2108-The Twig Antiques -Residential (1 Tenant) 2118-Residential (1 Tenant) 2122-Residential (1 Tenant) 2128-Residential (1 Tenant) 2136-Residential (1 Tenant)
Almas Common (All)	-Street Not Listed
Bates Common (All)	-Street Not Listed
Brant Street (353-390)	353-355-Hucker's, A H Dry Goods 355-Residential (1 Tenant) 357-Waumsley's Book Store

	-Residential (1 Tenant) 359-Howden Shoes Ltd -Residential (1 Tenant) 361-Shaver Drugs Ltd 367-Dale's Hdwe 369-Waumsley's Home Bkry -Residential (1 Tenant) 371-Burl Shoe Repr 373-Bush Orman G Ltd 377-Welington Square Mall 383-Graham Hdwe 387-Peter's Platters 358-Lum's Restaurant & Tavern -Residential (1 Tenant) 366-Burlington Dry Cleaners 368-Sheers Co -Burlington Print & Litho Co 370-Burl Gazette -Burl Prntg Co Ltd 372-Coiffure by Adam & Ben 374-Brant Fish & Chips -Residential (1 Tenant) 380-Coronation House -Residential (1 Tenant)

Detlor Common (All)	-Street Not Listed
Elizabeth Street (1-470)	-All Residential 451-Royal Canadian Sea Cadets 467-Knox Presby Church 396-Brewers' Retail Store
Harris Crescent (2123-2163)	-All Residential
James Street (2031-2079 odd)	2047-Residential (1 Tenant) 2057-Residential (1 Tenant) 2075-Residential (1 Tenant) 2079-Residential (1 Tenant)
James Street (2046-2090 even)	2046-Residential (1 Tenant) 2050-Residential (1 Tenant) 2082-Residential (1 Tenant) 2086-Residential (2 Tenants) 2090-Residential (1 Tenant)
John Street (390-455)	389-Kenny, Jean, Antiques 391-Apartments 393-Schmid, A L, jwlr 395-Lakeshore Laundromat 397-Residential (1 Tenant)

	399-Clegg Glass Ltd 411-Residential (2 Tenants) 455-Burl Auto Body 390-Bus Terminal Brbr Shop 392-Residential (1 Tenant) 398-Residential (1 Tenant) 404-Storage 408-Pets & Gardens 424-Eddie's Mtr Reprs 444-Imber Plmbg & Htg -Residential (1 Tenant) 448-Robson Fuels Ltd 450-Boy Scouts of Can (Burl Div)
Martha Street (395-441 odd)	-All Residential
Martha Street (374-420 even)	-All Residential
Old Lakeshore Road (All)	-Street Not Listed
Pearl Street (360-480)	-All Residential 389-Mr. Chips, The Casual Shop, men's wear 409-Ukrainian Catholic Church 384-Three Eighty-Four Pearl Ladies' Wear

Pine Street (All)	-All Residential 2005-Dale's Hdwe, Parking Lot 2037-Burl Fire Dept 2046-Brant Lawn & Cycle 2077-St Mary's Ukrainian Parish Hall
Torrance Street (All)	-All Residential 360-Torrance Terrace Apartments
Waterfront Trail	-No Civic Addresses Within Desired Radius

PROJECT NUMBER: 22040800543	
Site Address:	2069 Lakeshore Road, Burlington, Ontario
Year: 1963	
Site Listing:	-Site Not Listed
Adjacent Properties:	
Lakeshore Road (1477-2165 odd)	2003-Royal Bank of Canada 2007-London Pride -Residential (2 Tenants) 2009-Odeon Theatre 2011-13-Victoria Restr

	2017-Burlington Bus Terminal
	2023-Burlington Mtrs
	-Dept of Tranp License
	2025-Lakeshore Laundromat
	2027-Farrauto, J, tlr
	2037-McAlister Mtrs (Burl) Ltd
	2071-Pascoe & Lee Sunoco Service Stn
	2075-Insp of Sep Schls (Burl)
	-Hayes & McBride Import Co Ltd
	-Them'x Co of Can
	-Medical Offices
	2077-Residential (1 Tenant)
	2083-Estaminet Parking Lot
	-Residential (1 Tenant)
	2087-Residential (1 Tenant)
	2089-Riddell, M, trk broker
	2093-Hill's Antiques
	-Residential (1 Tenant)
	2097-Residential (1 Tenant)
	2101-Hoover Shoppe, sls & serv
	2103-Smith Mark, Tile
	-Sefton House, books
	2105-Residential (2 Tenants)
	2107-The Dutch Door
	2111-Residential (1 Tenant)
	2119-Hall's Serv Stn

	2159-Residential (2 Tenants)
Lakeshore Road (2020-2160 even)	2042-Canadian Petrofina Ltd, serv stn 2054-Dairy Queen Frozen Prod (Can) Ltd 2058-Dairy Queen 2076-Ascot Motel -Residential (1 Tenant) 2084-The Estaminet Restaurant 2092-Emerson S, Cities Serv -Emerson, U Rent, car rental 2100-The Alice Peck Gallery -The Treasury -Residential (1 Tenant) 2104-David's Colonial Terrace Beauty Salon -Residential (1 Tenant) 2108-The Twig Antiques -Residential (1 Tenant) 2118-Residential (1 Tenant) 2122-Residential (1 Tenant) 2128-Residential (1 Tenant) 2136-Residential (1 Tenant) 2154-Residential (1 Tenant)
Almas Common (All)	-Street Not Listed
Bates Common (All)	-Street Not Listed

Brant Street (353-390)	353-Brant Carpet & Draperies Co 355-Hucker's Dry Goods -Residential (1 Tenant) 357-Waumsley's Book Store -Residential (1 Tenant) 359-Howden Shoes Ltd -Residential (1 Tenant) 361-Shaver Drugs Ltd 367-Dale's Hardware -Residential (1 Tenant) 369-Waumsley's Home Bkry 371-Burl Shoe Repr 373-Howell Hdwe Ltd 375-Burl Radio 379-Modern Shoe Repair 381-Burl Fruit Market 383-Graham Crest Hdwe Ltd 385-De Luxe Taxi 387-Anderson's Brunch Bar 358-Lum's Restr -Residential (1 Tenant) 360-Residential (1 Tenant) 362-Swank Shop 366-Burl Dry Cleaners

	368-Rand Billiards & Brbr -Residential (1 Tenant) 370-Burl Gazette -Burl Prntg Co Ltd 372-James Hair Stylists 374-Brant Fish & Chips -Residential (3 Tenants) 380-Coronation House -Residential (1 Tenant)
Detlor Common (All)	-Street Not Listed
Elizabeth Street (1-470)	-All Residential 395-Lakeside Dairy Bar 451-Royal Canadian Sea Cadets 467-Knox Presby Ch 396-Brewers Retail Store
Harris Crescent (2123-2163)	-All Residential
James Street (2031-2079 odd)	2047-Residential (1 Tenant) 2057-Residential (1 Tenant) 2075-Residential (1 Tenant) 2079-Residential (1 Tenant)

James Street (2046-2090 even)	2046-Residential (1 Tenant) 2050-Residential (1 Tenant) 2054-Residential (1 Tenant) 2082-Residential (1 Tenant) 2086-Residential (2 Tenants) 2090-Residential (1 Tenant)
John Street (390-455)	391-Apts -Hickling Walter Studio 393-Residential (1 Tenant) 399-Clegg Glass Ltd 411-Crown Cabs -Residential (1 Tenant) 421-Burlington Transport Ltd -McGrath, A W, Ctge Co Ltd -Residential (1 Tenant) 455-Bernie's Auto Body 390-Bus Terminal Brbr Shop 392-Residential (1 Tenant) 398-Residential (1 Tenant) 408-Pets & Gardens 418-Burl Musical Socy 424-Guenther Grademarkers 444-Imber Plmbg 448-Ellerbeck, F E Co, fuel oils etc

Martha Street (395-441 odd)	-All Residential
Martha Street (374-420 even)	-All Residential
Old Lakeshore Road (All)	-Street Not Listed
Pearl Street (360-480)	-All Residential 409-Greek Orthodox Church
Pine Street (All)	-All Residential 2037-Burl Fire Dept 2046-Oilfield Auto Serv 2077-St Mary's Ukrainian Catholic Parish Hall
Torrance Street (All)	-All Residential
Waterfront Trail	-No Civic Addresses Within Desired Radius

PROJECT NUMBER: 22040800543	
Site Address:	2069 Lakeshore Road, Burlington, Ontario
Year: 1957	
Site Listing:	-Site Not Listed

Adjacent Properties:	
Lakeshore Road (1477-2165 odd)	-Street Not Listed
Lakeshore Road (2020-2160 even)	-Street Not Listed
Almas Common (All)	-Street Not Listed
Bates Common (All)	-Street Not Listed
Brant Street (353-390)	361-Residential (1 Tenant) 375-Residential (1 Tenant) 360-Residential (1 Tenant) 368-Residential (2 Tenants) 380-Doctors Office 386-Gaudaur Mtr Co Ltd
Detlor Common (All)	-Street Not Listed
Elizabeth Street (1-470)	-All Residential 10-Lakeside Dairy Bar -Royal Oak Dairy Depot 36-England, Albt Royal Can Sea Cadets 50-Burl Scout Hall

	52-Trinity United Ch 11-Brewers Retail Warehouse 49-Burl Pub Libry
Harris Crescent (2123-2163)	-No Listings Within Radius
James Street (2031-2079 odd)	-No Listings Within Radius
James Street (2046-2090 even)	-No Listings Within Radius
John Street (390-455)	-No Listings Within Radius
Martha Street (395-441 odd)	-No Listings Within Radius
Martha Street (374-420 even)	-No Listings Within Radius
Old Lakeshore Road (All)	-Street Not Listed
Pearl Street (360-480)	-No Listings Within Radius
Pine Street (All)	-All Residential -Burl Fire Stn 8-Lucas Feed & Feed

Torrance Street (All)	-All Residential
Waterfront Trail	-No Civic Addresses Within Desired Radius

*****Burlington, Ontario is listed from 1957 to 2013 within the city directory archives*****

*****Prior to 2003, Old Lakeshore Road is listed as Lakeshore Road*****

-All listings for businesses were listed as they are in the city directory.

-Listings that are residential are listed as “residential” with the number of tenants. The name of the residential tenant is not listed in the above city directory.

APPENDIX E





DATABASE REPORT

Project Property: *Phase One ESA 2072 Lakeshore Road,
Burlington ON
2072 Lakeshore Road
Burlington ON L7R 1E3*

Project No: *22-282*

Report Type: *Quote - Custom-Build Your Own Report*

Order No: *23021400831*

Requested by: *Grounded Engineering Inc.*

Date Completed: *February 17, 2023*

Table of Contents

Table of Contents.....	2
Executive Summary.....	3
Executive Summary: Report Summary.....	4
Executive Summary: Site Report Summary - Project Property.....	6
Executive Summary: Site Report Summary - Surrounding Properties.....	7
Executive Summary: Summary By Data Source.....	19
Map.....	35
Aerial.....	36
Topographic Map.....	37
Detail Report.....	38
Unplottable Summary.....	214
Unplottable Report.....	215
Appendix: Database Descriptions.....	220
Definitions.....	229

Notice: IMPORTANT LIMITATIONS and YOUR LIABILITY

Reliance on information in Report: This report DOES NOT replace a full Phase I Environmental Site Assessment but is solely intended to be used as a database review of environmental records.

License for use of information in Report: No page of this report can be used without this cover page, this notice and the project property identifier. The information in Report(s) may not be modified or re-sold.

Your Liability for misuse: Using this Service and/or its reports in a manner contrary to this Notice or your agreement will be in breach of copyright and contract and ERIS may obtain damages for such mis-use, including damages caused to third parties, and gives ERIS the right to terminate your account, rescind your license to any previous reports and to bar you from future use of the Service.

No warranty of Accuracy or Liability for ERIS: The information contained in this report has been produced by ERIS Information Limited Partnership ("ERIS") using various sources of information, including information provided by Federal and Provincial government departments. The report applies only to the address and up to the date specified on the cover of this report, and any alterations or deviation from this description will require a new report. This report and the data contained herein does not purport to be and does not constitute a guarantee of the accuracy of the information contained herein and does not constitute a legal opinion nor medical advice. Although ERIS has endeavored to present you with information that is accurate, ERIS disclaims, any and all liability for any errors, omissions, or inaccuracies in such information and data, whether attributable to inadvertence, negligence or otherwise, and for any consequences arising therefrom. Liability on the part of ERIS is limited to the monetary value paid for this report.

Trademark and Copyright: You may not use the ERIS trademarks or attribute any work to ERIS other than as outlined above. This Service and Report (s) are protected by copyright owned by ERIS Information Limited Partnership. Copyright in data used in the Service or Report(s) (the "Data") is owned by ERIS or its licensors. The Service, Report(s) and Data may not be copied or reproduced in whole or in any substantial part without prior written consent of ERIS.

Executive Summary

Property Information:

Project Property: *Phase One ESA 2072 Lakeshore Road, Burlington ON
2072 Lakeshore Road Burlington ON L7R 1E3*

Project No: *22-282*

Order Information:

Order No: *23021400831*

Date Requested: *February 14, 2023*

Requested by: *Grounded Engineering Inc.*

Report Type: *Quote - Custom-Build Your Own Report*

Historical/Products:

ERIS Xplorer *ERIS Xplorer*

Insurance Products *Fire Insurance Maps/Inspection Reports/Site Plans*

Executive Summary: Report Summary

<i>Database</i>	<i>Name</i>	<i>Searched</i>	<i>Project Property</i>	<i>Boundary to 0.25km</i>	<i>Total</i>
AAGR	Abandoned Aggregate Inventory	Y	0	0	0
AGR	Aggregate Inventory	Y	0	0	0
AMIS	Abandoned Mine Information System	Y	0	0	0
ANDR	Anderson's Waste Disposal Sites	Y	0	0	0
AST	Aboveground Storage Tanks	Y	0	0	0
AUWR	Automobile Wrecking & Supplies	Y	0	0	0
BORE	Borehole	Y	0	10	10
CA	Certificates of Approval	Y	0	5	5
CDRY	Dry Cleaning Facilities	Y	0	0	0
CFOT	Commercial Fuel Oil Tanks	Y	0	0	0
CHEM	Chemical Manufacturers and Distributors	Y	0	0	0
CHM	Chemical Register	Y	0	0	0
CNG	Compressed Natural Gas Stations	Y	0	0	0
COAL	Inventory of Coal Gasification Plants and Coal Tar Sites	Y	0	0	0
CONV	Compliance and Convictions	Y	0	0	0
CPU	Certificates of Property Use	Y	0	0	0
DRL	Drill Hole Database	Y	0	0	0
DTNK	Delisted Fuel Tanks	Y	0	1	1
EASR	Environmental Activity and Sector Registry	Y	0	2	2
EBR	Environmental Registry	Y	0	0	0
ECA	Environmental Compliance Approval	Y	0	1	1
EEM	Environmental Effects Monitoring	Y	0	0	0
EHS	ERIS Historical Searches	Y	3	36	39
EIIS	Environmental Issues Inventory System	Y	0	0	0
EMHE	Emergency Management Historical Event	Y	0	0	0
EPAR	Environmental Penalty Annual Report	Y	0	0	0
EXP	List of Expired Fuels Safety Facilities	Y	0	0	0
FCON	Federal Convictions	Y	0	0	0
FCS	Contaminated Sites on Federal Land	Y	0	0	0
FOFT	Fisheries & Oceans Fuel Tanks	Y	0	0	0
FRST	Federal Identification Registry for Storage Tank Systems (FIRSTS)	Y	0	0	0
FST	Fuel Storage Tank	Y	0	0	0
FSTH	Fuel Storage Tank - Historic	Y	0	0	0
GEN	Ontario Regulation 347 Waste Generators Summary	Y	0	21	21
GHG	Greenhouse Gas Emissions from Large Facilities	Y	0	0	0
HINC	TSSA Historic Incidents	Y	0	1	1

<i>Database</i>	<i>Name</i>	<i>Searched</i>	<i>Project Property</i>	<i>Boundary to 0.25km</i>	<i>Total</i>
IAFT	Indian & Northern Affairs Fuel Tanks	Y	0	0	0
INC	Fuel Oil Spills and Leaks	Y	0	1	1
LIMO	Landfill Inventory Management Ontario	Y	0	0	0
MINE	Canadian Mine Locations	Y	0	0	0
MNR	Mineral Occurrences	Y	0	0	0
NATE	National Analysis of Trends in Emergencies System (NATES)	Y	0	0	0
NCPL	Non-Compliance Reports	Y	0	0	0
NDFT	National Defense & Canadian Forces Fuel Tanks	Y	0	0	0
NDSP	National Defense & Canadian Forces Spills	Y	0	0	0
NDWD	National Defence & Canadian Forces Waste Disposal Sites	Y	0	0	0
NEBI	National Energy Board Pipeline Incidents	Y	0	0	0
NEBP	National Energy Board Wells	Y	0	0	0
NEES	National Environmental Emergencies System (NEES)	Y	0	0	0
NPCB	National PCB Inventory	Y	0	0	0
NPRI	National Pollutant Release Inventory	Y	0	0	0
OGWE	Oil and Gas Wells	Y	0	0	0
OOGW	Ontario Oil and Gas Wells	Y	0	0	0
OPCB	Inventory of PCB Storage Sites	Y	0	0	0
ORD	Orders	Y	0	0	0
PAP	Canadian Pulp and Paper	Y	0	0	0
PCFT	Parks Canada Fuel Storage Tanks	Y	0	0	0
PES	Pesticide Register	Y	0	0	0
PINC	Pipeline Incidents	Y	0	1	1
PRT	Private and Retail Fuel Storage Tanks	Y	0	1	1
PTTW	Permit to Take Water	Y	0	1	1
REC	Ontario Regulation 347 Waste Receivers Summary	Y	0	0	0
RSC	Record of Site Condition	Y	0	14	14
RST	Retail Fuel Storage Tanks	Y	0	0	0
SCT	Scott's Manufacturing Directory	Y	0	1	1
SPL	Ontario Spills	Y	0	8	8
SRDS	Wastewater Discharger Registration Database	Y	0	0	0
TANK	Anderson's Storage Tanks	Y	0	0	0
TCFT	Transport Canada Fuel Storage Tanks	Y	0	0	0
VAR	Variances for Abandonment of Underground Storage Tanks	Y	0	0	0
WDS	Waste Disposal Sites - MOE CA Inventory	Y	0	0	0
WDSH	Waste Disposal Sites - MOE 1991 Historical Approval Inventory	Y	0	0	0
WWIS	Water Well Information System	Y	3	35	38
Total:			6	139	145

Executive Summary: Site Report Summary - Project Property

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev diff (m)</i>	<i>Page Number</i>
<u>1</u>	WWIS		2072 Lakeshore Road Burlington ON <i>Well ID: 7335602</i>	W/0.0	0.00	<u>38</u>
<u>2</u>	EHS		2072 Lakeshore Road Burlington ON L7R 1E3	ENE/0.0	-0.58	<u>41</u>
<u>2</u>	EHS		2072 Lakeshore Road Burlington ON L7R 1E3	ENE/0.0	-0.58	<u>41</u>
<u>3</u>	EHS		2072 Lakeshore Road Burlington ON L7R 1E3	ENE/0.0	-0.58	<u>41</u>
<u>4</u>	WWIS		2072 lakeshore Road Burlington ON <i>Well ID: 7335604</i>	SW/0.0	-0.06	<u>42</u>
<u>5</u>	WWIS		2072 Lakeshore Road Burlington ON <i>Well ID: 7335603</i>	WSW/0.0	0.33	<u>45</u>

Executive Summary: Site Report Summary - Surrounding Properties

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
6	WWIS		2107 OLD LAKESHORE ROAD BURLINGTON ON Well ID: 2810677	E/14.2	-1.59	48
7	WWIS		2048 OLD LAKESHORE ROAD Burlington ON Well ID: 7047892	SSW/14.5	-0.31	51
8	WWIS		2076 OLD LAKESHORE RD Burlington ON Well ID: 7202389	S/21.6	-1.25	54
9	EHS		2083 Old Lakeshore Road Burlington ON L7R 1E3	ENE/21.9	-1.19	57
10	WWIS		2076 OLD LAKESHORE RD Burlington ON Well ID: 7202390	SE/23.4	-1.53	57
11	WWIS		2065 2079 Lakeshore Road Burlington ON Well ID: 7329173	NNW/26.3	0.43	60
12	RSC	The Corporation of the City of Burlington	2080 LAKESHORE ROAD, BURLINGTON, ONTARIO L7R 1E3 Burlington ON	WSW/26.5	1.45	63
12	PTTW	Mady Burlington Ltd.	Bridgewater Development 2042, 2048, 2054, 2058, 2080 Lakeshore Road Parts 1 - 9 of Plan 20R-17007 City of Burlington, Regional Municipality of Halton CITY OF BURLINGTON ON	WSW/26.5	1.45	64
13	WWIS		2080 OLD LAKESHORE RD BURLINGTON ON Well ID: 7213159	SSW/28.3	-0.19	65
14	WWIS		2042 OLD LAKESHORE RD BURLINGTON ON Well ID: 7261445	SE/35.6	-1.62	67
15	EHS		2069 Lakeshore Rd Burlington ON L7R1E2	WNW/40.5	1.41	70

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>15</u>	GEN	Lakeshore Professional Arts Limited	2069 Lakeshore Rd. Suite 4 Burlington ON L7R 1E2	WNW/40.5	1.41	<u>70</u>
<u>15</u>	GEN	Lakeshore Professional Arts Limited	2069 Lakeshore Rd. Suite 4 Burlington ON L7R 1E2	WNW/40.5	1.41	<u>70</u>
<u>15</u>	EHS		2069 Lakeshore Rd Burlington ON	WNW/40.5	1.41	<u>71</u>
<u>16</u>	EHS		2076 Old Lakeshore Road Burlington ON	SE/43.9	-1.66	<u>71</u>
<u>16</u>	EHS		2076 Old Lakeshore Road Burlington ON	SE/43.9	-1.66	<u>71</u>
<u>17</u>	EHS		2084 Old Lakeshore Road Burlington ON L7R	ESE/43.9	-3.12	<u>71</u>
<u>17</u>	EHS		2084 Old Lakeshore Road Burlington ON L7R	ESE/43.9	-3.12	<u>71</u>
<u>18</u>	EHS		390 Pearl Street Burlington ON	W/44.8	2.36	<u>72</u>
<u>19</u>	EHS		2092 Old Lakeshore Road Burlington ON L7R 1A3	E/45.0	-2.33	<u>72</u>
<u>20</u>	WWIS		2096 LAKESHORE RD ON Well ID: 7287810	ENE/45.7	-1.24	<u>72</u>
<u>21</u>	GEN	Aviva Medical Diagnostics & Specialist Clinic Inc	2079 Lakeshore Rd. Burlington ON	NW/47.5	0.66	<u>75</u>
<u>21</u>	GEN	Aviva Medical Diagnostics & Specialist Clinic Inc	2079 Lakeshore Rd. Burlington ON	NW/47.5	0.66	<u>75</u>
<u>21</u>	GEN	LMC Clinical Researc Inc.	2079 Lakeshore Road Burlington ON L7R 1E2	NW/47.5	0.66	<u>75</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>21</u>	GEN	Aviva Medical Diagnostics & Specialist Clinic Inc	2079 Lakeshore Rd. Burlington ON L7R 1E2	NW/47.5	0.66	<u>76</u>
<u>21</u>	GEN	Aviva Medical Diagnostics & Specialist Clinic Inc	2079 Lakeshore Rd. Burlington ON L7R 1E2	NW/47.5	0.66	<u>76</u>
<u>21</u>	GEN	Aviva Medical Diagnostics & Specialist Clinic Inc	2079 Lakeshore Rd. Burlington ON L7R 1E2	NW/47.5	0.66	<u>76</u>
<u>22</u>	EHS		2069 Lakeshore Road Burlington ON L7R 1E2	NW/48.4	1.39	<u>77</u>
<u>22</u>	EHS		2069 Lakeshore Road Burlington ON L7R 1E2	NW/48.4	1.39	<u>77</u>
<u>23</u>	WWIS		2042 LAKESHORE ROAD Burlington ON Well ID: 7253016	S/49.0	-1.99	<u>77</u>
<u>24</u>	RSC	Bridgewater Lakeshore Developer Inc.	2058 LAKESHORE ROAD, BURLINGTON, ONTARIO L7R 1A3 Burlington ON	SSW/50.9	-1.15	<u>85</u>
<u>25</u>	WWIS		374 MARTHA ST Burlington ON Well ID: 7244963	N/51.9	-0.59	<u>86</u>
<u>26</u>	GEN	173716 Ont Inc	374 Martha St Burlington ON L7R 2P7	NNW/52.2	-0.01	<u>89</u>
<u>27</u>	SPL	Wilderness Group<UNOFFICIAL>	APPROXIMATELY 2093 LAKESHORE BLVE, BURLINGTON<UNOFFICIAL> Burlington ON	ENE/52.2	-1.59	<u>89</u>
<u>28</u>	EHS		2042-2058 LAKESHORE ROAD BURLINGTON ON L7R 1A3	WSW/55.5	1.40	<u>90</u>
<u>29</u>	EHS		2096 Lakeshore Rd Burlington ON L7R1E3	NE/56.2	-1.13	<u>90</u>
<u>30</u>	BORE		ON	NNW/57.3	0.48	<u>90</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>31</u>	GEN	2042 Lakeshore Holdings Ltd.	2048 Lakeshore Road Burlington ON	SW/60.1	0.68	<u>91</u>
<u>31</u>	RSC	Bridgewater Lakeshore Developer Inc.	2048 LAKESHORE ROAD, BURLINGTON, ONTARIO L7R 1A3 Burlington ON	SW/60.1	0.68	<u>92</u>
<u>31</u>	RSC	Bridgewater Lakeshore Developer Inc.	2048 LAKESHORE ROAD, BURLINGTON, ONTARIO L7R 1A3 Burlington ON	SW/60.1	0.68	<u>93</u>
<u>32</u>	WWIS		2092 OLD LAKESHORE RD. Burlington ON Well ID: 7107069	E/62.9	-2.16	<u>94</u>
<u>33</u>	EHS		2093 Old Lakeshore Rd Burlington ON L7R1A4	ENE/67.9	-1.61	<u>103</u>
<u>34</u>	RSC	Mr. Stuart Scott	389 Pearl Street, Burlington, Ontario Burlington ON L7R 2M8	WNW/68.8	2.36	<u>103</u>
<u>35</u>	EASR	ADI MORGAN DEVELOPMENTS (LAKESHORE) INC.	374-380 MARTHA ST BURLINGTON ON L7R 2P7	N/69.2	-0.62	<u>103</u>
<u>35</u>	RSC	ADI MORGAN DEVELOPMENTS (LAKESHORE) INC.	380 MARTHA STREET, BURLINGTON, ON L7R 2P7 Burlington ON	N/69.2	-0.62	<u>104</u>
<u>36</u>	EHS		2093, 2097, 2101 Old Lakeshore & 2096, 2100 Lakeshore Road Burlington ON L7R 1A4	ENE/69.8	-1.61	<u>105</u>
<u>37</u>	BORE		ON	W/71.0	2.42	<u>105</u>
<u>38</u>	WWIS		2071 LAKESHORE RD Burlington ON Well ID: 7280353	NW/71.3	1.54	<u>106</u>
<u>39</u>	WWIS		2402 LAKESHORE RD. Burlington ON Well ID: 7122728	SW/72.6	1.33	<u>109</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>40</u>	WWIS		2100 LAKESHORE RD ON Well ID: 7287811	NE/74.3	-1.67	<u>112</u>
<u>41</u>	BORE		ON	W/74.4	2.39	<u>114</u>
<u>42</u>	WWIS		ON Well ID: 7287812	ENE/77.7	-1.62	<u>116</u>
<u>43</u>	RSC	Mr. Stuart Scott	393 Pearl Street, Burlington, Ontario, ON L7R 2M8	WNW/82.1	2.43	<u>118</u>
<u>44</u>	WWIS		2042 LAKESHORE RD Burlington ON Well ID: 7147293	WSW/88.7	1.52	<u>119</u>
<u>45</u>	WWIS		2048 LAKESHORE RD BURLINGTON ON Well ID: 2810175	SW/89.6	1.41	<u>128</u>
<u>45</u>	WWIS		2042-2058 LAKESHORE RD BURLINGTON ON Well ID: 2810279	SW/89.6	1.41	<u>130</u>
<u>46</u>	PRT	MARALYN WALSH	2042 LAKESHORE RD BURLINGTON ON	SW/90.3	0.71	<u>132</u>
<u>46</u>	GEN	2042 Lakeshore Holdings Ltd.	2042 - 2058 Lakeshore Rd Burlington ON L7R 1A3	SW/90.3	0.71	<u>132</u>
<u>46</u>	DTNK	MARALYN WALSH HOLDINGS LTD	2042 LAKESHORE RD BURLINGTON ON L7R 1A3	SW/90.3	0.71	<u>133</u>
<u>46</u>	EHS		2042 Lakeshore Road Burlington ON	SW/90.3	0.71	<u>133</u>
<u>46</u>	GEN	Suncor Energy Products	2042 Lakeshore Road Burlington ON	SW/90.3	0.71	<u>133</u>
<u>46</u>	GEN	Suncor Energy Products	2042 Lakeshore Road Burlington ON L7L1C8	SW/90.3	0.71	<u>134</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>47</u>	RSC	987032 Ontario Inc.	388 Martha Street, Burlington, Ontario Burlington ON L7R 2P7	NNW/90.5	-0.69	<u>134</u>
<u>48</u>	WWIS		2042 LAKESHORE ROAD BURLINGTON ON Well ID: 2809958	SW/90.9	1.41	<u>135</u>
<u>49</u>	EHS		2101 Old Lakeshore Road Burlington ON L7R 1A4	ENE/91.0	-1.58	<u>137</u>
<u>50</u>	SPL	BURLINGTON HYDRO	LAKE ONTARIO OUTFALL 2047 LAKESHORE RD (AT BRANT) IN FRONT OF RIVERA TRANSFORMER BURLINGTON CITY ON L7R 1E1	WSW/91.8	2.04	<u>138</u>
<u>51</u>	WWIS		ON Well ID: 7181460	SW/95.0	1.38	<u>138</u>
<u>52</u>	GEN	Thornwood Development Group Inc.	399 Pearl St. Burlington ON L7R 2M8	WNW/96.0	2.51	<u>139</u>
<u>52</u>	RSC	987032 Ontario Inc.	399 Pearl Street, Burlington, Ontario, ON L7R 2M8	WNW/96.0	2.51	<u>139</u>
<u>53</u>	WWIS		37 HANARTHA ST. (#374) BURLINGTON ON Well ID: 7251745	NW/98.9	1.50	<u>140</u>
<u>54</u>	WWIS		2402 LAKESHORE RD. Burlington ON Well ID: 7122727	SW/99.2	1.15	<u>143</u>
<u>55</u>	WWIS		2088 LAKESHORE RD. BURLINGTON ON Well ID: 2810472	SW/103.5	-0.10	<u>146</u>
<u>56</u>	RSC	987032 Ontario Inc.	394 Martha Street, Burlington, Ontario, ON L7R 2P7	NNW/105.4	-0.58	<u>150</u>
<u>57</u>	EHS		390 Pearl Street Burlington ON L7R 2M9	WNW/110.7	2.82	<u>150</u>
<u>57</u>	EHS		390 Pearl Street Burlington ON L7R 2M9	WNW/110.7	2.82	<u>150</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>58</u>	EHS		2085 Pine St Burlington ON L7R1G1	NW/115.3	0.94	<u>151</u>
<u>59</u>	WWIS		2119 LAKSHORE RD Burlington ON Well ID: 7280352	ENE/115.4	-1.58	<u>151</u>
<u>60</u>	BORE		ON	W/121.1	2.47	<u>154</u>
<u>61</u>	BORE		ON	W/121.2	2.21	<u>155</u>
<u>62</u>	RSC	987032 Ontario Inc.	2082 Pine Street, Burlington, Ontario, ON L7R 1G2	NW/123.5	1.34	<u>156</u>
<u>63</u>	RSC	987032 Ontario Inc.	2078 Pine Street, Burlington, Ontario Burlington ON L7R 1G2	NW/123.6	2.13	<u>157</u>
<u>64</u>	HINC		2086 Pine St BURLINGTON ON L7R 1G2	NW/123.9	0.94	<u>157</u>
<u>65</u>	SPL	BURLINGTON HYDRO- ELECTRIC COMM	399 ELIZABETH STREET TRANSFORMER BURLINGTON CITY ON	W/125.7	2.13	<u>158</u>
<u>65</u>	RSC	BAXTER'S WHARF INC.	399 ELIZABETH STREET, BURLINGTON, ONTARIO , L7R 2L7 ON L7R 0A4	W/125.7	2.13	<u>158</u>
<u>65</u>	SPL		399 Elizabeth Street Burlington ON	W/125.7	2.13	<u>159</u>
<u>66</u>	RSC	Pearl & Pine St. Facility Inc.	398 PEARL ST, BURLINGTON, ON, L7R 2M9 BURLINGTON ON L7R 2M9	W/130.4	2.48	<u>159</u>
<u>66</u>	GEN	Reichman Seniors Housing Development	392,398 Pearl Street Burlington ON L7R 2M9	W/130.4	2.48	<u>160</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
67	BORE		ON	W/131.0	2.14	160
68	EHS		2107 And 2119 Old Lakeshore Road Burlington ON	ENE/132.5	-2.16	162
69	SPL	PUC	VENTURE INN PARKING LOT LAKESHORE AND ELIZABETH MOTOR VEHICLE (OPERATING FLUID) BURLINGTON CITY ON	WSW/133.2	0.73	162
69	PINC	PIPELINE HIT 6"	ELIZABETH ST & LAKESHORE RD.,, BURLINGTON,ON,L7R 0A4,CA ON	WSW/133.2	0.73	162
70	EHS		395 Martha Street Burlington ON L7R 4A9	N/134.7	-2.39	163
70	EHS		395 Martha Street Burlington ON L7R 4A9	N/134.7	-2.39	163
71	GEN	Sun Mechanical	2121 Lakeshore Road Burlington ON	NE/144.1	-3.48	163
72	SPL	BURLINGTON HYDRO- ELECTRIC COMM	2119 LAKESHORE BLVD. AT JUNCTION ST. TRANSFORMER BURLINGTON CITY ON L7R 1A4	ENE/144.6	-2.19	163
72	GEN	LMC Clinical Research Inc. Research	2119 Lakeshore Road Burlington ON L7R 1A4	ENE/144.6	-2.19	164
72	GEN	AVIVA Medical Specialists Clinic	2119 Old Lakeshore Rd. Burlington ON L7R1A4	ENE/144.6	-2.19	164
72	GEN	AVIVA Medical Specialists Clinic	2119 Old Lakeshore Rd. Burlington ON L7R1A4	ENE/144.6	-2.19	165
72	GEN	LMC Clinical Research Inc. Research	2119 Lakeshore Road Burlington ON L7R 1A4	ENE/144.6	-2.19	165
73	WWIS		2107 Old Lakeshore Rd Burlington ON	ENE/149.6	-2.37	165

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
			Well ID: 7356014			
74	CA	VILLAGE SQUARE (BURLINGTON)	2049 PINE ST., UNITS 17 & 18 BURLINGTON ON L7R 1E9	W/161.1	3.21	168
75	GEN	1536493 Ont. Inc.	391 John St Burlington ON L7R 2K3	WSW/168.2	0.38	169
76	BORE		ON	NE/171.1	-4.60	169
77	INC		2037 PINE ST, BURLINGTON ON	W/176.4	2.35	170
78	EHS		415 Elizabeth St Burlington ON L7R 2L8	W/177.6	3.21	171
79	EHS		2037 Pine Street Burlington ON	W/177.9	3.21	171
80	WWIS		ON Well ID: 7272672	NNW/178.4	-1.62	171
81	WWIS		409 MARTHA STREET BURLINGTON ON Well ID: 7323240	NNW/178.8	-1.62	175
82	CA	ESPRESSO BAR, ROASTERY & DESSERT HOUSE L	413 ELIZABETH STREET BURLINGTON ON L7R 2L8	W/179.3	2.36	177
83	CA	1121206 ONTARIO INC.	420 PEARL STREET BURLINGTON CITY ON L7R 2N1	WNW/180.6	3.39	178
84	EHS		396 Elizabeth Street Burlington ON L7R 2L6	W/187.8	1.52	178
85	SCT	DESKTOP TEXT & DESIGN	399 JOHN ST UNIT 310 BURLINGTON ON L7R 2K3	W/190.1	1.52	178
86	SPL		2137 Lakeshore Road Burlington ON	NE/194.2	-4.01	178

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>87</u>	EHS		411 Martha St Burlington ON L7R2P6	NNW/194.7	-1.69	<u>179</u>
<u>88</u>	EHS		401 Martha Street Burlington ON	NNW/194.9	-1.64	<u>179</u>
<u>89</u>	EHS		2020 Lakeshore Road Burlington ON L7R 4G8	SW/197.7	-1.65	<u>179</u>
<u>89</u>	EHS		2020 Lakeshore Road Burlington ON L7R 4G8	SW/197.7	-1.65	<u>179</u>
<u>90</u>	WWIS		380 BRANT ST. BURLINGTON ON Well ID: 2810067	W/204.8	2.82	<u>180</u>
<u>91</u>	BORE		ON	W/205.4	2.82	<u>183</u>
<u>92</u>	BORE		ON	WSW/211.8	-0.56	<u>184</u>
<u>93</u>	EHS		425 Pearl St Burlington ON L7R2N2	NW/222.9	0.72	<u>185</u>
<u>94</u>	EHS		360 Torrance Street Burlington ON	NE/225.3	-0.67	<u>185</u>
<u>95</u>	CA	GWL Realty Advisors Inc.	360 Torrance St Torrance Terrace Apartments Burlington ON	NE/227.5	-0.01	<u>186</u>
<u>95</u>	ECA	GWL Realty Advisors Inc.	360 Torrance St Torrance Terrace Apartments Burlington ON M5G 1R8	NE/227.5	-0.01	<u>186</u>
<u>95</u>	EASR	1319399 ONTARIO INC	360 Torrance ST Burlington ON L7R 2R9	NE/227.5	-0.01	<u>186</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>96</u>	EHS		2020 LAKESHORE ROAD BURLINGTON ON L7R 4G8	WSW/233.5	-0.92	<u>187</u>
<u>96</u>	WWIS		2020 Lakeshore Road Burlington ON Well ID: 7385417	WSW/233.5	-0.92	<u>187</u>
<u>96</u>	WWIS		2020 Lakeshore Road Burlington ON Well ID: 7385418	WSW/233.5	-0.92	<u>190</u>
<u>96</u>	WWIS		2020 Lakeshore Road Burlington ON Well ID: 7385428	WSW/233.5	-0.92	<u>194</u>
<u>96</u>	WWIS		2020 Lakeshore Road Burlington ON Well ID: 7385413	WSW/233.5	-0.92	<u>197</u>
<u>96</u>	WWIS		2020 Lakeshore Road Burlington ON Well ID: 7385414	WSW/233.5	-0.92	<u>200</u>
<u>96</u>	WWIS		2020 Lakeshore Road Burlington ON Well ID: 7385415	WSW/233.5	-0.92	<u>204</u>
<u>96</u>	WWIS		2020 Lakeshore Road Burlington ON Well ID: 7385416	WSW/233.5	-0.92	<u>208</u>
<u>97</u>	BORE		ON	NNW/235.4	0.78	<u>211</u>
<u>98</u>	CA	RC'S BOARDWALK INC.	2013 LAKESHORE ROAD WEST BURLINGTON CITY ON	WSW/237.0	1.22	<u>212</u>
<u>99</u>	EHS		John St Burlington ON	W/244.4	3.39	<u>212</u>
<u>100</u>	EHS		2160 Lakeshore Rd And 360 Torrance St Burlington ON	NE/247.4	-0.61	<u>213</u>
<u>101</u>	SPL		Martha Street and south of New street Burlington ON	NNW/248.5	-0.86	<u>213</u>

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev Diff (m)</i>	<i>Page Number</i>
102	EHS		360 Torrance Street Burlington ON L7R 2R9	NE/249.3	-0.30	213

Executive Summary: Summary By Data Source

BORE - Borehole

A search of the BORE database, dated 1875-Jul 2018 has found that there are 10 BORE site(s) within approximately 0.25 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	ON	57.3	<u>30</u>
	ON	71.0	<u>37</u>
	ON	74.4	<u>41</u>
	ON	121.1	<u>60</u>
	ON	121.2	<u>61</u>
	ON	131.0	<u>67</u>
	ON	171.1	<u>76</u>
	ON	205.4	<u>91</u>
	ON	211.8	<u>92</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	ON	235.4	<u>97</u>

CA - Certificates of Approval

A search of the CA database, dated 1985-Oct 30, 2011* has found that there are 5 CA site(s) within approximately 0.25 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
VILLAGE SQUARE (BURLINGTON)	2049 PINE ST., UNITS 17 & 18 BURLINGTON ON L7R 1E9	161.1	<u>74</u>
ESPRESSO BAR, ROASTERY & DESSERT HOUSE L	413 ELIZABETH STREET BURLINGTON ON L7R 2L8	179.3	<u>82</u>
1121206 ONTARIO INC.	420 PEARL STREET BURLINGTON CITY ON L7R 2N1	180.6	<u>83</u>
GWL Realty Advisors Inc.	360 Torrance St Torrance Terrace Apartments Burlington ON	227.5	<u>95</u>
RC'S BOARDWALK INC.	2013 LAKESHORE ROAD WEST BURLINGTON CITY ON	237.0	<u>98</u>

DTNK - Delisted Fuel Tanks

A search of the DTNK database, dated Feb 28, 2022 has found that there are 1 DTNK site(s) within approximately 0.25 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
MARALYN WALSH HOLDINGS LTD	2042 LAKESHORE RD BURLINGTON ON L7R 1A3	90.3	<u>46</u>

EASR - Environmental Activity and Sector Registry

A search of the EASR database, dated Oct 2011- Dec 31, 2022 has found that there are 2 EASR site(s) within approximately 0.25 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
ADI MORGAN DEVELOPMENTS (LAKESHORE) INC.	374-380 MARTHA ST BURLINGTON ON L7R 2P7	69.2	<u>35</u>
1319399 ONTARIO INC	360 Torrance ST Burlington ON L7R 2R9	227.5	<u>95</u>

ECA - Environmental Compliance Approval

A search of the ECA database, dated Oct 2011- Dec 31, 2022 has found that there are 1 ECA site(s) within approximately 0.25 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
GWL Realty Advisors Inc.	360 Torrance St Torrance Terrace Apartments Burlington ON M5G 1R8	227.5	<u>95</u>

EHS - ERIS Historical Searches

A search of the EHS database, dated 1999-Jul 31, 2022 has found that there are 39 EHS site(s) within approximately 0.25 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	2072 Lakeshore Road Burlington ON L7R 1E3	0.0	<u>2</u>
	2072 Lakeshore Road Burlington ON L7R 1E3	0.0	<u>2</u>
	2072 Lakeshore Road Burlington ON L7R 1E3	0.0	<u>3</u>
	2083 Old Lakeshore Road Burlington ON L7R 1E3	21.9	<u>9</u>
	2069 Lakeshore Rd Burlington ON L7R1E2	40.5	<u>15</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	2069 Lakeshore Rd Burlington ON	40.5	<u>15</u>
	2076 Old Lakeshore Road Burlington ON	43.9	<u>16</u>
	2076 Old Lakeshore Road Burlington ON	43.9	<u>16</u>
	2084 Old Lakeshore Road Burlington ON L7R	43.9	<u>17</u>
	2084 Old Lakeshore Road Burlington ON L7R	43.9	<u>17</u>
	390 Pearl Street Burlington ON	44.8	<u>18</u>
	2092 Old Lakeshore Road Burlington ON L7R 1A3	45.0	<u>19</u>
	2069 Lakeshore Road Burlington ON L7R 1E2	48.4	<u>22</u>
	2069 Lakeshore Road Burlington ON L7R 1E2	48.4	<u>22</u>
	2042-2058 LAKESHORE ROAD BURLINGTON ON L7R 1A3	55.5	<u>28</u>
	2096 Lakeshore Rd Burlington ON L7R1E3	56.2	<u>29</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	2093 Old Lakeshore Rd Burlington ON L7R1A4	67.9	<u>33</u>
	2093, 2097, 2101 Old Lakeshore & 2096, 2100 Lakeshore Road Burlington ON L7R 1A4	69.8	<u>36</u>
	2042 Lakeshore Road Burlington ON	90.3	<u>46</u>
	2101 Old Lakeshore Road Burlington ON L7R 1A4	91.0	<u>49</u>
	390 Pearl Street Burlington ON L7R 2M9	110.7	<u>57</u>
	390 Pearl Street Burlington ON L7R 2M9	110.7	<u>57</u>
	2085 Pine St Burlington ON L7R1G1	115.3	<u>58</u>
	2107 And 2119 Old Lakeshore Road Burlington ON	132.5	<u>68</u>
	395 Martha Street Burlington ON L7R 4A9	134.7	<u>70</u>
	395 Martha Street Burlington ON L7R 4A9	134.7	<u>70</u>
	415 Elizabeth St Burlington ON L7R 2L8	177.6	<u>78</u>
	2037 Pine Street Burlington ON	177.9	<u>79</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	396 Elizabeth Street Burlington ON L7R 2L6	187.8	<u>84</u>
	411 Martha St Burlington ON L7R2P6	194.7	<u>87</u>
	401 Martha Street Burlington ON	194.9	<u>88</u>
	2020 Lakeshore Road Burlington ON L7R 4G8	197.7	<u>89</u>
	2020 Lakeshore Road Burlington ON L7R 4G8	197.7	<u>89</u>
	425 Pearl St Burlington ON L7R2N2	222.9	<u>93</u>
	360 Torrance Street Burlington ON	225.3	<u>94</u>
	2020 LAKESHORE ROAD BURLINGTON ON L7R 4G8	233.5	<u>96</u>
	John St Burlington ON	244.4	<u>99</u>
	2160 Lakeshore Rd And 360 Torrance St Burlington ON	247.4	<u>100</u>
	360 Torrance Street Burlington ON L7R 2R9	249.3	<u>102</u>

GEN - Ontario Regulation 347 Waste Generators Summary

A search of the GEN database, dated 1986-Oct 31, 2022 has found that there are 21 GEN site(s) within approximately 0.25 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
Lakeshore Professional Arts Limited	2069 Lakeshore Rd. Suite 4 Burlington ON L7R 1E2	40.5	<u>15</u>
Lakeshore Professional Arts Limited	2069 Lakeshore Rd. Suite 4 Burlington ON L7R 1E2	40.5	<u>15</u>
Aviva Medical Diagnostics & Specialist Clinic Inc	2079 Lakeshore Rd. Burlington ON	47.5	<u>21</u>
Aviva Medical Diagnostics & Specialist Clinic Inc	2079 Lakeshore Rd. Burlington ON	47.5	<u>21</u>
LMC Clinical Researc Inc.	2079 Lakeshore Road Burlington ON L7R 1E2	47.5	<u>21</u>
Aviva Medical Diagnostics & Specialist Clinic Inc	2079 Lakeshore Rd. Burlington ON L7R 1E2	47.5	<u>21</u>
Aviva Medical Diagnostics & Specialist Clinic Inc	2079 Lakeshore Rd. Burlington ON L7R 1E2	47.5	<u>21</u>
Aviva Medical Diagnostics & Specialist Clinic Inc	2079 Lakeshore Rd. Burlington ON L7R 1E2	47.5	<u>21</u>
173716 Ont Inc	374 Martha St Burlington ON L7R 2P7	52.2	<u>26</u>
2042 Lakeshore Holdings Ltd.	2048 Lakeshore Road Burlington ON	60.1	<u>31</u>
2042 Lakeshore Holdings Ltd.	2042 - 2058 Lakeshore Rd Burlington ON L7R 1A3	90.3	<u>46</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
Suncor Energy Products	2042 Lakeshore Road Burlington ON L7L1C8	90.3	<u>46</u>
Suncor Energy Products	2042 Lakeshore Road Burlington ON	90.3	<u>46</u>
Thornwood Development Group Inc.	399 Pearl St. Burlington ON L7R 2M8	96.0	<u>52</u>
Reichman Seniors Housing Development	392,398 Pearl Street Burlington ON L7R 2M9	130.4	<u>66</u>
Sun Mechanical	2121 Lakeshore Road Burlington ON	144.1	<u>71</u>
LMC Clinical Research Inc. Research	2119 Lakeshore Road Burlington ON L7R 1A4	144.6	<u>72</u>
AVIVA Medical Specialists Clinic	2119 Old Lakeshore Rd. Burlington ON L7R1A4	144.6	<u>72</u>
AVIVA Medical Specialists Clinic	2119 Old Lakeshore Rd. Burlington ON L7R1A4	144.6	<u>72</u>
LMC Clinical Research Inc. Research	2119 Lakeshore Road Burlington ON L7R 1A4	144.6	<u>72</u>
1536493 Ont. Inc.	391 John St Burlington ON L7R 2K3	168.2	<u>75</u>

HINC - TSSA Historic Incidents

A search of the HINC database, dated 2006-June 2009* has found that there are 1 HINC site(s) within approximately 0.25 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	2086 Pine St BURLINGTON ON L7R 1G2	123.9	64

INC - Fuel Oil Spills and Leaks

A search of the INC database, dated Feb 28, 2022 has found that there are 1 INC site(s) within approximately 0.25 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	2037 PINE ST, BURLINGTON ON	176.4	77

PINC - Pipeline Incidents

A search of the PINC database, dated Feb 28, 2021 has found that there are 1 PINC site(s) within approximately 0.25 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
PIPELINE HIT 6"	ELIZABETH ST & LAKESHORE RD., BURLINGTON,ON,L7R 0A4,CA ON	133.2	69

PRT - Private and Retail Fuel Storage Tanks

A search of the PRT database, dated 1989-1996* has found that there are 1 PRT site(s) within approximately 0.25 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
MARALYN WALSH	2042 LAKESHORE RD BURLINGTON ON	90.3	46

PTTW - Permit to Take Water

A search of the PTTW database, dated 1994 - Dec 31, 2022 has found that there are 1 PTTW site(s) within approximately 0.25 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
Mady Burlington Ltd.	Bridgewater Development 2042, 2048, 2054, 2058, 2080 Lakeshore Road Parts 1 - 9 of Plan 20R-17007 City of Burlington, Regional Municipality of Halton CITY OF BURLINGTON ON	26.5	<u>12</u>

RSC - Record of Site Condition

A search of the RSC database, dated 1997-Sept 2001, Oct 2004-Dec 2022 has found that there are 14 RSC site(s) within approximately 0.25 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
The Corporation of the City of Burlington	2080 LAKESHORE ROAD, BURLINGTON, ONTARIO L7R 1E3 Burlington ON	26.5	<u>12</u>
Bridgewater Lakeshore Developer Inc.	2058 LAKESHORE ROAD, BURLINGTON, ONTARIO L7R 1A3 Burlington ON	50.9	<u>24</u>
Bridgewater Lakeshore Developer Inc.	2048 LAKESHORE ROAD, BURLINGTON, ONTARIO L7R 1A3 Burlington ON	60.1	<u>31</u>
Bridgewater Lakeshore Developer Inc.	2048 LAKESHORE ROAD, BURLINGTON, ONTARIO L7R 1A3 Burlington ON	60.1	<u>31</u>
Mr. Stuart Scott	389 Pearl Street, Burlington, Ontario Burlington ON L7R 2M8	68.8	<u>34</u>
ADI MORGAN DEVELOPMENTS (LAKESHORE) INC.	380 MARTHA STREET, BURLINGTON, ON L7R 2P7 Burlington ON	69.2	<u>35</u>
Mr. Stuart Scott	393 Pearl Street, Burlington, Ontario, ON L7R 2M8	82.1	<u>43</u>
987032 Ontario Inc.	388 Martha Street, Burlington, Ontario Burlington ON L7R 2P7	90.5	<u>47</u>
987032 Ontario Inc.	399 Pearl Street, Burlington, Ontario, ON L7R 2M8	96.0	<u>52</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
987032 Ontario Inc.	394 Martha Street, Burlington, Ontario, ON L7R 2P7	105.4	56
987032 Ontario Inc.	2082 Pine Street, Burlington, Ontario, ON L7R 1G2	123.5	62
987032 Ontario Inc.	2078 Pine Street, Burlington, Ontario Burlington ON L7R 1G2	123.6	63
BAXTER'S WHARF INC.	399 ELIZABETH STREET, BURLINGTON, ONTARIO , L7R 2L7 ON L7R 0A4	125.7	65
Pearl & Pine St. Facility Inc.	398 PEARL ST, BURLINGTON, ON, L7R 2M9 BURLINGTON ON L7R 2M9	130.4	66

SCT - Scott's Manufacturing Directory

A search of the SCT database, dated 1992-Mar 2011* has found that there are 1 SCT site(s) within approximately 0.25 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
DESKTOP TEXT & DESIGN	399 JOHN ST UNIT 310 BURLINGTON ON L7R 2K3	190.1	85

SPL - Ontario Spills

A search of the SPL database, dated 1988-Sep 2020; Dec 2020-Mar 2021 has found that there are 8 SPL site(s) within approximately 0.25 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
Wilderness Group<UNOFFICIAL>	APPROXIMATELY 2093 LAKESHORE BLVE, BURLINGTON<UNOFFICIAL> Burlington ON	52.2	27
BURLINGTON HYDRO	LAKE ONTARIO OUTFALL 2047 LAKESHORE RD (AT BRANT) IN FRONT OF RIVERA TRANSFORMER BURLINGTON CITY ON L7R 1E1	91.8	50

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
BURLINGTON HYDRO-ELECTRIC COMM	399 ELIZABETH STREET TRANSFORMER BURLINGTON CITY ON	125.7	<u>65</u>
	399 Elizabeth Street Burlington ON	125.7	<u>65</u>
PUC	VENTURE INN PARKING LOT LAKESHORE AND ELIZABETH MOTOR VEHICLE (OPERATING FLUID) BURLINGTON CITY ON	133.2	<u>69</u>
BURLINGTON HYDRO-ELECTRIC COMM	2119 LAKESHORE BLVD. AT JUNCTION ST. TRANSFORMER BURLINGTON CITY ON L7R 1A4	144.6	<u>72</u>
	2137 Lakeshore Road Burlington ON	194.2	<u>86</u>
	Martha Street and south of New street Burlington ON	248.5	<u>101</u>

WWIS - Water Well Information System

A search of the WWIS database, dated Jun 30 2022 has found that there are 38 WWIS site(s) within approximately 0.25 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	2072 Lakeshore Road Burlington ON <i>Well ID: 7335602</i>	0.0	<u>1</u>
	2072 lakeshore Road Burlington ON <i>Well ID: 7335604</i>	0.0	<u>4</u>
	2072 Lakeshore Road Burlington ON <i>Well ID: 7335603</i>	0.0	<u>5</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	2107 OLD LAKESHORE ROAD BURLINGTON ON <i>Well ID: 2810677</i>	14.2	<u>6</u>
	2048 OLD LAKESHORE ROAD Burlington ON <i>Well ID: 7047892</i>	14.5	<u>7</u>
	2076 OLD LAKESHORE RD Burlington ON <i>Well ID: 7202389</i>	21.6	<u>8</u>
	2076 OLD LAKESHORE RD Burlington ON <i>Well ID: 7202390</i>	23.4	<u>10</u>
	2065 2079 Lakeshore Road Burlington ON <i>Well ID: 7329173</i>	26.3	<u>11</u>
	2080 OLD LAKESHORE RD BURLINGTON ON <i>Well ID: 7213159</i>	28.3	<u>13</u>
	2042 OLD LAKESHORE RD BURLINGTON ON <i>Well ID: 7261445</i>	35.6	<u>14</u>
	2096 LAKESHORE RD ON <i>Well ID: 7287810</i>	45.7	<u>20</u>
	2042 LAKESHORE ROAD Burlington ON <i>Well ID: 7253016</i>	49.0	<u>23</u>
	374 MARTHA ST Burlington ON <i>Well ID: 7244963</i>	51.9	<u>25</u>
	2092 OLD LAKESHORE RD. Burlington ON <i>Well ID: 7107069</i>	62.9	<u>32</u>
	2071 LAKESHORE RD Burlington ON	71.3	<u>38</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	Well ID: 7280353		
	2402 LAKESHORE RD. Burlington ON	72.6	<u>39</u>
	Well ID: 7122728		
	2100 LAKESHORE RD ON	74.3	<u>40</u>
	Well ID: 7287811		
	ON	77.7	<u>42</u>
	Well ID: 7287812		
	2042 LAKESHORE RD Burlington ON	88.7	<u>44</u>
	Well ID: 7147293		
	2048 LAKESHORE RD BURLINGTON ON	89.6	<u>45</u>
	Well ID: 2810175		
	2042-2058 LAKESHORE RD BURLINGTON ON	89.6	<u>45</u>
	Well ID: 2810279		
	2042 LAKESHORE ROAD BURLINGTON ON	90.9	<u>48</u>
	Well ID: 2809958		
	ON	95.0	<u>51</u>
	Well ID: 7181460		
	37 HANARTHA ST. (#374) BURLINGTON ON	98.9	<u>53</u>
	Well ID: 7251745		
	2402 LAKESHORE RD. Burlington ON	99.2	<u>54</u>
	Well ID: 7122727		
	2088 LAKESHORE RD. BURLINGTON ON	103.5	<u>55</u>
	Well ID: 2810472		

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	2119 LAKSHORE RD Burlington ON <i>Well ID: 7280352</i>	115.4	<u>59</u>
	2107 Old Lakeshore Rd Burlington ON <i>Well ID: 7356014</i>	149.6	<u>73</u>
	ON <i>Well ID: 7272672</i>	178.4	<u>80</u>
	409 MARTHA STREET BURLINGTON ON <i>Well ID: 7323240</i>	178.8	<u>81</u>
	380 BRANT ST. BURLINGTON ON <i>Well ID: 2810067</i>	204.8	<u>90</u>
	2020 Lakeshore Road Burlington ON <i>Well ID: 7385416</i>	233.5	<u>96</u>
	2020 Lakeshore Road Burlington ON <i>Well ID: 7385417</i>	233.5	<u>96</u>
	2020 Lakeshore Road Burlington ON <i>Well ID: 7385418</i>	233.5	<u>96</u>
	2020 Lakeshore Road Burlington ON <i>Well ID: 7385428</i>	233.5	<u>96</u>
	2020 Lakeshore Road Burlington ON <i>Well ID: 7385413</i>	233.5	<u>96</u>
	2020 Lakeshore Road Burlington ON <i>Well ID: 7385414</i>	233.5	<u>96</u>
	2020 Lakeshore Road Burlington ON	233.5	<u>96</u>


Site

Address

Distance (m)

Map Key

Well ID: 7385415

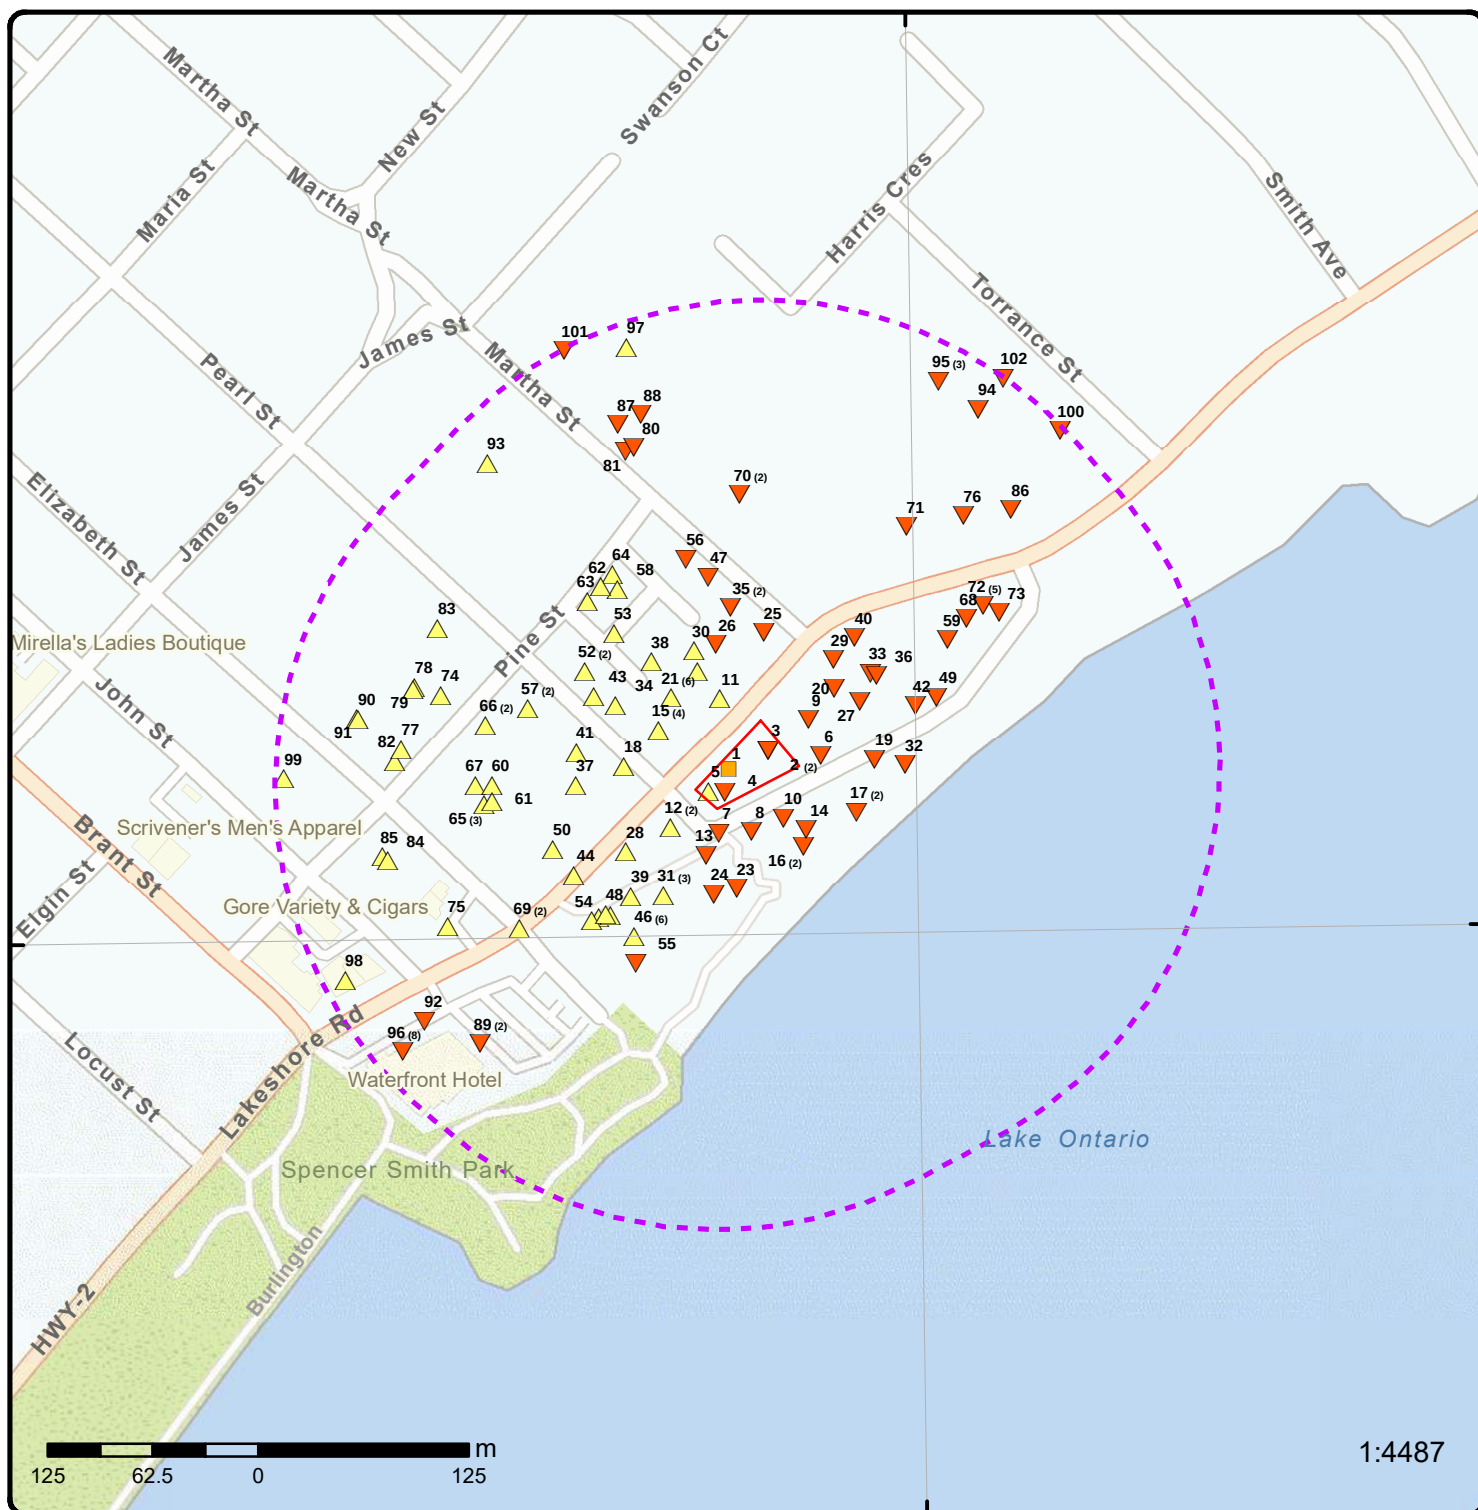

Map: 0.25 Kilometer Radius

Order Number: 23021400831

Address: 2072 Lakeshore Road, Burlington, ON




 Project Property	 Freeways; Highways	 Beach	 Shopping & Sports Area
 Buffer Outline	 Traffic Circle; Ramp	 Airport	 University/College
▲ Eris Sites with Higher Elevation	 Major Arterial; Minor Arterial	 Industrial Area	 Cemetery; Golf Course
▲ Eris Sites with Same Elevation	 Local Road	 Military Base	 Parkt (National)
▲ Eris Sites with Lower Elevation	 Service Road; Traffic Circle; Ramp	 Aircraft Roads	 Park (City/County)
○ Eris Sites with Unknown Elevation	 Rail	 Native Reservation	
		 Hospital	

79°48'W

43°19'30"N

43°19'30"N

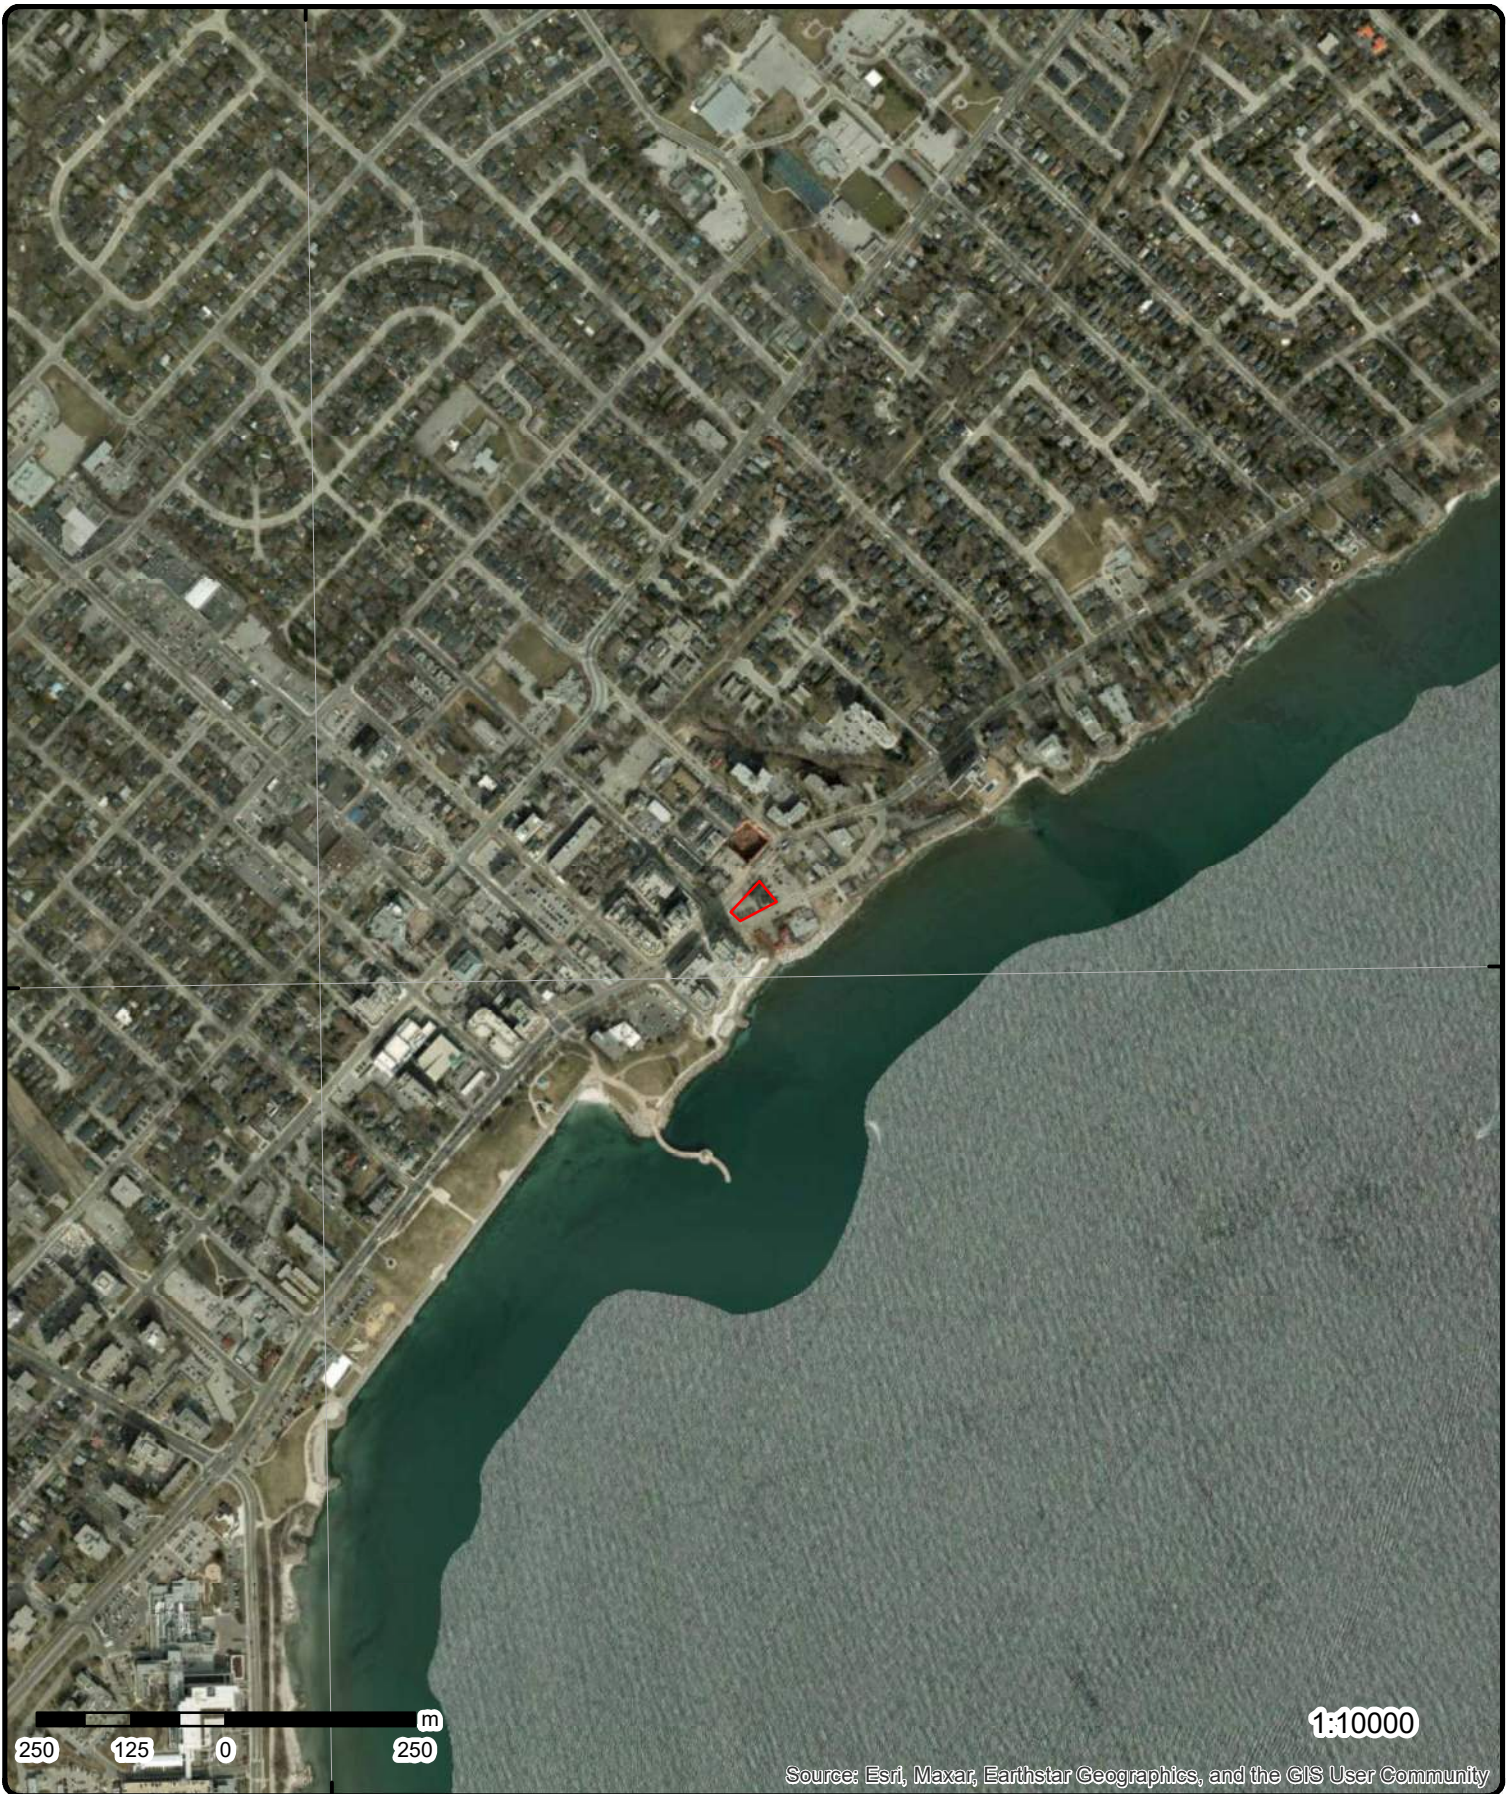

Aerial Year: 2021

Order Number: 23021400831

Address: 2072 Lakeshore Road, Burlington, ON



Source: ESRI World Imagery

© ERIS Information Limited Partnership

79°48'W


79°46'30"W

43°21'N

43°21'N

43°19'30"N

43°19'30"N

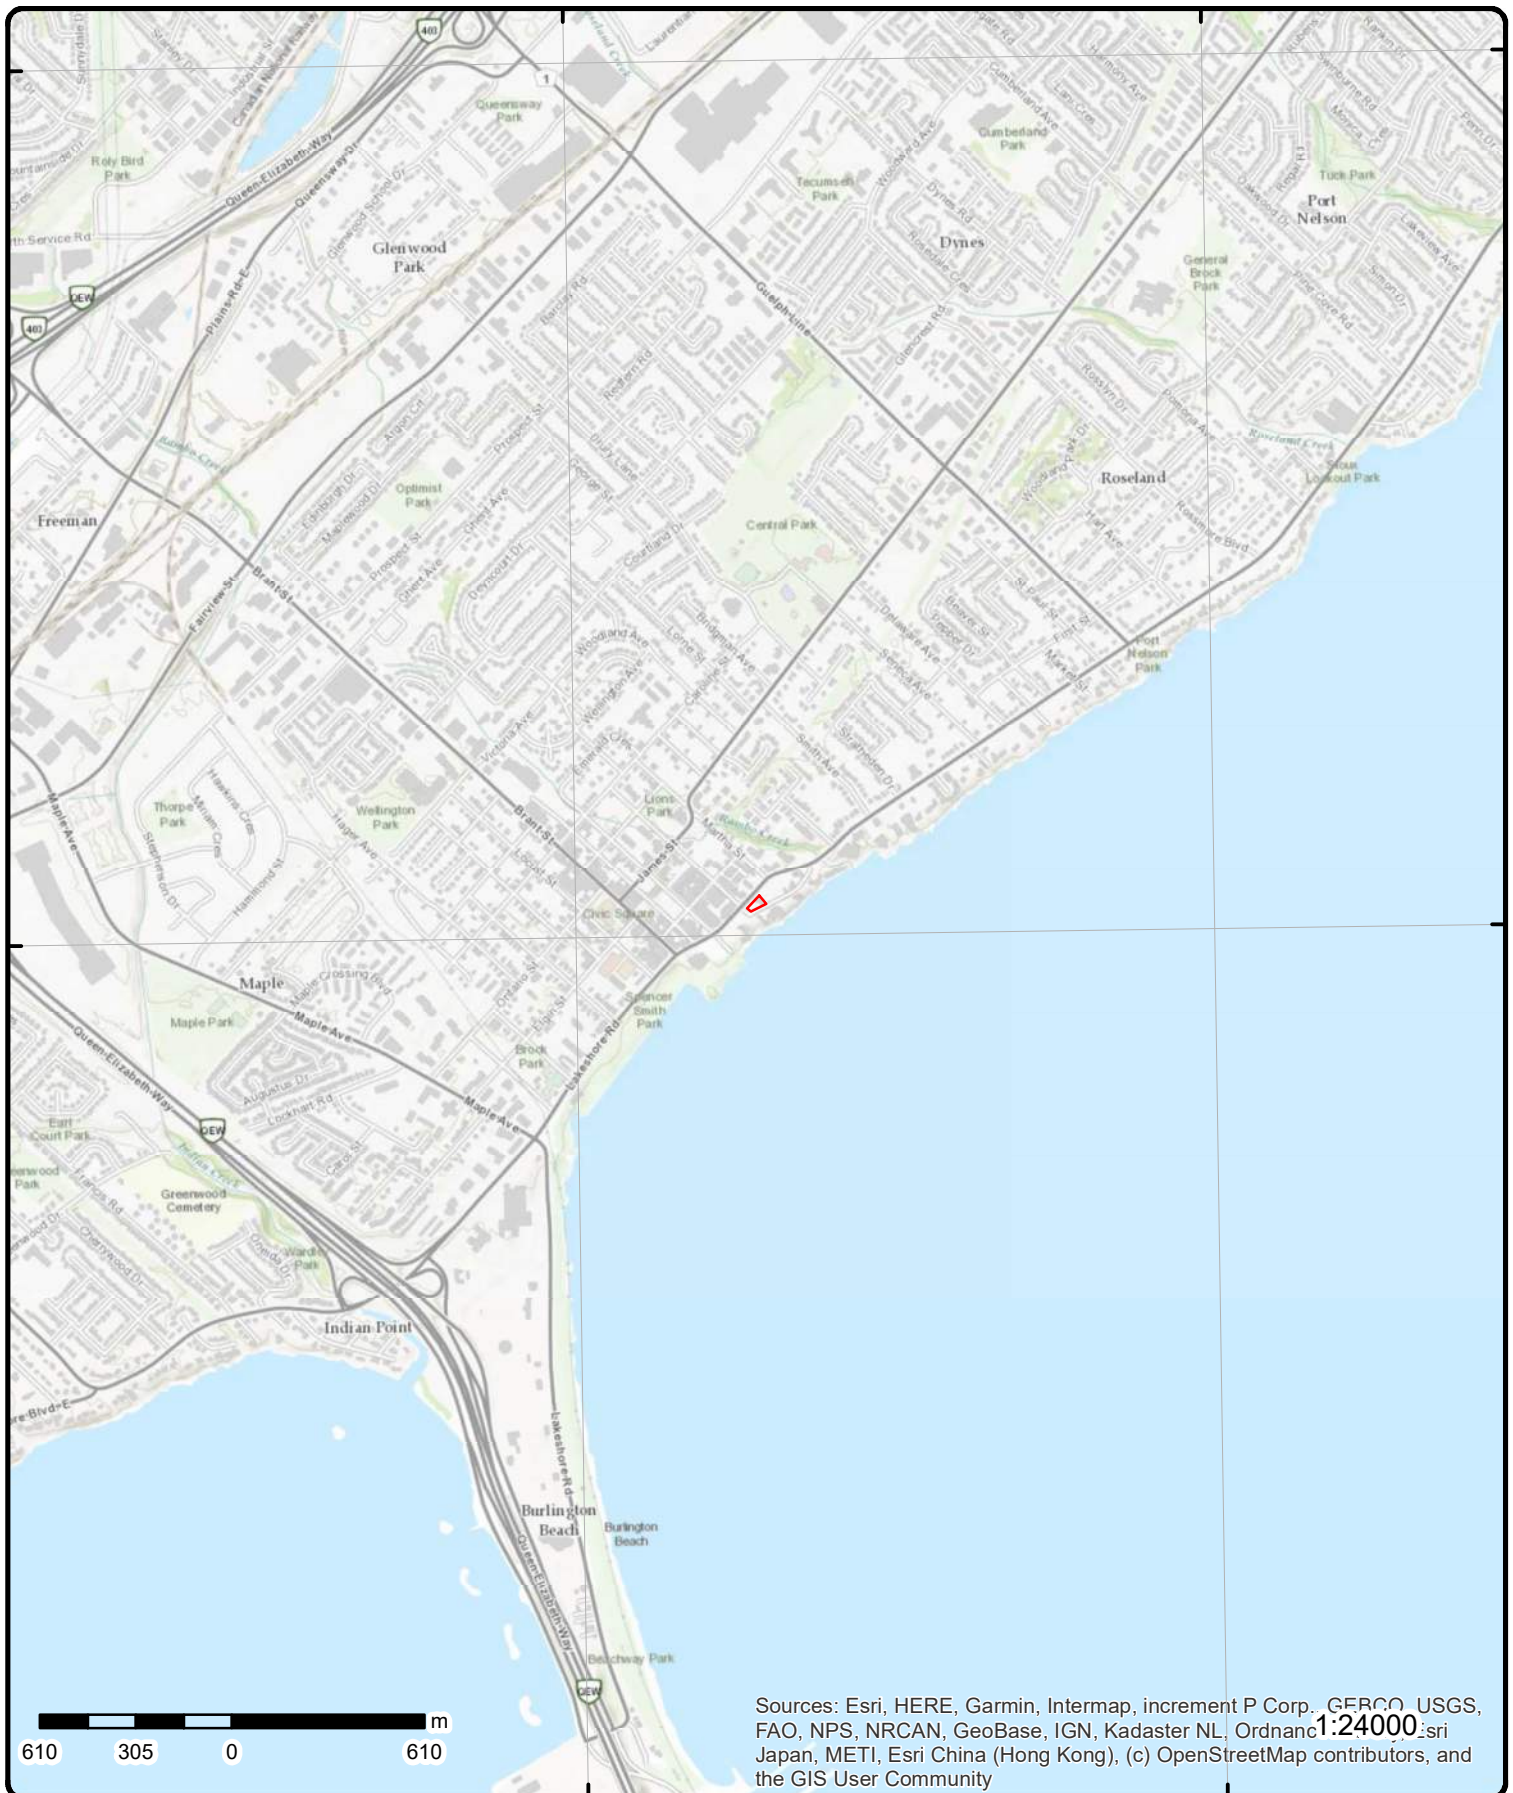

Topographic Map

Address: 2072 Lakeshore Road, ON

Source: ESRI World Topographic Map

Order Number: 23021400831



© ERIS Information Limited Partnership

Detail Report

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
1	1 of 1	W/0.0	81.5 / 0.00	2072 Lakeshore Road Burlington ON	WWIS
Well ID: 7335602 Construction Date: Use 1st: Monitoring and Test Hole Use 2nd: Final Well Status: Monitoring and Test Hole Water Type: Casing Material: Audit No: Z305232 Tag: A262989 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: BURLINGTON CITY Site Info: Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 08-Mar-2019 00:00:00 Selected Flag: TRUE Abandonment Rec: Contractor: 7241 Form Version: 7 Owner: County: HALTON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
PDF URL (Map):					
<u>Additional Detail(s) (Map)</u>					
Well Completed Date: 2019/02/02 Year Completed: 2019 Depth (m): 4.572 Latitude: 43.3258845698931 Longitude: -79.7930553759251 Path:					
<u>Bore Hole Information</u>					
Bore Hole ID: 1007506436 DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: 02-Feb-2019 00:00:00 Remarks: Loc Method Desc: on Water Well Record Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment: Elevation: Elevrc: Zone: 17 East83: 597855.00 North83: 4797712.00 Org CS: UTM83 UTMRC: 4 UTMRC Desc: margin of error : 30 m - 100 m Location Method: wwr					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007836116			
Layer:		2			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		0.4169999957084656			
Formation End Depth:		10.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007836115			
Layer:		1			
Color:		8			
General Color:		BLACK			
Mat1:		27			
Most Common Material:		OTHER			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		0.4169999957084656			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007836117			
Layer:		3			
Color:		7			
General Color:		RED			
Mat1:		17			
Most Common Material:		SHALE			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		10.0			
Formation End Depth:		15.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007836912			
Layer:		1			
Plug From:		0.0			
Plug To:		0.4169999957084656			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug ID: 1007836913					
Layer: 2					
Plug From: 0.4169999957084656					
Plug To: 4.0					
Plug Depth UOM: ft					
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID: 1007836914					
Layer: 3					
Plug From: 4.0					
Plug To: 15.0					
Plug Depth UOM: ft					
<u>Method of Construction & Well Use</u>					
Method Construction ID: 1007837698					
Method Construction Code: D					
Method Construction: Direct Push					
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID: 1007834559					
Casing No: 0					
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID: 1007838298					
Layer: 1					
Material: 5					
Open Hole or Material: PLASTIC					
Depth From: 0.0					
Depth To: 5.0					
Casing Diameter: 2.0					
Casing Diameter UOM: Inch					
Casing Depth UOM: ft					
<u>Construction Record - Screen</u>					
Screen ID: 1007838663					
Layer: 1					
Slot: 10					
Screen Top Depth: 5.0					
Screen End Depth: 15.0					
Screen Material: 5					
Screen Depth UOM: ft					
Screen Diameter UOM: inch					
Screen Diameter: 2.25					
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID: 1007839189					
Pump Set At:					
Static Level:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Final Level After Pumping: Recommended Pump Depth: Pumping Rate: Flowing Rate: Recommended Pump Rate: Levels UOM: ft Rate UOM: GPM Water State After Test Code: Water State After Test: Pumping Test Method: 0 Pumping Duration HR: Pumping Duration MIN: Flowing:					
<u>Hole Diameter</u>					
Hole ID: 1007837492 Diameter: 6.0 Depth From: 0.0 Depth To: 15.0 Hole Depth UOM: ft Hole Diameter UOM: Inch					
<u>Links</u>					
Bore Hole ID: 1007506436 Depth M: 4.572 Year Completed: 2019 Well Completed Dt: 2019/02/02 Audit No: Z305232					
Tag No: A262989 Contractor: 7241 Path: 733\7335602.pdf Latitude: 43.3258845698931 Longitude: -79.7930553759251					
2	1 of 2	ENE/0.0	80.9 / -0.58	2072 Lakeshore Road Burlington ON L7R 1E3	EHS
Order No: 22031000050 Status: C Report Type: Standard Report Report Date: 15-MAR-22 Date Received: 10-MAR-22 Previous Site Name: Lot/Building Size: Additional Info Ordered:					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -79.7927615 Y: 43.3259823					
2	2 of 2	ENE/0.0	80.9 / -0.58	2072 Lakeshore Road Burlington ON L7R 1E3	EHS
Order No: 22031000050 Status: C Report Type: Standard Report Report Date: 15-MAR-22 Date Received: 10-MAR-22 Previous Site Name: Lot/Building Size: Additional Info Ordered:					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -79.7927615 Y: 43.3259823					
3	1 of 1	ENE/0.0	80.9 / -0.58	2072 Lakeshore Road Burlington ON L7R 1E3	EHS
Order No: 20181207031 Nearest Intersection:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Status:	C			Municipality:	
Report Type:	Standard Report			Client Prov/State:	ON
Report Date:	12-DEC-18			Search Radius (km):	.25
Date Received:	07-DEC-18			X:	-79.792761
Previous Site Name:				Y:	43.325982
Lot/Building Size:					
Additional Info Ordered:	Fire Insur. Maps and/or Site Plans				

4	1 of 1	SW/0.0	81.4 / -0.06	2072 lakeshore Road Burlington ON	WWIS

Well ID:	7335604	Flowing (Y/N):	
Construction Date:		Flow Rate:	
Use 1st:	Monitoring and Test Hole	Data Entry Status:	
Use 2nd:		Data Src:	
Final Well Status:	Monitoring and Test Hole	Date Received:	08-Mar-2019 00:00:00
Water Type:		Selected Flag:	TRUE
Casing Material:		Abandonment Rec:	
Audit No:	Z305234	Contractor:	7241
Tag:	A263421	Form Version:	7
Constructn Method:		Owner:	
Elevation (m):		County:	HALTON
Elevatn Reliability:		Lot:	
Depth to Bedrock:		Concession:	
Well Depth:		Concession Name:	
Overburden/Bedrock:		Easting NAD83:	
Pump Rate:		Northing NAD83:	
Static Water Level:		Zone:	
Clear/Cloudy:		UTM Reliability:	
Municipality:	BURLINGTON CITY		
Site Info:			

PDF URL (Map):

Additional Detail(s) (Map)

Well Completed Date:	2019/02/02
Year Completed:	2019
Depth (m):	4.572
Latitude:	43.3257587941298
Longitude:	-79.7930825341679
Path:	

Bore Hole Information

Bore Hole ID:	1007506442	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	597853.00
Code OB Desc:		North83:	4797698.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	02-Feb-2019 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	www
Loc Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007836122			
Layer:		2			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		0.4169999957084656			
Formation End Depth:		10.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007836123			
Layer:		3			
Color:		7			
General Color:		RED			
Mat1:		17			
Most Common Material:		SHALE			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		10.0			
Formation End Depth:		15.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007836121			
Layer:		1			
Color:		8			
General Color:		BLACK			
Mat1:		27			
Most Common Material:		OTHER			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		0.4169999957084656			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007836918			
Layer:		1			
Plug From:		0.0			
Plug To:		0.4169999957084656			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug ID:		1007836919			
Layer:		2			
Plug From:		0.4169999957084656			
Plug To:		4.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007836920			
Layer:		3			
Plug From:		4.0			
Plug To:		15.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007837702			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007834561			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007838303			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		5.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		Inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1007838667			
Layer:		1			
Slot:		10			
Screen Top Depth:		5.0			
Screen End Depth:		15.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.25			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1007839194			
Pump Set At:					
Static Level:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Final Level After Pumping: Recommended Pump Depth: Pumping Rate: Flowing Rate: Recommended Pump Rate: Levels UOM: ft Rate UOM: GPM Water State After Test Code: Water State After Test: Pumping Test Method: 0 Pumping Duration HR: Pumping Duration MIN: Flowing:					
<u>Hole Diameter</u>					
Hole ID: 1007837494 Diameter: 6.0 Depth From: 0.0 Depth To: 15.0 Hole Depth UOM: ft Hole Diameter UOM: Inch					
<u>Links</u>					
Bore Hole ID: 1007506442 Depth M: 4.572 Year Completed: 2019 Well Completed Dt: 2019/02/02 Audit No: Z305234					
Tag No: A263421 Contractor: 7241 Path: 733\7335604.pdf Latitude: 43.3257587941298 Longitude: -79.7930825341679					
5	1 of 1	WSW/0.0	81.8 / 0.33	2072 Lakeshore Road Burlington ON	WWIS
Well ID: 7335603 Construction Date: Use 1st: Monitoring and Test Hole Use 2nd: Final Well Status: Monitoring and Test Hole Water Type: Casing Material: Audit No: Z305233 Tag: A263100 Constructn Method: Elevation (m): Elevatn Reliability: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: BURLINGTON CITY Site Info:					
Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 08-Mar-2019 00:00:00 Selected Flag: TRUE Abandonment Rec: Contractor: 7241 Form Version: 7 Owner: County: HALTON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
PDF URL (Map):					
<u>Additional Detail(s) (Map)</u>					
Well Completed Date: 2019/02/02 Year Completed: 2019 Depth (m): 4.572					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Latitude:		43.3257690980133			
Longitude:		-79.7932056689217			
Path:					
<u>Bore Hole Information</u>					
Bore Hole ID:	1007506439			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	597843.00
Code OB Desc:				North83:	4797699.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	02-Feb-2019 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007836120				
Layer:	3				
Color:	7				
General Color:	RED				
Mat1:	17				
Most Common Material:	SHALE				
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:	10.0				
Formation End Depth:	15.0				
Formation End Depth UOM:	ft				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007836118				
Layer:	1				
Color:	8				
General Color:	BLACK				
Mat1:	27				
Most Common Material:	OTHER				
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:	0.0				
Formation End Depth:	0.4169999957084656				
Formation End Depth UOM:	ft				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007836119				
Layer:	2				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		0.4169999957084656			
Formation End Depth:		10.0			
Formation End Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007836915			
Layer:		1			
Plug From:		0.0			
Plug To:		0.4169999957084656			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007836916			
Layer:		2			
Plug From:		0.4169999957084656			
Plug To:		4.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007836917			
Layer:		3			
Plug From:		4.0			
Plug To:		15.0			
Plug Depth UOM:		ft			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1007837700			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1007834560			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1007838300			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth To:		5.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		Inch			
Casing Depth UOM:		ft			
 <u>Construction Record - Screen</u>					
Screen ID:		1007838665			
Layer:		1			
Slot:		10			
Screen Top Depth:		5.0			
Screen End Depth:		10.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.25			
 <u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1007839191			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:		0			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
 <u>Hole Diameter</u>					
Hole ID:		1007837493			
Diameter:		6.0			
Depth From:		0.0			
Depth To:		15.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		Inch			
 <u>Links</u>					
Bore Hole ID:	1007506439			Tag No:	A263100
Depth M:	4.572			Contractor:	7241
Year Completed:	2019			Path:	733\7335603.pdf
Well Completed Dt:	2019/02/02			Latitude:	43.3257690980133
Audit No:	Z305233			Longitude:	-79.7932056689217
6	1 of 1	E/14.2	79.9 / -1.59	2107 OLD LAKESHORE ROAD BURLINGTON ON	WWIS
Well ID:	2810677			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Not Used			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Observation Wells			Date Received:	17-Oct-2006 00:00:00

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Water Type:			Selected Flag:		TRUE
Casing Material:			Abandonment Rec:		
Audit No:	Z49012			Contractor:	6607
Tag:	A043879			Form Version:	3
Constructn Method:			Owner:		
Elevation (m):			County:		HALTON
Elevatn Reliabilty:			Lot:		
Depth to Bedrock:			Concession:		
Well Depth:			Concession Name:		
Overburden/Bedrock:			Easting NAD83:		
Pump Rate:			Northing NAD83:		
Static Water Level:			Zone:		
Clear/Cloudy:			UTM Reliability:		
Municipality:					
Site Info:					
PDF URL (Map):					https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/281\2810677.pdf
Additional Detail(s) (Map)					
Well Completed Date:			2006/05/25		
Year Completed:			2006		
Depth (m):			6		
Latitude:			43.3259494307181		
Longitude:			-79.7923757263339		
Path:			281\2810677.pdf		
Bore Hole Information					
Bore Hole ID:			11692882		
DP2BR:					
Spatial Status:					
Code OB:					
Code OB Desc:					
Open Hole:					
Cluster Kind:					
Date Completed:			25-May-2006 00:00:00		
Remarks:					
Loc Method Desc:			on Water Well Record		
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
Overburden and Bedrock					
Materials Interval					
Formation ID:			933073980		
Layer:			2		
Color:			7		
General Color:			RED		
Mat1:			17		
Most Common Material:			SHALE		
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:			1.5		
Formation End Depth:			6.0		
Formation End Depth UOM:			m		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		933073979			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		84			
Mat2 Desc:		SILTY			
Mat3:		17			
Mat3 Desc:		SHALE			
Formation Top Depth:		0.0			
Formation End Depth:		1.5			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		933303554			
Layer:		1			
Plug From:		0.0			
Plug To:		2.799999952316284			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		962810677			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		11697748			
Casing No:		1			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		930888228			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		3.0			
Casing Diameter:		1.899999976158142			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		933420790			
Layer:		1			
Slot:		10			
Screen Top Depth:		3.0			
Screen End Depth:		6.0			
Screen Material:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		2.700000047683716			
<u>Water Details</u>					
Water ID:		934071757			
Layer:		1			
Kind Code:		1			
Kind:		FRESH			
Water Found Depth:		4.5			
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		11756655			
Diameter:		1.5			
Depth From:		0.0			
Depth To:		6.0			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Links</u>					
Bore Hole ID:	11692882			Tag No:	A043879
Depth M:	6			Contractor:	6607
Year Completed:	2006			Path:	281\2810677.pdf
Well Completed Dt:	2006/05/25			Latitude:	43.3259494307181
Audit No:	Z49012			Longitude:	-79.7923757263339
7	1 of 1	SSW/14.5	81.1 / -0.31	2048 OLD LAKESHORE ROAD Burlington ON	WWIS
Well ID:		7047892		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:		Monitoring		Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:		Observation Wells		Date Received:	10-Aug-2007 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:		Z67979		Contractor:	7295
Tag:		A059958		Form Version:	4
Constructn Method:				Owner:	
Elevation (m):				County:	HALTON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		BURLINGTON CITY			
Site Info:					
<u>Bore Hole Information</u>					
Bore Hole ID:		23047892		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	
Code OB:				East83:	
Code OB Desc:				North83:	
Open Hole:				Org CS:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Cluster Kind:				UTMRC:	9
Date Completed:	11-Jul-2007 00:00:00			UTMRC Desc:	unknown UTM
Remarks:				Location Method:	na
Loc Method Desc:	Not Applicable i.e. no UTM				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:	1000012485				
Layer:	3				
Color:	7				
General Color:	RED				
Mat1:	17				
Most Common Material:	SHALE				
Mat2:	85				
Mat2 Desc:	SOFT				
Mat3:	91				
Mat3 Desc:	WATER-BEARING				
Formation Top Depth:	1.6799999475479126				
Formation End Depth:	3.3499999046325684				
Formation End Depth UOM:	m				
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:	1000012483				
Layer:	1				
Color:	6				
General Color:	BROWN				
Mat1:	28				
Most Common Material:	SAND				
Mat2:	05				
Mat2 Desc:	CLAY				
Mat3:	77				
Mat3 Desc:	LOOSE				
Formation Top Depth:	0.0				
Formation End Depth:	1.2200000286102295				
Formation End Depth UOM:	m				
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:	1000012484				
Layer:	2				
Color:	2				
General Color:	GREY				
Mat1:	15				
Most Common Material:	LIMESTONE				
Mat2:	28				
Mat2 Desc:	SAND				
Mat3:	73				
Mat3 Desc:	HARD				
Formation Top Depth:	1.2200000286102295				
Formation End Depth:	1.6799999475479126				
Formation End Depth UOM:	m				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1000012487			
Layer:		1			
Plug From:		1.22000000286102295			
Plug To:		0.15000000596046448			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1000012492			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1000012481			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1000012489			
Layer:					
Material:					
Open Hole or Material:					
Depth From:					
Depth To:					
Casing Diameter:					
Casing Diameter UOM:					
Casing Depth UOM:					
<u>Construction Record - Screen</u>					
Screen ID:		1000012490			
Layer:					
Slot:					
Screen Top Depth:					
Screen End Depth:					
Screen Material:					
Screen Depth UOM:					
Screen Diameter UOM:					
Screen Diameter:					
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1000012482			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		m			
Rate UOM:		LPM			
Water State After Test Code:		0			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Water State After Test: Pumping Test Method: Pumping Duration HR: Pumping Duration MIN: Flowing:					
		0			
<u>Water Details</u>					
Water ID:		1000012488			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1000012486			
Diameter:		20.31999969482422			
Depth From:					
Depth To:		3.3499999046325684			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
8	1 of 1	S/21.6	80.2 / -1.25	2076 OLD LAKESHORE RD Burlington ON	WWIS
Well ID:	7202389			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Observation Wells			Date Received:	03-Jun-2013 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z168486			Contractor:	7472
Tag:	A145784			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	HALTON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	BURLINGTON CITY				
Site Info:					
PDF URL (Map):					
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	2013/05/13				
Year Completed:	2013				
Depth (m):	6				
Latitude:	43.3255496525563				
Longitude:	-79.7928893339381				
Path:					
<u>Bore Hole Information</u>					
Bore Hole ID:	1004323988			Elevation:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	597869.00
Code OB Desc:				North83:	4797675.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	13-May-2013 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1004897203			
Layer:		2			
Color:		7			
General Color:		RED			
Mat1:		17			
Most Common Material:		SHALE			
Mat2:					
Mat2 Desc:					
Mat3:		73			
Mat3 Desc:		HARD			
Formation Top Depth:		4.5			
Formation End Depth:		6.0			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1004897202			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		06			
Mat2 Desc:		SILT			
Mat3:		05			
Mat3 Desc:		CLAY			
Formation Top Depth:		0.0			
Formation End Depth:		4.5			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1004897210			
Layer:		1			
Plug From:		0.0			
Plug To:		2.4000000953674316			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug ID:		1004897211			
Layer:		2			
Plug From:		2.4000000953674316			
Plug To:		6.0			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1004897209			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1004897201			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1004897206			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		3.0			
Casing Diameter:		5.199999809265137			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1004897207			
Layer:		1			
Slot:		10			
Screen Top Depth:		3.0			
Screen End Depth:		6.0			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.400000095367432			
<u>Water Details</u>					
Water ID:		1004897205			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1004897204			
Diameter:		21.0			
Depth From:		0.0			
Depth To:		6.0			
Hole Depth UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Hole Diameter UOM:		cm			
<u>Links</u>					
Bore Hole ID:	1004323988			Tag No:	A145784
Depth M:	6			Contractor:	7472
Year Completed:	2013			Path:	720\7202389.pdf
Well Completed Dt:	2013/05/13			Latitude:	43.3255496525563
Audit No:	Z168486			Longitude:	-79.7928893339381
9	1 of 1	ENE/21.9	80.3 / -1.19	2083 Old Lakeshore Road Burlington ON L7R 1E3	EHS
Order No:	22040100416			Nearest Intersection:	
Status:	C			Municipality:	
Report Type:	Standard Report			Client Prov/State:	ON
Report Date:	06-APR-22			Search Radius (km):	.25
Date Received:	01-APR-22			X:	-79.79246217
Previous Site Name:				Y:	43.32614237
Lot/Building Size:					
Additional Info Ordered:	Fire Insur. Maps and/or Site Plans; City Directory; Aerial Photos				
10	1 of 1	SE/23.4	79.9 / -1.53	2076 OLD LAKESHORE RD Burlington ON	WWIS
Well ID:	7202390			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Observation Wells			Date Received:	03-Jun-2013 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z168485			Contractor:	7472
Tag:	A145783			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	HALTON
Elevatn Reliability:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	BURLINGTON CITY				
Site Info:					
PDF URL (Map):					
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	2013/05/13				
Year Completed:	2013				
Depth (m):	9.1				
Latitude:	43.3256191999047				
Longitude:	-79.7926536135504				
Path:					
<u>Bore Hole Information</u>					
Bore Hole ID:	1004323991			Elevation:	
DP2BR:				Elevrc:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Spatial Status:				Zone:	17
Code OB:				East83:	597888.00
Code OB Desc:				North83:	4797683.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:		13-May-2013 00:00:00		UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1004897229			
Layer:		2			
Color:		7			
General Color:		RED			
Mat1:		17			
Most Common Material:		SHALE			
Mat2:					
Mat2 Desc:					
Mat3:		73			
Mat3 Desc:		HARD			
Formation Top Depth:		4.5			
Formation End Depth:		9.100000381469727			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1004897228			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		06			
Mat2 Desc:		SILT			
Mat3:		05			
Mat3 Desc:		CLAY			
Formation Top Depth:		0.0			
Formation End Depth:		4.5			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1004897236			
Layer:		1			
Plug From:		0.0			
Plug To:		5.5			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1004897237			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:		2			
Plug From:		5.5			
Plug To:		9.100000381469727			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1004897235			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1004897227			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1004897232			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		6.099999904632568			
Casing Diameter:		5.199999809265137			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1004897233			
Layer:		1			
Slot:		10			
Screen Top Depth:		6.099999904632568			
Screen End Depth:		9.100000381469727			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.400000095367432			
<u>Water Details</u>					
Water ID:		1004897231			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1004897230			
Diameter:		21.0			
Depth From:		0.0			
Depth To:		9.100000381469727			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Links					
Bore Hole ID:	1004323991			Tag No:	A145783
Depth M:	9.1			Contractor:	7472
Year Completed:	2013			Path:	720\7202390.pdf
Well Completed Dt:	2013/05/13			Latitude:	43.3256191999047
Audit No:	Z168485			Longitude:	-79.7926536135504
11	1 of 1	NNW/26.3	81.9 / 0.43	2065 2079 Lakeshore Road Burlington ON	WWIS
Well ID:	7329173			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Monitoring and Test Hole			Date Received:	26-Feb-2019 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z305693			Contractor:	7247
Tag:	A263860			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	HALTON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	BURLINGTON CITY				
Site Info:					
PDF URL (Map):					
Additional Detail(s) (Map)					
Well Completed Date:	2018/12/18				
Year Completed:	2018				
Depth (m):	9.7536				
Latitude:	43.3262633286941				
Longitude:	-79.7931095458958				
Path:					
Bore Hole Information					
Bore Hole ID:	1007381414			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	597850.00
Code OB Desc:				North83:	4797754.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	18-Dec-2018 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007818181			
Layer:		4			
Color:		7			
General Color:		RED			
Mat1:		17			
Most Common Material:		SHALE			
Mat2:					
Mat2 Desc:					
Mat3:		73			
Mat3 Desc:		HARD			
Formation Top Depth:		12.0			
Formation End Depth:		32.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007818178			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		01			
Most Common Material:		FILL			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		2.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007818179			
Layer:		2			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		06			
Mat2 Desc:		SILT			
Mat3:		11			
Mat3 Desc:		GRAVEL			
Formation Top Depth:		2.0			
Formation End Depth:		5.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007818180			
Layer:		3			
Color:		6			
General Color:		BROWN			
Mat1:		05			
Most Common Material:		CLAY			
Mat2:		06			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Mat2 Desc:		SILT			
Mat3:					
Mat3 Desc:					
Formation Top Depth:		5.0			
Formation End Depth:		12.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007818587			
Layer:		1			
Plug From:		0.0			
Plug To:		20.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007819241			
Method Construction Code:		2			
Method Construction:		Rotary (Convent.)			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007817824			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007819399			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		22.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		Inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1007819555			
Layer:		1			
Slot:		10			
Screen Top Depth:		22.0			
Screen End Depth:		32.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.125			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1007819780			
Pump Set At:					
Static Level:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Final Level After Pumping: Recommended Pump Depth: Pumping Rate: Flowing Rate: Recommended Pump Rate: Levels UOM: ft Rate UOM: GPM Water State After Test Code: Water State After Test: Pumping Test Method: 0 Pumping Duration HR: Pumping Duration MIN: Flowing:					
Hole Diameter					
Hole ID: 1007818920 Diameter: 6.0 Depth From: 0.0 Depth To: 32.0 Hole Depth UOM: ft Hole Diameter UOM: Inch					
Links					
Bore Hole ID: 1007381414 Depth M: 9.7536 Year Completed: 2018 Well Completed Dt: 2018/12/18 Audit No: Z305693					
Tag No: A263860 Contractor: 7247 Path: 732\7329173.pdf Latitude: 43.3262633286941 Longitude: -79.7931095458958					
12	1 of 2	WSW/26.5	82.9 / 1.45	The Corporation of the City of Burlington 2080 LAKESHORE ROAD, BURLINGTON, ONTARIO L7R 1E3 Burlington ON	RSC
RSC ID: 210472 RA No: RSC Type: Phase 1 and 2 RSC Curr Property Use: Parkland Ministry District: Halton-Peel District Office Filing Date: 2013/10/15 Date Ack: Date Returned: Restoration Type: Soil Type: Criteria: CPU Issued Sect 1686: Asmt Roll No: 240206068063000000 Prop ID No (PIN): 07061-0081, 07061-0018 Property Municipal Address: 2080 LAKESHORE ROAD, BURLINGTON, ONTARIO L7R 1E3 Mailing Address: Latitude & Longitude: UTM Coordinates: Consultant: Legal Desc: Measurement Method: Applicable Standards: RSC PDF: https://www.lrcsde.lrc.gov.on.ca/BFISWebPublic/pub/viewDocument.action?attachmentId=26968&fileName=BROWNFIELDSE.pdf					
Cert Date: Cert Prop Use No: Intended Prop Use: Residential Qual Person Name: Melissa King Stratified (Y/N): Audit (Y/N): Entire Leg Prop. (Y/N): Accuracy Estimate: Telephone: Fax: Email:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Document(s) Detail</u>					
Document Heading:		Supporting Documents			
Document Name:		City NDL - Lawyer Letter Sept 2013.pdf			
Document Type:		Lawyer's letter consisting of a legal description of the property			
Document Link:		https://www.lrcsde.lrc.gov.on.ca/BFISWebPublic/pub/viewDocument.action?attachmentId=26972&fileName=City+NDL+-+Lawyer+Letter+Sept+2013.pdf			
Document Heading:		Supporting Documents			
Document Name:		City NDL - APEC Table Revised.pdf			
Document Type:		Area(s) of Potential Environmental Concern			
Document Link:		https://www.lrcsde.lrc.gov.on.ca/BFISWebPublic/pub/viewDocument.action?attachmentId=26970&fileName=City+NDL+-+APEC+Table+Revised.pdf			
Document Heading:		Supporting Documents			
Document Name:		City NDL - Table of Current and Past Uses - Revised 2013-08-01.pdf			
Document Type:		Table of Current and Past Property Use			
Document Link:		https://www.lrcsde.lrc.gov.on.ca/BFISWebPublic/pub/viewDocument.action?attachmentId=26974&fileName=City+NDL+-+Table+of+Current+and+Past+Uses+-+Revised+2013-08-01.pdf			
Document Heading:		Supporting Documents			
Document Name:		CSM - City land 2013-10-04 final.pdf			
Document Type:		Phase 2 Conceptual Site Model			
Document Link:		https://www.lrcsde.lrc.gov.on.ca/BFISWebPublic/pub/viewDocument.action?attachmentId=26971&fileName=CSM+-+City+land+2013-10-04+final.pdf			
Document Heading:		Supporting Documents			
Document Name:		City NDL - Agent Authorization Sept 2013.pdf			
Document Type:		Proof of the owner's authorization			
Document Link:		https://www.lrcsde.lrc.gov.on.ca/BFISWebPublic/pub/viewDocument.action?attachmentId=26967&fileName=City+NDL+-+Agent+Authorization+Sept+2013.pdf			
Document Heading:		Supporting Documents			
Document Name:		City NDL - Deed Documents.pdf			
Document Type:		Copy of any deed(s), transfer(s) or other document(s)			
Document Link:		https://www.lrcsde.lrc.gov.on.ca/BFISWebPublic/pub/viewDocument.action?attachmentId=26965&fileName=City+NDL+-+Deed+Documents.pdf			
Document Heading:		Supporting Documents			
Document Name:		City NDL Survey Plan.pdf			
Document Type:		A Current plan of Survey			
Document Link:		https://www.lrcsde.lrc.gov.on.ca/BFISWebPublic/pub/viewDocument.action?attachmentId=26969&fileName=City+NDL+Survey+Plan.pdf			
<u>12</u>	2 of 2	WSW/26.5	82.9 / 1.45	Mady Burlington Ltd. Bridgewater Development 2042, 2048, 2054, 2058, 2080 Lakeshore Road Parts 1 - 9 of Plan 20R-17007 City of Burlington, Regional Municipality of Halton CITY OF BURLINGTON ON	PTTW
EBR Registry No:	012-2254				
Ministry Ref No:	1137-9LMJBA				
Notice Type:	Instrument Decision				
Notice Stage:					
Notice Date:	September 29, 2014				
Proposal Date:	July 22, 2014				
Year:	2014				
Instrument Type:	(OWRA s. 34) - Permit to Take Water				
Off Instrument Name:					
Posted By:					
Company Name:	Mady Burlington Ltd.				
Site Address:					
Location Other:					
Proponent Name:					
				Decision Posted:	
				Exception Posted:	
				Section:	
				Act 1:	
				Act 2:	
				Site Location Map:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Proponent Address:		8791 Woodbine Avenue , Suite 100, Markham Ontario, Canada L3R0P4			
Comment Period:					
URL:					
Site Location Details:					
Bridgewater Development 2042, 2048, 2054, 2058, 2080 Lakeshore Road Parts 1 - 9 of Plan 20R-17007 City of Burlington, Regional Municipality of Halton CITY OF BURLINGTON					

13

1 of 1

SSW/28.3

81.3 / -0.19

2080 OLD LAKESHORE RD
BURLINGTON ON

WWIS

Well ID:7213159

Construction Date:

Use 1st:Other

Use 2nd:

Final Well Status:Observation Wells

Water Type:

Casing Material:

Audit No:Z141668

Tag:A136427

Constructn Method:

Elevation (m):

Elevatn Reliabilty:

Depth to Bedrock:

Well Depth:

Overburden/Bedrock:

Pump Rate:

Static Water Level:

Clear/Cloudy:

Municipality:BURLINGTON CITY

Site Info:

Flowing (Y/N):

Flow Rate:

Data Entry Status:

Data Src:

Date Received:17-Dec-2013 00:00:00

Selected Flag:TRUE

Abandonment Rec:

Contractor:7484

Form Version:7

Owner:

County:HALTON

Lot:

Concession:

Concession Name:

Easting NAD83:

Northing NAD83:

Zone:

UTM Reliability:

PDF URL (Map):

Additional Detail(s) (Map)

Well Completed Date:2013/09/16

Year Completed:2013

Depth (m):13.716

Latitude:43.3254271302773

Longitude:-79.7932247731404

Path:

Bore Hole Information

Bore Hole ID:1004667992

DP2BR:

Spatial Status:

Code OB:

Code OB Desc:

Open Hole:

Cluster Kind:

Date Completed:16-Sep-2013 00:00:00

Remarks:

Loc Method Desc:on Water Well Record

Elevrc Desc:

Location Source Date:

Improvement Location Source:

Improvement Location Method:

Source Revision Comment:

Elevation:

Elevrc:

Zone:17

East83:597842.00

North83:4797661.00

Org CS:UTM83

UTMRC:4

UTMRC Desc:margin of error : 30 m - 100 m

Location Method:wwr

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1005016380			
Layer:		2			
Color:		7			
General Color:		RED			
Mat1:		17			
Most Common Material:		SHALE			
Mat2:		73			
Mat2 Desc:		HARD			
Mat3:		68			
Mat3 Desc:		DRY			
Formation Top Depth:		9.0			
Formation End Depth:		45.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1005016379			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		85			
Mat3 Desc:		SOFT			
Formation Top Depth:		0.0			
Formation End Depth:		9.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005016388			
Layer:		2			
Plug From:		6.0			
Plug To:		0.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005016387			
Layer:		1			
Plug From:		45.0			
Plug To:		6.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1005016386			
Method Construction Code:		E			
Method Construction:		Auger			
Other Method Construction:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Pipe Information</u>					
Pipe ID:		1005016378			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1005016383			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		35.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1005016384			
Layer:		1			
Slot:		540			
Screen Top Depth:		35.0			
Screen End Depth:		45.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.25			
<u>Water Details</u>					
Water ID:		1005016382			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					
Hole ID:		1005016381			
Diameter:					
Depth From:					
Depth To:					
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
<u>Links</u>					
Bore Hole ID:	1004667992			Tag No:	A136427
Depth M:	13.716			Contractor:	7484
Year Completed:	2013			Path:	721\7213159.pdf
Well Completed Dt:	2013/09/16			Latitude:	43.3254271302773
Audit No:	Z141668			Longitude:	-79.7932247731404
14	1 of 1	SE/35.6	79.8 / -1.62	2042 OLD LAKESHORE RD BURLINGTON ON	WWIS

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Well ID:	7261445			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Abandoned-Other			Date Received:	14-Apr-2016 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	Yes
Audit No:	Z221860			Contractor:	7295
Tag:				Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	HALTON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		BURLINGTON CITY			
Site Info:					
PDF URL (Map):					
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		2016/03/09			
Year Completed:		2016			
Depth (m):					
Latitude:		43.325554489398			
Longitude:		-79.79249455546			
Path:					
<u>Bore Hole Information</u>					
Bore Hole ID:	1005930583			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	597901.00
Code OB Desc:				North83:	4797676.00
Open Hole:				Org CS:	dms83
Cluster Kind:				UTMRC:	5
Date Completed:	09-Mar-2016 00:00:00			UTMRC Desc:	margin of error : 100 m - 300 m
Remarks:				Location Method:	wwr
Loc Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:	1006027504				
Layer:	1				
Plug From:					
Plug To:					
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Method Construction ID: 1006027503					
Method Construction Code: 6					
Method Construction: Boring					
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID: 1006027496					
Casing No: 0					
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID: 1006027500					
Layer: 1					
Material: 5					
Open Hole or Material: PLASTIC					
Depth From:					
Depth To:					
Casing Diameter: 1.7999999523162842					
Casing Diameter UOM: inch					
Casing Depth UOM: ft					
<u>Construction Record - Screen</u>					
Screen ID: 1006027501					
Layer: 1					
Slot:					
Screen Top Depth:					
Screen End Depth:					
Screen Material: 5					
Screen Depth UOM: ft					
Screen Diameter UOM: inch					
Screen Diameter: 2.0					
<u>Water Details</u>					
Water ID: 1006027499					
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM: ft					
<u>Hole Diameter</u>					
Hole ID: 1006027498					
Diameter: 6.0					
Depth From: 0.0					
Depth To: 7.0					
Hole Depth UOM: ft					
Hole Diameter UOM: inch					
<u>Links</u>					
Bore Hole ID:	1005930583			Tag No:	
Depth M:				Contractor:	7295
Year Completed:	2016			Path:	726\7261445.pdf
Well Completed Dt:	2016/03/09			Latitude:	43.325554489398

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Audit No:		Z221860		Longitude:	-79.79249455546
15	1 of 4	WNW/40.5	82.9 / 1.41	2069 Lakeshore Rd Burlington ON L7R1E2	EHS
Order No:		20140121054		Nearest Intersection:	
Status:		C		Municipality:	
Report Type:		Custom Report		Client Prov/State: ON	
Report Date:		30-JAN-14		Search Radius (km): .25	
Date Received:		21-JAN-14		X: -79.792943	
Previous Site Name:				Y: 43.326563	
Lot/Building Size:					
Additional Info Ordered:		Fire Insur. Maps and/or Site Plans; Title Searches; City Directory; Aerial Photos			
15	2 of 4	WNW/40.5	82.9 / 1.41	Lakeshore Professional Arts Limited 2069 Lakeshore Rd. Suite 4 Burlington ON L7R 1E2	GEN
Generator No:		ON5796930			
SIC Code:		621210			
SIC Description:		OFFICES OF DENTISTS			
Approval Years:		2016			
PO Box No:					
Country:		Canada			
Status:					
Co Admin:		Jessica Rathonyi			
Choice of Contact:		CO_OFFICIAL			
Phone No Admin:		905-681-1536 Ext.			
Contaminated Facility:		No			
MHSW Facility:		No			
<u>Detail(s)</u>					
Waste Class:		264			
Waste Class Name:		PHOTOPROCESSING WASTES			
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
15	3 of 4	WNW/40.5	82.9 / 1.41	Lakeshore Professional Arts Limited 2069 Lakeshore Rd. Suite 4 Burlington ON L7R 1E2	GEN
Generator No:		ON5796930			
SIC Code:		621210			
SIC Description:		OFFICES OF DENTISTS			
Approval Years:		2015			
PO Box No:					
Country:		Canada			
Status:					
Co Admin:		Jessica Rathonyi			
Choice of Contact:		CO_OFFICIAL			
Phone No Admin:		905-681-1536 Ext.			
Contaminated Facility:		No			
MHSW Facility:		No			
<u>Detail(s)</u>					
Waste Class:		264			
Waste Class Name:		PHOTOPROCESSING WASTES			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class: Waste Class Name:		312 PATHOLOGICAL WASTES			
15	4 of 4	WNW/40.5	82.9 / 1.41	2069 Lakeshore Rd Burlington ON	EHS
Order No: 20161124017 Status: C Report Type: Standard Report Report Date: 30-NOV-16 Date Received: 24-NOV-16 Previous Site Name: Lot/Building Size: Additional Info Ordered:				Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -79.793443 Y: 43.326278	
16	1 of 2	SE/43.9	79.8 / -1.66	2076 Old Lakeshore Road Burlington ON	EHS
Order No: 20200511042 Status: C Report Type: RSC Report (Urban) Report Date: 14-MAY-20 Date Received: 11-MAY-20 Previous Site Name: Lot/Building Size: Additional Info Ordered:				Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .3 X: -79.79251151 Y: 43.32546493	
16	2 of 2	SE/43.9	79.8 / -1.66	2076 Old Lakeshore Road Burlington ON	EHS
Order No: 20200511042 Status: C Report Type: RSC Report (Urban) Report Date: 14-MAY-20 Date Received: 11-MAY-20 Previous Site Name: Lot/Building Size: Additional Info Ordered:				Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .3 X: -79.79251151 Y: 43.32546493	
17	1 of 2	ESE/43.9	78.3 / -3.12	2084 Old Lakeshore Road Burlington ON L7R	EHS
Order No: 22032500137 Status: C Report Type: Standard Report Report Date: 30-MAR-22 Date Received: 25-MAR-22 Previous Site Name: Lot/Building Size: Additional Info Ordered: Fire Insur. Maps and/or Site Plans; City Directory; Aerial Photos				Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -79.79212 Y: 43.3256456	
17	2 of 2	ESE/43.9	78.3 / -3.12	2084 Old Lakeshore Road Burlington ON L7R	EHS
Order No: 22032500137 Status: C Report Type: Standard Report Report Date: 30-MAR-22				Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Date Received: 25-MAR-22 Previous Site Name: Lot/Building Size: Additional Info Ordered: Fire Insur. Maps and/or Site Plans; City Directory; Aerial Photos					
18	1 of 1	W/44.8	83.8 / 2.36	390 Pearl Street Burlington ON	EHS
Order No: 20110505007 Status: C Report Type: Standard Select Report Report Date: 5/10/2011 Date Received: 5/5/2011 11:00:02 AM Previous Site Name: Lot/Building Size: Approx. 2500 m2 Additional Info Ordered:					
Nearest Intersection: Pearl Street and Pine Street Municipality: Burlington Client Prov/State: ON Search Radius (km): 0.25 X: -79.79382 Y: 43.325912					
19	1 of 1	E/45.0	79.1 / -2.33	2092 Old Lakeshore Road Burlington ON L7R 1A3	EHS
Order No: 20080501010 Status: C Report Type: Complete Report Report Date: 5/9/2008 Date Received: 5/1/2008 Previous Site Name: Lot/Building Size: Additional Info Ordered:					
Nearest Intersection: Old Lakeshore Rd & Lakeshore Rd Municipality: Client Prov/State: AB Search Radius (km): 0.25 X: -79.791971 Y: 43.325819					
20	1 of 1	ENE/45.7	80.2 / -1.24	2096 LAKESHORE RD ON	WWIS
Well ID: 7287810 Construction Date: Use 1st: Monitoring Use 2nd: Final Well Status: Observation Wells Water Type: Casing Material: Audit No: Z237635 Tag: A208282 Constructn Method: Elevation (m): Elevatn Reliability: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: BURLINGTON CITY Site Info: PDF URL (Map): Additional Detail(s) (Map)					
Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 06-Jun-2017 00:00:00 Selected Flag: TRUE Abandonment Rec: Contractor: 7464 Form Version: 7 Owner: County: HALTON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
Well Completed Date: 2016/09/26 Year Completed: 2016 Depth (m): 4.572					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Latitude:		43.3263084918131			
Longitude:		-79.7922699405459			
Path:					
<u>Bore Hole Information</u>					
Bore Hole ID:	1006521979			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	597918.00
Code OB Desc:				North83:	4797760.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	26-Sep-2016 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1006739065				
Layer:	1				
Color:	6				
General Color:	BROWN				
Mat1:	06				
Most Common Material:	SILT				
Mat2:	28				
Mat2 Desc:	SAND				
Mat3:	85				
Mat3 Desc:	SOFT				
Formation Top Depth:	0.0				
Formation End Depth:	7.0				
Formation End Depth UOM:	ft				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1006739066				
Layer:	2				
Color:	7				
General Color:	RED				
Mat1:	17				
Most Common Material:	SHALE				
Mat2:					
Mat2 Desc:					
Mat3:	73				
Mat3 Desc:	HARD				
Formation Top Depth:	7.0				
Formation End Depth:	15.0				
Formation End Depth UOM:	ft				
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:	1006739073				
Layer:	1				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug From:		0.0			
Plug To:		4.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1006739072			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1006739064			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1006739069			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		4.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1006739070			
Layer:		1			
Slot:					
Screen Top Depth:		5.0			
Screen End Depth:		15.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.0			
<u>Water Details</u>					
Water ID:		1006739068			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					
Hole ID:		1006739067			
Diameter:					
Depth From:		0.0			
Depth To:		15.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Links</u>					
Bore Hole ID:	1006521979			Tag No:	A208282
Depth M:	4.572			Contractor:	7464
Year Completed:	2016			Path:	
Well Completed Dt:	2016/09/26			Latitude:	43.3263084918131
Audit No:	Z237635			Longitude:	-79.7922699405459
21	1 of 6	NW/47.5	82.1 / 0.66	Aviva Medical Diagnostics & Specialist Clinic Inc 2079 Lakeshore Rd. Burlington ON	GEN
Generator No:		ON6600220			
SIC Code:		621110			
SIC Description:		Offices of Physicians			
Approval Years:		2012			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
21	2 of 6	NW/47.5	82.1 / 0.66	Aviva Medical Diagnostics & Specialist Clinic Inc 2079 Lakeshore Rd. Burlington ON	GEN
Generator No:		ON6600220			
SIC Code:		621110			
SIC Description:		OFFICES OF PHYSICIANS			
Approval Years:		2013			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
21	3 of 6	NW/47.5	82.1 / 0.66	LMC Clinical Researc Inc. 2079 Lakeshore Road Burlington ON L7R 1E2	GEN
Generator No:		ON5032847			
SIC Code:		621390			
SIC Description:		OFFICES OF ALL OTHER HEALTH PRACTITIONERS			
Approval Years:		2016			
PO Box No:					
Country:		Canada			
Status:					
Co Admin:		Peggy Yeh			
Choice of Contact:		CO_OFFICIAL			
Phone No Admin:		416-797-9165 Ext.			
Contaminated Facility:		No			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
MHSW Facility:		No			
<u>Detail(s)</u>					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
Waste Class:		261			
Waste Class Name:		PHARMACEUTICALS			
<u>21</u>	4 of 6	NW/47.5	82.1 / 0.66	Aviva Medical Diagnostics & Specialist Clinic Inc 2079 Lakeshore Rd. Burlington ON L7R 1E2	GEN
Generator No:		ON6600220			
SIC Code:		621110			
SIC Description:		OFFICES OF PHYSICIANS			
Approval Years:		2016			
PO Box No:					
Country:		Canada			
Status:					
Co Admin:		Michelle Pererra			
Choice of Contact:		CO_ADMIN			
Phone No Admin:		905-920-7662 Ext.			
Contaminated Facility:		No			
MHSW Facility:		No			
<u>Detail(s)</u>					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
<u>21</u>	5 of 6	NW/47.5	82.1 / 0.66	Aviva Medical Diagnostics & Specialist Clinic Inc 2079 Lakeshore Rd. Burlington ON L7R 1E2	GEN
Generator No:		ON6600220			
SIC Code:		621110			
SIC Description:		OFFICES OF PHYSICIANS			
Approval Years:		2015			
PO Box No:					
Country:		Canada			
Status:					
Co Admin:		Lori Dewar			
Choice of Contact:		CO_ADMIN			
Phone No Admin:		905-634-1625 Ext.814			
Contaminated Facility:		No			
MHSW Facility:		No			
<u>Detail(s)</u>					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
<u>21</u>	6 of 6	NW/47.5	82.1 / 0.66	Aviva Medical Diagnostics & Specialist Clinic Inc 2079 Lakeshore Rd. Burlington ON L7R 1E2	GEN
Generator No:		ON6600220			
SIC Code:		621110			
SIC Description:		OFFICES OF PHYSICIANS			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Approval Years: 2014 PO Box No: Country: Canada Status: Co Admin: Melissa Cherepa Choice of Contact: CO_ADMIN Phone No Admin: 905-634-1625 Ext.814 Contaminated Facility: No MHSW Facility: No					
<u>Detail(s)</u>					
Waste Class: 312 Waste Class Name: PATHOLOGICAL WASTES					
22	1 of 2	NW/48.4	82.8 / 1.39	2069 Lakeshore Road Burlington ON L7R 1E2	EHS
Order No: 22040800563 Status: C Report Type: RSC Report (Urban) Report Date: 13-APR-22 Date Received: 08-APR-22 Previous Site Name: Lot/Building Size: Additional Info Ordered:					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .3 X: -79.79346957 Y: 43.32627706					
22	2 of 2	NW/48.4	82.8 / 1.39	2069 Lakeshore Road Burlington ON L7R 1E2	EHS
Order No: 22040800563 Status: C Report Type: RSC Report (Urban) Report Date: 13-APR-22 Date Received: 08-APR-22 Previous Site Name: Lot/Building Size: Additional Info Ordered:					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .3 X: -79.79346957 Y: 43.32627706					
23	1 of 1	S/49.0	79.5 / -1.99	2042 LAKESHORE ROAD Burlington ON	WWIS
Well ID: 7253016 Construction Date: Use 1st: Test Hole Use 2nd: Final Well Status: Test Hole Water Type: Casing Material: Audit No: Z196169 Tag: A170779 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: BURLINGTON CITY					
Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 26-Nov-2015 00:00:00 Selected Flag: TRUE Abandonment Rec: Contractor: 2123 Form Version: 7 Owner: County: HALTON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/725\7253016.pdf				
Additional Detail(s) (Map)					
Well Completed Date:	2015/10/15				
Year Completed:	2015				
Depth (m):	21.6408				
Latitude:	43.3252447363782				
Longitude:	-79.7930063762727				
Path:	725\7253016.pdf				
Bore Hole Information					
Bore Hole ID:	1005817084		Elevation:		
DP2BR:			Elevrc:		
Spatial Status:			Zone:		
Code OB:			East83:		
Code OB Desc:			North83:		
Open Hole:			Org CS:		
Cluster Kind:			UTMRC:		
Date Completed:	15-Oct-2015 00:00:00		UTMRC Desc:		
Remarks:			Location Method:		
Loc Method Desc:	on Water Well Record		wwr		
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
Overburden and Bedrock					
Materials Interval					
Formation ID:	1005854288				
Layer:	2				
Color:	7				
General Color:	RED				
Mat1:	17				
Most Common Material:	SHALE				
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:	22.0				
Formation End Depth:	41.0				
Formation End Depth UOM:	ft				
Overburden and Bedrock					
Materials Interval					
Formation ID:	1005854291				
Layer:	5				
Color:	7				
General Color:	RED				
Mat1:	17				
Most Common Material:	SHALE				
Mat2:					
Mat2 Desc:					
Mat3:	74				
Mat3 Desc:	LAYERED				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation Top Depth:		48.0			
Formation End Depth:		71.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1005854290			
Layer:		4			
Color:		7			
General Color:		RED			
Mat1:		17			
Most Common Material:		SHALE			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		43.0			
Formation End Depth:		48.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1005854289			
Layer:		3			
Color:		2			
General Color:		GREY			
Mat1:		17			
Most Common Material:		SHALE			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		41.0			
Formation End Depth:		43.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1005854287			
Layer:		1			
Color:		7			
General Color:		RED			
Mat1:		17			
Most Common Material:		SHALE			
Mat2:		05			
Mat2 Desc:		CLAY			
Mat3:					
Mat3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		22.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005854325			
Layer:		1			
Plug From:		0.0			
Plug To:		22.0			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1005854324			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1005854285			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1005854295			
Layer:		1			
Material:		1			
Open Hole or Material:		STEEL			
Depth From:		0.0			
Depth To:		26.0			
Casing Diameter:		6.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1005854296			
Layer:					
Slot:					
Screen Top Depth:					
Screen End Depth:					
Screen Material:					
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:					
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1005854286			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:		0			
Water State After Test:					
Pumping Test Method:		0			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1005854301			
Test Type:		Draw Down			
Test Duration:		3			
Test Level:		9.300000190734863			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1005854306			
Test Type:		Recovery			
Test Duration:		5			
Test Level:		18.149999618530273			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1005854312			
Test Type:		Recovery			
Test Duration:		20			
Test Level:		17.809999465942383			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1005854319			
Test Type:		Draw Down			
Test Duration:		50			
Test Level:		12.4399995803833			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1005854321			
Test Type:		Draw Down			
Test Duration:		60			
Test Level:		13.069999694824219			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1005854322			
Test Type:		Recovery			
Test Duration:		60			
Test Level:		14.75			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1005854297			
Test Type:		Draw Down			
Test Duration:		1			
Test Level:		8.539999961853027			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1005854303			
Test Type:		Draw Down			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Test Duration:		4			
Test Level:		9.40999984741211			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1005854299			
Test Type:		Draw Down			
Test Duration:		2			
Test Level:		9.109999656677246			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1005854311			
Test Type:		Draw Down			
Test Duration:		20			
Test Level:		9.949999809265137			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1005854318			
Test Type:		Recovery			
Test Duration:		40			
Test Level:		9.75			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1005854304			
Test Type:		Recovery			
Test Duration:		4			
Test Level:		18.209999084472656			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1005854309			
Test Type:		Draw Down			
Test Duration:		15			
Test Level:		9.699999809265137			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1005854317			
Test Type:		Draw Down			
Test Duration:		40			
Test Level:		11.760000228881836			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1005854298			
Test Type:		Recovery			
Test Duration:		1			
Test Level:		18.440000534057617			
Test Level UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1005854305			
Test Type:		Draw Down			
Test Duration:		5			
Test Level:		9.5600004196167			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1005854310			
Test Type:		Recovery			
Test Duration:		15			
Test Level:		17.950000762939453			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1005854320			
Test Type:		Recovery			
Test Duration:		50			
Test Level:		15.289999961853027			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1005854314			
Test Type:		Recovery			
Test Duration:		25			
Test Level:		17.18000030517578			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1005854300			
Test Type:		Recovery			
Test Duration:		2			
Test Level:		18.34000015258789			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1005854302			
Test Type:		Recovery			
Test Duration:		3			
Test Level:		18.270000457763672			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1005854307			
Test Type:		Draw Down			
Test Duration:		10			
Test Level:		9.619999885559082			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1005854313			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Test Type:		Draw Down			
Test Duration:		25			
Test Level:		10.199999809265137			
Test Level UOM:		ft			
 <u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1005854315			
Test Type:		Draw Down			
Test Duration:		30			
Test Level:		11.020000457763672			
Test Level UOM:		ft			
 <u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1005854316			
Test Type:		Recovery			
Test Duration:		30			
Test Level:		16.579999923706055			
Test Level UOM:		ft			
 <u>Draw Down & Recovery</u>					
Pump Test Detail ID:		1005854308			
Test Type:		Recovery			
Test Duration:		10			
Test Level:		18.06999969482422			
Test Level UOM:		ft			
 <u>Water Details</u>					
Water ID:		1005854294			
Layer:		1			
Kind Code:		8			
Kind:		Untested			
Water Found Depth:		35.0			
Water Found Depth UOM:		ft			
 <u>Hole Diameter</u>					
Hole ID:		1005854292			
Diameter:		10.0			
Depth From:		0.0			
Depth To:		26.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
 <u>Hole Diameter</u>					
Hole ID:		1005854293			
Diameter:		6.0			
Depth From:		26.0			
Depth To:		71.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
 <u>Links</u>					
Bore Hole ID:	1005817084		Tag No:	A170779	
Depth M:	21.6408		Contractor:	2123	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Year Completed:	2015			Path:	725\7253016.pdf
Well Completed Dt:	2015/10/15			Latitude:	43.3252447363782
Audit No:	Z196169			Longitude:	-79.7930063762727

24	1 of 1	SSW/50.9	80.3 / -1.15	Bridgewater Lakeshore Developer Inc. 2058 LAKESHORE ROAD, BURLINGTON, ONTARIO L7R 1A3 Burlington ON	RSC
RSC ID:	209751			Cert Date:	
RA No:				Cert Prop Use No:	
RSC Type:	Phase 1 and 2 RSC			Intended Prop Use:	Residential
Curr Property Use:	Commercial			Qual Person Name:	Melissa King
Ministry District:	Halton-Peel District Office			Stratified (Y/N):	
Filing Date:	2013/08/23			Audit (Y/N):	
Date Ack:				Entire Leg Prop. (Y/N):	
Date Returned:				Accuracy Estimate:	
Restoration Type:				Telephone:	
Soil Type:				Fax:	
Criteria:				Email:	
CPU Issued Sect 1686:					
Asmt Roll No:	2402-060-608-06200-0000, 2402-060-608-06400-0000, 2402-060-608-06500-0000				
Prop ID No (PIN):	07061-0091 (LT)				
Property Municipal Address:	2042 LAKESHORE ROAD, BURLINGTON, ONTARIO L7R 1A3, 2048 LAKESHORE ROAD, BURLINGTON, ONTARIO L7R 1A3, 2054 LAKESHORE ROAD, BURLINGTON, ONTARIO L7R 1A3, 2058 LAKESHORE ROAD, BURLINGTON, ONTARIO L7R 1A3				
Mailing Address:					
Latitude & Latitude:					
UTM Coordinates:					
Consultant:					
Legal Desc:					
Measurement Method:					
Applicable Standards:					
RSC PDF:	https://www.lrcsde.lrc.gov.on.ca/BFISWebPublic/pub/viewDocument.action? attachmentId=25035&fileName=BROWNFIELDS-E-FILE.pdf				
<u>Document(s) Detail</u>					
Document Heading:	Supporting Documents				
Document Name:	ON505488 cert.PDF				
Document Type:	Certificate of Status				
Document Link:	https://www.lrcsde.lrc.gov.on.ca/BFISWebPublic/pub/viewDocument.action? attachmentId=25036&fileName=ON505488+cert.PDF				
Document Heading:	Supporting Documents				
Document Name:	T9 NDL deed-transfer docs revised.pdf				
Document Type:	Copy of any deed(s), transfer(s) or other document(s)				
Document Link:	https://www.lrcsde.lrc.gov.on.ca/BFISWebPublic/pub/viewDocument.action? attachmentId=25040&fileName=T9+NDL+deed-transfer+docs+revised.pdf				
Document Heading:	Supporting Documents				
Document Name:	No Objection Statement.pdf				
Document Type:	A copy of No Objection Statement from municipality				
Document Link:	https://www.lrcsde.lrc.gov.on.ca/BFISWebPublic/pub/viewDocument.action? attachmentId=25037&fileName=No+Objection+Statement.pdf				
Document Heading:	Supporting Documents				
Document Name:	TABLE OF CURRENT AND PAST USES T9 NDL-revised Aug 2013.pdf				
Document Type:	Table of Current and Past Property Use				
Document Link:	https://www.lrcsde.lrc.gov.on.ca/BFISWebPublic/pub/viewDocument.action? attachmentId=25032&fileName=TABLE+OF+CURRENT+AND+PAST+USES+T9+NDL-revised+Aug+2013.pdf				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Document Heading:		Supporting Documents			
Document Name:		Phase Two ESA CSM -T9 NDL revised August 14.pdf			
Document Type:		Phase 2 Conceptual Site Model			
Document Link:		https://www.lrcsde.lrc.gov.on.ca/BFISWebPublic/pub/viewDocument.action?attachmentId=25034&fileName=Phase+Two+ESA+CSM+-T9+NDL+revised+August+14.pdf			
Document Heading:		Supporting Documents			
Document Name:		Area_s_ of Potential Environmental Concern T9 NDL - 2.pdf			
Document Type:		Area(s) of Potential Environmental Concern			
Document Link:		https://www.lrcsde.lrc.gov.on.ca/BFISWebPublic/pub/viewDocument.action?attachmentId=25039&fileName=Area_s_+of+Potential+Environmental+Concern+T9+NDL+-+2.pdf			
Document Heading:		Supporting Documents			
Document Name:		agent authorization-T9 NDL revised.pdf			
Document Type:		Proof of the owner's authorization			
Document Link:		https://www.lrcsde.lrc.gov.on.ca/BFISWebPublic/pub/viewDocument.action?attachmentId=25033&fileName=agent+authorization-T9+NDL+revised.pdf			
Document Heading:		Supporting Documents			
Document Name:		T9 NDL Survey Plan.pdf			
Document Type:		A Current plan of Survey			
Document Link:		https://www.lrcsde.lrc.gov.on.ca/BFISWebPublic/pub/viewDocument.action?attachmentId=25030&fileName=T9+NDL+Survey+Plan.pdf			
Document Heading:		Supporting Documents			
Document Name:		Lawyer Letter T9 NDL.pdf			
Document Type:		Lawyer's letter consisting of a legal description of the property			
Document Link:		https://www.lrcsde.lrc.gov.on.ca/BFISWebPublic/pub/viewDocument.action?attachmentId=25031&fileName=Lawyer+Letter+T9+NDL.pdf			

25

1 of 1

N/51.9

80.9 / -0.59

374 MARTHA ST
Burlington ON

WWIS

Well ID:

7244963

Construction Date:

Use 1st:

Monitoring

Use 2nd:

Final Well Status:

Observation Wells

Water Type:

Casing Material:

Audit No:

Z204800

Tag:

A179597

Constructn Method:

Elevation (m):

Elevatn Reliabilty:

Depth to Bedrock:

Well Depth:

Overburden/Bedrock:

Pump Rate:

Static Water Level:

Clear/Cloudy:

Municipality:

BURLINGTON CITY

Site Info:

Flowing (Y/N):

Flow Rate:

Data Entry Status:

Data Src:

Date Received:

21-Jul-2015 00:00:00

Selected Flag:

TRUE

Abandonment Rec:

Contractor:

7295

Form Version:

7

Owner:

County:

HALTON

Lot:

Concession:

Concession Name:

Easting NAD83:

Northing NAD83:

Zone:

UTM Reliability:

PDF URL (Map):

Additional Detail(s) (Map)

Well Completed Date:

2015/06/05

Year Completed:

2015

Depth (m):

7.62

Latitude:

43.326611045041

Longitude:

-79.7927819756332

Path:

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Bore Hole Information</u>					
Bore Hole ID:	1005492669			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	597876.00
Code OB Desc:				North83:	4797793.00
Open Hole:				Org CS:	dms83
Cluster Kind:				UTMRC:	4
Date Completed:	05-Jun-2015 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1005608856				
Layer:	2				
Color:	2				
General Color:	GREY				
Mat1:	05				
Most Common Material:	CLAY				
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:	6.0				
Formation End Depth:	12.0				
Formation End Depth UOM:	ft				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1005608857				
Layer:	3				
Color:	7				
General Color:	RED				
Mat1:	17				
Most Common Material:	SHALE				
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:	12.0				
Formation End Depth:	25.0				
Formation End Depth UOM:	ft				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1005608855				
Layer:	1				
Color:	2				
General Color:	GREY				
Mat1:	05				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Most Common Material:		CLAY			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		6.0			
Formation End Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005608864			
Layer:		1			
Plug From:		0.0			
Plug To:		14.0			
Plug Depth UOM:		ft			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1005608863			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1005608854			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1005608860			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		15.0			
Casing Diameter:		1.7999999523162842			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
 <u>Construction Record - Screen</u>					
Screen ID:		1005608861			
Layer:		1			
Slot:		10			
Screen Top Depth:		15.0			
Screen End Depth:		25.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.0			
 <u>Water Details</u>					
Water ID:		1005608859			
Layer:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Kind Code: Kind: Water Found Depth: Water Found Depth UOM:ft Hole Diameter Hole ID:1005608858 Diameter: Depth From: Depth To: Hole Depth UOM:ft Hole Diameter UOM:inch Links Bore Hole ID:1005492669 Depth M:7.62 Year Completed:2015 Well Completed Dt:2015/06/05 Audit No:Z204800 Tag No:A179597 Contractor:7295 Path:724\7244963.pdf Latitude:43.326611045041 Longitude:-79.7927819756332					
26	1 of 1	NNW/52.2	81.4 / -0.01	173716 Ont Inc 374 Martha St Burlington ON L7R 2P7	GEN
Generator No:ON7488787 SIC Code: SIC Description: Approval Years:As of Nov 2021 PO Box No: Country:Canada Status:Registered Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility: Detail(s) Waste Class:146 L Waste Class Name:Other specified inorganic sludges, slurries or solids					
27	1 of 1	ENE/52.2	79.9 / -1.59	Wilderness Group<UNOFFICIAL> APPROXIMATELY 2093 LAKESHORE BLVE, BURLINGTON<UNOFFICIAL> Burlington ON	SPL
Ref No:1200-6PRR2L Site No: Incident Dt:5/13/2006 Year: Incident Cause:Pipe Or Hose Leak Incident Event: Contaminant Code:15 Contaminant Name:HYDRAULIC OIL Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Environment Impact:Possible Nature of Impact:Soil Contamination Discharger Report: Material Group:Oils Health/Env Conseq: Client Type: Sector Type:Other Agency Involved: Nearest Watercourse: Site Address: Site District Office:Halton-Peel Site Postal Code: Site Region: Site Municipality:Burlington Site Lot:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Receiving Medium: Receiving Env: MOE Response: Dt MOE Arvl on Scn: MOE Reported Dt: Dt Document Closed: Incident Reason: Site Name: Site County/District: Site Geo Ref Meth: Incident Summary: Contaminant Qty:	Land 5/13/2006 Wilderness Group: ~20 L hydraulic oil to pavement & grass 20 L			Site Conc: Northing: Easting: Site Geo Ref Accu: Site Map Datum: SAC Action Class: Source Type:	
28	1 of 1	WSW/55.5	82.9 / 1.40	2042-2058 LAKESHORE ROAD BURLINGTON ON L7R 1A3	EHS
Order No: Status: Report Type: Report Date: Date Received: Previous Site Name: Lot/Building Size: Additional Info Ordered:	20090316007 C Custom Report 3/24/2009 3/16/2009 			Nearest Intersection: Municipality: Client Prov/State: Search Radius (km): X: Y:	ON 0.25 -79.793407 43.325249
29	1 of 1	NE/56.2	80.3 / -1.13	2096 Lakeshore Rd Burlington ON L7R1E3	EHS
Order No: Status: Report Type: Report Date: Date Received: Previous Site Name: Lot/Building Size: Additional Info Ordered:	20160830095 C Standard Report 07-SEP-16 30-AUG-16 			Nearest Intersection: Municipality: Client Prov/State: Search Radius (km): X: Y:	ON .25 -79.792275 43.326462
30	1 of 1	NNW/57.3	81.9 / 0.48	ON	BORE
Borehole ID: OGF ID: Status: Type: Use: Completion Date: Static Water Level: Primary Water Use: Sec. Water Use: Total Depth m: Depth Ref: Depth Elev: Drill Method: Orig Ground Elev m: Elev Reliabil Note: DEM Ground Elev m: Concession: Location D: Survey D: Comments:	624599 215525051 Borehole Geotechnical/Geological Investigation AUG-1935 Not Used 3.3 Ground Surface Power auger 82.3 82.1 			Inclin FLG: SP Status: Surv Elev: Piezometer: Primary Name: Municipality: Lot: Township: Latitude DD: Longitude DD: UTM Zone: Easting: Northing: Location Accuracy: Accuracy:	No Initial Entry No No 43.326523 -79.793295 17 597835 4797783 Not Applicable

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:	218434542			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	2.7			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Unknown			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	Quaternary
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	UNSPECIFIED. AGE QUATERNARY.				
Geology Stratum ID:	218434543			Mat Consistency:	Stiff
Top Depth:	2.7			Material Moisture:	
Bottom Depth:	3.3			Material Texture:	
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Till			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Sand			Geologic Period:	
Material 4:	Clay			Depositional Gen:	glacial
Gsc Material Description:					
Stratum Description:	TILL,SILT,SAND,CLAY.BROWN,GLACIAL,STIFF, AGE GLACIAL. 00090015 **Note: Many records provided by the department have a truncated [Stratum Description] field.				
<u>Source</u>					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada			Source Iden:	1
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:	M			Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Details:	File: HAM.txt RecordID: 036000 NTS_Sheet: 30M05C				
Confiden 1:	Reliable information but incomplete.				
<u>Source List</u>					
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Originators:	Geological Survey of Canada				
31	1 of 3	SW/60.1	82.1 / 0.68	2042 Lakeshore Holdings Ltd. 2048 Lakeshore Road Burlington ON	GEN
Generator No:	ON2853854				
SIC Code:	531390				
SIC Description:	Other Activities Related to Real Estate				
Approval Years:	2012				
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
31	2 of 3	SW/60.1	82.1 / 0.68	Bridgewater Lakeshore Developer Inc. 2048 LAKESHORE ROAD, BURLINGTON, ONTARIO L7R 1A3 Burlington ON	RSC
RSC ID:		209314	Cert Date:		
RA No:			Cert Prop Use No:		
RSC Type:		Phase 1 and 2 RSC	Intended Prop Use: Parkland		
Curr Property Use:		Commercial	Qual Person Name: Melissa King		
Ministry District:		Halton-Peel District Office	Stratified (Y/N):		
Filing Date:		2013/08/08	Audit (Y/N):		
Date Ack:			Entire Leg Prop. (Y/N):		
Date Returned:			Accuracy Estimate:		
Restoration Type:			Telephone:		
Soil Type:			Fax:		
Criteria:			Email:		
CPU Issued Sect 1686:					
Asmt Roll No:		2402-060-608-06200-0000, 2402-060-608-06400-0000, 2402-060-608-06500-0000			
Prop ID No (PIN):		07061-0091 (LT)			
Property Municipal Address:		2058 LAKESHORE ROAD, BURLINGTON, ONTARIO L7R 1A3, 2054 LAKESHORE ROAD, BURLINGTON, ONTARIO L7R 1A3, 2048 LAKESHORE ROAD, BURLINGTON, ONTARIO L7R 1A3, 2042 LAKESHORE ROAD, BURLINGTON, ONTARIO L7R 1A3			
Mailing Address:					
Latitude & Latitude:					
UTM Coordinates:					
Consultant:					
Legal Desc:					
Measurement Method:					
Applicable Standards:					
RSC PDF:		https://www.lrcsde.lrc.gov.on.ca/BFISWebPublic/pub/viewDocument.action?attachmentId=23563&fileName=BROWNFIELDS-E-FILE.pdf			
<u>Document(s) Detail</u>					
Document Heading:		Supporting Documents			
Document Name:		Lawyer Letter SPA.pdf			
Document Type:		Lawyer's letter consisting of a legal description of the property			
Document Link:		https://www.lrcsde.lrc.gov.on.ca/BFISWebPublic/pub/viewDocument.action?attachmentId=23561&fileName=Lawyer+Letter+SPA.pdf			
Document Heading:		Supporting Documents			
Document Name:		TABLE OF CURRENT AND PAST USES-revised June 2013 SPA.pdf			
Document Type:		Table of Current and Past Property Use			
Document Link:		https://www.lrcsde.lrc.gov.on.ca/BFISWebPublic/pub/viewDocument.action?attachmentId=23559&fileName=TABLE+OF+CURRENT+AND+PAST+USES-revised+June+2013+SPA.pdf			
Document Heading:		Supporting Documents			
Document Name:		Areas of Potential Environmental Concern.pdf			
Document Type:		Area(s) of Potential Environmental Concern			
Document Link:		https://www.lrcsde.lrc.gov.on.ca/BFISWebPublic/pub/viewDocument.action?attachmentId=23564&fileName=Areas+of+Potential+Environmental+Concern.pdf			
Document Heading:		Supporting Documents			
Document Name:		ON505488 cert.PDF			
Document Type:		Certificate of Status			
Document Link:		https://www.lrcsde.lrc.gov.on.ca/BFISWebPublic/pub/viewDocument.action?attachmentId=23557&fileName=ON505488+cert.PDF			
Document Heading:		Supporting Documents			
Document Name:		CSM-Revised SPA.pdf			
Document Type:		Phase 2 Conceptual Site Model			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Document Link:		https://www.lrcsde.lrc.gov.on.ca/BFISWebPublic/pub/viewDocument.action?attachmentId=23560&fileName=CSM-Revised+SPA.pdf			
Document Heading:		Supporting Documents			
Document Name:		Agent Authorization SPA.pdf			
Document Type:		Proof of the owner's authorization			
Document Link:		https://www.lrcsde.lrc.gov.on.ca/BFISWebPublic/pub/viewDocument.action?attachmentId=23562&fileName=Agent+Authorization+SPA.pdf			
Document Heading:		Supporting Documents			
Document Name:		PINs-deed-transfer docs revised.pdf			
Document Type:		Copy of any deed(s), transfer(s) or other document(s)			
Document Link:		https://www.lrcsde.lrc.gov.on.ca/BFISWebPublic/pub/viewDocument.action?attachmentId=23567&fileName=PINs-deed-transfer+docs+revised.pdf			
Document Heading:		Supporting Documents			
Document Name:		T9 SPA Survey Plan.pdf			
Document Type:		A Current plan of Survey			
Document Link:		https://www.lrcsde.lrc.gov.on.ca/BFISWebPublic/pub/viewDocument.action?attachmentId=23566&fileName=T9+SPA+Survey+Plan.pdf			

31

3 of 3

SW/60.1

82.1 / 0.68

Bridgewater Lakeshore Developer Inc.

2048 LAKESHORE ROAD, BURLINGTON,

ONTARIO L7R 1A3

Burlington ON

RSC

RSC ID:

210368

RA No:

RSC Type:

Phase 1 and 2 RSC

Curr Property Use:

Commercial

Ministry District:

Halton-Peel District Office

Filing Date:

2013/10/16

Date Ack:

Date Returned:

Restoration Type:

Soil Type:

Criteria:

CPU Issued Sect 1686:

Asmt Roll No:

2402-060-608-06200-0000,

2402-060-608-06500-0000,

2402-060-608-06400-0000

Prop ID No (PIN):

Part of PIN 07061-0091

Property Municipal Address:

2054 LAKESHORE ROAD, BURLINGTON, ONTARIO L7R 1A3, 2048 LAKESHORE ROAD, BURLINGTON,

ONTARIO L7R 1A3, 2042 LAKESHORE ROAD, BURLINGTON, ONTARIO L7R 1A3, 2058 LAKESHORE ROAD,

BURLINGTON, ONTARIO L7R 1A3

Mailing Address:

Latitude & Latitude:

UTM Coordinates:

Consultant:

Legal Desc:

Measurement Method:

Applicable Standards:

RSC PDF:

https://www.lrcsde.lrc.gov.on.ca/BFISWebPublic/pub/viewDocument.action?

attachmentId=26730&fileName=BROWNFIELDS-E.pdf

Document(s) Detail

Document Heading:

Supporting Documents

Document Name:

ON740108.PDF

Document Type:

Certificate of Status

Document Link:

https://www.lrcsde.lrc.gov.on.ca/BFISWebPublic/pub/viewDocument.action?attachmentId=26734&fileName=ON740108.PDF

Document Heading:

Supporting Documents

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Document Name:		NDL Deed-Transfer Docs Revised.pdf			
Document Type:		Copy of any deed(s), transfer(s) or other document(s)			
Document Link:		https://www.lrcsde.lrc.gov.on.ca/BFISWebPublic/pub/viewDocument.action?attachmentId=26731&fileName=NDL+Deed-Transfer+Docs+Revised.pdf			
Document Heading:		Supporting Documents			
Document Name:		NDL Survey Plan.pdf			
Document Type:		A Current plan of Survey			
Document Link:		https://www.lrcsde.lrc.gov.on.ca/BFISWebPublic/pub/viewDocument.action?attachmentId=26728&fileName=NDL+Survey+Plan.pdf			
Document Heading:		Supporting Documents			
Document Name:		Agent Authoriation - Final NDL.pdf			
Document Type:		Proof of the owner's authorization			
Document Link:		https://www.lrcsde.lrc.gov.on.ca/BFISWebPublic/pub/viewDocument.action?attachmentId=26727&fileName=Agent+Authoriation+-+Final+NDL.pdf			
Document Heading:		Supporting Documents			
Document Name:		Areas of Potential Environmental Concern - NDL 2013-07-30.pdf			
Document Type:		Area(s) of Potential Environmental Concern			
Document Link:		https://www.lrcsde.lrc.gov.on.ca/BFISWebPublic/pub/viewDocument.action?attachmentId=26733&fileName=Areas++of+Potential+Environmental+Concern+-+NDL+2013-07-30.pdf			
Document Heading:		Supporting Documents			
Document Name:		Lawyer Letter NDL.pdf			
Document Type:		Lawyer's letter consisting of a legal description of the property			
Document Link:		https://www.lrcsde.lrc.gov.on.ca/BFISWebPublic/pub/viewDocument.action?attachmentId=26726&fileName=Lawyer+Letter+NDL.pdf			
Document Heading:		Supporting Documents			
Document Name:		Table of Current and Past Uses - NDL revised FINAL.pdf			
Document Type:		Table of Current and Past Property Use			
Document Link:		https://www.lrcsde.lrc.gov.on.ca/BFISWebPublic/pub/viewDocument.action?attachmentId=26725&fileName=Table+of+Current+and+Past+Uses+-+NDL+revised+FINAL.pdf			
Document Heading:		Supporting Documents			
Document Name:		CSM - NDL final.pdf			
Document Type:		Phase 2 Conceptual Site Model			
Document Link:		https://www.lrcsde.lrc.gov.on.ca/BFISWebPublic/pub/viewDocument.action?attachmentId=26732&fileName=CSM+-+NDL+final.pdf			

32	1 of 1	E/62.9	79.3 / -2.16	2092 OLD LAKESHORE RD. Burlington ON	WWIS
Well ID:	7107069			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Test Hole			Date Received:	25-Jun-2008 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	M01266			Contractor:	6607
Tag:	A067304			Form Version:	5
Constructn Method:				Owner:	
Elevation (m):				County:	HALTON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	BURLINGTON CITY				
Site Info:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/710\7107069.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		2008/05/22			
Year Completed:		2008			
Depth (m):					
Latitude:		43.3257448618082			
Longitude:		-79.7917630856716			
Path:		710\7107069.pdf			
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/710\7107069.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		2008/05/21			
Year Completed:		2008			
Depth (m):					
Latitude:		43.3257640394129			
Longitude:		-79.7918737104152			
Path:		710\7107069.pdf			
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/710\7107069.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		2008/05/22			
Year Completed:		2008			
Depth (m):					
Latitude:		43.3258979054991			
Longitude:		-79.7917600519939			
Path:		710\7107069.pdf			
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/710\7107069.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		2008/05/21			
Year Completed:		2008			
Depth (m):		9.1			
Latitude:		43.3257803509586			
Longitude:		-79.791713046679			
Path:		710\7107069.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1002712844		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	
Code OB:				East83:	
Code OB Desc:				North83:	
Open Hole:				Org CS:	
Cluster Kind:		This is a record from cluster log sheet		UTMRC:	
Date Completed:		22-May-2008 00:00:00		UTMRC Desc:	
Remarks:				Location Method:	
Loc Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1002712848			
Layer:					
Plug From:					
Plug To:					
Plug Depth UOM:					
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1002712847			
Method Construction Code:					
Method Construction:					
Other Method Construction:		AUGER			
<u>Pipe Information</u>					
Pipe ID:		1002712849			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1002712851			
Layer:					
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:					
Depth To:		6.0			
Casing Diameter:					
Casing Diameter UOM:					
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1002712850			
Layer:					
Slot:					
Screen Top Depth:		6.0			
Screen End Depth:		9.100000381469727			
Screen Material:					
Screen Depth UOM:		m			
Screen Diameter UOM:					
Screen Diameter:					
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1002712852			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Rate UOM: Water State After Test Code: Water State After Test: Pumping Test Method: Pumping Duration HR: Pumping Duration MIN: Flowing:					
<u>Hole Diameter</u>					
Hole ID:		1002712846			
Diameter:		21.0			
Depth From:					
Depth To:		9.100000381469727			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Bore Hole Information</u>					
Bore Hole ID:	1001627739			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	597964.00
Code OB Desc:				North83:	4797702.00
Open Hole:	No			Org CS:	UTM83
Cluster Kind:				UTMRC:	3
Date Completed:	21-May-2008 00:00:00			UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	www
Loc Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1002712856			
Layer:		3			
Color:		7			
General Color:		RED			
Mat1:		17			
Most Common Material:		SHALE			
Mat2:		15			
Mat2 Desc:		LIMESTONE			
Mat3:		92			
Mat3 Desc:		WEATHERED			
Formation Top Depth:		4.199999809265137			
Formation End Depth:		9.100000381469727			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1002712854			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Mat2:		06			
Mat2 Desc:		SILT			
Mat3:		05			
Mat3 Desc:		CLAY			
Formation Top Depth:		0.0			
Formation End Depth:		3.0			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1002712855			
Layer:		2			
Color:		7			
General Color:		RED			
Mat1:		05			
Most Common Material:		CLAY			
Mat2:		06			
Mat2 Desc:		SILT			
Mat3:		28			
Mat3 Desc:		SAND			
Formation Top Depth:		3.0			
Formation End Depth:		4.199999809265137			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1002712858			
Layer:		1			
Plug From:		0.0			
Plug To:		5.699999809265137			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1002712863			
Method Construction Code:		E			
Method Construction:		Auger			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1002712853			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1002712860			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		6.0			
Casing Diameter:		5.099999904632568			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Construction Record - Screen</u>					
Screen ID:		1002712861			
Layer:		1			
Slot:		20			
Screen Top Depth:					
Screen End Depth:					
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.400000095367432			
<u>Water Details</u>					
Water ID:		1002712859			
Layer:		1			
Kind Code:					
Kind:					
Water Found Depth:		7.800000190734863			
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1002712857			
Diameter:		21.0			
Depth From:		0.0			
Depth To:		9.100000381469727			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Bore Hole Information</u>					
Bore Hole ID:	1002712826			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	597951.00
Code OB Desc:				North83:	4797700.00
Open Hole:				Org CS:	UTM83
Cluster Kind:	This is a record from cluster log sheet			UTMRC:	3
Date Completed:	21-May-2008 00:00:00			UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	www
Loc Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1002712830			
Layer:					
Plug From:					
Plug To:					
Plug Depth UOM:					
<u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		1002712829			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Method Construction Code:					
Method Construction:					
Other Method Construction:		AUGER			
<u>Pipe Information</u>					
Pipe ID:		1002712831			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1002712833			
Layer:					
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:					
Depth To:		6.0			
Casing Diameter:					
Casing Diameter UOM:					
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1002712832			
Layer:					
Slot:					
Screen Top Depth:		6.0			
Screen End Depth:		9.100000381469727			
Screen Material:					
Screen Depth UOM:		m			
Screen Diameter UOM:					
Screen Diameter:					
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1002712834			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:					
Rate UOM:					
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:					
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:		1002712828			
Diameter:		21.0			
Depth From:					
Depth To:		9.100000381469727			
Hole Depth UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Hole Diameter UOM:		cm			
<u>Bore Hole Information</u>					
Bore Hole ID:	1002712835			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	597960.00
Code OB Desc:				North83:	4797698.00
Open Hole:				Org CS:	UTM83
Cluster Kind:	This is a record from cluster log sheet			UTMRC:	3
Date Completed:	22-May-2008 00:00:00			UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Loc Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:	1002712839				
Layer:					
Plug From:					
Plug To:					
Plug Depth UOM:					
<u>Method of Construction & Well Use</u>					
Method Construction ID:	1002712838				
Method Construction Code:					
Method Construction:					
Other Method Construction:	AUGER				
<u>Pipe Information</u>					
Pipe ID:	1002712840				
Casing No:	0				
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:	1002712842				
Layer:					
Material:	5				
Open Hole or Material:	PLASTIC				
Depth From:					
Depth To:	6.0				
Casing Diameter:					
Casing Diameter UOM:					
Casing Depth UOM:	m				
<u>Construction Record - Screen</u>					
Screen ID:	1002712841				
Layer:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Slot:					
Screen Top Depth:		6.0			
Screen End Depth:		9.100000381469727			
Screen Material:					
Screen Depth UOM:		m			
Screen Diameter UOM:					
Screen Diameter:					
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1002712843			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:					
Rate UOM:					
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:					
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:		1002712837			
Diameter:		21.0			
Depth From:					
Depth To:		9.100000381469727			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Links</u>					
Bore Hole ID:	1002712844			Tag No:	A067304
Depth M:				Contractor:	6607
Year Completed:	2008			Path:	710\7107069.pdf
Well Completed Dt:	2008/05/22			Latitude:	43.3258979054991
Audit No:	M01266			Longitude:	-79.7917600519939
<u>Links</u>					
Bore Hole ID:	1002712835			Tag No:	A067304
Depth M:				Contractor:	6607
Year Completed:	2008			Path:	710\7107069.pdf
Well Completed Dt:	2008/05/22			Latitude:	43.3257448618082
Audit No:	M01266			Longitude:	-79.7917630856716
<u>Links</u>					
Bore Hole ID:	1002712826			Tag No:	A067304
Depth M:				Contractor:	6607
Year Completed:	2008			Path:	710\7107069.pdf
Well Completed Dt:	2008/05/21			Latitude:	43.3257640394129
Audit No:	M01266			Longitude:	-79.7918737104152

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Links					
Bore Hole ID:	1001627739			Tag No:	A067304
Depth M:	9.1			Contractor:	6607
Year Completed:	2008			Path:	710\7107069.pdf
Well Completed Dt:	2008/05/21			Latitude:	43.3257803509586
Audit No:	M01266			Longitude:	-79.791713046679
33	1 of 1	ENE/67.9	79.8 / -1.61	2093 Old Lakeshore Rd Burlington ON L7R1A4	EHS
Order No:	20170905027			Nearest Intersection:	
Status:	C			Municipality:	
Report Type:	Custom Report			Client Prov/State:	ON
Report Date:	14-SEP-17			Search Radius (km):	.25
Date Received:	05-SEP-17			X:	-79.792004
Previous Site Name:				Y:	43.326388
Lot/Building Size:					
Additional Info Ordered:					
34	1 of 1	WNW/68.8	83.8 / 2.36	Mr. Stuart Scott 389 Pearl Street, Burlington, Ontario Burlington ON L7R 2M8	RSC
RSC ID:	2375			Cert Date:	11-Oct-05
RA No:				Cert Prop Use No:	No CPU
RSC Type:				Intended Prop Use:	Residential
Curr Property Use:	Residential			Qual Person Name:	
Ministry District:	BURLINGTON			Stratified (Y/N):	
Filing Date:	26-Oct-05			Audit (Y/N):	
Date Ack:				Entire Leg Prop. (Y/N):	Yes
Date Returned:				Accuracy Estimate:	11 to 20 meters
Restoration Type:				Telephone:	905-4694455
Soil Type:				Fax:	905-4694170
Criteria:				Email:	
CPU Issued Sect 1686:	No				
Asmt Roll No:	2402060-60807500				
Prop ID No (PIN):	07065-0054 [LT]				
Property Municipal Address:	389 Pearl Street, Burlington, Ontario				
Mailing Address:	2400 Wyecroft Road, Unit 6, Oakville, Ontario , L6L 6M8				
Latitude & Longitude:	43.32444630N 79.79499560W				
UTM Coordinates:	NAD83 17-597700-4797550 (converted from Latitude & Longitude)				
Consultant:					
Legal Desc:	Lot 4, Block P, Compiled Plan PL92; Burlington				
Measurement Method:	Interpolation from a map				
Applicable Standards:	ESA Phase 1				
RSC PDF:					
35	1 of 2	N/69.2	80.8 / -0.62	ADI MORGAN DEVELOPMENTS (LAKESHORE) INC. 374-380 MARTHA ST BURLINGTON ON L7R 2P7	EASR
Approval No:	R-009-7111578639			MOE District:	Halton-Peel
Status:	REGISTERED			Municipality:	BURLINGTON
Date:	2019-09-25			Latitude:	43.32666667
Record Type:	EASR			Longitude:	-79.79305556
Link Source:	MOFA			Geometry X:	
Project Type:	Water Taking - Construction Dewatering			Geometry Y:	
Full Address:					
Approval Type:	EASR-Water Taking - Construction Dewatering				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
SWP Area Name:		Halton			
PDF URL:					
PDF Site Location:					
35	2 of 2	N/69.2	80.8 / -0.62	ADI MORGAN DEVELOPMENTS (LAKESHORE) INC. 380 MARTHA STREET, BURLINGTON, ON L7R 2P7 Burlington ON	RSC
RSC ID:	226627			Cert Date:	
RA No:				Cert Prop Use No:	
RSC Type:	Phase 1 and 2 RSC			Intended Prop Use:	Residential
Curr Property Use:	Commercial			Qual Person Name:	PAUL BLUNT
Ministry District:	Halton-Peel District Office			Stratified (Y/N):	
Filing Date:	2020/04/30			Audit (Y/N):	
Date Ack:				Entire Leg Prop. (Y/N):	
Date Returned:				Accuracy Estimate:	
Restoration Type:				Telephone:	
Soil Type:				Fax:	
Criteria:				Email:	
CPU Issued Sect 1686:					
Asmt Roll No:	2402060608067000000, 2402060608066000000				
Prop ID No (PIN):	07065-0101 (LT), 07065-0057 (LT)				
Property Municipal Address:	374 MARTHA STREET, BURLINGTON, ON L7R 2P7, 380 MARTHA STREET, BURLINGTON, ON L7R 2P7				
Mailing Address:					
Latitude & Longitude:					
UTM Coordinates:					
Consultant:					
Legal Desc:					
Measurement Method:					
Applicable Standards:					
RSC PDF:	https://www.lrcsde.lrc.gov.on.ca/BFISWebPublic/pub/viewDocument.action?attachmentId=125693&fileName=BROWNFIELDS-E.pdf				
<u>Document(s) Detail</u>					
Document Heading:	Supporting Documents				
Document Name:	Table of APECs.pdf				
Document Type:	Area(s) of Potential Environmental Concern				
Document Link:	https://www.lrcsde.lrc.gov.on.ca/BFISWebPublic/pub/viewDocument.action?attachmentId=125692&fileName=Table+of+APECs.pdf				
Document Heading:	Supporting Documents				
Document Name:	Deed and Other Documents.pdf				
Document Type:	Copy of any deed(s), transfer(s) or other document(s)				
Document Link:	https://www.lrcsde.lrc.gov.on.ca/BFISWebPublic/pub/viewDocument.action?attachmentId=125687&fileName=Deed+and+Other+Documents.pdf				
Document Heading:	Supporting Documents				
Document Name:	RSC Survey.pdf				
Document Type:	A Current plan of Survey				
Document Link:	https://www.lrcsde.lrc.gov.on.ca/BFISWebPublic/pub/viewDocument.action?attachmentId=125684&fileName=RSC+Survey.pdf				
Document Heading:	Supporting Documents				
Document Name:	Table of Current and Past Uses.pdf				
Document Type:	Table of Current and Past Property Use				
Document Link:	https://www.lrcsde.lrc.gov.on.ca/BFISWebPublic/pub/viewDocument.action?attachmentId=125690&fileName=Table+of+Current+and+Past+Uses.pdf				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Document Heading: Supporting Documents Document Name: PhaseTwo.pdf Document Type: Phase 2 Conceptual Site Model Document Link: https://www.lrcsde.lrc.gov.on.ca/BFISWebPublic/pub/viewDocument.action?attachmentId=127886&fileName=PhaseTwo.pdf					
Document Heading: Supporting Documents Document Name: Certificate of Status - Nautique project.pdf Document Type: Certificate of Status Document Link: https://www.lrcsde.lrc.gov.on.ca/BFISWebPublic/pub/viewDocument.action?attachmentId=125685&fileName=Certificate+of+Status+-+Nautique+project.pdf					
Document Heading: Supporting Documents Document Name: Lawyers Letter.pdf Document Type: Lawyer's letter consisting of a legal description of the property Document Link: https://www.lrcsde.lrc.gov.on.ca/BFISWebPublic/pub/viewDocument.action?attachmentId=125694&fileName=Lawyers+Letter.pdf					
36	1 of 1	ENE/69.8	79.8 / -1.61	2093, 2097, 2101 Old Lakeshore & 2096, 2100 Lakeshore Road Burlington ON L7R 1A4	EHS
Order No: 22081200435 Status: C Report Type: Custom Report Report Date: 17-AUG-22 Date Received: 12-AUG-22 Previous Site Name: Lot/Building Size: Additional Info Ordered: Fire Insur. Maps and/or Site Plans					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -79.79195928 Y: 43.32637578					
37	1 of 1	W/71.0	83.9 / 2.42	ON	BORE
Borehole ID: 624867 OGF ID: 215525319 Status: Type: Borehole Use: Geotechnical/Geological Investigation Completion Date: AUG-1965 Static Water Level: Primary Water Use: Not Used Sec. Water Use: Total Depth m: 3.3 Depth Ref: Ground Surface Depth Elev: Drill Method: Power auger Orig Ground Elev m: 80.5 Elev Reliabil Note: DEM Ground Elev m: 81.2 Concession: Location D: Survey D: Comments:					
Inclin FLG: No SP Status: Initial Entry Surv Elev: No Piezometer: No Primary Name: Municipality: Lot: Township: Latitude DD: 43.325812 Longitude DD: -79.794173 UTM Zone: 17 Easting: 597765 Northing: 4797703 Location Accuracy: Accuracy: Not Applicable					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID: 218435728 Top Depth: 0 Bottom Depth: 2.7 Material Color: Material 1: Unknown Material 2:					
Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 3: Material 4: Gsc Material Description: Stratum Description:				Geologic Period: Depositional Gen:	Quaternary
UNSPECIFIED. AGE QUATERNARY.					
Geology Stratum ID:		218435729	Mat Consistency:		Soft
Top Depth:		2.7	Material Moisture:		
Bottom Depth:		3.3	Material Texture:		
Material Color:		Brown	Non Geo Mat Type:		
Material 1:		Till	Geologic Formation:		
Material 2:		Silt	Geologic Group:		
Material 3:		Sand	Geologic Period:		
Material 4:		Clay	Depositional Gen:		glacial
Gsc Material Description: Stratum Description:		TILL,SILT,SAND,CLAY.BROWN,GLACIAL,VERY SOFT, AGE GLACIAL. 00090015 **Note: Many records provided by the department have a truncated [Stratum Description] field.			
Source					
Source Type:		Data Survey	Source Appl:		Spatial/Tabular
Source Orig:		Geological Survey of Canada	Source Iden:		1
Source Date:		1956-1972	Scale or Res:		Varies
Confidence:		M	Horizontal:		NAD27
Observatio:			Verticalda:		Mean Average Sea Level
Source Name:		Urban Geology Automated Information System (UGAIS)			
Source Details:		File: HAM.txt RecordID: 038680 NTS_Sheet: 30M05C			
Confiden 1:		Reliable information but incomplete.			
Source List					
Source Identifier:		1	Horizontal Datum:		NAD27
Source Type:		Data Survey	Vertical Datum:		Mean Average Sea Level
Source Date:		1956-1972	Projection Name:		Universal Transverse Mercator
Scale or Resolution:		Varies			
Source Name:		Urban Geology Automated Information System (UGAIS)			
Source Originators:		Geological Survey of Canada			
38	1 of 1	NW/71.3	83.0 / 1.54	2071 LAKESHORE RD Burlington ON	WWIS
Well ID:		7280353	Flowing (Y/N):		
Construction Date:			Flow Rate:		
Use 1st:			Data Entry Status:		
Use 2nd:		Monitoring	Data Src:		
Final Well Status:		Observation Wells	Date Received:		01-Feb-2017 00:00:00
Water Type:			Selected Flag:		TRUE
Casing Material:			Abandonment Rec:		
Audit No:		Z220724	Contractor:		7484
Tag:		A125155	Form Version:		7
Constructn Method:			Owner:		
Elevation (m):			County:		HALTON
Elevatn Reliabilty:			Lot:		
Depth to Bedrock:			Concession:		
Well Depth:			Concession Name:		
Overburden/Bedrock:			Easting NAD83:		
Pump Rate:			Northing NAD83:		
Static Water Level:			Zone:		
Clear/Cloudy:			UTM Reliability:		
Municipality:		BURLINGTON CITY			
Site Info:					
PDF URL (Map):					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	2016/11/24				
Year Completed:	2016				
Depth (m):	24.384				
Latitude:	43.3264667198019				
Longitude:	-79.7936112134086				
Path:					
<u>Bore Hole Information</u>					
Bore Hole ID:	1006349425			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	597809.00
Code OB Desc:				North83:	4797776.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	24-Nov-2016 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1006547654				
Layer:	1				
Color:	6				
General Color:	BROWN				
Mat1:	28				
Most Common Material:	SAND				
Mat2:	05				
Mat2 Desc:	CLAY				
Mat3:	06				
Mat3 Desc:	SILT				
Formation Top Depth:	0.0				
Formation End Depth:	13.0				
Formation End Depth UOM:	ft				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1006547655				
Layer:	2				
Color:	7				
General Color:	RED				
Mat1:	17				
Most Common Material:	SHALE				
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:	13.0				
Formation End Depth:	80.0				
Formation End Depth UOM:	ft				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006547664			
Layer:		2			
Plug From:		29.0			
Plug To:		40.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006547663			
Layer:		1			
Plug From:		0.0			
Plug To:		29.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1006547662			
Method Construction Code:		B			
Method Construction:		Other Method			
Other Method Construction:		AUGER			
<u>Pipe Information</u>					
Pipe ID:		1006547653			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1006547659			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		30.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1006547660			
Layer:		1			
Slot:		10			
Screen Top Depth:		30.0			
Screen End Depth:		40.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.5			
<u>Water Details</u>					
Water ID:		1006547658			
Layer:		1			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Kind Code:					
Kind:					
Water Found Depth:		2.0			
Water Found Depth UOM:		ft			
Hole Diameter					
Hole ID:		1006547656			
Diameter:		6.0			
Depth From:		0.0			
Depth To:		6.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
Hole Diameter					
Hole ID:		1006547657			
Diameter:		3.5			
Depth From:		6.0			
Depth To:		40.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
Links					
Bore Hole ID:		1006349425	Tag No:		A125155
Depth M:		24.384	Contractor:		7484
Year Completed:		2016	Path:		
Well Completed Dt:		2016/11/24	Latitude:		43.3264667198019
Audit No:		Z220724	Longitude:		-79.7936112134086
39	1 of 1	SW/72.6	82.8 / 1.33	2402 LAKESHORE RD. Burlington ON	WWIS
Well ID:		7122728	Flowing (Y/N):		
Construction Date:			Flow Rate:		
Use 1st:		Monitoring and Test Hole	Data Entry Status:		
Use 2nd:		0	Data Src:		
Final Well Status:		Monitoring and Test Hole	Date Received:		07-May-2009 00:00:00
Water Type:			Selected Flag:		TRUE
Casing Material:			Abandonment Rec:		
Audit No:		Z93193	Contractor:		7241
Tag:		A081893	Form Version:		7
Constructn Method:			Owner:		
Elevation (m):			County:		HALTON
Elevatn Reliabilty:			Lot:		
Depth to Bedrock:			Concession:		
Well Depth:			Concession Name:		
Overburden/Bedrock:			Easting NAD83:		
Pump Rate:			Northing NAD83:		
Static Water Level:			Zone:		
Clear/Cloudy:			UTM Reliability:		
Municipality:		BURLINGTON CITY			
Site Info:		WKQ-001154			
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/712\7122728.pdf			
Additional Detail(s) (Map)					
Well Completed Date:		2009/03/26			
Year Completed:		2009			
Depth (m):		3.3528			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Latitude:		43.3252169225326			
Longitude:		-79.7937839542832			
Path:		712\7122728.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:	1002422146			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	597797.00
Code OB Desc:				North83:	4797637.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	26-Mar-2009 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1002549706				
Layer:	1				
Color:	6				
General Color:	BROWN				
Mat1:	28				
Most Common Material:	SAND				
Mat2:	01				
Mat2 Desc:	FILL				
Mat3:	77				
Mat3 Desc:	LOOSE				
Formation Top Depth:	0.0				
Formation End Depth:	6.0				
Formation End Depth UOM:	ft				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1002549707				
Layer:	2				
Color:	2				
General Color:	GREY				
Mat1:	05				
Most Common Material:	CLAY				
Mat2:	34				
Mat2 Desc:	TILL				
Mat3:	66				
Mat3 Desc:	DENSE				
Formation Top Depth:	6.0				
Formation End Depth:	11.0				
Formation End Depth UOM:	ft				
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:	1002549709				
Layer:	1				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug From:		0.0			
Plug To:		4.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1002549710			
Layer:		2			
Plug From:		4.0			
Plug To:		11.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1002549716			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1002549705			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1002549712			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		4.0			
Casing Diameter:		1.5			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1002549713			
Layer:		1			
Slot:					
Screen Top Depth:		4.0			
Screen End Depth:		11.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		1.5			
<u>Water Details</u>					
Water ID:		1002549711			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Hole Diameter</u>					
Hole ID:	1002549708				
Diameter:	3.5				
Depth From:	0.0				
Depth To:	11.0				
Hole Depth UOM:	ft				
Hole Diameter UOM:	inch				
<u>Links</u>					
Bore Hole ID:	1002422146			Tag No:	A081893
Depth M:	3.3528			Contractor:	7241
Year Completed:	2009			Path:	712\7122728.pdf
Well Completed Dt:	2009/03/26			Latitude:	43.3252169225326
Audit No:	Z93193			Longitude:	-79.7937839542832
40	1 of 1	NE/74.3	79.8 / -1.67	2100 LAKESHORE RD ON	WWIS
Well ID:	7287811			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Observation Wells			Date Received:	06-Jun-2017 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z237634			Contractor:	7464
Tag:	A208286			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	HALTON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	BURLINGTON CITY				
Site Info:					
PDF URL (Map):					
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	2016/09/26				
Year Completed:	2016				
Depth (m):	4.572				
Latitude:	43.3265770061082				
Longitude:	-79.7921166115966				
Path:					
<u>Bore Hole Information</u>					
Bore Hole ID:	1006521982			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	597930.00
Code OB Desc:				North83:	4797790.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	26-Sep-2016 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Remarks:		Location Method:		WWF	
Loc Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1006739138			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		06			
Most Common Material:		SILT			
Mat2:		28			
Mat2 Desc:		SAND			
Mat3:		85			
Mat3 Desc:		SOFT			
Formation Top Depth:		0.0			
Formation End Depth:		7.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1006739139			
Layer:		2			
Color:		7			
General Color:		RED			
Mat1:		17			
Most Common Material:		SHALE			
Mat2:					
Mat2 Desc:					
Mat3:		73			
Mat3 Desc:		HARD			
Formation Top Depth:		7.0			
Formation End Depth:		15.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1006739146			
Layer:		1			
Plug From:		0.0			
Plug To:		4.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		1006739145			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
<u>Pipe Information</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Pipe ID:		1006739137			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1006739142			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		5.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
 <u>Construction Record - Screen</u>					
Screen ID:		1006739143			
Layer:		1			
Slot:					
Screen Top Depth:		5.0			
Screen End Depth:		15.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.0			
 <u>Water Details</u>					
Water ID:		1006739141			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
 <u>Hole Diameter</u>					
Hole ID:		1006739140			
Diameter:					
Depth From:		0.0			
Depth To:		15.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
 <u>Links</u>					
Bore Hole ID:	1006521982			Tag No:	A208286
Depth M:	4.572			Contractor:	7464
Year Completed:	2016			Path:	
Well Completed Dt:	2016/09/26			Latitude:	43.3265770061082
Audit No:	Z237634			Longitude:	-79.7921166115966
41	1 of 1	W/74.4	83.8 / 2.39	ON	BORE
Borehole ID:	624868			Inclin FLG:	No
OGF ID:	215525320			SP Status:	Initial Entry
Status:				Surv Elev:	No

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Type: Use: Completion Date: Static Water Level: Primary Water Use: Sec. Water Use: Total Depth m: Depth Ref: Depth Elev: Drill Method: Orig Ground Elev m: Elev Reliabil Note: DEM Ground Elev m: Concession: Location D: Survey D: Comments:	Borehole Geotechnical/Geological Investigation AUG-1965 Not Used 4.2 Ground Surface Power auger 81.1 81.6			Piezometer: Primary Name: Municipality: Lot: Township: Latitude DD: Longitude DD: UTM Zone: Easting: Northing: Location Accuracy: Accuracy:	No 43.325992 -79.794169 17 597765 4797723 Not Applicable
<u>Borehole Geology Stratum</u>					
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218435730 0 3.1 Unknown Unknown Unknown Unknown UNSPECIFIED. AGE QUATERNARY.			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	Quaternary
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218435731 3.1 4 Green Clay Silt Silt CLAY,SILT. GREEN,SOFT,AGE GLACIAL.			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	Soft glacial
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218435732 4 4.2 Brown Till Clay Sand Gravel TILL,CLAY,SAND, GRAVEL. BROWN,GLACIAL,VERY SOFT, AGE GLACIAL. 0010300400130025 **Note: Many records provided by the department have a truncated [Stratum Description] field.			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	Soft glacial
<u>Source</u>					
Source Type: Source Orig: Source Date: Confidence: Observatio: Source Name: Source Details: Confiden 1:	Data Survey Geological Survey of Canada 1956-1972 M Urban Geology Automated Information System (UGAIS) File: HAM.txt RecordID: 038690 NTS_Sheet: 30M05C Reliable information but incomplete.			Source Appl: Source Iden: Scale or Res: Horizontal: Verticalda:	Spatial/Tabular 1 Varies NAD27 Mean Average Sea Level

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Source List					
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Originators:	Geological Survey of Canada				
42	1 of 1	ENE/77.7	79.8 / -1.62	ON	WWIS
Well ID:	7287812			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Observation Wells			Date Received:	06-Jun-2017 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z237633			Contractor:	7464
Tag:	A208287			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	HALTON
Elevatn Reliability:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	BURLINGTON CITY				
Site Info:					
PDF URL (Map):					
Additional Detail(s) (Map)					
Well Completed Date:	2016/09/26				
Year Completed:	2016				
Depth (m):	4.572				
Latitude:	43.32621222137227				
Longitude:	-79.7916798178057				
Path:					
Bore Hole Information					
Bore Hole ID:	1006521985			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	597966.00
Code OB Desc:				North83:	4797750.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	26-Sep-2016 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	www
Loc Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1006739200			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		06			
Most Common Material:		SILT			
Mat2:		28			
Mat2 Desc:		SAND			
Mat3:		85			
Mat3 Desc:		SOFT			
Formation Top Depth:		0.0			
Formation End Depth:		7.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1006739201			
Layer:		2			
Color:		7			
General Color:		RED			
Mat1:		17			
Most Common Material:		SHALE			
Mat2:					
Mat2 Desc:					
Mat3:		73			
Mat3 Desc:		HARD			
Formation Top Depth:		7.0			
Formation End Depth:		15.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006739208			
Layer:		1			
Plug From:		0.0			
Plug To:		4.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1006739207			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1006739199			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Casing ID: 1006739204					
Layer: 1					
Material: 5					
Open Hole or Material: PLASTIC					
Depth From: 0.0					
Depth To: 5.0					
Casing Diameter: 2.0					
Casing Diameter UOM: inch					
Casing Depth UOM: ft					
Construction Record - Screen					
Screen ID: 1006739205					
Layer: 1					
Slot:					
Screen Top Depth: 5.0					
Screen End Depth: 15.0					
Screen Material: 5					
Screen Depth UOM: ft					
Screen Diameter UOM: inch					
Screen Diameter: 2.0					
Water Details					
Water ID: 1006739203					
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM: ft					
Hole Diameter					
Hole ID: 1006739202					
Diameter:					
Depth From: 0.0					
Depth To: 15.0					
Hole Depth UOM: ft					
Hole Diameter UOM: inch					
Links					
Bore Hole ID:	1006521985			Tag No:	A208287
Depth M:	4.572			Contractor:	7464
Year Completed:	2016			Path:	
Well Completed Dt:	2016/09/26			Latitude:	43.3262122137227
Audit No:	Z237633			Longitude:	-79.7916798178057
43	1 of 1	WNW/82.1	83.9 / 2.43	Mr. Stuart Scott 393 Pearl Street, Burlington, Ontario, ON L7R 2M8	RSC
RSC ID:	2378			Cert Date:	11-Oct-05
RA No:				Cert Prop Use No:	No CPU
RSC Type:				Intended Prop Use:	Residential
Curr Property Use:	Residential			Qual Person Name:	
Ministry District:	BURLINGTON			Stratified (Y/N):	
Filing Date:	26-Oct-05			Audit (Y/N):	
Date Ack:				Entire Leg Prop. (Y/N):	Yes
Date Returned:				Accuracy Estimate:	11 to 20 meters
Restoration Type:				Telephone:	905-4694455

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Soil Type: Criteria: CPU Issued Sect 1686: Asmt Roll No: Prop ID No (PIN): Property Municipal Address: Mailing Address: Latitude & Longitude: UTM Coordinates: Consultant: Legal Desc: Measurement Method: Applicable Standards: RSC PDF:		No 2402060-60807700 07065-0053 [LT] 393 Pearl Street, Burlington, Ontario, 2400 Wyecroft Road, Unit 6, Oakville, Ontario , L6L 6M8 43.32446630N 79.79499560W NAD83 17-597700-4797552 (converted from Latitude & Longitude) Part Lot 2, Block P, Complied Plan PL92, Part Lot 3, Block P, Complied Plan PL92, as in 851036; Burlington. Interpolation from a map ESA Phase 1		Fax: Email:	905-4694170

44	1 of 1	WSW/88.7	83.0 / 1.52	2042 LAKESHORE RD Burlington ON	WWIS
Well ID: Construction Date: Use 1st: Use 2nd: Final Well Status: Water Type: Casing Material: Audit No: Tag: Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: Site Info:		7147293 Monitoring Test Hole M06035 A099593 BURLINGTON CITY		Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: Selected Flag: Abandonment Rec: Contractor: Form Version: Owner: County: Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:	 25-Jun-2010 00:00:00 TRUE 7238 5 HALTON

PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/714\7147293.pdf

<u>Additional Detail(s) (Map)</u>					
Well Completed Date: Year Completed: Depth (m): Latitude: Longitude: Path:		2010/05/01 2010 43.3253293747727 -79.7942010778166 714\7147293.pdf			

PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/714\7147293.pdf

<u>Additional Detail(s) (Map)</u>					
Well Completed Date: Year Completed: Depth (m): Latitude: Longitude: Path:		2010/05/01 2010 43.3253601833828 -79.7937071165579 714\7147293.pdf			

PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/714\7147293.pdf

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	2010/05/01				
Year Completed:	2010				
Depth (m):					
Latitude:	43.3252722385406				
Longitude:	-79.7939061974232				
Path:	714\7147293.pdf				
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/714\7147293.pdf				
 <u>Additional Detail(s) (Map)</u>					
Well Completed Date:	2010/05/02				
Year Completed:	2010				
Depth (m):	19.3				
Latitude:	43.3255020132369				
Longitude:	-79.7934946347243				
Path:	714\7147293.pdf				
 <u>Bore Hole Information</u>					
Bore Hole ID:	1003322273			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	597787.00
Code OB Desc:				North83:	4797643.00
Open Hole:				Org CS:	UTM83
Cluster Kind:	This is a record from cluster log sheet			UTMRC:	4
Date Completed:	01-May-2010 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:	1003322277				
Layer:					
Plug From:					
Plug To:					
Plug Depth UOM:					
 <u>Method of Construction & Well Use</u>					
Method Construction ID:	1003322276				
Method Construction Code:					
Method Construction:					
Other Method Construction:	AUGER				
 <u>Pipe Information</u>					
Pipe ID:	1003322278				
Casing No:	0				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1003322280			
Layer:					
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:					
Depth To:		7.599999904632568			
Casing Diameter:					
Casing Diameter UOM:					
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1003322279			
Layer:					
Slot:					
Screen Top Depth:		7.599999904632568			
Screen End Depth:		10.0			
Screen Material:					
Screen Depth UOM:		m			
Screen Diameter UOM:					
Screen Diameter:					
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1003322281			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:					
Rate UOM:					
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:					
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:		1003322275			
Diameter:		5.0			
Depth From:					
Depth To:		10.0			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Bore Hole Information</u>					
Bore Hole ID:	1003322264			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	597803.00

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Code OB Desc:				North83:	4797653.00
Open Hole:				Org CS:	UTM83
Cluster Kind:	This is a record from cluster log sheet			UTMRC:	4
Date Completed:	01-May-2010 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1003322268			
Layer:					
Plug From:					
Plug To:					
Plug Depth UOM:					
<u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		1003322267			
Method Construction Code:					
Method Construction:					
Other Method Construction:		AUGER			
<u>Pipe Information</u>					
Pipe ID:		1003322269			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1003322271			
Layer:					
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:					
Depth To:		2.299999952316284			
Casing Diameter:					
Casing Diameter UOM:					
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1003322270			
Layer:					
Slot:					
Screen Top Depth:		2.299999952316284			
Screen End Depth:		4.0			
Screen Material:					
Screen Depth UOM:		m			
Screen Diameter UOM:					
Screen Diameter:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:	1003322272				
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:					
Rate UOM:					
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:					
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:	1003322266				
Diameter:	15.0				
Depth From:					
Depth To:	4.0				
Hole Depth UOM:	m				
Hole Diameter UOM:	cm				
<u>Bore Hole Information</u>					
Bore Hole ID:	1003322282			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	597763.00
Code OB Desc:				North83:	4797649.00
Open Hole:				Org CS:	UTM83
Cluster Kind:	This is a record from cluster log sheet			UTMRC:	4
Date Completed:	01-May-2010 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	www
Loc Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:	1003322286				
Layer:					
Plug From:					
Plug To:					
Plug Depth UOM:					
<u>Method of Construction & Well Use</u>					
Method Construction ID:	1003322285				
Method Construction Code:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Method Construction:					
Other Method Construction:		AUGER			
<u>Pipe Information</u>					
Pipe ID:		1003322287			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1003322289			
Layer:					
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:					
Depth To:		2.299999952316284			
Casing Diameter:					
Casing Diameter UOM:					
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1003322288			
Layer:					
Slot:					
Screen Top Depth:		2.299999952316284			
Screen End Depth:		4.0			
Screen Material:					
Screen Depth UOM:		m			
Screen Diameter UOM:					
Screen Diameter:					
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1003322290			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:					
Rate UOM:					
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:					
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:		1003322284			
Diameter:		15.0			
Depth From:					
Depth To:		4.0			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Bore Hole Information</u>					
Bore Hole ID:	1003071080			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	597820.00
Code OB Desc:				North83:	4797669.00
Open Hole:	No			Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	02-May-2010 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1003322293				
Layer:	2				
Color:	6				
General Color:	BROWN				
Mat1:	28				
Most Common Material:	SAND				
Mat2:	77				
Mat2 Desc:	LOOSE				
Mat3:					
Mat3 Desc:					
Formation Top Depth:	2.0				
Formation End Depth:	3.0				
Formation End Depth UOM:	m				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1003322294				
Layer:	3				
Color:	6				
General Color:	BROWN				
Mat1:	17				
Most Common Material:	SHALE				
Mat2:					
Mat2 Desc:					
Mat3:	74				
Mat3 Desc:	LAYERED				
Formation Top Depth:	3.0				
Formation End Depth:	19.299999237060547				
Formation End Depth UOM:	m				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1003322292				
Layer:	1				
Color:	6				
General Color:	BROWN				
Mat1:	01				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Most Common Material:		FILL			
Mat2:					
Mat2 Desc:					
Mat3:		85			
Mat3 Desc:		SOFT			
Formation Top Depth:		0.0			
Formation End Depth:		2.0			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003322298			
Layer:		2			
Plug From:		15.0			
Plug To:		19.299999237060547			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003322297			
Layer:		1			
Plug From:		0.0			
Plug To:		15.0			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1003322304			
Method Construction Code:		7			
Method Construction:		Diamond			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1003322291			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1003322301			
Layer:		2			
Material:					
Open Hole or Material:					
Depth From:					
Depth To:					
Casing Diameter:					
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Casing</u>					
Casing ID:		1003322300			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth To:		19.299999237060547			
Casing Diameter:		3.0			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1003322302			
Layer:		1			
Slot:		10			
Screen Top Depth:					
Screen End Depth:					
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		3.0			
<u>Water Details</u>					
Water ID:		1003322299			
Layer:		1			
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1003322295			
Diameter:		7.5			
Depth From:		0.0			
Depth To:		3.0			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Hole Diameter</u>					
Hole ID:		1003322296			
Diameter:		5.0			
Depth From:		3.0			
Depth To:		19.299999237060547			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Links</u>					
Bore Hole ID:	1003071080			Tag No:	A099593
Depth M:	19.3			Contractor:	7238
Year Completed:	2010			Path:	714\7147293.pdf
Well Completed Dt:	2010/05/02			Latitude:	43.3255020132369
Audit No:	M06035			Longitude:	-79.7934946347243
<u>Links</u>					
Bore Hole ID:	1003322282			Tag No:	A099593
Depth M:				Contractor:	7238
Year Completed:	2010			Path:	714\7147293.pdf
Well Completed Dt:	2010/05/01			Latitude:	43.3253293747727
Audit No:	M06035			Longitude:	-79.7942010778166

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Links</u>					
Bore Hole ID:	1003322264			Tag No:	A099593
Depth M:				Contractor:	7238
Year Completed:	2010			Path:	714\7147293.pdf
Well Completed Dt:	2010/05/01			Latitude:	43.3253601833828
Audit No:	M06035			Longitude:	-79.7937071165579
<u>Links</u>					
Bore Hole ID:	1003322273			Tag No:	A099593
Depth M:				Contractor:	7238
Year Completed:	2010			Path:	714\7147293.pdf
Well Completed Dt:	2010/05/01			Latitude:	43.3252722385406
Audit No:	M06035			Longitude:	-79.7939061974232
45	1 of 2	SW/89.6	82.9 / 1.41	2048 LAKESHORE RD BURLINGTON ON	WWIS
Well ID:	2810175			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Observation Wells			Date Received:	22-Mar-2005 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z24232			Contractor:	6607
Tag:	A021354			Form Version:	3
Constructn Method:				Owner:	
Elevation (m):				County:	HALTON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	BURLINGTON CITY				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/281\2810175.pdf				
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	2005/02/03				
Year Completed:	2005				
Depth (m):	3.5				
Latitude:	43.3251104522245				
Longitude:	-79.7939340661198				
Path:	281\2810175.pdf				
<u>Bore Hole Information</u>					
Bore Hole ID:	11319130			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	597785.00
Code OB Desc:				North83:	4797625.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	03-Feb-2005 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Loc Method Desc: on Water Well Record Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:					
<u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		933007162			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		06			
Most Common Material:		SILT			
Mat2:		28			
Mat2 Desc:		SAND			
Mat3:		01			
Mat3 Desc:		FILL			
Formation Top Depth:		0.0			
Formation End Depth:		3.0			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		933007163			
Layer:		2			
Color:		7			
General Color:		RED			
Mat1:		17			
Most Common Material:		SHALE			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		3.0			
Formation End Depth:		3.5			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		933266234			
Layer:		1			
Plug From:		0.0			
Plug To:		1.399999976158142			
Plug Depth UOM:		m			
<u>Method of Construction & Well</u> <u>Use</u>					
Method Construction ID:		962810175			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		11333985			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Casing No:		1			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		930860123			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		1.5			
Casing Diameter:		5.099999904632568			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
 <u>Construction Record - Screen</u>					
Screen ID:		933412048			
Layer:		1			
Slot:		10			
Screen Top Depth:		1.5			
Screen End Depth:		3.5			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.400000095367432			
 <u>Water Details</u>					
Water ID:		934058539			
Layer:		1			
Kind Code:		1			
Kind:		FRESH			
Water Found Depth:		2.5			
Water Found Depth UOM:		m			
 <u>Hole Diameter</u>					
Hole ID:		11537689			
Diameter:		16.0			
Depth From:		0.0			
Depth To:		3.5			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
 <u>Links</u>					
Bore Hole ID:	11319130			Tag No:	A021354
Depth M:	3.5			Contractor:	6607
Year Completed:	2005			Path:	281\2810175.pdf
Well Completed Dt:	2005/02/03			Latitude:	43.3251104522245
Audit No:	Z24232			Longitude:	-79.7939340661198
45	2 of 2	SW/89.6	82.9 / 1.41	2042-2058 LAKESHORE RD BURLINGTON ON	WWIS
Well ID:	2810279			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Not Used			Data Entry Status:	
Use 2nd:				Data Src:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Final Well Status:	Abandoned-Other			Date Received:	08-Jul-2005 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	Yes
Audit No:	Z28253			Contractor:	6607
Tag:	A021354			Form Version:	3
Constructn Method:				Owner:	
Elevation (m):				County:	HALTON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	BURLINGTON CITY				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/281\2810279.pdf				
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	2005/06/02				
Year Completed:	2005				
Depth (m):					
Latitude:	43.3251104522245				
Longitude:	-79.7939340661198				
Path:	281\2810279.pdf				
<u>Bore Hole Information</u>					
Bore Hole ID:	11319234			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	597785.00
Code OB Desc:				North83:	4797625.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	02-Jun-2005 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:	933272251				
Layer:	1				
Plug From:	0.0				
Plug To:	2.0				
Plug Depth UOM:	m				
<u>Method of Construction & Well Use</u>					
Method Construction ID:	962810279				
Method Construction Code:	6				
Method Construction:	Boring				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		11334089			
Casing No:		1			
Comment:					
Alt Name:					
<u>Water Details</u>					
Water ID:		934061916			
Layer:		1			
Kind Code:		1			
Kind:		FRESH			
Water Found Depth:		1.0			
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		11537810			
Diameter:		15.0			
Depth From:		0.0			
Depth To:		2.0			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Links</u>					
Bore Hole ID:	11319234			Tag No:	A021354
Depth M:				Contractor:	6607
Year Completed:	2005			Path:	281\2810279.pdf
Well Completed Dt:	2005/06/02			Latitude:	43.3251104522245
Audit No:	Z28253			Longitude:	-79.7939340661198
46	1 of 6	SW/90.3	82.2 / 0.71	MARALYN WALSH 2042 LAKESHORE RD BURLINGTON ON	PRT
Location ID:	2446				
Type:	retail				
Expiry Date:	1991-02-28				
Capacity (L):	28949				
Licence #:	0053216001				
46	2 of 6	SW/90.3	82.2 / 0.71	2042 Lakeshore Holdings Ltd. 2042 - 2058 Lakeshore Rd Burlington ON L7R 1A3	GEN
Generator No:	ON5299651				
SIC Code:	531310				
SIC Description:	Real Estate Property Managers				
Approval Years:	04				
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
MHSW Facility:					
46	3 of 6	SW/90.3	82.2 / 0.71	MARALYN WALSH HOLDINGS LTD 2042 LAKESHORE RD BURLINGTON ON L7R 1A3	DTNK
<u>Delisted Expired Fuel Safety Facilities</u>					
Instance No:		9754136	Expired Date:		10/9/2009 10:21
Status:		EXPIRED	Max Hazard Rank:		
Instance ID:			Facility Location:		
Instance Type:		FS Facility	Facility Type:		
Instance Creation Dt:			Fuel Type 2:		
Instance Install Dt:			Fuel Type 3:		
Item Description:			Panam Related:		
Manufacturer:			Panam Venue Nm:		
Model:			External Identifier:		
Serial No:			Item:		
ULC Standard:			Piping Steel:		
Quantity:			Piping Galvanized:		
Unit of Measure:			Tank Single Wall St:		
Overfill Prot Type:			Piping Underground:		
Creation Date:			Tank Underground:		
Next Periodic Str DT:			Source:		
TSSA Base Sched Cycle 2:					
TSSAMax Hazard Rank 1:					
TSSA Risk Based Periodic Yn:					
TSSA Volume of Directives:					
TSSA Periodic Exempt:					
TSSA Statutory Interval:					
TSSA Recd Insp Interva:					
TSSA Recd Tolerance:					
TSSA Program Area:					
TSSA Program Area 2:					
Description:					
Original Source:		EXP			
Record Date:		Up to May 2013			
46	4 of 6	SW/90.3	82.2 / 0.71	2042 Lakeshore Road Burlington ON	EHS
Order No:		20120619011	Nearest Intersection:		
Status:		C	Municipality:		Burlington
Report Type:		Standard Report	Client Prov/State:		ON
Report Date:		27-JUN-12	Search Radius (km):		.25
Date Received:		19-JUN-12	X:		-79.793954
Previous Site Name:			Y:		43.325368
Lot/Building Size:		0.7 hectares			
Additional Info Ordered:					
46	5 of 6	SW/90.3	82.2 / 0.71	Suncor Energy Products 2042 Lakeshore Road Burlington ON	GEN
Generator No:		ON3072555			
SIC Code:		447110			
SIC Description:					
Approval Years:		2013			
PO Box No:					
Country:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		251			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
Waste Class:		221			
Waste Class Name:		LIGHT FUELS			
46	6 of 6	SW/90.3	82.2 / 0.71	Suncor Energy Products 2042 Lakeshore Road Burlington ON L7L1C8	GEN
Generator No:		ON3072555			
SIC Code:		447110			
SIC Description:		447110			
Approval Years:		2014			
PO Box No:					
Country:		Canada			
Status:					
Co Admin:		Anita Langley			
Choice of Contact:		CO_ADMIN			
Phone No Admin:		9057940168 Ext.23			
Contaminated Facility:		No			
MHSW Facility:		No			
<u>Detail(s)</u>					
Waste Class:		221			
Waste Class Name:		LIGHT FUELS			
Waste Class:		251			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
47	1 of 1	NNW/90.5	80.8 / -0.69	987032 Ontario Inc. 388 Martha Street, Burlington, Ontario Burlington ON L7R 2P7	RSC
RSC ID:	2196			Cert Date:	19-Aug-05
RA No:				Cert Prop Use No:	No CPU
RSC Type:				Intended Prop Use:	Residential
Curr Property Use:	Residential			Qual Person Name:	Mr. David Gowans
Ministry District:	BURLINGTON			Stratified (Y/N):	
Filing Date:	29-Sep-05			Audit (Y/N):	
Date Ack:				Entire Leg Prop. (Y/N):	Yes
Date Returned:				Accuracy Estimate:	11 to 20 meters
Restoration Type:				Telephone:	905-4694455
Soil Type:				Fax:	905-4694170
Criteria:				Email:	
CPU Issued Sect 1686:	No				
Asmt Roll No:					
Prop ID No (PIN):		07065-0105			
Property Municipal Address:		388 Martha Street, Burlington, Ontario			
Mailing Address:		2400 Wyecroft Road, Unit 6, Oakville, Ontario , L6L 6M8			
Latitude & Longitude:		43.32488340N 79.79375360W (converted from UTM)			
UTM Coordinates:		NAD83 17-597800-4797600			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Consultant: Legal Desc: PT LT 11 BLK P, PL 92, AS IN 584332, PT LTS 11 & 12, BLK P, PL92, PT 2, 20R13745; BURLINGTON. S/T EXEC. NO. 96-00930, IF ENFORCEABLE Measurement Method: Interpolation from a map Applicable Standards: ESA Phase 1 RSC PDF:					
48	1 of 1	SW/90.9	82.9 / 1.41	2042 LAKESHORE ROAD BURLINGTON ON	WWIS
Well ID: 2809958 Construction Date: Use 1st: Not Used Use 2nd: Final Well Status: Observation Wells Water Type: Casing Material: Audit No: Z11846 Tag: A010184 Constructn Method: Elevation (m): Elevatn Reliability: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: BURLINGTON CITY Site Info:					
Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 15-Jun-2004 00:00:00 Selected Flag: TRUE Abandonment Rec: Contractor: 6607 Form Version: 3 Owner: County: HALTON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/280\2809958.pdf					
<u>Additional Detail(s) (Map)</u>					
Well Completed Date: 2004/05/04 Year Completed: 2004 Depth (m): 5 Latitude: 43.3251198449294 Longitude: -79.7939708815137 Path: 280\2809958.pdf					
<u>Bore Hole Information</u>					
Bore Hole ID: 11105807 DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: 04-May-2004 00:00:00 Remarks: Loc Method Desc: on Water Well Record Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:					
Elevation: Elevrc: Zone: 17 East83: 597782.00 North83: 4797626.00 Org CS: UTM83 UTMRC: 5 UTMRC Desc: margin of error : 100 m - 300 m Location Method: wwr					
<u>Overburden and Bedrock</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Materials Interval</u>					
Formation ID:		932958069			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		01			
Mat2 Desc:		FILL			
Mat3:					
Mat3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		3.0			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		932958070			
Layer:		2			
Color:		2			
General Color:		GREY			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		92			
Mat2 Desc:		WEATHERED			
Mat3:					
Mat3 Desc:					
Formation Top Depth:		3.0			
Formation End Depth:		5.0			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		933249702			
Layer:		1			
Plug From:		0.0			
Plug To:		0.30000001192092896			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		933249703			
Layer:		2			
Plug From:		0.30000001192092896			
Plug To:		1.5			
Plug Depth UOM:		m			
<u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		962809958			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		11111391			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Casing No:		1			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		930838614			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		1.600000023841858			
Casing Diameter:		5.0			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
 <u>Construction Record - Screen</u>					
Screen ID:		933408059			
Layer:		1			
Slot:		010			
Screen Top Depth:		1.600000023841858			
Screen End Depth:		5.0			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.400000095367432			
 <u>Water Details</u>					
Water ID:		934047281			
Layer:		1			
Kind Code:		1			
Kind:		FRESH			
Water Found Depth:		3.0			
Water Found Depth UOM:		m			
 <u>Hole Diameter</u>					
Hole ID:		11111390			
Diameter:		15.0			
Depth From:		0.0			
Depth To:		5.0			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
 <u>Links</u>					
Bore Hole ID:	11105807			Tag No:	A010184
Depth M:	5			Contractor:	6607
Year Completed:	2004			Path:	280\2809958.pdf
Well Completed Dt:	2004/05/04			Latitude:	43.3251198449294
Audit No:	Z11846			Longitude:	-79.7939708815137

49	1 of 1	ENE/91.0	79.9 / -1.58	2101 Old Lakeshore Road Burlington ON L7R 1A4	EHS
Order No:	20120910002			Nearest Intersection:	
Status:	C			Municipality:	
Report Type:	Custom Report			Client Prov/State:	ON
Report Date:	14-SEP-12			Search Radius (km):	.25

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Date Received: 10-SEP-12				X: -79.791976	
Previous Site Name:				Y: 43.326073	
Lot/Building Size:					
Additional Info Ordered:					
50	1 of 1	WSW/91.8	83.5 / 2.04	BURLINGTON HYDRO LAKE ONTARIO OUTFALL 2047 LAKESHORE RD (AT BRANT) IN FRONT OF RIVERA TRANSFORMER BURLINGTON CITY ON L7R 1E1	SPL
Ref No: 199012				Discharger Report:	
Site No:				Material Group:	
Incident Dt: 4/24/2001				Health/Env Conseq:	
Year:				Client Type:	
Incident Cause: OTHER CONTAINER LEAK				Sector Type:	
Incident Event:				Agency Involved: WORKS, FIRE, EPS	
Contaminant Code:				Nearest Watercourse:	
Contaminant Name:				Site Address:	
Contaminant Limit 1:				Site District Office:	
Contam Limit Freq 1:				Site Postal Code:	
Contaminant UN No 1:				Site Region:	
Environment Impact: Possible				Site Municipality: 14101	
Nature of Impact: Multi Media Pollution				Site Lot:	
Receiving Medium: Land, Water				Site Conc:	
Receiving Env:				Northing:	
MOE Response:				Easting:	
Dt MOE Arvl on Scn:				Site Geo Ref Accu:	
MOE Reported Dt: 4/24/2001				Site Map Datum:	
Dt Document Closed:				SAC Action Class:	
Incident Reason: STORM, FLOOD				Source Type:	
Site Name:					
Site County/District:					
Site Geo Ref Meth:					
Incident Summary: BURLINGTON HYDRO: SPILL OF POS. PCB TRANS. OIL TOGROUND, C/B-WORKS/HYDRO.					
Contaminant Qty:					
51	1 of 1	SW/95.0	82.8 / 1.38	ON	WWIS
Well ID: 7181460				Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status: Yes	
Use 2nd:				Data Src:	
Final Well Status:				Date Received: 22-May-2012 00:00:00	
Water Type:				Selected Flag: TRUE	
Casing Material:				Abandonment Rec:	
Audit No: M08211				Contractor: 7238	
Tag: A123978				Form Version: 5	
Constructn Method:				Owner:	
Elevation (m):				County: HALTON	
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality: BURLINGTON CITY					
Site Info:					
PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/718\7181460.pdf					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	2012/05/08				
Year Completed:	2012				
Depth (m):					
Latitude:	43.3251023599223				
Longitude:	-79.7940205624359				
Path:	718\7181460.pdf				
<u>Bore Hole Information</u>					
Bore Hole ID:	1003798788			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	597778.00
Code OB Desc:				North83:	4797624.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	08-May-2012 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	www
Loc Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Links</u>					
Bore Hole ID:	1003798788			Tag No:	A123978
Depth M:				Contractor:	7238
Year Completed:	2012			Path:	718\7181460.pdf
Well Completed Dt:	2012/05/08			Latitude:	43.3251023599223
Audit No:	M08211			Longitude:	-79.7940205624359
52	1 of 2	WNW/96.0	84.0 / 2.51	Thornwood Development Group Inc. 399 Pearl St. Burlington ON L7R 2M8	GEN
Generator No:	ON1990367				
SIC Code:	236110				
SIC Description:	Residential Building Construction				
Approval Years:	05				
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:	221				
Waste Class Name:	LIGHT FUELS				
52	2 of 2	WNW/96.0	84.0 / 2.51	987032 Ontario Inc. 399 Pearl Street, Burlington, Ontario,	RSC

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
ON L7R 2M8					
RSC ID:	2195			Cert Date:	19-Aug-05
RA No:				Cert Prop Use No:	No CPU
RSC Type:				Intended Prop Use:	Residential
Curr Property Use:	Residential			Qual Person Name:	Mr. David Gowans
Ministry District:	BURLINGTON			Stratified (Y/N):	
Filing Date:	29-Sep-05			Audit (Y/N):	
Date Ack:				Entire Leg Prop. (Y/N):	Yes
Date Returned:				Accuracy Estimate:	11 to 20 meters
Restoration Type:				Telephone:	905-4694455
Soil Type:				Fax:	905-4694170
Criteria:				Email:	
CPU Issued Sect 1686:	No				
Asmt Roll No:		2402060-60807900			
Prop ID No (PIN):		07065-0052			
Property Municipal Address:		399 Pearl Street, Burlington, Ontario,			
Mailing Address:		2400 Wyecroft Road, Unit 6, Oakville, Ontario , L6L 6M8			
Latitude & Latitude:		43.32444630N 79.79499560W (converted from UTM)			
UTM Coordinates:		NAD83 17-597700-4797550			
Consultant:					
Legal Desc:		PT LT 1 BLK P, COMPILED PLAN PL92, PT LT 2 BLK P, COMPILED PLAN PL92, AS IN 851035; BURLINGTON.			
Measurement Method:		Interpolation from a map			
Applicable Standards:		ESA Phase 1			
RSC PDF:					

53	1 of 1	NW/98.9	83.0 / 1.50	37 HANARTHA ST. (#374) BURLINGTON ON	WWIS
Well ID:	7251745			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Observation Wells			Date Received:	09-Nov-2015 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z189199			Contractor:	7484
Tag:	A165794			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	HALTON
Elevatn Reliability:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	BURLINGTON CITY				
Site Info:					
PDF URL (Map):					

Additional Detail(s) (Map)

Well Completed Date: 2015/07/28
 Year Completed: 2015
 Depth (m): 19.812
 Latitude: 43.3266226250796
 Longitude: -79.793879476771
 Path:

Bore Hole Information

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Bore Hole ID:	1005792586			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	597787.00
Code OB Desc:				North83:	4797793.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	28-Jul-2015 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1005803655				
Layer:	1				
Color:	6				
General Color:	BROWN				
Mat1:	05				
Most Common Material:	CLAY				
Mat2:	84				
Mat2 Desc:	SILTY				
Mat3:					
Mat3 Desc:					
Formation Top Depth:	0.0				
Formation End Depth:	15.0				
Formation End Depth UOM:	ft				
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1005803656				
Layer:	2				
Color:	7				
General Color:	RED				
Mat1:	17				
Most Common Material:	SHALE				
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:	15.0				
Formation End Depth:	65.0				
Formation End Depth UOM:	ft				
 <u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:	1005803665				
Layer:	2				
Plug From:	54.0				
Plug To:	65.0				
Plug Depth UOM:	ft				
 <u>Annular Space/Abandonment</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Sealing Record</u>					
Plug ID:		1005803664			
Layer:		1			
Plug From:		0.0			
Plug To:		54.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1005803663			
Method Construction Code:		E			
Method Construction:		Auger			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1005803654			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1005803660			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		55.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1005803661			
Layer:		1			
Slot:		10			
Screen Top Depth:		55.0			
Screen End Depth:		65.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		25.0			
<u>Water Details</u>					
Water ID:		1005803659			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					
Hole ID:		1005803658			
Diameter:		3.0			
Depth From:		20.0			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth To: 60.0 Hole Depth UOM: ft Hole Diameter UOM: inch					
<u>Hole Diameter</u>					
Hole ID: 1005803657 Diameter: 6.0 Depth From: 0.0 Depth To: 20.0 Hole Depth UOM: ft Hole Diameter UOM: inch					
<u>Links</u>					
Bore Hole ID: 1005792586 Depth M: 19.812 Year Completed: 2015 Well Completed Dt: 2015/07/28 Audit No: Z189199					
Tag No: A165794 Contractor: 7484 Path: 725\7251745.pdf Latitude: 43.3266226250796 Longitude: -79.793879476771					
54	1 of 1	SW/99.2	82.6 / 1.15	2402 LAKESHORE RD. Burlington ON	WWIS
Well ID: 7122727 Construction Date: Use 1st: Monitoring and Test Hole Use 2nd: 0 Final Well Status: Monitoring and Test Hole Water Type: Casing Material: Audit No: Z93174 Tag: A081892 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: BURLINGTON CITY Site Info: WKQ-001154					
Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 07-May-2009 00:00:00 Selected Flag: TRUE Abandonment Rec: Contractor: 7241 Form Version: 7 Owner: County: HALTON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/712\7122727.pdf					
<u>Additional Detail(s) (Map)</u>					
Well Completed Date: 2009/03/26 Year Completed: 2009 Depth (m): 3.048 Latitude: 43.3250848748932 Longitude: -79.7940702433299 Path: 712\7122727.pdf					
<u>Bore Hole Information</u>					
Bore Hole ID: 1002422143 DP2BR: Spatial Status: Code OB:					
Elevation: Elevrc: Zone: 17 East83: 597774.00					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Code OB Desc:				North83:	4797622.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	3
Date Completed:		26-Mar-2009 00:00:00		UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Loc Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1002549693			
Layer:		2			
Color:		2			
General Color:		GREY			
Mat1:		05			
Most Common Material:		CLAY			
Mat2:		34			
Mat2 Desc:		TILL			
Mat3:		66			
Mat3 Desc:		DENSE			
Formation Top Depth:		6.0			
Formation End Depth:		10.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1002549692			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		77			
Mat3 Desc:		LOOSE			
Formation Top Depth:		0.0			
Formation End Depth:		6.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1002549695			
Layer:		1			
Plug From:		0.0			
Plug To:		4.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1002549696			
Layer:		2			
Plug From:		4.0			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug To:		10.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1002549702			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1002549691			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1002549698			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		5.0			
Casing Diameter:		1.5			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1002549699			
Layer:		1			
Slot:		10			
Screen Top Depth:		5.0			
Screen End Depth:		10.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		1.5			
<u>Water Details</u>					
Water ID:		1002549697			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					
Hole ID:		1002549694			
Diameter:		3.5			
Depth From:		0.0			
Depth To:		10.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Links</u>					
Bore Hole ID:	1002422143			Tag No:	A081892
Depth M:	3.048			Contractor:	7241
Year Completed:	2009			Path:	712\7122727.pdf
Well Completed Dt:	2009/03/26			Latitude:	43.3250848748932
Audit No:	Z93174			Longitude:	-79.7940702433299

55	1 of 1	SW/103.5	81.4 / -0.10	2088 LAKESHORE RD. BURLINGTON ON	WWIS
Well ID:	2810472			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Observation Wells			Date Received:	18-Jan-2006 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z15886			Contractor:	6607
Tag:	A015765			Form Version:	3
Constructn Method:				Owner:	
Elevation (m):				County:	HALTON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	BURLINGTON CITY				
Site Info:					

PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/281\2810472.pdf

Additional Detail(s) (Map)

Well Completed Date: 2004/07/30
Year Completed: 2004
Depth (m): 4.6
Latitude: 43.3248564292291
Longitude: -79.7937540868278
Path: 281\2810472.pdf

Bore Hole Information

Bore Hole ID:	11552382	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	597800.00
Code OB Desc:		North83:	4797597.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	3
Date Completed:	30-Jul-2004 00:00:00	UTMRC Desc:	margin of error : 10 - 30 m
Remarks:		Location Method:	wwr
Loc Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		933045269			
Layer:		5			
Color:		7			
General Color:		RED			
Mat1:		06			
Most Common Material:		SILT			
Mat2:		05			
Mat2 Desc:		CLAY			
Mat3:		34			
Mat3 Desc:		TILL			
Formation Top Depth:		2.700000047683716			
Formation End Depth:		3.5			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		933045268			
Layer:		4			
Color:		2			
General Color:		GREY			
Mat1:		06			
Most Common Material:		SILT			
Mat2:		05			
Mat2 Desc:		CLAY			
Mat3:					
Mat3 Desc:					
Formation Top Depth:		2.0			
Formation End Depth:		2.700000047683716			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		933045265			
Layer:		1			
Color:		3			
General Color:		BLUE			
Mat1:		01			
Most Common Material:		FILL			
Mat2:		06			
Mat2 Desc:		SILT			
Mat3:		28			
Mat3 Desc:		SAND			
Formation Top Depth:		0.0			
Formation End Depth:		0.800000011920929			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		933045267			
Layer:		3			
Color:		6			
General Color:		BROWN			
Mat1:		06			
Most Common Material:		SILT			
Mat2:		28			
Mat2 Desc:		SAND			
Mat3:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Mat3 Desc:					
Formation Top Depth:		1.2000000476837158			
Formation End Depth:		2.0			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		933045266			
Layer:		2			
Color:		6			
General Color:		BROWN			
Mat1:		06			
Most Common Material:		SILT			
Mat2:		28			
Mat2 Desc:		SAND			
Mat3:					
Mat3 Desc:					
Formation Top Depth:		0.800000011920929			
Formation End Depth:		1.2000000476837158			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		933045270			
Layer:		6			
Color:		7			
General Color:		RED			
Mat1:		06			
Most Common Material:		SILT			
Mat2:		05			
Mat2 Desc:		CLAY			
Mat3:		34			
Mat3 Desc:		TILL			
Formation Top Depth:		3.5			
Formation End Depth:		4.300000190734863			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		933045271			
Layer:		7			
Color:		7			
General Color:		RED			
Mat1:		17			
Most Common Material:		SHALE			
Mat2:		71			
Mat2 Desc:		FRACTURED			
Mat3:		68			
Mat3 Desc:		DRY			
Formation Top Depth:		4.300000190734863			
Formation End Depth:		4.599999904632568			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		933287714			
Layer:		2			
Plug From:		1.0			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug To:		0.0			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		933287713			
Layer:		1			
Plug From:		4.599999904632568			
Plug To:		1.0			
Plug Depth UOM:		m			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		962810472			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		11561989			
Casing No:		1			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		930875832			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		1.0			
Casing Diameter:		0.20000000298023224			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
 <u>Construction Record - Screen</u>					
Screen ID:		933417304			
Layer:		1			
Slot:		010			
Screen Top Depth:		1.0			
Screen End Depth:		4.5			
Screen Material:					
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		4.5			
 <u>Water Details</u>					
Water ID:		934072286			
Layer:		1			
Kind Code:					
Kind:					
Water Found Depth:		3.0			
Water Found Depth UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Hole Diameter</u>					
Hole ID:		11683497			
Diameter:		15.0			
Depth From:		0.0			
Depth To:		4.5			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Links</u>					
Bore Hole ID:	11552382			Tag No:	A015765
Depth M:	4.6			Contractor:	6607
Year Completed:	2004			Path:	281\2810472.pdf
Well Completed Dt:	2004/07/30			Latitude:	43.3248564292291
Audit No:	Z15886			Longitude:	-79.7937540868278
56	1 of 1	NNW/105.4	80.9 / -0.58	987032 Ontario Inc. 394 Martha Street, Burlington, Ontario, ON L7R 2P7	RSC
RSC ID:	2197			Cert Date:	19-Aug-05
RA No:				Cert Prop Use No:	No CPU
RSC Type:				Intended Prop Use:	Residential
Curr Property Use:	Residential			Qual Person Name:	Mr. David Gowans
Ministry District:	BURLINGTON			Stratified (Y/N):	
Filing Date:	29-Sep-05			Audit (Y/N):	
Date Ack:				Entire Leg Prop. (Y/N):	Yes
Date Returned:				Accuracy Estimate:	11 to 20 meters
Restoration Type:				Telephone:	905-4694455
Soil Type:				Fax:	905-4694170
Criteria:				Email:	
CPU Issued Sect 1686:	No				
Asmt Roll No:					
Prop ID No (PIN):	07065-104				
Property Municipal Address:	394 Martha Street, Burlington, Ontario,				
Mailing Address:	2400 Wyecroft Road, Unit 6, Oakville, Ontario , L6L 6M8				
Latitude & Latitude:	43.32488340N 79.79375360W (converted from UTM)				
UTM Coordinates:	NAD83 17-597800-4797600				
Consultant:					
Legal Desc:	PT LTS 12 & 13, BLK P, PL92, PTS 1 & 3, 20R13745; BURLINGTON. S/T 395579. S/T EXEC NO. 96-00930, IF ENFORCABLE.				
Measurement Method:	Interpolation from a map				
Applicable Standards:	ESA Phase 1				
RSC PDF:					
57	1 of 2	WNW/110.7	84.3 / 2.82	390 Pearl Street Burlington ON L7R 2M9	EHS
Order No:	22021100021			Nearest Intersection:	
Status:	C			Municipality:	
Report Type:	Standard Report			Client Prov/State:	ON
Report Date:	16-FEB-22			Search Radius (km):	.25
Date Received:	11-FEB-22			X:	-79.7945198
Previous Site Name:				Y:	43.3262256
Lot/Building Size:					
Additional Info Ordered:	Fire Insur. Maps and/or Site Plans				
57	2 of 2	WNW/110.7	84.3 / 2.82	390 Pearl Street Burlington ON L7R 2M9	EHS

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Order No: 22021100021 Status: C Report Type: Standard Report Report Date: 16-FEB-22 Date Received: 11-FEB-22 Previous Site Name: Lot/Building Size: Additional Info Ordered: Fire Insur. Maps and/or Site Plans					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -79.7945198 Y: 43.3262256					
58	1 of 1	NW/115.3	82.4 / 0.94	2085 Pine St Burlington ON L7R1G1	EHS
Order No: 20140512025 Status: C Report Type: Standard Report Report Date: 13-MAY-14 Date Received: 12-MAY-14 Previous Site Name: Lot/Building Size: Additional Info Ordered: Title Searches; City Directory					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -79.793849 Y: 43.326857					
59	1 of 1	ENE/115.4	79.9 / -1.58	2119 LAKSHORE RD Burlington ON	WWIS
Well ID: 7280352 Construction Date: Use 1st: Use 2nd: Monitoring Final Well Status: Observation Wells Water Type: Casing Material: Audit No: Z220723 Tag: A165774 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: BURLINGTON CITY Site Info: PDF URL (Map): Additional Detail(s) (Map) Well Completed Date: 2016/11/29 Year Completed: 2016 Depth (m): 12.192 Latitude: 43.3265608381323 Longitude: -79.7914385599316 Path: Bore Hole Information Bore Hole ID: 1006349422 DP2BR: Spatial Status:					
Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 01-Feb-2017 00:00:00 Selected Flag: TRUE Abandonment Rec: Contractor: 7484 Form Version: 7 Owner: County: HALTON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
Elevation: Elevrc: Zone: 17					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Code OB:				East83:	597985.00
Code OB Desc:				North83:	4797789.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	29-Nov-2016 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1006547630			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		05			
Mat2 Desc:		CLAY			
Mat3:		06			
Mat3 Desc:		SILT			
Formation Top Depth:		0.0			
Formation End Depth:		8.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1006547631			
Layer:		2			
Color:		7			
General Color:		RED			
Mat1:		17			
Most Common Material:		SHALE			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		8.0			
Formation End Depth:		40.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1006547640			
Layer:		2			
Plug From:		29.0			
Plug To:		40.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1006547639			
Layer:		1			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug From:		0.0			
Plug To:		29.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1006547638			
Method Construction Code:		B			
Method Construction:		Other Method			
Other Method Construction:		AUGER			
<u>Pipe Information</u>					
Pipe ID:		1006547629			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1006547635			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		30.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1006547636			
Layer:		1			
Slot:		10			
Screen Top Depth:		30.0			
Screen End Depth:		40.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.5			
<u>Water Details</u>					
Water ID:		1006547634			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					
Hole ID:		1006547633			
Diameter:		32.0			
Depth From:		8.0			
Depth To:		40.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Hole Diameter</u>					
Hole ID:	1006547632				
Diameter:	6.0				
Depth From:	0.0				
Depth To:	8.0				
Hole Depth UOM:	ft				
Hole Diameter UOM:	inch				
<u>Links</u>					
Bore Hole ID:	1006349422			Tag No:	A165774
Depth M:	12.192			Contractor:	7484
Year Completed:	2016			Path:	
Well Completed Dt:	2016/11/29			Latitude:	43.3265608381323
Audit No:	Z220723			Longitude:	-79.7914385599316
60	1 of 1	W/121.1	83.9 / 2.47	ON	BORE
Borehole ID:	622393			Inclin FLG:	No
OGF ID:	215522847			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:	Geotechnical/Geological Investigation			Primary Name:	
Completion Date:	SEP-1970			Municipality:	
Static Water Level:				Lot:	
Primary Water Use:	Not Used			Township:	
Sec. Water Use:				Latitude DD:	43.325819
Total Depth m:	4.6			Longitude DD:	-79.79479
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	597715
Drill Method:	Power auger			Northing:	4797703
Orig Ground Elev m:	83.8			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	82.2				
Concession:					
Location D:					
Survey D:					
Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:	218425413			Mat Consistency:	Dense
Top Depth:	2.4			Material Moisture:	
Bottom Depth:	4.6			Material Texture:	
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Till			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	glacial
Gsc Material Description:					
Stratum Description:	TILL,SILT. BROWN,GLACIAL,VERY DENSE, UNIFORM,AGE GLACIAL.				
Geology Stratum ID:	218425412			Mat Consistency:	Compact
Top Depth:	0			Material Moisture:	
Bottom Depth:	2.4			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Fill			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Sand			Geologic Period:	
Material 4:	Organic			Depositional Gen:	fill

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Gsc Material Description:					
Stratum Description:		FILL,SILT,SAND, ORGANIC. MAN-MADE,COMPACT,UNIFORM, AGE POST-GLACIAL.			
Geology Stratum ID:	218425414			Mat Consistency:	
Top Depth:	4.6			Material Moisture:	
Bottom Depth:	4.6			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Bedrock			Geologic Formation:	
Material 2:	Shale			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:		BEDROCK,SHALE. AGE UNDIFFERENTIATED. 000000120008008500093 **Note: Many records provided by the department have a truncated [Stratum Description] field.			
Source					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada			Source Iden:	1
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:	M			Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Details:	File: HAM.txt RecordID: 013930 NTS_Sheet: 30M05C				
Confiden 1:	Reliable information but incomplete.				
Source List					
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Originators:	Geological Survey of Canada				
61	1 of 1	W/121.2	83.7 / 2.21	ON	BORE
Borehole ID:	622391			Inclin FLG:	No
OGF ID:	215522845			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:	Geotechnical/Geological Investigation			Primary Name:	
Completion Date:	SEP-1970			Municipality:	
Static Water Level:				Lot:	
Primary Water Use:	Not Used			Township:	
Sec. Water Use:				Latitude DD:	43.325729
Total Depth m:	-999			Longitude DD:	-79.794791
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	597715
Drill Method:	Power auger			Northing:	4797693
Orig Ground Elev m:	83.8			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	82.1				
Concession:					
Location D:					
Survey D:					
Comments:					
Borehole Geology Stratum					
Geology Stratum ID:	218425408			Mat Consistency:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB																																										
Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description: 4.4 Refusal REFUSAL OF ENTRY. 000000010009010500105E **Note: Many records provided by the department have a truncated [Stratum Description] field. Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description: 218425407 2.7 4.4 Brown Till Silt TILL,SILT. BROWN,GLACIAL,VERY DENSE, UNIFORM,AGE GLACIAL. Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description: 218425406 0 2.7 Fill Silt Clay Concrete FILL,SILT,CLAY, CONCRETE. MAN-MADE,VERY LOOSE, AGE POST-GLACIAL. Source Type: Source Orig: Source Date: Confidence: Observatio: Source Name: Source Details: Confiden 1: Data Survey Geological Survey of Canada 1956-1972 M Urban Geology Automated Information System (UGAIS) File: HAM.txt RecordID: 013910 NTS_Sheet: 30M05C Reliable information but incomplete. Source Appl: Source Iden: Scale or Res: Horizontal: Verticalda: Spatial/Tabular 1 Varies NAD27 Mean Average Sea Level Source Identifier: Source Type: Source Date: Scale or Resolution: Source Name: Source Originators: 1 Data Survey 1956-1972 Varies Urban Geology Automated Information System (UGAIS) Geological Survey of Canada Horizontal Datum: Vertical Datum: Projection Name: NAD27 Mean Average Sea Level Universal Transverse Mercator <tr><td>62</td><td>1 of 1</td><td>NW/123.5</td><td>82.8 / 1.34</td><td>987032 Ontario Inc. 2082 Pine Street, Burlington, Ontario, ON L7R 1G2</td><td>RSC</td></tr> <tr><td>RSC ID:</td><td>2194</td><td></td><td></td><td>Cert Date:</td><td>19-Aug-05</td></tr> <tr><td>RA No:</td><td></td><td></td><td></td><td>Cert Prop Use No:</td><td>No CPU</td></tr> <tr><td>RSC Type:</td><td></td><td></td><td></td><td>Intended Prop Use:</td><td>Residential</td></tr> <tr><td>Curr Property Use:</td><td>Residential</td><td></td><td></td><td>Qual Person Name:</td><td>Mr. David Gowans</td></tr> <tr><td>Ministry District:</td><td>BURLINGTON</td><td></td><td></td><td>Stratified (Y/N):</td><td></td></tr> <tr><td>Filing Date:</td><td>29-Sep-05</td><td></td><td></td><td>Audit (Y/N):</td><td></td></tr>						62	1 of 1	NW/123.5	82.8 / 1.34	987032 Ontario Inc. 2082 Pine Street, Burlington, Ontario, ON L7R 1G2	RSC	RSC ID:	2194			Cert Date:	19-Aug-05	RA No:				Cert Prop Use No:	No CPU	RSC Type:				Intended Prop Use:	Residential	Curr Property Use:	Residential			Qual Person Name:	Mr. David Gowans	Ministry District:	BURLINGTON			Stratified (Y/N):		Filing Date:	29-Sep-05			Audit (Y/N):	
62	1 of 1	NW/123.5	82.8 / 1.34	987032 Ontario Inc. 2082 Pine Street, Burlington, Ontario, ON L7R 1G2	RSC																																										
RSC ID:	2194			Cert Date:	19-Aug-05																																										
RA No:				Cert Prop Use No:	No CPU																																										
RSC Type:				Intended Prop Use:	Residential																																										
Curr Property Use:	Residential			Qual Person Name:	Mr. David Gowans																																										
Ministry District:	BURLINGTON			Stratified (Y/N):																																											
Filing Date:	29-Sep-05			Audit (Y/N):																																											

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Date Ack: Date Returned: Restoration Type: Soil Type: Criteria: CPU Issued Sect No 1686: Asmt Roll No: 2402060-60810000 Prop ID No (PIN): 07065-0050 Property Municipal Address: 2082 Pine Street, Burlington, Ontario, Mailing Address: 2400 Wyecroft Road, Unit 6, Oakville, Ontario , L6L M8 Latitude & Latitude: 43.32488990N 79.79437010W (converted from UTM) UTM Coordinates: NAD83 17-597750-4797600 Consultant: Legal Desc: PT LOT 11 BLK P, COMPILED PLAN PL92, PT LOT 12 BLK P, COMPILED PLAN PL92, PT LOT 13 BLK P, COMPILED PLAN PL92, AS IN 529136, EXCEPT PT 1 20R5223; BURLINGTON Measurement Method: Interpolation from a map Applicable Standards: ESA Phase 1 RSC PDF:					
Entire Leg Prop. (Y/N): Yes Accuracy Estimate: 11 to 20 meters Telephone: 905-4694455 Fax: 905-4694170 Email:					
63	1 of 1	NW/123.6	83.6 / 2.13	987032 Ontario Inc. 2078 Pine Street, Burlington, Ontario Burlington ON L7R 1G2	RSC
RSC ID: 2193 RA No: RSC Type: Curr Property Use: Residential Ministry District: BURLINGTON Filing Date: 29-Sep-05 Date Ack: Date Returned: Restoration Type: Soil Type: Criteria: CPU Issued Sect No 1686: Asmt Roll No: 2402060-60809900 Prop ID No (PIN): 07065-0051 Property Municipal Address: 2078 Pine Street, Burlington, Ontario Mailing Address: 2400 Wyecroft Road, Unit 6, Oakville, Ontario , L6L 6M8 Latitude & Latitude: 43.32488990N 79.79437010W (converted from UTM) UTM Coordinates: NAD83 17-597750-4797600 Consultant: Legal Desc: PT LT 1 BLK P, COMPLIED PLAN PL92, PT LT 2 BLK P, COMPLIED PLAN PL92, PT LT 3 BLK P, COMPLIED PLAN PL92,, AS IN 503528, EXCEPT PT4 20R6031; BURLINGTON Measurement Method: Interpolation from a map Applicable Standards: ESA Phase 1 RSC PDF:					
Cert Date: 19-Aug-05 Cert Prop Use No: No CPU Intended Prop Use: Residential Qual Person Name: Mr. David Gowans Stratified (Y/N): Audit (Y/N): Entire Leg Prop. (Y/N): Yes Accuracy Estimate: 11 to 20 meters Telephone: 905-4694455 Fax: 905-4694170 Email:					
64	1 of 1	NW/123.9	82.4 / 0.94	2086 Pine St BURLINGTON ON L7R 1G2	HINC
External File Num: FS INC 0803-01277 Fuel Occurrence Type: Pipeline Strike Date of Occurrence: 1/8/2008 Fuel Type Involved: Natural Gas Status Desc: Completed - Causal Analysis(End) Job Type Desc: Incident/Near-Miss Occurrence (FS) Oper. Type Involved: Construction Site (pipeline strike) Service Interruptions: Yes Property Damage: No Fuel Life Cycle Stage: Transmission, Distribution and Transportation Root Cause: Root Cause: Equipment/Material/Component:No Procedures:Yes Maintenance:No Design:No Training:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
		Yes	Management:Yes	Human Factors:Yes	
Reported Details:					
Fuel Category:		Gaseous Fuel			
Occurrence Type:		Incident			
Affiliation:		Industry Stakeholder (Licensee/Registration/Certificate Holder, Facility Owner, etc.)			
County Name:		Halton			
Approx. Quant. Rel:					
Nearby body of water:					
Enter Drainage Syst.:					
Approx. Quant. Unit:					
Environmental Impact:					
65	1 of 3	W/125.7	83.6 / 2.13	BURLINGTON HYDRO-ELECTRIC COMM 399 ELIZABETH STREET TRANSFORMER BURLINGTON CITY ON	SPL
Ref No:		71095		Discharger Report:	
Site No:				Material Group:	
Incident Dt:		5/23/1992		Health/Env Conseq:	
Year:				Client Type:	
Incident Cause:		COOLING SYSTEM LEAK		Sector Type:	
Incident Event:				Agency Involved:	
Contaminant Code:				Nearest Watercourse:	
Contaminant Name:				Site Address:	
Contaminant Limit 1:				Site District Office:	
Contam Limit Freq 1:				Site Postal Code:	
Contaminant UN No 1:				Site Region:	
Environment Impact:		NOT ANTICIPATED		Site Municipality: 14101	
Nature of Impact:				Site Lot:	
Receiving Medium:		LAND		Site Conc:	
Receiving Env:				Northing:	
MOE Response:				Easting:	
Dt MOE Arvl on Scn:				Site Geo Ref Accu:	
MOE Reported Dt:		5/23/1992		Site Map Datum:	
Dt Document Closed:				SAC Action Class:	
Incident Reason:		GASKET/JOINT		Source Type:	
Site Name:					
Site County/District:					
Site Geo Ref Meth:					
Incident Summary:		BURLINGTON HYDRO: 10 L TRANSFORMER OIL TO GROUND			
Contaminant Qty:					
65	2 of 3	W/125.7	83.6 / 2.13	BAXTER'S WHARF INC. 399 ELIZABETH STREET, BURLINGTON, ONTARIO , L7R 2L7 ON L7R 0A4	RSC
RSC ID:		1311		Cert Date: 15-Jul-04	
RA No:				Cert Prop Use No: No CPU	
RSC Type:				Intended Prop Use: Residential	
Curr Property Use:		Commercial		Qual Person Name: VINCE MOLINARO	
Ministry District:		BURLINGTON		Stratified (Y/N):	
Filing Date:		8-Feb-05		Audit (Y/N):	
Date Ack:				Entire Leg Prop. (Y/N): Yes	
Date Returned:				Accuracy Estimate: 501 to 1,000 meters	
Restoration Type:				Telephone: 905-5291123	
Soil Type:				Fax: 905-5297969	
Criteria:				Email: vincemol@molinaro.ca	
CPU Issued Sect		No			
1686:					
Asmt Roll No:		2402-060-608-02200-0000			
Prop ID No (PIN):					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Property Municipal Address: Mailing Address: Latitude & Longitude: UTM Coordinates: Consultant: Legal Desc:		399 ELIZABETH STREET, BURLINGTON, ONTARIO , L7R 2L7 Suite 1ST FLOOR, 155 MARKET ST, HAMILTON, ON, L8R 3H5 43.32579670N 79.79496890W (converted from UTM) NAD83 17-597700-4797700 LOT 2, BLOCK O, COMPILED PLAN PL92, LOT 3, BLOCK O, COMPILED PLAN PL92, PART LOT 1, BLOCK O, COMPILED PLAN PL92, PART LOT 4, BLOCK O, COMPILED PLAN PL92, AND PART LOT 5, BLOCK O, COMPILED PLAN PL92, DESIGNATED AS PART 1 ON REFERENCE PLAN 20R-7161, CITY OF BURLINGTON, REGIONAL MUNICIPALITY OF HALTON, LAND REGISTRY OFFICE FOR THE LAND TITLES DIVISION OF HALTON (No. 20) Measurement Method: Applicable Standards: RSC PDF:			
		Interpolation from a map Full Depth Site Conditions Standard, with Nonpotable Ground Water, Coarse Textured Soil, for Residential/Parkland/Institutional property use			

65	3 of 3	W/125.7	83.6 / 2.13	399 Elizabeth Street Burlington ON	SPL
Ref No: Site No: Incident Dt: Year: Incident Cause: Incident Event: Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Environment Impact: Nature of Impact: Receiving Medium: Receiving Env: MOE Response: Dt MOE Arvl on Scn: MOE Reported Dt: Dt Document Closed:		3207-B2BNVE NA 2018/06/30 Operator/Human error 46 COOKING GREASE n/a Land No 2018/07/03		Discharger Report: Material Group: Health/Env Conseq: Client Type: Sector Type: Agency Involved: Nearest Watercourse: Site Address: Site District Office: Site Postal Code: Site Region: Site Municipality: Site Lot: Site Conc: Northing: Easting: Site Geo Ref Accu: Site Map Datum: SAC Action Class: Source Type:	
		2 - Minor Environment Miscellaneous Communal 399 Elizabeth Street Halton-Peel Central Burlington 4797683 597710 Pollution Incident Reports (PIRs) and "Other" calls Other			
Incident Reason: Site Name: Site County/District: Site Geo Ref Meth: Incident Summary: Contaminant Qty:		Deliberate Act The Baxter (apartment building)<UNOFFICIAL> Regional Municipality of Halton Progress Property Management- 15L used oil to cb 15 L			

66	1 of 2	W/130.4	83.9 / 2.48	Pearl & Pine St. Facility Inc. 398 PEARL ST, BURLINGTON, ON, L7R 2M9 BURLINGTON ON L7R 2M9	RSC
RSC ID: RA No: RSC Type: Curr Property Use: Ministry District: Filing Date: Date Ack: Date Returned: Restoration Type: Soil Type: Criteria: CPU Issued Sect 1686: Asmt Roll No:		45459 Commercial BURLINGTON 19-Aug-08 No		Cert Date: Cert Prop Use No: Intended Prop Use: Qual Person Name: Stratified (Y/N): Audit (Y/N): Entire Leg Prop. (Y/N): Accuracy Estimate: Telephone: Fax: Email:	
				20-Aug-07 No CPU Residential Bennie Seliger Yes 11 to 20 meters 416-6409659 416-6462673 bseliger@rshdevco.com	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Prop ID No (PIN): Property Municipal Address: Mailing Address: Latitude & Longitude: UTM Coordinates: Consultant: Legal Desc: Measurement Method: Applicable Standards: RSC PDF:		07065 - 0014 LT 398 PEARL ST, BURLINGTON, ON, L7R 2M9 Suite 1200, 22 ST. CLAIRE AVE E, TORONTO, ON, M4T 2S3 43.32618030N 79.79462830W (converted from UTM) NAD83 17-597727-4797743 LT 11 BLK O , Compiled Plan PL92 ; LT 12 BLK O , Compiled Plan PL92 , EXCEPT PT 2 20R5331 ; BURLINGTON Interpolation from a map Full Depth Site Conditions Standard, with Potable Ground Water, Coarse Textured Soil, for Residential/Parkland/Institutional property use			

662 of 2W/130.483.9 / 2.48Reichman Seniors Housing Development392,398 Pearl StreetBurlington ON L7R 2M9GEN

Generator No:ON7923094SIC Code:210250SIC Description:Approval Years:2009PO Box No:Country:Status:Co Admin:Choice of Contact:Phone No Admin:Contaminated Facility:MHSW Facility:

Detail(s)

Waste Class:135Waste Class Name:REACTIVE ANION WASTES

Waste Class:145Waste Class Name:PAINT/PIGMENT/COATING RESIDUES

Waste Class:251Waste Class Name:OIL SKIMMINGS & SLUDGES

Waste Class:262Waste Class Name:DETERGENTS/SOAPS

Waste Class:331Waste Class Name:WASTE COMPRESSED GASES

67	1 of 1	W/131.0	83.6 / 2.14	ON	BORE
Borehole ID:		622392	Inclin FLG:		No
OGF ID:		215522846	SP Status:		Initial Entry
Status:			Surv Elev:		No
Type:		Borehole	Piezometer:		No
Use:		Geotechnical/Geological Investigation	Primary Name:		
Completion Date:		SEP-1970	Municipality:		
Static Water Level:			Lot:		
Primary Water Use:		Not Used	Township:		
Sec. Water Use:			Latitude DD:		43.32582
Total Depth m:		4.6	Longitude DD:		-79.794913
Depth Ref:		Ground Surface	UTM Zone:		17
Depth Elev:			Easting:		597705
Drill Method:		Power auger	Northing:		4797703

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Orig Ground Elev m: Elev Reliabil Note: DEM Ground Elev m: Concession: Location D: Survey D: Comments:	83.8 82.4			Location Accuracy: Accuracy:	Not Applicable
<u>Borehole Geology Stratum</u>					
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218425410 2.1 4.6 Brown Till Silt TILL,SILT. BROWN,GLACIAL,VERY DENSE, UNIFORM,AGE GLACIAL.			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	Dense glacial
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218425409 0 2.1 Fill Sand Silt Organic FILL,SAND,SILT, ORGANIC. MAN-MADE,COMPACT,UNIFORM, AGE POST-GLACIAL.			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	Compact fill
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218425411 4.6 4.6 Bedrock Shale BEDROCK,SHALE. AGE UNDIFFERENTIATED. 000000120007016400125 **Note: Many records provided by the department have a truncated [Stratum Description] field.			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	
<u>Source</u>					
Source Type: Source Orig: Source Date: Confidence: Observatio: Source Name: Source Details: Confiden 1:	Data Survey Geological Survey of Canada 1956-1972 M Urban Geology Automated Information System (UGAIS) File: HAM.txt RecordID: 013920 NTS_Sheet: 30M05C Reliable information but incomplete.			Source Appl: Source Iden: Scale or Res: Horizontal: Verticalda:	Spatial/Tabular 1 Varies NAD27 Mean Average Sea Level
<u>Source List</u>					
Source Identifier: Source Type: Source Date: Scale or Resolution: Source Name: Source Originators:	1 Data Survey 1956-1972 Varies Urban Geology Automated Information System (UGAIS) Geological Survey of Canada			Horizontal Datum: Vertical Datum: Projection Name:	NAD27 Mean Average Sea Level Universal Transverse Mercator

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
68	1 of 1	ENE/132.5	79.3 / -2.16	2107 And 2119 Old Lakeshore Road Burlington ON	EHS
Order No: 20161124016 Status: C Report Type: Standard Report Report Date: 30-NOV-16 Date Received: 24-NOV-16 Previous Site Name: Lot/Building Size: Additional Info Ordered:		Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -79.791292 Y: 43.326673			
69	1 of 2	WSW/133.2	82.2 / 0.73	PUC VENTURE INN PARKING LOT LAKESHORE AND ELIZABETH MOTOR VEHICLE (OPERATING FLUID) BURLINGTON CITY ON	SPL
Ref No: 43204 Site No: Incident Dt: 11/9/1990 Year: Incident Cause: PIPE/HOSE LEAK Incident Event: Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Environment Impact: POSSIBLE Nature of Impact: Soil contamination Receiving Medium: LAND Receiving Env: MOE Response: Dt MOE Arvl on Scn: MOE Reported Dt: 11/9/1990 Dt Document Closed: Incident Reason: OVERSTRESS/OVERPRESSURE Site Name: Site County/District: Site Geo Ref Meth: Incident Summary: BURLINGTON PUC VEHICLE- 8 L HYDRAULIC OIL TO PARKING LOT. Contaminant Qty:		Discharger Report: Material Group: Health/Env Conseq: Client Type: Sector Type: Agency Involved: Nearest Watercourse: Site Address: Site District Office: Site Postal Code: Site Region: Site Municipality: 14101 Site Lot: Site Conc: Northing: Easting: Site Geo Ref Accu: Site Map Datum: SAC Action Class: Source Type:			
69	2 of 2	WSW/133.2	82.2 / 0.73	PIPELINE HIT 6" ELIZABETH ST & LAKESHORE RD,, BURLINGTON,ON,L7R 0A4,CA ON	PINC
Incident Id: Incident No: 2320040 Incident Reported Dt: 6/5/2018 Type: FS-Pipeline Incident Status Code: Tank Status: Pipeline Damage Reason Est Task No: Spills Action Centre: Fuel Type: Fuel Occurrence Tp: Date of Occurrence:		Pipe Material: Fuel Category: Health Impact: Environment Impact: Property Damage: Service Interrupt: Enforce Policy: Public Relation: Pipeline System: PSIG: Attribute Category:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Occurrence Start Dt: Depth: Customer Acct Name: Incident Address: Operation Type: Pipeline Type: Regulator Type: Summary: Reported By: Affiliation: Occurrence Desc: Damage Reason: Notes:					
Regulator Location: Method Details:					
PIPELINE HIT 6" ELIZABETH ST & LAKESHORE RD,,BURLINGTON,ON,L7R 0A4,CA					
70	1 of 2	N/134.7	79.1 / -2.39	395 Martha Street Burlington ON L7R 4A9	EHS
Order No: 22011800394 Status: C Report Type: Standard Report Report Date: 21-JAN-22 Date Received: 18-JAN-22 Previous Site Name: Lot/Building Size: Additional Info Ordered: Fire Insur. Maps and/or Site Plans					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -79.7929434 Y: 43.3273537					
70	2 of 2	N/134.7	79.1 / -2.39	395 Martha Street Burlington ON L7R 4A9	EHS
Order No: 22011800394 Status: C Report Type: Standard Report Report Date: 21-JAN-22 Date Received: 18-JAN-22 Previous Site Name: Lot/Building Size: Additional Info Ordered: Fire Insur. Maps and/or Site Plans					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -79.7929434 Y: 43.3273537					
71	1 of 1	NE/144.1	78.0 / -3.48	Sun Mechanical 2121 Lakeshore Road Burlington ON	GEN
Generator No: ON8629510 SIC Code: 238220 SIC Description: Plumbing Heating and Air-Conditioning Contractors Approval Years: 2012 PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
72	1 of 5	ENE/144.6	79.3 / -2.19	BURLINGTON HYDRO-ELECTRIC COMM 2119 LAKESHORE BLVD. AT JUNCTION ST. TRANSFORMER BURLINGTON CITY ON L7R 1A4	SPL

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Ref No: Site No: Incident Dt: Year: Incident Cause: Incident Event: Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Environment Impact: Nature of Impact: Receiving Medium: Receiving Env: MOE Response: Dt MOE Arvl on Scn: MOE Reported Dt: Dt Document Closed: Incident Reason: Site Name: Site County/District: Site Geo Ref Meth: Incident Summary: Contaminant Qty:	133345 10/22/1996 OTHER CONTAINER LEAK POSSIBLE Water course or lake LAND / WATER 10/22/1996 CORROSION			Discharger Report: Material Group: Health/Env Conseq: Client Type: Sector Type: Agency Involved: Nearest Watercourse: Site Address: Site District Office: Site Postal Code: Site Region: Site Municipality: 14101 Site Lot: Site Conc: Northing: Easting: Site Geo Ref Accu: Site Map Datum: SAC Action Class: Source Type:	
				BURLINGTON HYDRO-99L OF TRANSFORMER OIL TO GROUND DUE TO ROTTEN POLE.	
72	2 of 5	ENE/144.6	79.3 / -2.19	LMC Clinical Research Inc. Research 2119 Lakeshore Road Burlington ON L7R 1A4	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:	ON8001894 As of Dec 2018 N/A Canada Registered				
<u>Detail(s)</u>					
Waste Class: Waste Class Name:	261 A Pharmaceuticals				
Waste Class: Waste Class Name:	312 P Pathological wastes				
72	3 of 5	ENE/144.6	79.3 / -2.19	AVIVA Medical Specialists Clinic 2119 Old Lakeshore Rd. Burlington ON L7R1A4	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country: Status:	ON4373261 As of Dec 2018 Canada Registered				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
Detail(s)					
Waste Class: Waste Class Name:		312 P Pathological wastes			
72	4 of 5	ENE/144.6	79.3 / -2.19	AVIVA Medical Specialists Clinic 2119 Old Lakeshore Rd. Burlington ON L7R1A4	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:		ON4373261 As of Oct 2019 Canada Registered			
Detail(s)					
Waste Class: Waste Class Name:		312 P Pathological wastes			
72	5 of 5	ENE/144.6	79.3 / -2.19	LMC Clinical Research Inc. Research 2119 Lakeshore Road Burlington ON L7R 1A4	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:		ON8001894 As of Oct 2019 N/A Canada Registered			
Detail(s)					
Waste Class: Waste Class Name:		261 A Pharmaceuticals			
Waste Class: Waste Class Name:		312 P Pathological wastes			
73	1 of 1	ENE/149.6	79.1 / -2.37	2107 Old Lakeshore Rd Burlington ON	WWIS

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Well ID:	7356014			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Observation Wells			Date Received:	25-Mar-2020 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z307809			Contractor:	7247
Tag:	A174094			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	HALTON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	BURLINGTON CITY				
Site Info:					

PDF URL (Map):

Additional Detail(s) (Map)

Well Completed Date: 2019/03/26
Year Completed: 2019
Depth (m): 7.62
Latitude: 43.3267008387402
Longitude: -79.7910534279354
Path:

Bore Hole Information

Bore Hole ID:	1008225702	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	598016.00
Code OB Desc:		North83:	4797805.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	26-Mar-2019 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Loc Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Overburden and Bedrock

Materials Interval

Formation ID: 1008360794
Layer: 1
Color: 6
General Color: BROWN
Mat1: 01
Most Common Material: FILL
Mat2:
Mat2 Desc:
Mat3:

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Mat3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		5.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1008360795			
Layer:		2			
Color:		7			
General Color:		RED			
Mat1:		06			
Most Common Material:		SILT			
Mat2:		34			
Mat2 Desc:		TILL			
Mat3:					
Mat3 Desc:					
Formation Top Depth:		5.0			
Formation End Depth:		25.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008361511			
Layer:		1			
Plug From:		0.0			
Plug To:		13.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1008362547			
Method Construction Code:		2			
Method Construction:		Rotary (Convent.)			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1008360218			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1008362773			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		15.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		Inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1008363071			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:					
		1			
Slot:					
		10			
Screen Top Depth:					
		15.0			
Screen End Depth:					
		25.0			
Screen Material:					
		5			
Screen Depth UOM:					
		ft			
Screen Diameter UOM:					
		inch			
Screen Diameter:					
		2.125			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1008363513			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:		0			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Water Details</u>					
Water ID:		1008363360			
Layer:					
		1			
Kind Code:					
		8			
Kind:					
		Untested			
Water Found Depth:					
		20.0			
Water Found Depth UOM:					
		ft			
<u>Hole Diameter</u>					
Hole ID:		1008362220			
Diameter:					
		6.0			
Depth From:					
		0.0			
Depth To:					
		25.0			
Hole Depth UOM:					
		ft			
Hole Diameter UOM:					
		Inch			
<u>Links</u>					
Bore Hole ID:		1008225702		Tag No:	A174094
Depth M:		7.62		Contractor:	7247
Year Completed:		2019		Path:	735\7356014.pdf
Well Completed Dt:		2019/03/26		Latitude:	43.3267008387402
Audit No:		Z307809		Longitude:	-79.7910534279354
74	1 of 1	W/161.1	84.7 / 3.21	VILLAGE SQUARE (BURLINGTON) 2049 PINE ST., UNITS 17 & 18 BURLINGTON ON L7R 1E9	CA
Certificate #:					
		8-3211-98-			
Application Year:					
		98			
Issue Date:					
		6/1/1998			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Approval Type: Status: Application Type: Client Name: Client Address: Client City: Client Postal Code: Project Description: Contaminants: Emission Control:		Industrial air Approved			
75	1 of 1	WSW/168.2	81.8 / 0.38	1536493 Ont. Inc. 391 John St Burlington ON L7R 2K3	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:		ON8545477 453999 All Other Miscellaneous Store Retailers (except Beer and Wine-Making Supplies Stores) 04			
76	1 of 1	NE/171.1	76.8 / -4.60	ON	BORE
Borehole ID: OGF ID: Status: Type: Use: Completion Date: Static Water Level: Primary Water Use: Sec. Water Use: Total Depth m: Depth Ref: Depth Elev: Drill Method: Orig Ground Elev m: Elev Reliabil Note: DEM Ground Elev m: Concession: Location D: Survey D: Comments:		621665 215522119 Borehole Geotechnical/Geological Investigation NOV-1970 Not Used 7.7 Ground Surface Power auger 80.8 78.2		Inclin FLG: SP Status: Surv Elev: Piezometer: Primary Name: Municipality: Lot: Township: Latitude DD: Longitude DD: UTM Zone: Easting: Northing: Location Accuracy: Accuracy:	No Initial Entry No No 43.327223 -79.791308 17 597995 4797863 Not Applicable
<u>Borehole Geology Stratum</u>					
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4:		218421908 .6 3 Brown Silt Sand Clay		Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	Dense glacial

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Gsc Material Description:					
Stratum Description:		SILT,SAND,CLAY. BROWN,VERY DENSE,AGE GLACIAL.			
Geology Stratum ID:	218421909			Mat Consistency:	Hard
Top Depth:	3			Material Moisture:	
Bottom Depth:	7.7			Material Texture:	
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Silt			Geologic Formation:	
Material 2:	Clay			Geologic Group:	
Material 3:	Shale			Geologic Period:	
Material 4:				Depositional Gen:	glacial
Gsc Material Description:					
Stratum Description:		SILT,CLAY,SHALE. BROWN,HARD,LAMINATED, AGE GLACIAL. 000200830010042000040 **Note: Many records provided by the department have a truncated [Stratum Description] field.			
Geology Stratum ID:	218421907			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	.6			Material Texture:	
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Soil			Geologic Formation:	
Material 2:	Sand			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:		SOIL,SAND. BROWN,SURFACE, AGE POST-GLACIAL.			
Source					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada			Source Iden:	1
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:	M			Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Details:	File: HAM.txt RecordID: 006640 NTS_Sheet: 30M05C				
Confiden 1:	Reliable information but incomplete.				
Source List					
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Originators:	Geological Survey of Canada				
77	1 of 1	W/176.4	83.8 / 2.35	2037 PINE ST, BURLINGTON ON	INC
Incident No:	1256122			Any Health Impact:	No
Incident ID:				Any Enviro Impact:	No
Instance No:				Service Interrupted:	Yes
Status Code:				Was Prop Damaged:	No
Attribute Category:	FS-Perform L1 Incident Insp			Reside App. Type:	
Context:				Commer App. Type:	
Date of Occurrence:	2013/10/01 00:00:00			Indus App. Type:	
Time of Occurrence:	NULL			Institut App. Type:	
Incident Created On:				Venting Type:	
Instance Creation Dt:				Vent Conn Mater:	
Instance Install Dt:				Vent Chimney Mater:	
Occur Insp Start Date:	2013/10/01 00:00:00			Pipeline Type:	
Approx Quant Rel:				Pipeline Involved:	
Tank Capacity:				Pipe Material:	

171 erisinfo.com | Environmental Risk Information Services Order No: 23021400831

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: Site Info:				Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:	
		BURLINGTON CITY			
PDF URL (Map):					
<u>Additional Detail(s) (Map)</u>					
Well Completed Date: Year Completed: Depth (m): Latitude: Longitude: Path:		2016/08/04 2016 15.24 43.3276113475366 -79.7937119003269			
<u>Bore Hole Information</u>					
Bore Hole ID: DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: Remarks: Loc Method Desc: Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:		1006262066 04-Aug-2016 00:00:00 on Water Well Record		Elevation: Elevrc: Zone: East83: North83: Org CS: UTMRC: UTMRC Desc: Location Method:	 17 597799.00 4797903.00 UTM83 4 margin of error : 30 m - 100 m wwr
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID: Layer: Color: General Color: Mat1: Most Common Material: Mat2: Mat2 Desc: Mat3: Mat3 Desc: Formation Top Depth: Formation End Depth: Formation End Depth UOM:		1006392050 1 6 BROWN 11 GRAVEL 28 SAND 01 FILL 0.0 2.0 ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID: Laver:		1006392051 2			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Color:		2			
General Color:		GREY			
Mat1:		06			
Most Common Material:		SILT			
Mat2:		28			
Mat2 Desc:		SAND			
Mat3:		05			
Mat3 Desc:		CLAY			
Formation Top Depth:		2.0			
Formation End Depth:		7.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1006392052			
Layer:		3			
Color:		2			
General Color:		GREY			
Mat1:		17			
Most Common Material:		SHALE			
Mat2:					
Mat2 Desc:					
Mat3:		92			
Mat3 Desc:		WEATHERED			
Formation Top Depth:		7.0			
Formation End Depth:		50.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1006392061			
Layer:		2			
Plug From:		19.0			
Plug To:		50.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1006392060			
Layer:		1			
Plug From:		0.0			
Plug To:		19.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		1006392059			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:		DIAMOND			
<u>Pipe Information</u>					
Pipe ID:		1006392049			
Casing No:		0			
Comment:					
Alt Name:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Construction Record - Casing</u>					
Casing ID:		1006392056			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		20.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1006392057			
Layer:		1			
Slot:		10			
Screen Top Depth:		20.0			
Screen End Depth:		50.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.5			
<u>Water Details</u>					
Water ID:		1006392055			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					
Hole ID:		1006392053			
Diameter:		6.0			
Depth From:		0.0			
Depth To:		7.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
<u>Hole Diameter</u>					
Hole ID:		1006392054			
Diameter:		4.0			
Depth From:		7.0			
Depth To:		50.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
<u>Links</u>					
Bore Hole ID:	1006262066		Tag No:	A206289	
Depth M:	15.24		Contractor:	7472	
Year Completed:	2016		Path:	727\7272672.pdf	
Well Completed Dt:	2016/08/04		Latitude:	43.3276113475366	
Audit No:	Z239817		Longitude:	-79.7937119003269	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
81	1 of 1	NNW/178.8	79.8 / -1.62	409 MARTHA STREET BURLINGTON ON	WWIS
Well ID: 7323240 Construction Date: Use 1st: Monitoring Use 2nd: Final Well Status: Observation Wells Water Type: Casing Material: Audit No: Z290747 Tag: A250428 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: BURLINGTON CITY Site Info: Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 22-Nov-2018 00:00:00 Selected Flag: TRUE Abandonment Rec: Contractor: 7472 Form Version: 7 Owner: County: HALTON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
PDF URL (Map):					
<u>Additional Detail(s) (Map)</u>					
Well Completed Date: 2018/08/15 Year Completed: 2018 Depth (m): 4.572 Latitude: 43.3275939927425 Longitude: -79.7937739150409 Path:					
<u>Bore Hole Information</u>					
Bore Hole ID: 1007317561 DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: 15-Aug-2018 00:00:00 Remarks: Loc Method Desc: on Water Well Record Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment: Elevation: Elevrc: Zone: 17 East83: 597794.00 North83: 4797901.00 Org CS: UTM83 UTMRC: 4 UTMRC Desc: margin of error : 30 m - 100 m Location Method: wwr					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID: 1007641657 Layer: 1 Color: 6 General Color: BROWN Mat1: 34 Most Common Material: TILL					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Mat2:		28			
Mat2 Desc:		SAND			
Mat3:		85			
Mat3 Desc:		SOFT			
Formation Top Depth:		0.0			
Formation End Depth:		5.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1007641658			
Layer:		2			
Color:		7			
General Color:		RED			
Mat1:		17			
Most Common Material:		SHALE			
Mat2:					
Mat2 Desc:					
Mat3:		73			
Mat3 Desc:		HARD			
Formation Top Depth:		5.0			
Formation End Depth:		15.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1007641665			
Layer:		1			
Plug From:		0.0			
Plug To:		9.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1007641666			
Layer:		2			
Plug From:		9.0			
Plug To:		15.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		1007641664			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007641656			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007641661			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		10.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
 <u>Construction Record - Screen</u>					
Screen ID:		1007641662			
Layer:		1			
Slot:		10			
Screen Top Depth:		10.0			
Screen End Depth:		15.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.5			
 <u>Water Details</u>					
Water ID:		1007641660			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
 <u>Hole Diameter</u>					
Hole ID:		1007641659			
Diameter:		6.0			
Depth From:		0.0			
Depth To:		15.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
 <u>Links</u>					
Bore Hole ID:	1007317561			Tag No:	A250428
Depth M:	4.572			Contractor:	7472
Year Completed:	2018			Path:	732\7323240.pdf
Well Completed Dt:	2018/08/15			Latitude:	43.3275939927425
Audit No:	Z290747			Longitude:	-79.7937739150409
82	1 of 1	W/179.3	83.8 / 2.36	ESPRESSO BAR, ROASTERY & DESSERT HOUSE L 413 ELIZABETH STREET BURLINGTON ON L7R 2L8	CA
Certificate #:		8-3173-98-			
Application Year:		98			
Issue Date:		4/21/1998			
Approval Type:		Industrial air			
Status:		Approved			
Application Type:					
Client Name:					
Client Address:					
Client City:					
Client Postal Code:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Project Description:		COMMERCIAL KITCHEN EXHAUST HOOD			
Contaminants:		Odour/Fumes			
Emission Control:		Mist Eliminator,			
83	1 of 1	WNW/180.6	84.8 / 3.39	1121206 ONTARIO INC. 420 PEARL STREET BURLINGTON CITY ON L7R 2N1	CA
Certificate #:		8-3243-95-			
Application Year:		95			
Issue Date:		4/28/1995			
Approval Type:		Industrial air			
Status:		Approved			
Application Type:					
Client Name:					
Client Address:					
Client City:					
Client Postal Code:					
Project Description:		COMMERCIAL KITCHEN EXHAUST SYSTEM			
Contaminants:		Odour/Fumes			
Emission Control:		No Controls			
84	1 of 1	W/187.8	83.0 / 1.52	396 Elizabeth Street Burlington ON L7R 2L6	EHS
Order No:		20190812255		Nearest Intersection:	
Status:		C		Municipality:	
Report Type:		Standard Express Report		Client Prov/State:	
Report Date:		12-AUG-19		Search Radius (km):	
Date Received:		12-AUG-19		X:	
Previous Site Name:				Y:	
Lot/Building Size:					
Additional Info Ordered:					
85	1 of 1	W/190.1	83.0 / 1.52	DESKTOP TEXT & DESIGN 399 JOHN ST UNIT 310 BURLINGTON ON L7R 2K3	SCT
Established:		0000			
Plant Size (ft²):		0			
Employment:		1			
--Details--					
Description:		MISCELLANEOUS PUBLISHING			
SIC/NAICS Code:		2741			
86	1 of 1	NE/194.2	77.4 / -4.01	2137 Lakeshore Road Burlington ON	SPL
Ref No:		1844-AMRS6W		Discharger Report:	
Site No:				Material Group:	
Incident Dt:		5/27/2017		Health/Env Conseq:	
Year:				Client Type:	
Incident Cause:				Sector Type:	
Incident Event:		Leak/Break		Agency Involved:	
Contaminant Code:		44		Nearest Watercourse:	
Contaminant Name:		SEWAGE,RAW UNCHLORINATED		Site Address:	
Contaminant Limit 1:				Site District Office:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Contam Limit Freq 1: n/a Contaminant UN No 1: n/a Environment Impact: Nature of Impact: Receiving Medium: Receiving Env: Land; Surface Water MOE Response: Dt MOE Arvl on Scn: MOE Reported Dt: 5/27/2017 Dt Document Closed: Incident Reason: Equipment Failure Site Name: Pump Station - Junction Street<UNOFFICIAL> Site County/District: Regional Municipality of Halton Site Geo Ref Meth: 10 -100 metres eg. Topographic Map Incident Summary: Region of Halton: swg spill to Rambo Creek; ongoing Contaminant Qty: 1267 m³					
Site Postal Code: Site Region: Central Site Municipality: Burlington Site Lot: Site Conc: Northing: 4797866 Easting: 598023 Site Geo Ref Accu: Site Map Datum: SAC Action Class: Source Type: Sewage Treatment					
87	1 of 1	NNW/194.7	79.8 / -1.69	411 Martha St Burlington ON L7R2P6	EHS
Order No: 20160812015 Status: C Report Type: Standard Report Report Date: 17-AUG-16 Date Received: 12-AUG-16 Previous Site Name: Lot/Building Size: Additional Info Ordered:					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -79.793828 Y: 43.327734					
88	1 of 1	NNW/194.9	79.8 / -1.64	401 Martha Street Burlington ON	EHS
Order No: 20160711032 Status: C Report Type: RSC Report (Urban) Report Date: 12-JUL-16 Date Received: 11-JUL-16 Previous Site Name: Lot/Building Size: Additional Info Ordered:					
Nearest Intersection: Municipality: Burlington Client Prov/State: ON Search Radius (km): .3 X: -79.793659 Y: 43.327788					
89	1 of 2	SW/197.7	79.8 / -1.65	2020 Lakeshore Road Burlington ON L7R 4G8	EHS
Order No: 21031100101 Status: C Report Type: RSC Report (Urban) Report Date: 16-MAR-21 Date Received: 11-MAR-21 Previous Site Name: Lot/Building Size: Additional Info Ordered:					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .3 X: -79.7949017 Y: 43.32443804					
89	2 of 2	SW/197.7	79.8 / -1.65	2020 Lakeshore Road Burlington ON L7R 4G8	EHS
Order No: 21031100101 Status: C Report Type: RSC Report (Urban)					
Nearest Intersection: Municipality: Client Prov/State: ON					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Report Date: 16-MAR-21 Date Received: 11-MAR-21 Previous Site Name: Lot/Building Size: Additional Info Ordered:					
Search Radius (km): .3 X: -79.7949017 Y: 43.32443804					
90	1 of 1	W/204.8	84.3 / 2.82	380 BRANT ST. BURLINGTON ON	WWIS
Well ID: 2810067 Construction Date: Use 1st: Use 2nd: Final Well Status: Observation Wells Water Type: Casing Material: Audit No: Z19529 Tag: A016894 Constructn Method: Elevation (m): Elevatn Reliability: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: BURLINGTON CITY Site Info:					
Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: 1 Date Received: 11-Oct-2004 00:00:00 Selected Flag: TRUE Abandonment Rec: Contractor: 6607 Form Version: 3 Owner: County: HALTON Lot: Concession: Concession Name: BB Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/281\2810067.pdf					
<u>Additional Detail(s) (Map)</u>					
Well Completed Date: 2004/10/08 Year Completed: 2004 Depth (m): 6 Latitude: 43.3261832461781 Longitude: -79.7957629333622 Path: 281\2810067.pdf					
<u>Bore Hole Information</u>					
Bore Hole ID: 11174684 DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: 08-Oct-2004 00:00:00 Remarks: Loc Method Desc: on Water Well Record Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:					
Elevation: Elevrc: Zone: 17 East83: 597635.00 North83: 4797742.00 Org CS: UTM83 UTMRC: 3 UTMRC Desc: margin of error : 10 - 30 m Location Method: wwr					
<u>Overburden and Bedrock</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Materials Interval</u>					
Formation ID:		932974938			
Layer:		2			
Color:		2			
General Color:		GREY			
Mat1:		05			
Most Common Material:		CLAY			
Mat2:		06			
Mat2 Desc:		SILT			
Mat3:					
Mat3 Desc:					
Formation Top Depth:		0.8999999761581421			
Formation End Depth:		4.0			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		932974939			
Layer:		3			
Color:		7			
General Color:		RED			
Mat1:		17			
Most Common Material:		SHALE			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		4.0			
Formation End Depth:		6.0			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		932974937			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		06			
Mat2 Desc:		SILT			
Mat3:					
Mat3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		0.8999999761581421			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		933255931			
Layer:		1			
Plug From:		0.0			
Plug To:		0.15000000596046448			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug ID:		933255932			
Layer:		2			
Plug From:		0.15000000596046448			
Plug To:		2.5999999046325684			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		962810067			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		11183203			
Casing No:		1			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		930845990			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		3.0			
Casing Diameter:		5.0			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		933409581			
Layer:		1			
Slot:		10			
Screen Top Depth:		3.0			
Screen End Depth:		6.0			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.400000095367432			
<u>Water Details</u>					
Water ID:		934052452			
Layer:		1			
Kind Code:					
Kind:					
Water Found Depth:		0.0			
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		11308285			
Diameter:		15.0			
Depth From:		0.0			
Depth To:		6.0			
Hole Depth UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Hole Diameter UOM:		cm			
<u>Links</u>					
Bore Hole ID:	11174684			Tag No:	A016894
Depth M:	6			Contractor:	6607
Year Completed:	2004			Path:	281\2810067.pdf
Well Completed Dt:	2004/10/08			Latitude:	43.3261832461781
Audit No:	Z19529			Longitude:	-79.7957629333622
<u>91</u>	1 of 1	W/205.4	84.3 / 2.82	ON	BORE
Borehole ID:	622677			Inclin FLG:	No
OGF ID:	215523131			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:	Geotechnical/Geological Investigation			Primary Name:	
Completion Date:	FEB-1967			Municipality:	
Static Water Level:				Lot:	
Primary Water Use:	Not Used			Township:	
Sec. Water Use:				Latitude DD:	43.326189
Total Depth m:	4.7			Longitude DD:	-79.795769
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	597635
Drill Method:	Power auger			Northing:	4797743
Orig Ground Elev m:	88.4			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	84.1				
Concession:					
Location D:					
Survey D:					
Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:	218426652			Mat Consistency:	Hard
Top Depth:	0			Material Moisture:	
Bottom Depth:	3.4			Material Texture:	Medium
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Silt			Geologic Formation:	
Material 2:	Clay			Geologic Group:	
Material 3:	Sand			Geologic Period:	
Material 4:				Depositional Gen:	glacial
Gsc Material Description:					
Stratum Description:	SILT,CLAY,SAND MEDIUM. BROWN,VERY HARD,UNIFORM, AGE GLACIAL.				
Geology Stratum ID:	218426653			Mat Consistency:	Hard
Top Depth:	3.4			Material Moisture:	
Bottom Depth:	4.7			Material Texture:	
Material Color:	Green			Non Geo Mat Type:	
Material 1:	Silt			Geologic Formation:	
Material 2:	Clay			Geologic Group:	
Material 3:	Gravel			Geologic Period:	
Material 4:				Depositional Gen:	glacial
Gsc Material Description:					
Stratum Description:	SILT,CLAY,GRAVEL. GREEN,VERY HARD,UNIFORM, AGE GLACIAL. 012 012 0000010200110 **Note: Many records provided by the department have a truncated [Stratum Description] field.				
<u>Source</u>					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Source Orig:	Geological Survey of Canada			Source Iden:	1
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:	M			Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Details:	File: HAM.txt RecordID: 016770 NTS_Sheet: 30M05C				
Confiden 1:	Reliable information but incomplete.				
Source List					
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Originators:	Geological Survey of Canada				

92	1 of 1	WSW/211.8	80.9 / -0.56	ON	BORE
Borehole ID:	621734			Inclin FLG:	No
OGF ID:	215522188			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:	Geotechnical/Geological Investigation			Primary Name:	
Completion Date:	MAY-1964			Municipality:	
Static Water Level:				Lot:	
Primary Water Use:	Not Used			Township:	
Sec. Water Use:				Latitude DD:	43.324563
Total Depth m:	4.5			Longitude DD:	-79.795308
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	597675
Drill Method:	Power auger			Northing:	4797563
Orig Ground Elev m:	82.6			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	81.2				
Concession:					
Location D:					
Survey D:					
Comments:					

Borehole Geology Stratum

Geology Stratum ID:	218422183			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	.9			Material Texture:	
Material Color:	Green			Non Geo Mat Type:	
Material 1:	Fill			Geologic Formation:	
Material 2:	Sand			Geologic Group:	
Material 3:	Gravel			Geologic Period:	
Material 4:				Depositional Gen:	fill
Gsc Material Description:					
Stratum Description:	FILL,SAND,GRAVEL. GREEN,MAN-MADE,GRANULAR, AGE POST-GLACIAL.				
Geology Stratum ID:	218422186			Mat Consistency:	Dense
Top Depth:	2.8			Material Moisture:	
Bottom Depth:	4.5			Material Texture:	
Material Color:	Red			Non Geo Mat Type:	
Material 1:	Bedrock			Geologic Formation:	
Material 2:	Shale			Geologic Group:	
Material 3:	Limestone			Geologic Period:	Ordovician
Material 4:				Depositional Gen:	
Gsc Material Description:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Stratum Description:		BEDROCK, SHALE, LIMESTONE. RED, VERY DENSE, LAYERED, AGE ORDOVICIAN. 000300030007060000093100, SILT **Note: Many records provided by the department have a truncated [Stratum Description] field.			
Geology Stratum ID:	218422184			Mat Consistency:	Loose
Top Depth:	.9			Material Moisture:	
Bottom Depth:	2.1			Material Texture:	
Material Color:	Green			Non Geo Mat Type:	
Material 1:	Fill			Geologic Formation:	
Material 2:	Sand			Geologic Group:	
Material 3:	Silt			Geologic Period:	
Material 4:	Wood Fragments			Depositional Gen:	fill
Gsc Material Description:					
Stratum Description:		FILL, SAND, SILT, WOOD. GREEN, MAN-MADE, LOOSE, RUBBLY, AGE POST-GLACIAL.			
Geology Stratum ID:	218422185			Mat Consistency:	Dense
Top Depth:	2.1			Material Moisture:	
Bottom Depth:	2.8			Material Texture:	
Material Color:	Red			Non Geo Mat Type:	
Material 1:	Bedrock			Geologic Formation:	
Material 2:	Shale			Geologic Group:	
Material 3:				Geologic Period:	Ordovician
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:		BEDROCK, SHALE. RED, VERY DENSE, WEATHERED, AGE ORDOVICIAN.			
Source					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada			Source Iden:	1
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:	M			Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Details:	File: HAM.txt RecordID: 007340 NTS_Sheet: 30M05C				
Confiden 1:	Reliable information but incomplete.				
Source List					
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Originators:	Geological Survey of Canada				
93	1 of 1	NW/222.9	82.2 / 0.72	425 Pearl St Burlington ON L7R2N2	EHS
Order No:	20140612046			Nearest Intersection:	
Status:	C			Municipality:	
Report Type:	Custom Report			Client Prov/State:	ON
Report Date:	18-JUN-14			Search Radius (km):	.25
Date Received:	12-JUN-14			X:	-79.794789
Previous Site Name:				Y:	43.327541
Lot/Building Size:					
Additional Info Ordered:					
94	1 of 1	NE/225.3	80.8 / -0.67	360 Torrance Street Burlington ON	EHS
Order No:	20171116165			Nearest Intersection:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Status: C Report Type: Custom Report Report Date: 24-NOV-17 Date Received: 16-NOV-17 Previous Site Name: Lot/Building Size: Additional Info Ordered:					
Municipality: Client Prov/State: ON Search Radius (km): .25 X: -79.791189 Y: 43.327789					
95	1 of 3	NE/227.5	81.4 / -0.01	GWL Realty Advisors Inc. 360 Torrance St Torrance Terrace Apartments Burlington ON	CA
Certificate #: 4977-7K9LB5 Application Year: 2008 Issue Date: 10/9/2008 Approval Type: Air Status: Approved Application Type: Client Name: Client Address: Client City: Client Postal Code: Project Description: Contaminants: Emission Control:					
95	2 of 3	NE/227.5	81.4 / -0.01	GWL Realty Advisors Inc. 360 Torrance St Torrance Terrace Apartments Burlington ON M5G 1R8	ECA
Approval No: 4977-7K9LB5 Approval Date: 2008-10-09 Status: Approved Record Type: ECA Link Source: IDS SWP Area Name: Halton Approval Type: ECA-AIR Project Type: AIR Business Name: GWL Realty Advisors Inc. Address: 360 Torrance St Torrance Terrace Apartments Full Address: Full PDF Link: https://www.accessenvironment.ene.gov.on.ca/instruments/9116-7GVNRH-14.pdf PDF Site Location:					
MOE District: Halton-Peel City: Longitude: -79.79131 Latitude: 43.327827 Geometry X: Geometry Y:					
95	3 of 3	NE/227.5	81.4 / -0.01	1319399 ONTARIO INC 360 Torrance ST Burlington ON L7R 2R9	EASR
Approval No: R-010-1114578473 Status: REGISTERED Date: November 17, 2022 Record Type: EASR Link Source: MOFA Project Type: Air Emissions Full Address: Approval Type: EASR-Air Emissions SWP Area Name: Halton PDF URL: http://www.accessenvironment.ene.gov.on.ca/AEWeb/ae/ViewDocument.action?documentRefID=2785768 PDF Site Location: 360 Torrance Street Burlington ON L7R 2R9					
MOE District: Halton-Peel Municipality: Burlington Latitude: 43.32777778 Longitude: -79.79138889 Geometry X: -8882336.7808000017 Geometry Y: 5361996.7938999981					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
96	1 of 8	WSW/233.5	80.5 / -0.92	2020 LAKESHORE ROAD BURLINGTON ON L7R 4G8	EHS
Order No: 20080117003				Nearest Intersection:	
Status: C				Municipality:	
Report Type: Complete Report				Client Prov/State: ON	
Report Date: 1/25/2008				Search Radius (km): 0.25	
Date Received: 1/17/2008				X: -79.79525	
Previous Site Name:				Y: 43.324318	
Lot/Building Size:					
Additional Info Ordered:					
96	2 of 8	WSW/233.5	80.5 / -0.92	2020 Lakeshore Road Burlington ON	WWIS
Well ID: 7385417				Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st: Monitoring				Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status: Observation Wells				Date Received: 22-Apr-2021 00:00:00	
Water Type:				Selected Flag: TRUE	
Casing Material:				Abandonment Rec:	
Audit No: KS9M3WZN				Contractor: 7472	
Tag: A322955				Form Version: 9	
Constructn Method:				Owner:	
Elevation (m):				County: HALTON	
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name: BB	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality: BURLINGTON CITY					
Site Info:					
<u>Bore Hole Information</u>					
Bore Hole ID: 1008613984				Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone: 17	
Code OB:				East83: 597676.00	
Code OB Desc:				North83: 4797552.00	
Open Hole:				Org CS: UTM83	
Cluster Kind:				UTMRC: 4	
Date Completed: 08-Apr-2021 00:00:00				UTMRC Desc: margin of error : 30 m - 100 m	
Remarks:				Location Method: wwr	
Loc Method Desc: on Water Well Record					
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID: 1008614098					
Layer: 2					
Color: 6					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
General Color:		BROWN			
Mat1:		01			
Most Common Material:		FILL			
Mat2:					
Mat2 Desc:					
Mat3:		77			
Mat3 Desc:		LOOSE			
Formation Top Depth:		2.0			
Formation End Depth:		6.0			
Formation End Depth UOM:		ft			
 <u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1008614097			
Layer:		1			
Color:		2			
General Color:		GREY			
Mat1:		11			
Most Common Material:		GRAVEL			
Mat2:					
Mat2 Desc:					
Mat3:		77			
Mat3 Desc:		LOOSE			
Formation Top Depth:		0.0			
Formation End Depth:		2.0			
Formation End Depth UOM:		ft			
 <u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1008614100			
Layer:		4			
Color:					
General Color:					
Mat1:		17			
Most Common Material:		SHALE			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		8.0			
Formation End Depth:		56.0			
Formation End Depth UOM:		ft			
 <u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1008614099			
Layer:		3			
Color:		2			
General Color:		GREY			
Mat1:		34			
Most Common Material:		TILL			
Mat2:					
Mat2 Desc:					
Mat3:		79			
Mat3 Desc:		PACKED			
Formation Top Depth:		6.0			
Formation End Depth:		8.0			
Formation End Depth UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008614184			
Layer:		1			
Plug From:		0.0			
Plug To:		45.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008614165			
Layer:		1			
Plug From:					
Plug To:					
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008614185			
Layer:		2			
Plug From:		45.0			
Plug To:		56.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1008614060			
Method Construction Code:		E			
Method Construction:		Auger			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1008614034			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1008614122			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		46.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1008614137			
Layer:		1			
Slot:		10			
Screen Top Depth:		46.0			
Screen End Depth:		56.0			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Screen Material:					
		5			
Screen Depth UOM:					
		ft			
Screen Diameter UOM:					
		inch			
Screen Diameter:					
		2.5			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1008614035			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:					
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:		1008614153			
Diameter:		7.5			
Depth From:		0.0			
Depth To:		20.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
<u>Hole Diameter</u>					
Hole ID:		1008614154			
Diameter:		4.0			
Depth From:		20.0			
Depth To:		56.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
<u>Links</u>					
Bore Hole ID:		1008613984		Tag No:	A322955
Depth M:		17.0688		Contractor:	7472
Year Completed:		2021		Path:	738\7385417.pdf
Well Completed Dt:		2021/04/08		Latitude:	43.3244674305568
Audit No:		KS9M3WZN		Longitude:	-79.7952911528253

96	3 of 8	WSW/233.5	80.5 / -0.92	2020 Lakeshore Road Burlington ON	WWIS
Well ID:					
		7385418		Flowing (Y/N):	
Construction Date:					
Use 1st:		Monitoring		Flow Rate:	
Use 2nd:		Observation Wells		Data Entry Status:	
Final Well Status:		Observation Wells		Data Src:	
Water Type:				Date Received:	22-Apr-2021 00:00:00
Casing Material:				Selected Flag:	TRUE
Audit No:		ZKKM5CSH		Abandonment Rec:	
				Contractor:	7472

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Tag:	A322956			Form Version:	9
Constructn Method:				Owner:	
Elevation (m):				County:	HALTON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	BB
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		BURLINGTON CITY			
Site Info:					

Bore Hole Information

Bore Hole ID:	1008613987	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	597718.00
Code OB Desc:		North83:	4797582.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	08-Apr-2021 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	www
Loc Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Overburden and Bedrock Materials Interval

Formation ID:	1008614102
Layer:	2
Color:	6
General Color:	BROWN
Mat1:	01
Most Common Material:	FILL
Mat2:	
Mat2 Desc:	
Mat3:	77
Mat3 Desc:	LOOSE
Formation Top Depth:	2.0
Formation End Depth:	6.0
Formation End Depth UOM:	ft

Overburden and Bedrock Materials Interval

Formation ID:	1008614101
Layer:	1
Color:	2
General Color:	GREY
Mat1:	11
Most Common Material:	GRAVEL
Mat2:	
Mat2 Desc:	
Mat3:	77
Mat3 Desc:	LOOSE
Formation Top Depth:	0.0

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation End Depth:		2.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1008614104			
Layer:		4			
Color:					
General Color:					
Mat1:		17			
Most Common Material:		SHALE			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		8.0			
Formation End Depth:		50.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1008614103			
Layer:		3			
Color:		2			
General Color:		GREY			
Mat1:		34			
Most Common Material:		TILL			
Mat2:					
Mat2 Desc:					
Mat3:		79			
Mat3 Desc:		PACKED			
Formation Top Depth:		6.0			
Formation End Depth:		8.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008614186			
Layer:		1			
Plug From:		0.0			
Plug To:		39.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008614187			
Layer:		2			
Plug From:		39.0			
Plug To:		50.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008614166			
Layer:		1			
Plug From:					
Plug To:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1008614061			
Method Construction Code:		E			
Method Construction:		Auger			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1008614036			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1008614123			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		40.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1008614138			
Layer:		1			
Slot:		10			
Screen Top Depth:		40.0			
Screen End Depth:		50.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.5			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1008614037			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:					
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Hole Diameter</u>					
Hole ID:		1008614155			
Diameter:		7.5			
Depth From:		0.0			
Depth To:		20.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
<u>Hole Diameter</u>					
Hole ID:		1008614156			
Diameter:		4.0			
Depth From:		20.0			
Depth To:		50.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
<u>Links</u>					
Bore Hole ID:	1008613987			Tag No:	A322956
Depth M:	15.24			Contractor:	7472
Year Completed:	2021			Path:	738\7385418.pdf
Well Completed Dt:	2021/04/08			Latitude:	43.3247320511983
Audit No:	ZKKM5CSH			Longitude:	-79.7947679089092

96	4 of 8	WSW/233.5	80.5 / -0.92	2020 Lakeshore Road Burlington ON	WWIS
Well ID:	7385428			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Observation Wells			Date Received:	22-Apr-2021 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	UJNX3FYG			Contractor:	7472
Tag:	A315215			Form Version:	9
Constructn Method:				Owner:	
Elevation (m):				County:	HALTON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	BB
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	BURLINGTON CITY				
Site Info:					
<u>Bore Hole Information</u>					
Bore Hole ID:	1008614246			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	17
Code OB:				East83:	597775.00
Code OB Desc:				North83:	4797555.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	08-Apr-2021 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:	on Water Well Record				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1008614353			
Layer:		3			
Color:					
General Color:					
Mat1:		17			
Most Common Material:		SHALE			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		26.0			
Formation End Depth:		66.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1008614351			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		01			
Most Common Material:		FILL			
Mat2:					
Mat2 Desc:					
Mat3:		77			
Mat3 Desc:		LOOSE			
Formation Top Depth:		0.0			
Formation End Depth:		18.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1008614352			
Layer:		2			
Color:		2			
General Color:		GREY			
Mat1:		34			
Most Common Material:		TILL			
Mat2:					
Mat2 Desc:					
Mat3:		79			
Mat3 Desc:		PACKED			
Formation Top Depth:		18.0			
Formation End Depth:		26.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008614444			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:		2			
Plug From:		55.0			
Plug To:		66.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008614443			
Layer:		1			
Plug From:		0.0			
Plug To:		55.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008614428			
Layer:		1			
Plug From:					
Plug To:					
Plug Depth UOM:		ft			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1008614321			
Method Construction Code:		E			
Method Construction:		Auger			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1008614291			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1008614382			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		56.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
 <u>Construction Record - Screen</u>					
Screen ID:		1008614397			
Layer:		1			
Slot:		10			
Screen Top Depth:		56.0			
Screen End Depth:		66.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.5			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:	1008614292				
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:	ft				
Rate UOM:	GPM				
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:					
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:	1008614412				
Diameter:	7.5				
Depth From:	0.0				
Depth To:	20.0				
Hole Depth UOM:	ft				
Hole Diameter UOM:	inch				
<u>Hole Diameter</u>					
Hole ID:	1008614413				
Diameter:	4.0				
Depth From:	20.0				
Depth To:	66.0				
Hole Depth UOM:	ft				
Hole Diameter UOM:	inch				
<u>Links</u>					
Bore Hole ID:	1008614246			Tag No:	A315215
Depth M:	20.1168			Contractor:	7472
Year Completed:	2021			Path:	738\7385428.pdf
Well Completed Dt:	2021/04/08			Latitude:	43.3244815720478
Audit No:	UJNX3FYG			Longitude:	-79.7940698452104
96	5 of 8	WSW/233.5	80.5 / -0.92	2020 Lakeshore Road Burlington ON	WWIS
Well ID:	7385413			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Observation Wells			Date Received:	22-Apr-2021 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	KZTOLCM7			Contractor:	7472
Tag:	A315220			Form Version:	9
Constructn Method:				Owner:	
Elevation (m):				County:	HALTON
Elevatn Reliability:				Lot:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: Site Info:		BURLINGTON CITY		Concession: Concession Name: BB Easting NAD83: Northing NAD83: Zone: UTM Reliability:	
<u>Bore Hole Information</u>					
Bore Hole ID: DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: Remarks: Loc Method Desc: Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:	1008613972 08-Apr-2021 00:00:00 on Water Well Record			Elevation: Elevrc: Zone: 17 East83: 597684.00 North83: 4797491.00 Org CS: UTM83 UTMRC: 4 UTMRC Desc: margin of error : 30 m - 100 m Location Method: wwr	
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID: Layer: Color: General Color: Mat1: Most Common Material: Mat2: Mat2 Desc: Mat3: Mat3 Desc: Formation Top Depth: Formation End Depth: Formation End Depth UOM:	1008614085 3 17 SHALE 18.0 25.0 ft				
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID: Layer: Color: General Color: Mat1: Most Common Material: Mat2: Mat2 Desc: Mat3: Mat3 Desc: Formation Top Depth: Formation End Depth: Formation End Depth UOM:	1008614084 2 2 GREY 34 TILL 79 PACKED 12.0 18.0 ft				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1008614083			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		01			
Most Common Material:		FILL			
Mat2:					
Mat2 Desc:					
Mat3:		77			
Mat3 Desc:		LOOSE			
Formation Top Depth:		0.0			
Formation End Depth:		12.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008614176			
Layer:		1			
Plug From:		0.0			
Plug To:		14.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008614161			
Layer:		1			
Plug From:					
Plug To:					
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008614177			
Layer:		2			
Plug From:		14.0			
Plug To:		25.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1008614056			
Method Construction Code:		E			
Method Construction:		Auger			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1008614026			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Casing ID: 1008614118					
Layer: 1					
Material: 5					
Open Hole or Material: PLASTIC					
Depth From: 0.0					
Depth To: 15.0					
Casing Diameter: 2.0					
Casing Diameter UOM: inch					
Casing Depth UOM: ft					
<u>Construction Record - Screen</u>					
Screen ID: 1008614133					
Layer: 1					
Slot: 10					
Screen Top Depth: 15.0					
Screen End Depth: 25.0					
Screen Material: 5					
Screen Depth UOM: ft					
Screen Diameter UOM: inch					
Screen Diameter: 2.5					
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID: 1008614027					
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM: ft					
Rate UOM: GPM					
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:					
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID: 1008614148					
Diameter: 7.5					
Depth From: 0.0					
Depth To: 25.0					
Hole Depth UOM: ft					
Hole Diameter UOM: inch					
<u>Links</u>					
Bore Hole ID:	1008613972			Tag No:	A315220
Depth M:	7.62			Contractor:	7472
Year Completed:	2021			Path:	738\7385413.pdf
Well Completed Dt:	2021/04/08			Latitude:	43.3239172337183
Audit No:	KZTOLCM7			Longitude:	-79.7952033584242
96	6 of 8	WSW/233.5	80.5 / -0.92	2020 Lakeshore Road Burlington ON	WWIS

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Well ID:	7385414			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Observation Wells			Date Received:	22-Apr-2021 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	4AAD09U5			Contractor:	7472
Tag:	A322954			Form Version:	9
Constructn Method:				Owner:	
Elevation (m):				County:	HALTON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	BB
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		BURLINGTON CITY			
Site Info:					

Bore Hole Information

Bore Hole ID:	1008613975	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	17
Code OB:		East83:	597737.00
Code OB Desc:		North83:	4797588.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	08-Apr-2021 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Loc Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Overburden and Bedrock Materials Interval

Formation ID:	1008614088
Layer:	3
Color:	2
General Color:	GREY
Mat1:	34
Most Common Material:	TILL
Mat2:	
Mat2 Desc:	
Mat3:	79
Mat3 Desc:	PACKED
Formation Top Depth:	8.0
Formation End Depth:	12.0
Formation End Depth UOM:	ft

Overburden and Bedrock Materials Interval

Formation ID:	1008614087
Layer:	2
Color:	6

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
General Color:		BROWN			
Mat1:		01			
Most Common Material:		FILL			
Mat2:					
Mat2 Desc:					
Mat3:		77			
Mat3 Desc:		LOOSE			
Formation Top Depth:		2.0			
Formation End Depth:		8.0			
Formation End Depth UOM:		ft			
 <u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1008614089			
Layer:		4			
Color:					
General Color:					
Mat1:		17			
Most Common Material:		SHALE			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		12.0			
Formation End Depth:		25.0			
Formation End Depth UOM:		ft			
 <u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1008614086			
Layer:		1			
Color:		2			
General Color:		GREY			
Mat1:		11			
Most Common Material:		GRAVEL			
Mat2:					
Mat2 Desc:					
Mat3:		77			
Mat3 Desc:		LOOSE			
Formation Top Depth:		0.0			
Formation End Depth:		2.0			
Formation End Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008614178			
Layer:		1			
Plug From:		0.0			
Plug To:		14.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008614179			
Layer:		2			
Plug From:		14.0			
Plug To:		25.0			
Plug Depth UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008614162			
Layer:		1			
Plug From:					
Plug To:					
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1008614057			
Method Construction Code:		E			
Method Construction:		Auger			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1008614028			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1008614119			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		15.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1008614134			
Layer:		1			
Slot:		10			
Screen Top Depth:		15.0			
Screen End Depth:		25.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.5			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1008614029			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Rate UOM: GPM Water State After Test Code: Water State After Test: Pumping Test Method: Pumping Duration HR: Pumping Duration MIN: Flowing:					
<u>Hole Diameter</u>					
Hole ID: 1008614149 Diameter: 7.5 Depth From: 0.0 Depth To: 25.0 Hole Depth UOM: ft Hole Diameter UOM: inch					
<u>Links</u>					
Bore Hole ID: 1008613975 Depth M: 7.62 Year Completed: 2021 Well Completed Dt: 2021/04/08 Audit No: 4AADO9U5 Tag No: A322954 Contractor: 7472 Path: 738\7385414.pdf Latitude: 43.3247835973301 Longitude: -79.7945325498336					
96	7 of 8	WSW/233.5	80.5 / -0.92	2020 Lakeshore Road Burlington ON	WWIS
Well ID: 7385415 Construction Date: Use 1st: Monitoring Use 2nd: Final Well Status: Observation Wells Water Type: Casing Material: Audit No: I8QD43KA Tag: A322970 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: BURLINGTON CITY Site Info:					
Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 22-Apr-2021 00:00:00 Selected Flag: TRUE Abandonment Rec: Contractor: 7472 Form Version: 9 Owner: County: HALTON Lot: Concession: Concession Name: BB Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
<u>Bore Hole Information</u>					
Bore Hole ID: 1008613978 DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: 08-Apr-2021 00:00:00 Remarks: Loc Method Desc: on Water Well Record Elevrc Desc:					
Elevation: Elevrc: Zone: 17 East83: 597734.00 North83: 4797526.00 Org CS: UTM83 UTMRC: 4 UTMRC Desc: margin of error : 30 m - 100 m Location Method: wwr					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1008614091			
Layer:		2			
Color:		6			
General Color:		BROWN			
Mat1:		01			
Most Common Material:		FILL			
Mat2:					
Mat2 Desc:					
Mat3:		77			
Mat3 Desc:		LOOSE			
Formation Top Depth:		2.0			
Formation End Depth:		24.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1008614090			
Layer:		1			
Color:		2			
General Color:		GREY			
Mat1:		11			
Most Common Material:		GRAVEL			
Mat2:					
Mat2 Desc:					
Mat3:		77			
Mat3 Desc:		LOOSE			
Formation Top Depth:		0.0			
Formation End Depth:		2.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1008614092			
Layer:		3			
Color:		2			
General Color:		GREY			
Mat1:		34			
Most Common Material:		TILL			
Mat2:					
Mat2 Desc:					
Mat3:		79			
Mat3 Desc:		PACKED			
Formation Top Depth:		24.0			
Formation End Depth:		26.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1008614093			
Layer:		4			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Color:					
General Color:					
Mat1:		17			
Most Common Material:		SHALE			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		26.0			
Formation End Depth:		51.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008614180			
Layer:		1			
Plug From:		0.0			
Plug To:		40.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008614181			
Layer:		2			
Plug From:		40.0			
Plug To:		51.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008614163			
Layer:		1			
Plug From:					
Plug To:					
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1008614058			
Method Construction Code:		E			
Method Construction:		Auger			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1008614030			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1008614120			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth To:		41.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1008614135			
Layer:		1			
Slot:		10			
Screen Top Depth:		41.0			
Screen End Depth:		51.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.5			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1008614031			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:					
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:		1008614150			
Diameter:		7.5			
Depth From:		0.0			
Depth To:		20.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
<u>Hole Diameter</u>					
Hole ID:		1008614151			
Diameter:		4.0			
Depth From:		20.0			
Depth To:		51.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
<u>Links</u>					
Bore Hole ID:	1008613978		Tag No:	A322970	
Depth M:	15.5448		Contractor:	7472	
Year Completed:	2021		Path:	738\7385415.pdf	
Well Completed Dt:	2021/04/08		Latitude:	43.3242258272099	
Audit No:	I8QD43KA		Longitude:	-79.7945805808924	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
96	8 of 8	WSW/233.5	80.5 / -0.92	2020 Lakeshore Road Burlington ON	WWIS
Well ID: 7385416 Construction Date: Use 1st: Monitoring Use 2nd: Final Well Status: Observation Wells Water Type: Casing Material: Audit No: KFZY3M6J Tag: A322961 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: BURLINGTON CITY Site Info: Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 22-Apr-2021 00:00:00 Selected Flag: TRUE Abandonment Rec: Contractor: 7472 Form Version: 9 Owner: County: HALTON Lot: Concession: Concession Name: BB Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
<u>Bore Hole Information</u>					
Bore Hole ID: 1008613981 DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: 08-Apr-2021 00:00:00 Remarks: Loc Method Desc: on Water Well Record Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment: Elevation: Elevrc: Zone: 17 East83: 597643.00 North83: 4797538.00 Org CS: UTM83 UTMRC: 4 UTMRC Desc: margin of error : 30 m - 100 m Location Method: wwr					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID: 1008614095 Layer: 2 Color: 2 General Color: GREY Mat1: 34 Most Common Material: TILL Mat2: Mat2 Desc: Mat3: 79 Mat3 Desc: PACKED Formation Top Depth: 2.0 Formation End Depth: 8.0 Formation End Depth UOM: ft					
<u>Overburden and Bedrock</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Materials Interval</u>					
Formation ID:		1008614094			
Layer:		1			
Color:		2			
General Color:		GREY			
Mat1:		11			
Most Common Material:		GRAVEL			
Mat2:					
Mat2 Desc:					
Mat3:		77			
Mat3 Desc:		LOOSE			
Formation Top Depth:		0.0			
Formation End Depth:		2.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1008614096			
Layer:		3			
Color:					
General Color:					
Mat1:		17			
Most Common Material:		SHALE			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		8.0			
Formation End Depth:		24.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1008614183			
Layer:		2			
Plug From:		13.0			
Plug To:		24.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1008614182			
Layer:		1			
Plug From:		0.0			
Plug To:		13.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1008614164			
Layer:		1			
Plug From:					
Plug To:					
Plug Depth UOM:		ft			
<u>Method of Construction & Well</u>					
<u>Use</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Method Construction ID: 1008614059					
Method Construction Code: E					
Method Construction: Auger					
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID: 1008614032					
Casing No: 0					
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID: 1008614121					
Layer: 1					
Material: 5					
Open Hole or Material: PLASTIC					
Depth From: 0.0					
Depth To: 14.0					
Casing Diameter: 2.0					
Casing Diameter UOM: inch					
Casing Depth UOM: ft					
<u>Construction Record - Screen</u>					
Screen ID: 1008614136					
Layer: 1					
Slot: 10					
Screen Top Depth: 14.0					
Screen End Depth: 24.0					
Screen Material: 5					
Screen Depth UOM: ft					
Screen Diameter UOM: inch					
Screen Diameter: 2.5					
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID: 1008614033					
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM: ft					
Rate UOM: GPM					
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:					
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID: 1008614152					
Diameter: 7.5					
Depth From: 0.0					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth To:		24.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
Links					
Bore Hole ID:	1008613981			Tag No:	A322961
Depth M:	7.3152			Contractor:	7472
Year Completed:	2021			Path:	738\7385416.pdf
Well Completed Dt:	2021/04/08			Latitude:	43.3243456802168
Audit No:	KFZY3M6J			Longitude:	-79.7957005674994

97	1 of 1	NNW/235.4	82.2 / 0.78	ON	BORE
Borehole ID:	622281			Inclin FLG:	No
OGF ID:	215522735			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:	Geotechnical/Geological Investigation			Primary Name:	
Completion Date:	NOV-1970			Municipality:	
Static Water Level:				Lot:	
Primary Water Use:	Not Used			Township:	
Sec. Water Use:				Latitude DD:	43.328149
Total Depth m:	9.1			Longitude DD:	-79.793757
Depth Ref:	Ground Surface			UTM Zone:	17
Depth Elev:				Easting:	597795
Drill Method:	Power auger			Northing:	4797963
Orig Ground Elev m:	82.3			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	79.9				
Concession:					
Location D:					
Survey D:					
Comments:					

Borehole Geology Stratum

Geology Stratum ID:	218425028			Mat Consistency:	Loose
Top Depth:	0			Material Moisture:	
Bottom Depth:	.9			Material Texture:	
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Fill			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:	Sand			Geologic Period:	
Material 4:	Gravel			Depositional Gen:	fill
Gsc Material Description:					
Stratum Description:	FILL,SILT,SAND, GRAVEL. BROWN,MAN-MADE,LOOSE, AGE POST-GLACIAL.				
Geology Stratum ID:	218425030			Mat Consistency:	Dense
Top Depth:	1.7			Material Moisture:	
Bottom Depth:	9.1			Material Texture:	
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Silt			Geologic Formation:	
Material 2:	Clay			Geologic Group:	
Material 3:	Shale			Geologic Period:	
Material 4:				Depositional Gen:	glacial
Gsc Material Description:					
Stratum Description:	SILT,CLAY,SHALE. BROWN,DENSE,AGE GLACIAL. 000000070003007500056070 **Note: Many records provided by the department have a truncated [Stratum Description] field.				
Geology Stratum ID:	218425029			Mat Consistency:	Dense
Top Depth:	.9			Material Moisture:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	1.7 Brown Silt Sand Clay			Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	glacial
SILT,SAND,CLAY. BROWN,DENSE,AGE GLACIAL.					
Source					
Source Type: Source Orig: Source Date: Confidence: Observatio: Source Name: Source Details: Confiden 1:	Data Survey Geological Survey of Canada 1956-1972 H			Source Appl: Source Iden: Scale or Res: Horizontal: Verticalda:	Spatial/Tabular 1 Varies NAD27 Mean Average Sea Level
Urban Geology Automated Information System (UGAIS) File: HAM.txt RecordID: 012810 NTS_Sheet: 30M05C Logged by professional. Exact and complete description of material and properties.					
Source List					
Source Identifier: Source Type: Source Date: Scale or Resolution: Source Name: Source Originators:	1 Data Survey 1956-1972 Varies			Horizontal Datum: Vertical Datum: Projection Name:	NAD27 Mean Average Sea Level Universal Transverse Mercator
Urban Geology Automated Information System (UGAIS) Geological Survey of Canada					
98	1 of 1	WSW/237.0	82.7 / 1.22	RC'S BOARDWALK INC. 2013 LAKESHORE ROAD WEST BURLINGTON CITY ON	CA
Certificate #: Application Year: Issue Date: Approval Type: Status: Application Type: Client Name: Client Address: Client City: Client Postal Code: Project Description: Contaminants: Emission Control:	8-3191-95-95 5/5/1995 Industrial air Approved				
COMMERCIAL KITCHEN EXHAUST SYSTEM Nitrogen Oxides, Odour/Fumes Impingement Separator,					
99	1 of 1	W/244.4	84.8 / 3.39	John St Burlington ON	EHS
Order No: Status: Report Type: Report Date: Date Received: Previous Site Name: Lot/Building Size: Additional Info Ordered:	20130918031 C Custom Report 27-SEP-13 18-SEP-13			Nearest Intersection: Municipality: Client Prov/State: Search Radius (km): X: Y:	ON .25 -79.79631 43.32587

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
100	1 of 1	NE/247.4	80.8 / -0.61	2160 Lakeshore Rd And 360 Torrance St Burlington ON	EHS
Order No: 20120801032 Status: C Report Type: Custom Report Report Date: 13-AUG-12 Date Received: 01-AUG-12 Previous Site Name: Lot/Building Size: Additional Info Ordered:		Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -79.79059 Y: 43.327669			
101	1 of 1	NNW/248.5	80.6 / -0.86	Martha Street and south of New street Burlington ON	SPL
Ref No: 5852-AY7F55 Site No: NA Incident Dt: 2018/04/26 Year: Incident Cause: Incident Event: Unknown / N/A Contaminant Code: 46 Contaminant Name: FOAM Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: n/a Environment Impact: Nature of Impact: Receiving Medium: Receiving Env: Surface Water MOE Response: No Dt MOE Arvl on Scn: MOE Reported Dt: 2018/04/26 Dt Document Closed: Incident Reason: Unknown / N/A Site Name: creek<UNOFFICIAL> Site County/District: Regional Municipality of Halton Site Geo Ref Meth: Incident Summary: Rambo Creek - White foam Contaminant Qty: 0 other - see incident description		Discharger Report: Material Group: Health/Env Conseq: 2 - Minor Environment Client Type: Sector Type: Unknown / N/A Agency Involved: Nearest Watercourse: Site Address: Martha Street and south of New street Site District Office: Halton-Peel Site Postal Code: Site Region: Central Site Municipality: Burlington Site Lot: Site Conc: Northing: 4797960.61 Easting: 597757.53 Site Geo Ref Accu: Site Map Datum: SAC Action Class: Watercourse Spills Source Type: Unknown / N/A			
102	1 of 1	NE/249.3	81.2 / -0.30	360 Torrance Street Burlington ON L7R 2R9	EHS
Order No: 22071200571 Status: C Report Type: Standard Report Report Date: 15-JUL-22 Date Received: 12-JUL-22 Previous Site Name: Lot/Building Size: Additional Info Ordered: Fire Insur. Maps and/or Site Plans; City Directory; Aerial Photos		Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -79.7909994 Y: 43.3279562			

Unplottable Summary

Total: **15** Unplottable sites

DB	Company Name/Site Name	Address	City	Postal
CA	R.M. OF HALTON	LAKESHORE RD.	BURLINGTON CITY ON	
CA	712101 ONTARIO LTD.-PT LOT 3, 4 & 5	LAKESHORE TOWNHOUSES	BURLINGTON CITY ON	
CA	R.M. OF HALTON	GORE/ELIZABETH/MARTHA STS.	BURLINGTON CITY ON	
CA	BURLINGTON CITY	LAKESHORE RD.	BURLINGTON CITY ON	
CA	REG.MUN.OF HALTON	ELIZABETH ST.	BURLINGTON ON	
CA	The Regional Municipality of Halton	Lakeshore Road	Burlington ON	
CA		Lakeshore Road	Burlington ON	
CA	712101 ONTARIO LTD.-PT. LOT 3, 4 & 5	LAKESHORE TOWNHOUSES	BURLINGTON CITY ON	
CA	BURLINGTON CITY	LAKESHORE RD.	BURLINGTON CITY ON	
ECA	The Regional Municipality of Halton	Lakeshore Road	Burlington ON	L6M 3L1
ECA	The Regional Municipality of Halton	Lakeshore Road	Burlington ON	L6M 3L1
ECA	The Regional Municipality of Halton	Lakeshore Road	Burlington ON	L6M 3L1
SPL	To be determined<UNOFFICIAL>	cb and Old Lakeshore Rd<UNOFFICIAL>	Burlington ON	
SPL		3209 Pine Meadow St	Burlington ON	
SPL	BURLINGTON HYDRO-ELECTRIC COMM	LAKESHORE RD .5 K/M WEST OF WALKERS LINE TRANSFORMER	BURLINGTON CITY ON	

Unplottable Report

Site: R.M. OF HALTON
LAKESHORE RD. BURLINGTON CITY ON

Database:
CA

Certificate #: 7-0215-87-
Application Year: 87
Issue Date: 3/24/1987
Approval Type: Municipal water
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: 712101 ONTARIO LTD.-PT LOT 3, 4 & 5
LAKESHORE TOWNHOUSES BURLINGTON CITY ON

Database:
CA

Certificate #: 7-0490-90-
Application Year: 90
Issue Date: 4/25/1990
Approval Type: Municipal water
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: R.M. OF HALTON
GORE/ELIZABETH/MARTHA STS. BURLINGTON CITY ON

Database:
CA

Certificate #: 7-0688-95-
Application Year: 95
Issue Date: 7/18/1995
Approval Type: Municipal water
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: BURLINGTON CITY
LAKESHORE RD. BURLINGTON CITY ON

Database:
CA

Certificate #: 3-0826-89-

Application Year: 89
Issue Date: 5/16/1989
Approval Type: Municipal sewage
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: REG.MUN.OF HALTON
ELIZABETH ST. BURLINGTON ON

Database:
CA

Certificate #: 3-0932-85-006
Application Year: 85
Issue Date: 9/19/85
Approval Type: Municipal sewage
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: The Regional Municipality of Halton
Lakeshore Road Burlington ON

Database:
CA

Certificate #: 2034-64ZPCP
Application Year: 2004
Issue Date: 9/22/2004
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: Lakeshore Road Burlington ON

Database:
CA

Certificate #: 3366-56PGG2
Application Year: 02
Issue Date: 1/28/02
Approval Type: Municipal & Private water
Status: Approved
Application Type: New Certificate of Approval
Client Name: The Corporation of the Regional Municipality of Halton
Client Address: 1151 Bronte Road
Client City: Oakville
Client Postal Code: L6M 3L1
Project Description: This application is for approval to install watermain on Lakeshore Road
Contaminants:
Emission Control:

Site: 712101 ONTARIO LTD.-PT. LOT 3, 4 & 5
LAKESHORE TOWNHOUSES BURLINGTON CITY ON

Database:
CA

Certificate #: 3-0580-90-
Application Year: 90
Issue Date: 4/25/1990
Approval Type: Municipal sewage
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: BURLINGTON CITY
LAKESHORE RD. BURLINGTON CITY ON

Database:
CA

Certificate #: 3-0463-87-
Application Year: 87
Issue Date: 4/15/1987
Approval Type: Municipal sewage
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: The Regional Municipality of Halton
Lakeshore Road Burlington ON L6M 3L1

Database:
ECA

Approval No: 2034-64ZPCP
Approval Date: 2004-09-22
Status: Approved
Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-MUNICIPAL AND PRIVATE SEWAGE WORKS
Project Type: MUNICIPAL AND PRIVATE SEWAGE WORKS
Business Name: The Regional Municipality of Halton
Address: Lakeshore Road
Full Address:
Full PDF Link: <https://www.accessenvironment.ene.gov.on.ca/instruments/1364-64WUSN-14.pdf>
PDF Site Location:

MOE District:
City:
Longitude:
Latitude:
Geometry X:
Geometry Y:

Site: The Regional Municipality of Halton
Lakeshore Road Burlington ON L6M 3L1

Database:
ECA

Approval No: 2782-64ZPQU
Approval Date: 2004-09-22
Status: Approved
Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-Municipal Drinking Water Systems
Project Type: Municipal Drinking Water Systems

MOE District:
City:
Longitude:
Latitude:
Geometry X:
Geometry Y:

Business Name: The Regional Municipality of Halton
Address: Lakeshore Road
Full Address:
Full PDF Link:
PDF Site Location:

Site: *The Regional Municipality of Halton
Lakeshore Road Burlington ON L6M 3L1*

Database:
[ECA](#)

Approval No: 3366-56PGG2
Approval Date: 2002-01-28
Status: Approved
Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-Municipal and Private Water Works
Project Type: Municipal and Private Water Works
Business Name: The Regional Municipality of Halton
Address: Lakeshore Road
Full Address:
Full PDF Link:
PDF Site Location:

MOE District:
City:
Longitude:
Latitude:
Geometry X:
Geometry Y:

Site: *To be determined<UNOFFICIAL>
cb and Old Lakeshore Rd<UNOFFICIAL> Burlington ON*

Database:
[SPL](#)

Ref No: 0357-6Z6QP2
Site No:
Incident Dt:
Year:
Incident Cause: Unknown
Incident Event:
Contaminant Code: 15
Contaminant Name: OIL (PETROLEUM BASED, NOT SPECIFIED)
Contaminant Limit 1:
Contam Limit Freq 1:
Contaminant UN No 1:
Environment Impact: Confirmed
Nature of Impact: Surface Water Pollution
Receiving Medium: Water
Receiving Env:
MOE Response: No Field Response
Dt MOE Arvl on Scn:
MOE Reported Dt: 3/10/2007
Dt Document Closed: 4/4/2007
Incident Reason: Unknown - Reason not determined
Site Name: cb and Old Lakeshore Rd<UNOFFICIAL>
Site County/District:
Site Geo Ref Meth:
Incident Summary: ukn src: sheen flowing down road and into cb.
Contaminant Qty: 0 other - see incident description

Discharger Report:
Material Group: Oil
Health/Env Conseq:
Client Type:
Sector Type: Other Motor Vehicle
Agency Involved:
Nearest Watercourse:
Site Address:
Site District Office:
Site Postal Code:
Site Region:
Site Municipality: Burlington
Site Lot:
Site Conc:
Northing:
Easting:
Site Geo Ref Accu:
Site Map Datum:
SAC Action Class:
Source Type:

Site: *3209 Pine Meadow St Burlington ON*

Database:
[SPL](#)

Ref No: 3763-9WLSMR
Site No: NA
Incident Dt: 5/17/2015
Year:
Incident Cause: Leak/Break
Incident Event:
Contaminant Code: 35
Contaminant Name: NATURAL GAS (METHANE)
Contaminant Limit 1:

Discharger Report:
Material Group:
Health/Env Conseq:
Client Type:
Sector Type:
Agency Involved:
Nearest Watercourse:
Site Address: 3209 Pine Meadow St
Site District Office:

Contam Limit Freq 1:		Site Postal Code:	
Contaminant UN No 1:		Site Region:	
Environment Impact:		Site Municipality:	Burlington
Nature of Impact:	Air	Site Lot:	
Receiving Medium:		Site Conc:	
Receiving Env:		Northing:	
MOE Response:	N	Easting:	
Dt MOE Arvl on Scn:		Site Geo Ref Accu:	
MOE Reported Dt:	5/17/2015	Site Map Datum:	
Dt Document Closed:		SAC Action Class:	TSSA - Fuel Safety Branch - Hydrocarbon Fuel Release/Spill
Incident Reason:	Operator/Human Error	Source Type:	
Site Name:	Residence<UNOFFICIAL>		
Site County/District:			
Site Geo Ref Meth:			
Incident Summary:	TSSA: strike on 1/2 inch service		
Contaminant Qty:	0 other - see incident description		

<u>Site:</u>	BURLINGTON HYDRO-ELECTRIC COMM	Database:	SPL
	LAKESHORE RD .5 K/M WEST OF WALKERS LINE TRANSFORMER BURLINGTON CITY ON		
Ref No:	66512	Discharger Report:	
Site No:		Material Group:	
Incident Dt:	1/28/1992	Health/Env Conseq:	
Year:		Client Type:	
Incident Cause:	COOLING SYSTEM LEAK	Sector Type:	
Incident Event:		Agency Involved:	
Contaminant Code:		Nearest Watercourse:	
Contaminant Name:		Site Address:	
Contaminant Limit 1:		Site District Office:	
Contam Limit Freq 1:		Site Postal Code:	
Contaminant UN No 1:		Site Region:	
Environment Impact:	NOT ANTICIPATED	Site Municipality:	14101
Nature of Impact:		Site Lot:	
Receiving Medium:	LAND / WATER	Site Conc:	
Receiving Env:		Northing:	
MOE Response:		Easting:	HYDRO,WORKS,FD.
Dt MOE Arvl on Scn:		Site Geo Ref Accu:	
MOE Reported Dt:	1/28/1992	Site Map Datum:	
Dt Document Closed:		SAC Action Class:	
Incident Reason:	ERROR	Source Type:	
Site Name:			
Site County/District:			
Site Geo Ref Meth:			
Incident Summary:	BURLINGTON HYDRO-90 L. TRANSFROMER OIL TO GRND, 5 L. TO SEWER,CLEANED-UP.		
Contaminant Qty:			

Appendix: Database Descriptions

*Environmental Risk Information Services (ERIS) can search the following databases. The extent of historical information varies with each database and current information is determined by what is publicly available to ERIS at the time of update. **Note:** Databases denoted with " * " indicates that the database will no longer be updated. See the individual database description for more information.*

Abandoned Aggregate Inventory:

Provincial [AAGR](#)

The MAAP Program maintains a database of abandoned pits and quarries. Please note that the database is only referenced by lot and concession and city/town location. The database provides information regarding the location, type, size, land use, status and general comments.*

Government Publication Date: Sept 2002*

Aggregate Inventory:

Provincial [AGR](#)

The Ontario Ministry of Northern Development, Mines, Natural Resources and Forestry (ONDMNRF) maintains this database of pits and quarries. The database provides information regarding the registered owner/operator, location name, operation type, approval type, and maximum annual tonnage.

Government Publication Date: Up to Oct 2022

Abandoned Mine Information System:

Provincial [AMIS](#)

The Abandoned Mines Information System contains data on known abandoned and inactive mines located on both Crown and privately held lands. The information was provided by the Ministry of Northern Development and Mines (MNDM), with the following disclaimer: "the database provided has been compiled from various sources, and the Ministry of Northern Development and Mines makes no representation and takes no responsibility that such information is accurate, current or complete". Reported information includes official mine name, status, background information, mine start/end date, primary commodity, mine features, hazards and remediation.

Government Publication Date: 1800-Mar 2022

Anderson's Waste Disposal Sites:

Private [ANDR](#)

The information provided in this database was collected by examining various historical documents which aimed to characterize the likely position of former waste disposal sites from 1860 to present. The research initiative behind the creation of this database was to identify those sites that are missing from the Ontario MOE Waste Disposal Site Inventory, as well as to provide revisions and corrections to the positions and descriptions of sites currently listed in the MOE inventory. In addition to historic waste disposal facilities, the database also identifies certain auto wreckers and scrap yards that have been extrapolated from documentary sources. Please note that the data is not warranted to be complete, exhaustive or authoritative. The information was collected for research purposes only.

Government Publication Date: 1860s-Present

Aboveground Storage Tanks:

Provincial [AST](#)

Historical listing of aboveground storage tanks made available by the Department of Natural Resources and Forestry. Includes tanks used to hold water or petroleum. This dataset has been retired as of September 25, 2014 and will no longer be updated.

Government Publication Date: May 31, 2014

Automobile Wrecking & Supplies:

Private [AUWR](#)

This database provides an inventory of known locations that are involved in the scrap metal, automobile wrecking/recycling, and automobile parts & supplies industry. Information is provided on the company name, location and business type.

Government Publication Date: 1999-May 31, 2022

Borehole:

Provincial [BORE](#)

A borehole is the generalized term for any narrow shaft drilled in the ground, either vertically or horizontally. The information here includes geotechnical investigations or environmental site assessments, mineral exploration, or as a pilot hole for installing piers or underground utilities. Information is from many sources such as the Ministry of Transportation (MTO) boreholes from engineering reports and projects from the 1950 to 1990's in Southern Ontario. Boreholes from the Ontario Geological Survey (OGS) including The Urban Geology Analysis Information System (UGAIS) and the York Peel Durham Toronto (YPDT) database of the Conservation Authority Moraine Coalition. This database will include fields such as location, stratigraphy, depth, elevation, year drilled, etc. For all water well data or oil and gas well data for Ontario please refer to WWIS and OOGW.

Government Publication Date: 1875-Jul 2018

Certificates of Approval:

Provincial CA

This database contains the following types of approvals: Air & Noise, Industrial Sewage, Municipal & Private Sewage, Waste Management Systems and Renewable Energy Approvals. The MOE in Ontario states that any facility that releases emissions to the atmosphere, discharges contaminants to ground or surface water, provides potable water supplies, or stores, transports or disposes of waste, must have a Certificate of Approval before it can operate lawfully. Fields include approval number, business name, address, approval date, approval type and status. This database will no longer be updated, as CofA's have been replaced by either Environmental Activity and Sector Registry (EASR) or Environmental Compliance Approval (ECA). Please refer to those individual databases for any information after Oct.31, 2011.

Government Publication Date: 1985-Oct 30, 2011*

Dry Cleaning Facilities:

Federal CDRY

List of dry cleaning facilities made available by Environment and Climate Change Canada. Environment and Climate Change Canada's Tetrachloroethylene (Use in Dry Cleaning and Reporting Requirements) Regulations (SOR/2003-79) are intended to reduce releases of tetrachloroethylene to the environment from dry cleaning facilities.

Government Publication Date: Jan 2004-Dec 2020

Commercial Fuel Oil Tanks:

Provincial CFOT

Locations of commercial underground fuel oil tanks. This is not a comprehensive or complete inventory of commercial fuel tanks in the province; this listing is a copy of records of registered commercial underground fuel oil tanks obtained under Access to Public Information.

Note that the following types of tanks do not require registration: waste oil tanks in apartments, office buildings, residences, etc.; aboveground gas or diesel tanks. Records are not verified for accuracy or completeness.

Government Publication Date: Feb 28, 2022

Chemical Manufacturers and Distributors:

Private CHEM

This database includes information from both a one time study conducted in 1992 and private source and is a listing of facilities that manufacture or distribute chemicals. The production of these chemical substances may involve one or more chemical reactions and/or chemical separation processes (i.e. fractionation, solvent extraction, crystallization, etc.).

Government Publication Date: 1999-Jan 31, 2020

Chemical Register:

Private CHM

This database includes a listing of locations of facilities within the Province or Territory that either manufacture and/or distributes chemicals.

Government Publication Date: 1999-May 31, 2022

Compressed Natural Gas Stations:

Private CNG

Canada has a network of public access compressed natural gas (CNG) refuelling stations. These stations dispense natural gas in compressed form at 3,000 pounds per square inch (psi), the pressure which is allowed within the current Canadian codes and standards. The majority of natural gas refuelling is located at existing retail gasoline that have a separate refuelling island for natural gas. This list of stations is made available by the Canadian Natural Gas Vehicle Alliance.

Government Publication Date: Dec 2012 -Sep 2022

Inventory of Coal Gasification Plants and Coal Tar Sites:

Provincial COAL

This inventory includes both the "Inventory of Coal Gasification Plant Waste Sites in Ontario-April 1987" and the Inventory of Industrial Sites Producing or Using Coal Tar and Related Tars in Ontario-November 1988) collected by the MOE. It identifies industrial sites that produced and continue to produce or use coal tar and other related tars. Detailed information is available and includes: facility type, size, land use, information on adjoining properties, soil condition, site operators/occupants, site description, potential environmental impacts and historic maps available. This was a one-time inventory.*

Government Publication Date: Apr 1987 and Nov 1988*

Compliance and Convictions:

Provincial CONV

This database summarizes the fines and convictions handed down by the Ontario courts beginning in 1989. Companies and individuals named here have been found guilty of environmental offenses in Ontario courts of law.

Government Publication Date: 1989-Nov 2022

Certificates of Property Use:

Provincial CPU

This is a subset taken from Ontario's Environmental Registry (EBR) database. It will include CPU's on the registry such as (EPA s. 168.6) - Certificate of Property Use.

Government Publication Date: 1994 - Dec 31, 2022

Drill Hole Database:

Provincial

[DRL](#)

The Ontario Drill Hole Database contains information on more than 113,000 percussion, overburden, sonic and diamond drill holes from assessment files on record with the department of Mines and Minerals. Please note that limited data is available for southern Ontario, as it was the last area to be completed. The database was created when surveys submitted to the Ministry were converted in the Assessment File Research Image Database (AFRI) project. However, the degree of accuracy (coordinates) as to the exact location of drill holes is dependent upon the source document submitted to the MNDM. Levels of accuracy used to locate holes are: centering on the mining claim; a sketch of the mining claim; a 1:50,000 map; a detailed company map; or from submitted a "Report of Work".

Government Publication Date: 1886 - Oct 2022

Delisted Fuel Tanks:

Provincial

[DTNK](#)

List of fuel storage tank sites that were once found in - and have since been removed from - the list of fuel storage tanks made available by the regulatory agency under Access to Public Information.

Government Publication Date: Feb 28, 2022

Environmental Activity and Sector Registry:

Provincial

[EASR](#)

On October 31, 2011, a smarter, faster environmental approvals system came into effect in Ontario. The EASR allows businesses to register certain activities with the ministry, rather than apply for an approval. The registry is available for common systems and processes, to which preset rules of operation can be applied. The EASR is currently available for: heating systems, standby power systems and automotive refinishing. Businesses whose activities aren't subject to the EASR may apply for an ECA (Environmental Compliance Approval). Please see our ECA database.

Government Publication Date: Oct 2011- Dec 31, 2022

Environmental Registry:

Provincial

[EBR](#)

The Environmental Registry lists proposals, decisions and exceptions regarding policies, Acts, instruments, or regulations that could significantly affect the environment. Through the Registry, thirteen provincial ministries notify the public of upcoming proposals and invite their comments. For example, if a local business is requesting a permit, license, or certificate of approval to release substances into the air or water; these are notified on the registry. Data includes: Approval for discharge into the natural environment other than water (i.e. Air) - EPA s. 9, Approval for sewage works - OWRA s. 53(1), and EPA s. 27 - Approval for a waste disposal site. For information regarding Permit to Take Water (PTTW), Certificate of Property Use (CPU) and (ORD) Orders please refer to those individual databases.

Government Publication Date: 1994 - Dec 31, 2022

Environmental Compliance Approval:

Provincial

[ECA](#)

On October 31, 2011, a smarter, faster environmental approvals system came into effect in Ontario. In the past, a business had to apply for multiple approvals (known as certificates of approval) for individual processes and pieces of equipment. Today, a business either registers itself, or applies for a single approval, depending on the types of activities it conducts. Businesses whose activities aren't subject to the EASR may apply for an ECA. A single ECA addresses all of a business's emissions, discharges and wastes. Separate approvals for air, noise and waste are no longer required. This database will also include Renewable Energy Approvals. For certificates of approval prior to Nov 1st, 2011, please refer to the CA database. For all Waste Disposal Sites please refer to the WDS database.

Government Publication Date: Oct 2011- Dec 31, 2022

Environmental Effects Monitoring:

Federal

[EEM](#)

The Environmental Effects Monitoring program assesses the effects of effluent from industrial or other sources on fish, fish habitat and human usage of fisheries resources. Since 1992, pulp and paper mills have been required to conduct EEM studies under the Pulp and Paper Effluent Regulations. This database provides information on the mill name, geographical location and sub-lethal toxicity data.

Government Publication Date: 1992-2007*

ERIS Historical Searches:

Private

[EHS](#)

ERIS has compiled a database of all environmental risk reports completed since March 1999. Available fields for this database include: site location, date of report, type of report, and search radius. As per all other databases, the ERIS database can be referenced on both the map and "Statistical Profile" page.

Government Publication Date: 1999-Jul 31, 2022

Environmental Issues Inventory System:

Federal

[EIIS](#)

The Environmental Issues Inventory System was developed through the implementation of the Environmental Issues and Remediation Plan. This plan was established to determine the location and severity of contaminated sites on inhabited First Nation reserves, and where necessary, to remediate those that posed a risk to health and safety; and to prevent future environmental problems. The EIIS provides information on the reserve under investigation, inventory number, name of site, environmental issue, site action (Remediation, Site Assessment), and date investigation completed.

Government Publication Date: 1992-2001*

Emergency Management Historical Event:

Provincial

EMHE

List of locations of historical occurrences of emergency events, including those assigned to the Ministry of Natural Resources by Order-In-Council (OIC) under the Emergency Management and Civil Protection Act, as well as events where MNR provided requested emergency response assistance. Many of these events will have involved community evacuations, significant structural loss, and/or involvement of MNR emergency response staff. These events fall into one of ten (10) type categories: Dam Failure; Drought / Low Water; Erosion; Flood; Forest Fire; Soil and Bedrock Instability; Petroleum Resource Center Event, EMO Requested Assistance, Continuity of Operations Event, Other Requested Assistance. EMHE record details are reproduced by ERIIS under License with the Ontario Ministry of Natural Resources © Queen's Printer for Ontario, 2017.

Government Publication Date: Apr 30, 2022

Environmental Penalty Annual Report:

Provincial

EPAR

This database contains data from Ontario's annual environmental penalty report published by the Ministry of the Environment and Climate Change. These reports provide information on environmental penalties for land or water violations issued to companies in one of the nine industrial sectors covered by the Municipal Industrial Strategy for Abatement (MISA) regulations.

Government Publication Date: Jan 1, 2011 - Dec 31, 2021

List of Expired Fuels Safety Facilities:

Provincial

EXP

List of facilities and tanks for which there was once a fuel registration. This is not a comprehensive or complete inventory of expired tanks/tank facilities in the province; this listing is a copy of previously registered tanks and facilities obtained under Access to Public Information. Includes private fuel outlets, bulk plants, fuel oil tanks, gasoline stations, marinas, propane filling stations, liquid fuel tanks, piping systems, etc; includes tanks which have been removed from the ground.

Notes: registration was not required for private fuel underground/aboveground storage tanks prior to January 1990, nor for furnace oil tanks prior to May 1, 2002; registration is not required for waste oil tanks in apartments, office buildings, residences, etc., or aboveground gas or diesel tanks. Records are not verified for accuracy or completeness.

Government Publication Date: Feb 28, 2022

Federal Convictions:

Federal

FCON

Environment Canada maintains a database referred to as the "Environmental Registry" that details prosecutions under the Canadian Environmental Protection Act (CEPA) and the Fisheries Act (FA). Information is provided on the company name, location, charge date, offence and penalty.

Government Publication Date: 1988-Jun 2007*

Contaminated Sites on Federal Land:

Federal

FCS

The Federal Contaminated Sites Inventory includes information on known federal contaminated sites under the custodianship of departments, agencies and consolidated Crown corporations as well as those that are being or have been investigated to determine whether they have contamination arising from past use that could pose a risk to human health or the environment. The inventory also includes non-federal contaminated sites for which the Government of Canada has accepted some or all financial responsibility. It does not include sites where contamination has been caused by, and which are under the control of, enterprise Crown corporations, private individuals, firms or other levels of government. Includes fire training sites and sites at which Per- and Polyfluoroalkyl Substances (PFAS) are a concern.

Government Publication Date: Jun 2000-Dec 2022

Fisheries & Oceans Fuel Tanks:

Federal

FOFT

Fisheries & Oceans Canada maintains an inventory of aboveground & underground fuel storage tanks located on Fisheries & Oceans property or controlled by DFO. Our inventory provides information on the site name, location, tank owner, tank operator, facility type, storage tank location, tank contents & capacity, and date of tank installation.

Government Publication Date: 1964-Sep 2019

Federal Identification Registry for Storage Tank Systems (FIRSTS):

Federal

FRST

A list of federally regulated Storage tanks from the Federal Identification Registry for Storage Tank Systems (FIRSTS). FIRSTS is Environment and Climate Change Canada's database of storage tank systems subject to the Storage Tank for Petroleum Products and Allied Petroleum Products Regulations. The main objective of the Regulations is to prevent soil and groundwater contamination from storage tank systems located on federal and aboriginal lands. Storage tank systems that do not have a valid identification number displayed in a readily visible location on or near the storage tank system may be refused product delivery.

Government Publication Date: May 31, 2018

Fuel Storage Tank:

Provincial

FST

List of registered private and retail fuel storage tanks. This is not a comprehensive or complete inventory of private and retail fuel storage tanks in the province; this listing is a copy of registered private and retail fuel storage tanks, obtained under Access to Public Information.

Notes: registration was not required for private fuel underground/aboveground storage tanks prior to January 1990, nor for furnace oil tanks prior to May 1, 2002; registration is not required for waste oil tanks in apartments, office buildings, residences, etc., or aboveground gas or diesel tanks. Records are not verified for accuracy or completeness.

Government Publication Date: Feb 28, 2022

Fuel Storage Tank - Historic:

Provincial

FSTH

The Fuels Safety Branch of the Ontario Ministry of Consumer and Commercial Relations maintained a database of all registered private fuel storage tanks. Public records of private fuel storage tanks are only available since the registration became effective in September 1989. This information is now collected by the Technical Standards and Safety Authority.

Government Publication Date: Pre-Jan 2010*

Ontario Regulation 347 Waste Generators Summary:

Provincial

GEN

Regulation 347 of the Ontario EPA defines a waste generation site as any site, equipment and/or operation involved in the production, collection, handling and/or storage of regulated wastes. A generator of regulated waste is required to register the waste generation site and each waste produced, collected, handled, or stored at the site. This database contains the registration number, company name and address of registered generators including the types of hazardous wastes generated. It includes data on waste generating facilities such as: drycleaners, waste treatment and disposal facilities, machine shops, electric power distribution etc. This information is a summary of all years from 1986 including the most currently available data. Some records may contain, within the company name, the phrase "See & Use..." followed by a series of letters and numbers. This occurs when one company is amalgamated with or taken over by another registered company. The number listed as "See & Use", refers to the new ownership and the other identification number refers to the original ownership. This phrase serves as a link between the 2 companies until operations have been fully transferred.

Government Publication Date: 1986-Oct 31, 2022

Greenhouse Gas Emissions from Large Facilities:

Federal

GHG

List of greenhouse gas emissions from large facilities made available by Environment Canada. Greenhouse gas emissions in kilotonnes of carbon dioxide equivalents (kt CO₂ eq).

Government Publication Date: 2013-Dec 2019

TSSA Historic Incidents:

Provincial

HINC

List of historic incidences of spills and leaks of diesel, fuel oil, gasoline, natural gas, propane, and hydrogen recorded by the TSSA in their previous incident tracking system. The TSSA's Fuels Safety Program administers the Technical Standards & Safety Act 2000, providing fuel-related safety services associated with the safe transportation, storage, handling and use of fuels such as gasoline, diesel, propane, natural gas and hydrogen. Under this Act, the TSSA regulates fuel suppliers, storage facilities, transport trucks, pipelines, contractors and equipment or appliances that use fuels. Records are not verified for accuracy or completeness. This is not a comprehensive or complete inventory of historical fuel spills and leaks in the province. This listing is a copy of the data captured at one moment in time and is hence limited by the record date provided here.

Government Publication Date: 2006-June 2009*

Indian & Northern Affairs Fuel Tanks:

Federal

IAFT

The Department of Indian & Northern Affairs Canada (INAC) maintains an inventory of aboveground & underground fuel storage tanks located on both federal and crown land. Our inventory provides information on the reserve name, location, facility type, site/facility name, tank type, material & ID number, tank contents & capacity, and date of tank installation.

Government Publication Date: 1950-Aug 2003*

Fuel Oil Spills and Leaks:

Provincial

INC

Listing of spills and leaks of diesel, fuel oil, gasoline, natural gas, propane, and hydrogen reported to the Spills Action Centre (SAC). This is not a comprehensive or complete inventory of fuel-related leaks, spills, and incidents in the province; this listing is a copy of incidents reported to the SAC, obtained under Access to Public Information. Includes incidents from fuel-related hazards such as spills, fires, and explosions. Records are not verified for accuracy or completeness.

Government Publication Date: Feb 28, 2022

Landfill Inventory Management Ontario:

Provincial

LIMO

The Landfill Inventory Management Ontario (LIMO) database is updated every year, as the Ministry of the Environment, Conservation and Parks compiles new and updated information. Includes small and large landfills currently operating as well as those which are closed and historic. Operators of larger landfills provide landfill information for the previous operating year to the ministry for LIMO including: estimated amount of total waste received, landfill capacity, estimated total remaining landfill capacity, fill rates, engineering designs, reporting and monitoring details, size of location, service area, approved waste types, leachate of site treatment, contaminant attenuation zone and more. The small landfills include information such as site owner, site location and certificate of approval # and status.

Government Publication Date: Mar 21, 2022

Canadian Mine Locations:

Private

MINE

This information is collected from the Canadian & American Mines Handbook. The Mines database is a national database that provides over 290 listings on mines (listed as public companies) dealing primarily with precious metals and hard rocks. Listed are mines that are currently in operation, closed, suspended, or are still being developed (advanced projects). Their locations are provided as geographic coordinates (x, y and/or longitude, latitude). As of 2002, data pertaining to Canadian smelters and refineries has been appended to this database.

Government Publication Date: 1998-2009*

Mineral Occurrences:

Provincial

MNR

In the early 70's, the Ministry of Northern Development and Mines created an inventory of approximately 19,000 mineral occurrences in Ontario, in regard to metallic and industrial minerals, as well as some information on building stones and aggregate deposits. Please note that the "Horizontal Positional Accuracy" is approximately +/- 200 m. Many reference elements for each record were derived from field sketches using pace or chain/tape measurements against claim posts or topographic features in the area. The primary limiting factor for the level of positional accuracy is the scale of the source material. The testing of horizontal accuracy of the source materials was accomplished by comparing the plan metric (X and Y) coordinates of that point with the coordinates of the same point as defined from a source of higher accuracy.

Government Publication Date: 1846-Feb 2022

National Analysis of Trends in Emergencies System (NATES):

Federal

NATE

In 1974 Environment Canada established the National Analysis of Trends in Emergencies System (NATES) database, for the voluntary reporting of significant spill incidents. The data was to be used to assist in directing the work of the emergencies program. NATES ran from 1974 to 1994. Extensive information is available within this database including company names, place where the spill occurred, date of spill, cause, reason and source of spill, damage incurred, and amount, concentration, and volume of materials released.

Government Publication Date: 1974-1994*

Non-Compliance Reports:

Provincial

NCPL

The Ministry of the Environment provides information about non-compliant discharges of contaminants to air and water that exceed legal allowable limits, from regulated industrial and municipal facilities. A reported non-compliance failure may be in regard to a Control Order, Certificate of Approval, Sectoral Regulation or specific regulation/act.

Government Publication Date: Dec 31, 2021

National Defense & Canadian Forces Fuel Tanks:

Federal

NDFT

The Department of National Defense and the Canadian Forces maintains an inventory of all aboveground & underground fuel storage tanks located on DND lands. Our inventory provides information on the base name, location, tank type & capacity, tank contents, tank class, date of tank installation, date tank last used, and status of tank as of May 2001. This database will no longer be updated due to the new National Security protocols which have prohibited any release of this database.

Government Publication Date: Up to May 2001*

National Defense & Canadian Forces Spills:

Federal

NDSP

The Department of National Defense and the Canadian Forces maintains an inventory of spills to land and water. All spill sites have been classified under the "Transportation of Dangerous Goods Act - 1992". Our inventory provides information on the facility name, location, spill ID #, spill date, type of spill, as well as the quantity of substance spilled & recovered.

Government Publication Date: Mar 1999-Apr 2018

National Defence & Canadian Forces Waste Disposal Sites:

Federal

NDWD

The Department of National Defence and the Canadian Forces maintains an inventory of waste disposal sites located on DND lands. Where available, our inventory provides information on the base name, location, type of waste received, area of site, depth of site, year site opened/closed and status.

Government Publication Date: 2001-Apr 2007*

National Energy Board Pipeline Incidents:

Federal

NEBI

Locations of pipeline incidents from 2008 to present, made available by the Canada Energy Regulator (CER) - previously the National Energy Board (NEB). Includes incidents reported under the Onshore Pipeline Regulations and the Processing Plant Regulations related to pipelines under federal jurisdiction, does not include incident data related to pipelines under provincial or territorial jurisdiction.

Government Publication Date: 2008-Jun 30, 2021

National Energy Board Wells:

Federal

NEBP

The NEBW database contains information on onshore & offshore oil and gas wells that are outside provincial jurisdiction(s) and are thereby regulated by the National Energy Board. Data is provided regarding the operator, well name, well ID No./UWI, status, classification, well depth, spud and release date.

Government Publication Date: 1920-Feb 2003*

National Environmental Emergencies System (NEES):

Federal

[NEES](#)

In 2000, the Emergencies program implemented NEES, a reporting system for spills of hazardous substances. For the most part, this system only captured data from the Atlantic Provinces, some from Quebec and Ontario and a portion from British Columbia. Data for Alberta, Saskatchewan, Manitoba and the Territories was not captured. However, NEES is also a repository for previous Environment Canada spill datasets. NEES is composed of the historic datasets ' or Trends ' which dates from approximately 1974 to present. NEES Trends is a compilation of historic databases, which were merged and includes data from NATES (National Analysis of Trends in Emergencies System), ARTS (Atlantic Regional Trends System), and NEES. In 2001, the Emergencies Program determined that variations in reporting regimes and requirements between federal and provincial agencies made national spill reporting and trend analysis difficult to achieve. As a consequence, the department has focused efforts on capturing data on spills of substances which fall under its legislative authority only (CEPA and FA). As such, the NEES database will be decommissioned in December 2004.

Government Publication Date: 1974-2003***National PCB Inventory:**

Federal

[NPCB](#)

Environment Canada's National PCB inventory includes information on in-use PCB containing equipment in Canada including federal, provincial and private facilities. Federal out-of-service PCB containing equipment and PCB waste owned by the federal government or by federally regulated industries such as airlines, railway companies, broadcasting companies, telephone and telecommunications companies, pipeline companies, etc. are also listed. Although it is not Environment Canada's mandate to collect data on non-federal PCB waste, the National PCB inventory includes some information on provincial and private PCB waste and storage sites. Some addresses provided may be Head Office addresses and are not necessarily the location of where the waste is being used or stored.

Government Publication Date: 1988-2008***National Pollutant Release Inventory:**

Federal

[NPRI](#)

Environment Canada has defined the National Pollutant Release Inventory ("NPRI") as a federal government initiative designed to collect comprehensive national data regarding releases to air, water, or land, and waste transfers for recycling for more than 300 listed substances.

Government Publication Date: 1993-May 2017**Oil and Gas Wells:**

Private

[OGWE](#)

The Nickle's Energy Group (publisher of the Daily Oil Bulletin) collects information on drilling activity including operator and well statistics. The well information database includes name, location, class, status and depth. The main Nickle's database is updated on a daily basis, however, this database is updated on a monthly basis. More information is available at www.nickles.com.

Government Publication Date: 1988-Nov 30, 2022**Ontario Oil and Gas Wells:**

Provincial

[OOGW](#)

In 1998, the MNR handed over to the Ontario Oil, Gas and Salt Resources Corporation, the responsibility of maintaining a database of oil and gas wells drilled in Ontario. The OGSR Library has over 20,000+ wells in their database. Information available for all wells in the ERIS database include well owner/operator, location, permit issue date, and well cap date, license No., status, depth and the primary target (rock unit) of the well being drilled. All geology/stratigraphy table information, plus all water table information is also provide for each well record.

Government Publication Date: 1800-Aug 2021**Inventory of PCB Storage Sites:**

Provincial

[OPCB](#)

The Ontario Ministry of Environment, Waste Management Branch, maintains an inventory of PCB storage sites within the province. Ontario Regulation 11/82 (Waste Management - PCB) and Regulation 347 (Generator Waste Management) under the Ontario EPA requires the registration of inactive PCB storage equipment and/or disposal sites of PCB waste with the Ontario Ministry of Environment. This database contains information on: 1) waste quantities; 2) major and minor sites storing liquid or solid waste; and 3) a waste storage inventory.

Government Publication Date: 1987-Oct 2004; 2012-Dec 2013**Orders:**

Provincial

[ORD](#)

This is a subset taken from Ontario's Environmental Registry (EBR) database. It will include Orders on the registry such as (EPA s. 17) - Order for remedial work, (EPA s. 18) - Order for preventative measures, (EPA s. 43) - Order for removal of waste and restoration of site, (EPA s. 44) - Order for conformity with Act for waste disposal sites, (EPA s. 136) - Order for performance of environmental measures.

Government Publication Date: 1994 - Dec 31, 2022**Canadian Pulp and Paper:**

Private

[PAP](#)

This information is part of the Pulp and Paper Canada Directory. The Directory provides a comprehensive listing of the locations of pulp and paper mills and the products that they produce.

Government Publication Date: 1999, 2002, 2004, 2005, 2009-2014**Parks Canada Fuel Storage Tanks:**

Federal

[PCFT](#)

Canadian Heritage maintains an inventory of known fuel storage tanks operated by Parks Canada, in both National Parks and at National Historic Sites. The database details information on site name, location, tank install/removal date, capacity, fuel type, facility type, tank design and owner/operator.

Government Publication Date: 1920-Jan 2005*

Pesticide Register:

Provincial PES

The Ontario Ministry of the Environment and Climate Change maintains a database of licensed operators and vendors of registered pesticides.

Government Publication Date: Oct 2011- Dec 31, 2022

Pipeline Incidents:

Provincial PINC

List of pipeline incidents (strikes, leaks, spills). This is not a comprehensive or complete inventory of pipeline incidents in the province; this listing is an historical copy of records previously obtained under Access to Public Information. Records are not verified for accuracy or completeness.

Government Publication Date: Feb 28, 2021

Private and Retail Fuel Storage Tanks:

Provincial PRT

The Fuels Safety Branch of the Ontario Ministry of Consumer and Commercial Relations maintained a database of all registered private fuel storage tanks and licensed retail fuel outlets. This database includes an inventory of locations that have gasoline, oil, waste oil, natural gas and/or propane storage tanks on their property. The MCCR no longer collects this information. This information is now collected by the Technical Standards and Safety Authority (TSSA).

Government Publication Date: 1989-1996*

Permit to Take Water:

Provincial PTTW

This is a subset taken from Ontario's Environmental Registry (EBR) database. It will include PTTW's on the registry such as OWRA s. 34 - Permit to take water.

Government Publication Date: 1994 - Dec 31, 2022

Ontario Regulation 347 Waste Receivers Summary:

Provincial REC

Part V of the Ontario Environmental Protection Act ("EPA") regulates the disposal of regulated waste through an operating waste management system or a waste disposal site operated or used pursuant to the terms and conditions of a Certificate of Approval or a Provisional Certificate of Approval. Regulation 347 of the Ontario EPA defines a waste receiving site as any site or facility to which waste is transferred by a waste carrier. A receiver of regulated waste is required to register the waste receiving facility. This database represents registered receivers of regulated wastes, identified by registration number, company name and address, and includes receivers of waste such as: landfills, incinerators, transfer stations, PCB storage sites, sludge farms and water pollution control plants. This information is a summary of all years from 1986 including the most currently available data.

Government Publication Date: 1986-1990, 1992-2019

Record of Site Condition:

Provincial RSC

The Record of Site Condition (RSC) is part of the Ministry of the Environment's Brownfields Environmental Site Registry. Protection from environmental cleanup orders for property owners is contingent upon documentation known as a record of site condition (RSC) being filed in the Environmental Site Registry. In order to file an RSC, the property must have been properly assessed and shown to meet the soil, sediment and groundwater standards appropriate for the use (such as residential) proposed to take place on the property. The Record of Site Condition Regulation (O. Reg. 153/04) details requirements related to site assessment and clean up.

RSCs filed after July 1, 2011 will also be included as part of the new (O.Reg. 511/09).

Government Publication Date: 1997-Sept 2001, Oct 2004-Dec 2022

Retail Fuel Storage Tanks:

Private RST

This database includes an inventory of retail fuel outlet locations (including marinas) that have on their property gasoline, oil, waste oil, natural gas and / or propane storage tanks.

Government Publication Date: 1999-May 31, 2022

Scott's Manufacturing Directory:

Private SCT

Scott's Directories is a data bank containing information on over 200,000 manufacturers across Canada. Even though Scott's listings are voluntary, it is the most comprehensive database of Canadian manufacturers available. Information concerning a company's address, plant size, and main products are included in this database.

Government Publication Date: 1992-Mar 2011*

Ontario Spills:

Provincial SPL

List of spills and incidents made available the Ministry of the Environment, Conservation and Parks. This database identifies information such as location (approximate), type and quantity of contaminant, date of spill, environmental impact, cause, nature of impact, etc. Information from 1988-2002 was part of the ORIS (Occurrence Reporting Information System). The SAC (Spills Action Centre) handles all spills reported in Ontario. Regulations for spills in Ontario are part of the MOE's Environmental Protection Act, Part X. The Ministry of the Environment, Conservation and Parks cites the coronavirus pandemic as an explanation for delays in releasing data pursuant to requests.

Government Publication Date: 1988-Sep 2020; Dec 2020-Mar 2021

Wastewater Discharger Registration Database:

Provincial

SRDS

Facilities that report either municipal treated wastewater effluent or industrial wastewater discharges under the Effluent Monitoring and Effluent Limits (EMEL) and Municipal/Industrial Strategy for Abatement Regulations. The Municipal/Industrial Strategy for Abatement (MISA) division of the Ontario Ministry of Environment keeps record of direct dischargers of toxic pollutants within nine sectors including: Electric Power Generation, Mining, Petroleum Refining, Organic Chemicals, Inorganic Chemicals, Pulp & Paper, Metal Casting, Iron & Steel, and Quarries.

Government Publication Date: 1990-Dec 31, 2020

Anderson's Storage Tanks:

Private

TANK

The information provided in this database was collected by examining various historical documents, which identified the location of former storage tanks, containing substances such as fuel, water, gas, oil, and other various types of miscellaneous products. Information is available in regard to business operating at tank site, tank location, permit year, permit & installation type, no. of tanks installed & configuration and tank capacity. Data contained within this database pertains only to the city of Toronto and is not warranted to be complete, exhaustive or authoritative. The information was collected for research purposes only.

Government Publication Date: 1915-1953*

Transport Canada Fuel Storage Tanks:

Federal

TCFT

List of fuel storage tanks currently or previously owned or operated by Transport Canada. This inventory also includes tanks on The Pickering Lands, which refers to 7,530 hectares (18,600 acres) of land in Pickering, Markham, and Uxbridge owned by the Government of Canada since 1972; properties on this land has been leased by the government since 1975, and falls under the Site Management Policy of Transport Canada, but is administered by Public Works and Government Services Canada. This inventory provides information on the site name, location, tank age, capacity and fuel type.

Government Publication Date: 1970 - Apr 2020

Variances for Abandonment of Underground Storage Tanks:

Provincial

VAR

Listing of variances granted for storage tank abandonment. This is not a comprehensive or complete inventory of tank abandonment variances in the province; this listing is a copy of tank abandonment variance records previously obtained under Access to Public Information. In Ontario, registered underground storage tanks must be removed within two years of disuse; if removal of a tank is not feasible, an application may be sought for a variance from this code requirement.

Records are not verified for accuracy or completeness.

Government Publication Date: Feb 28, 2022

Waste Disposal Sites - MOE CA Inventory:

Provincial

WDS

The Ontario Ministry of Environment, Waste Management Branch, maintains an inventory of known open (active or inactive) and closed disposal sites in the Province of Ontario. Active sites maintain a Certificate of Approval, are approved to receive and are receiving waste. Inactive sites maintain Certificate(s) of Approval but are not receiving waste. Closed sites are not receiving waste. The data contained within this database was compiled from the MOE's Certificate of Approval database. Locations of these sites may be cross-referenced to the Anderson database described under ERIS's Private Source Database section, by the CA number. All new Environmental Compliance Approvals handed out after Oct 31, 2011 for Waste Disposal Sites will still be found in this database.

Government Publication Date: Oct 2011- Dec 31, 2022

Waste Disposal Sites - MOE 1991 Historical Approval Inventory:

Provincial

WDSH

In June 1991, the Ontario Ministry of Environment, Waste Management Branch, published the "June 1991 Waste Disposal Site Inventory", of all known active and closed waste disposal sites as of October 30st, 1990. For each "active" site as of October 31st 1990, information is provided on site location, site/CA number, waste type, site status and site classification. For each "closed" site as of October 31st 1990, information is provided on site location, site/CA number, closure date and site classification. Locations of these sites may be cross-referenced to the Anderson database described under ERIS's Private Source Database section, by the CA number.

Government Publication Date: Up to Oct 1990*

Water Well Information System:

Provincial

WWIS

This database describes locations and characteristics of water wells found within Ontario in accordance with Regulation 903. It includes such information as coordinates, construction date, well depth, primary and secondary use, pump rate, static water level, well status, etc. Also included are detailed stratigraphy information, approximate depth to bedrock and the approximate depth to the water table.

Government Publication Date: Jun 30 2022

Definitions

Database Descriptions: This section provides a detailed explanation for each database including: source, information available, time coverage, and acronyms used. They are listed in alphabetic order.

Detail Report: This is the section of the report which provides the most detail for each individual record. Records are summarized by location, starting with the project property followed by records in closest proximity.

Distance: The distance value is the distance between plotted points, not necessarily the distance between the sites' boundaries. All values are an approximation.

Direction: The direction value is the compass direction of the site in respect to the project property and/or center point of the report.

Elevation: The elevation value is taken from the location at which the records for the site address have been plotted. All values are an approximation. Source: Google Elevation API.

Executive Summary: This portion of the report is divided into 3 sections:

'Report Summary'- Displays a chart indicating how many records fall on the project property and, within the report search radii.

'Site Report Summary'-Project Property'- This section lists all the records which fall on the project property. For more details, see the 'Detail Report' section.

'Site Report Summary-Surrounding Properties'- This section summarizes all records on adjacent properties, listing them in order of proximity from the project property. For more details, see the 'Detail Report' section.

Map Key: The map key number is assigned according to closest proximity from the project property. Map Key numbers always start at #1. The project property will always have a map key of '1' if records are available. If there is a number in brackets beside the main number, this will indicate the number of records on that specific property. If there is no number in brackets, there is only one record for that property.

The symbol and colour used indicates 'elevation': the red inverted triangle will dictate 'ERIS Sites with Lower Elevation', the yellow triangle will dictate 'ERIS Sites with Higher Elevation' and the orange square will dictate 'ERIS Sites with Same Elevation.'

Unplottables: These are records that could not be mapped due to various reasons, including limited geographic information. These records may or may not be in your study area, and are included as reference.

APPENDIX F



Vivi Tran

From: Public Information Services <publicinformationsservices@tssa.org>
Sent: April 22, 2022 1:21 PM
To: Mariam Al Gailani
Subject: RE: TSSA Search Request

External (publicinformationsservices@tssa.org)

[Report This Email](#) [FAQ](#) [TeleGlobal Email Protection](#)

Please refrain from sending documents to head office and only submit your requests electronically via email along with credit card payment. We are all working remotely and mailing in applications with cheques will lengthen the overall processing time.

NO RECORD FOUND

Hello,

Thank you for your request for confirmation of public information.

- We confirm that there are no records in our database of any fuel storage tanks at the subject addresses.

For a further search in our archives please complete our release of public information form found at <https://www.tssa.org/en/about-tssa/release-of-public-information.aspx?mid=392> and email the completed form to publicinformationsservices@tssa.org along with a fee of \$56.50 (including HST) per location. The fee is payable with credit card (Visa or MasterCard).

Although TSSA believes the information provided pursuant to your request is accurate, please note that TSSA does not warrant this information in any way whatsoever.

Kind regards,

Sherees



Public Information Agent

Facilities and Business Services
345 Carlingview Drive
Toronto, Ontario M9W 6N9

Tel: +1-416-734-6222 | Fax: +1-416-734-3568 | E-Mail: publicinformationsservices@tssa.org

www.tssa.org



From: Mariam Al Gailani <malgailani@groundedeng.ca>
Sent: April 22, 2022 9:53 AM
To: Public Information Services <publicinformationsservices@tssa.org>
Subject: TSSA Search Request

[CAUTION]: This email originated outside the organisation.

Please do not click links or open attachments unless you recognise the source of this email and know the content is safe.

To Whom This May Concern,

I am doing a Phase One Assessment and would like to request a preliminary basic record search for the following properties in [City], Ontario please:

- **383 & 385 Pearl Street**
- **2069 Lakeshore Road**
- **2079 Lakeshore Road**
- **389 Pearl Street**
- **360 Pearl Street**
- **2091 & 2092 Bates Common**
- **2072 Lakeshore Road**

Thank you,

Mariam Al Gailani BASc EIT

Geotechnical and Environmental Engineering




Grounded Engineering Inc.

1 Banigan Drive, Toronto, ON M4H 1G3

malgailani@groundedeng.ca | www.groundedeng.ca | (647) 265-0906

This electronic message and any attached documents are intended only for the named recipients. This communication from the Technical Standards and Safety Authority may contain information that is privileged, confidential or otherwise protected from disclosure and it must not be disclosed, copied, forwarded or distributed without authorization. If you have received this message in error, please notify the sender immediately and delete the original message.

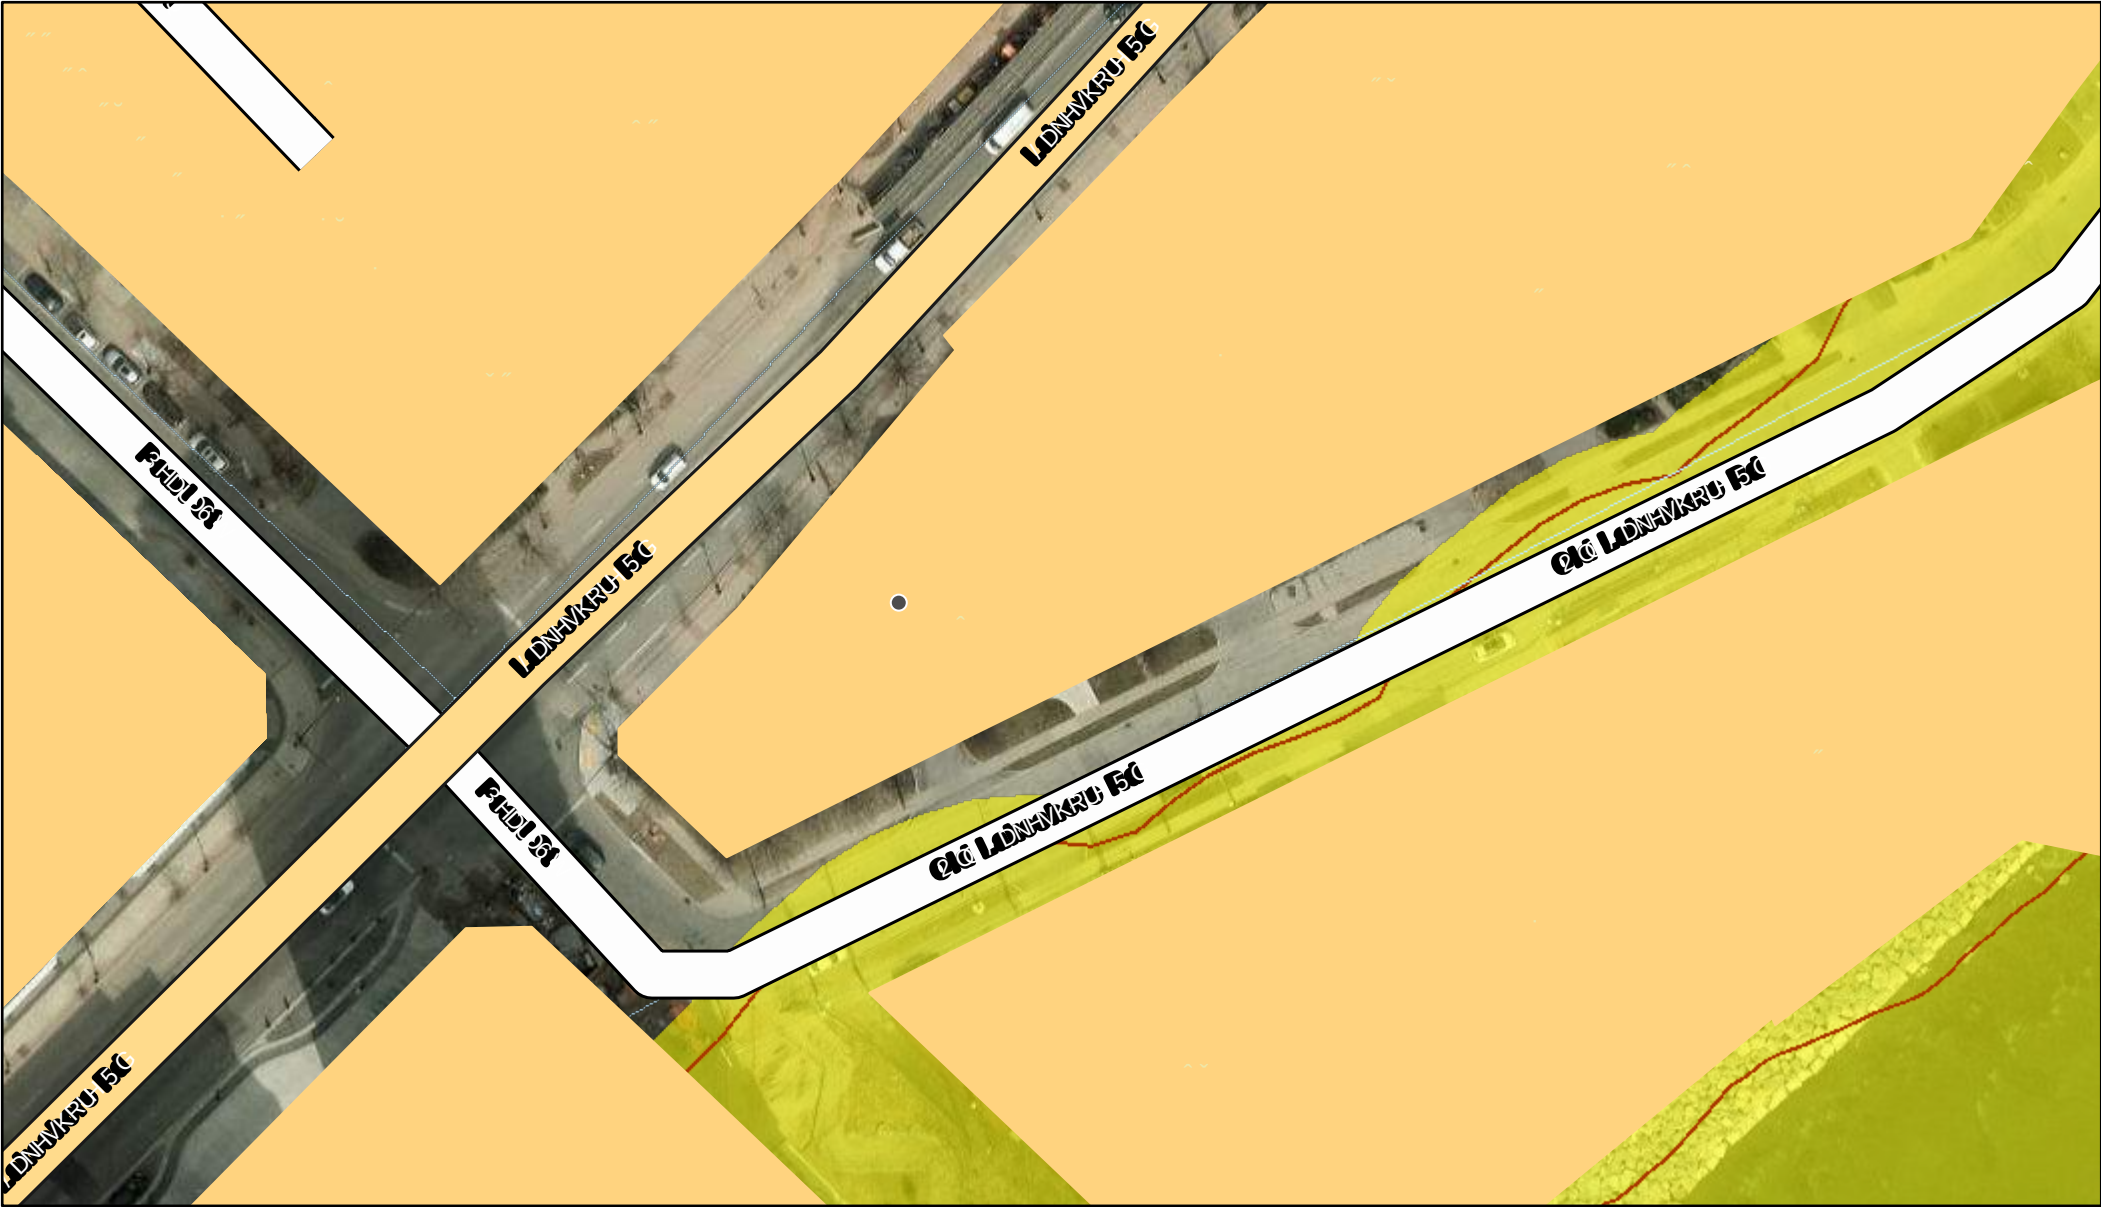

~ ^ \$0

3DUFHOV	6KRUHOLQH +DJDUG	)ORRGSODLQ +DJD	6SLOO \$UURZV
\$SSUR[LPDWH 5HJXODWLRQ	6KRUHOLQH +DJDUG	)ORRGSODLQ +DJD	6SLOO \$UURZV
6KRUHOLQH	6KRUHOLQH +DJDUG	6KRUHOLQH +DJDUG	6KRUHOLQH +DJDUG
6KRUHOLQH 'IQDPLF %HDFK	6KRUHOLQH +DJDUG	6KRUHOLQH +DJDUG	6KRUHOLQH +DJDUG

PL

NP

&RQVHUYDWLRQ +DOWRQ (VUL &RPPXQLW 0D
%XUOLQJWRQ &LW\ RI +DPLORW 3URYLQFH RI 2QW
(VUL +(5(*DUPLQ 6DIH*UDSK *HR7HFKQRORJLHV
(3\$ 136 86 &HQVXV %XUHDX 86'S 15&DQ 3DUNV
&RQVHUYDWLRQ +DOWRQ
&RQVHUYDWLRQ +DOWRQ

Ministry of the Environment, Conservation and Parks

Freedom of Information Request for Property Information

Instructions

Use this form to:

- submit and pay for a new FOI request for access to records/information about a property
- pay for a deposit or a final fee on an existing FOI request

Fields marked with an asterisk (*) are mandatory.

Are you: *

- ☒ Submitting a new FOI Request for Property Information
- ☐ Paying a deposit or final fee for an existing FOI Request for Property Information

Section 1 – Description of Records Requested

Time Period for Records Requested

From (yyyy/mm/dd) *

1798/01/01

To (yyyy/mm/dd) *

2023/05/03

Type of Record(s) *

- ☒ All environmental records relating to the identified property/site exclusive of Environmental Approvals and Registrations
- ☒ Environmental Approvals and Registrations (e.g. Environmental Compliance Approvals; Certificate of Approval; Renewable Energy Approvals; Environmental Activity and Sector Registry Registrations)

Select only if you are seeking access to an Approval or Registration that is not publicly available or if you are also seeking supporting documents relating to the Approval or Registration.

Operator and vendor Pesticide Licenses from September 4, 2018, final Approvals and Registrations are publicly available on the Access Environment website at:

<https://www.accessenvironment.ene.gov.on.ca/AEWeb/ae/GoSearch.action?search=basic&lang=en>.

Records of Site Condition (RSC) records are publicly available on the Brownfields Environmental Site Registry (BSER).

- RSC records between 2004 to June 30, 2011 are available at:
<https://www.lrcsde.lrc.gov.on.ca/besrWebPublic/generalSearch>
- RSC records filed after July 2011 are available at:
https://www.lrcsde.lrc.gov.on.ca/BFISWebPublic/pub/earchFiledRsc_search?request_locale=en

☐ Other Specific Document(s)

Type of Approval/Registration *

- ☒ Drinking Water Licenses
- ☐ No Supporting Documents ☒ All Supporting Documents ☐ Some Supporting Documents
- ☒ Pesticide Licenses

Only pesticide licenses post September 2018 are available. Prior to September 2018, only Pesticide license applications and supporting documentation is available

☐ No Supporting Documents ☒ All Supporting Documents ☐ Some Supporting Documents

☒ Permits to Take Water

☐ No Supporting Documents ☒ All Supporting Documents ☐ Some Supporting Documents

Water Source *

☒ Groundwater ☐ Surface Water

☒ Noise Vibrations Approvals/Registrations

☐ No Supporting Documents ☒ All Supporting Documents ☐ Some Supporting Documents

☒ Air Emissions Approvals/Registrations

☐ No Supporting Documents ☒ All Supporting Documents ☐ Some Supporting Documents

☒ Water Approvals/Registrations - Ontario Water Resources Commission, treatment, ground level, standpipes & elevated storage, pumping stations (local & booster), mains

☐ No Supporting Documents ☒ All Supporting Documents ☐ Some Supporting Documents

☒ Sewage – Treatment, Stormwater, Storm, Leachate & Lieachate Treatment & Sewage pump stations, Sanitary

☐ No Supporting Documents ☒ All Supporting Documents ☐ Some Supporting Documents

☒ Waste Water - Industrial discharge

☐ No Supporting Documents ☒ All Supporting Documents ☐ Some Supporting Documents

☒ Waste Sites - Disposal, Landfill sites, Transfer stations, Processing sites, Incinerator sites

☐ No Supporting Documents ☒ All Supporting Documents ☐ Some Supporting Documents

☒ Waste Management Systems - haulers: sewage, non-hazardous & hazardous waste, mobile waste processing units, Polychlorinated Biphenyls (PCBs) storage, transfer or destruction, Waste Generator Systems)

☐ No Supporting Documents ☒ All Supporting Documents ☐ Some Supporting Documents

Company Name

☒ Waste Generator Registration - number/class

List any record(s) that should be excluded from the scope of your request (e.g. email correspondences; records originating from your organization/business; records already in your possession, prior year(s) annual reports for approvals)

Please provide any additional relevant information relating to your request. For example, does your request relate to any other ministry business? Please note that this information is being requested only in order to provide contextual information to the Access and Privacy Office and will not in any way affect or expedite the status of any related ministry business identified.

Section 2 – Requester Information

Last Name * First Name * Middle Initial

Shaver Kristen

Business/Organization Name (if applicable or indicate "N/A") *

Grounded Engineering Inc.

Project/Reference Number (if applicable)

22-282

Are you submitting this request on behalf of a client? *

☐ Yes ☒ No

Mailing Address

Unit Number Street Number * Street Name *

1 Banigan Drive

PO Box City/Town * Province * Postal Code *

Toronto ON M4H 1G3

Telephone Number * Email Address *

647-370-3140 ext. kshaver@groundedeng.ca

Is there an alternate contact (e.g. office admin)? *

☒ Yes ☐ No

Alternate Contact

Last Name * First Name *

Levesque Lindsay

Telephone Number * Email Address *

647-361-5254 ext. llevesque@groundedeng.ca

Section 3 – Current Property Address Information

Is the property a:

☐ Park ☐ Lake ☐ First Nation Band ☐ Wind Farm ☐ Federal Land ☐ Island ☐ Unsurveyed Land

Are you requesting information about multiple addresses? *

☐ Yes ☒ No

Property Address

Unit Number Street Number Street Name

2072 Lakeshore Road

Full Lot Number Concession Geographic Township

City/Town/Village *

Burlington

Closest Intersection

Pearl Street and Lakeshore Road

Section 4 – Previous Property Address Information

Do you want the ministry to search all prior historical addresses for this property/site for the time period of the records requested? *

☐ Yes ☒ No

Section 5 – Owner Information

Please provide all present and previous property owner and/or tenant names for the search years requested.

Current Property Owner/Tenant

2072 Lakeshore Road
Burlington

Owner Name

Peter John Gerard Landry and Joann Katharine Landry

Date of Ownership (yyyy/mm/dd)

2019/07/12

Tenant Name

Section 6 – Supporting Documents

Please upload any documents (e.g. Maps) that are relevant to your FOI request.

The total size of all attachments must not be more than 8 MB.

1. File Name

Fig 1.pdf

Total File Size

1.02 MB

Payment confirmation number: 26017803

Ministry of the Environment, Conservation and Parks

Freedom of Information Request for Property Information

Instructions

Use this form to:

- submit and pay for a new FOI request for access to records/information about a property
- pay for a deposit or a final fee on an existing FOI request

Fields marked with an asterisk (*) are mandatory.

Are you: *

- ☒ Submitting a new FOI Request for Property Information
- ☐ Paying a deposit or final fee for an existing FOI Request for Property Information

Section 1 – Description of Records Requested

Time Period for Records Requested

From (yyyy/mm/dd) *

To (yyyy/mm/dd) *

1798/01/01

2023/05/03

Type of Record(s) *

- ☒ All environmental records relating to the identified property/site exclusive of Environmental Approvals and Registrations
- ☒ Environmental Approvals and Registrations (e.g. Environmental Compliance Approvals; Certificate of Approval; Renewable Energy Approvals; Environmental Activity and Sector Registry Registrations)

Select only if you are seeking access to an Approval or Registration that is not publicly available or if you are also seeking supporting documents relating to the Approval or Registration.

Operator and vendor Pesticide Licenses from September 4, 2018, final Approvals and Registrations are publicly available on the Access Environment website at:

<https://www.accessenvironment.ene.gov.on.ca/AEWeb/ae/GoSearch.action?search=basic&lang=en>.

Records of Site Condition (RSC) records are publicly available on the Brownfields Environmental Site Registry (BSER).

- RSC records between 2004 to June 30, 2011 are available at:
<https://www.lrcsde.lrc.gov.on.ca/besrWebPublic/generalSearch>
- RSC records filed after July 2011 are available at:
https://www.lrcsde.lrc.gov.on.ca/BFISWebPublic/pub/earchFiledRsc_search?request_locale=en

☐ Other Specific Document(s)

Type of Approval/Registration *

- ☒ Drinking Water Licenses
- ☐ No Supporting Documents ☒ All Supporting Documents ☐ Some Supporting Documents
- ☒ Pesticide Licenses

Only pesticide licenses post September 2018 are available. Prior to September 2018, only Pesticide license applications and supporting documentation is available

☐ No Supporting Documents ☒ All Supporting Documents ☐ Some Supporting Documents

☒ Permits to Take Water

☐ No Supporting Documents ☒ All Supporting Documents ☐ Some Supporting Documents

Water Source *

☒ Groundwater ☐ Surface Water

☒ Noise Vibrations Approvals/Registrations

☐ No Supporting Documents ☒ All Supporting Documents ☐ Some Supporting Documents

☒ Air Emissions Approvals/Registrations

☐ No Supporting Documents ☒ All Supporting Documents ☐ Some Supporting Documents

☒ Water Approvals/Registrations - Ontario Water Resources Commission, treatment, ground level, standpipes & elevated storage, pumping stations (local & booster), mains

☐ No Supporting Documents ☒ All Supporting Documents ☐ Some Supporting Documents

☒ Sewage – Treatment, Stormwater, Storm, Leachate & Leachate Treatment & Sewage pump stations, Sanitary

☐ No Supporting Documents ☒ All Supporting Documents ☐ Some Supporting Documents

☒ Waste Water - Industrial discharge

☐ No Supporting Documents ☒ All Supporting Documents ☐ Some Supporting Documents

☒ Waste Sites - Disposal, Landfill sites, Transfer stations, Processing sites, Incinerator sites

☐ No Supporting Documents ☒ All Supporting Documents ☐ Some Supporting Documents

☒ Waste Management Systems - haulers: sewage, non-hazardous & hazardous waste, mobile waste processing units, Polychlorinated Biphenyls (PCBs) storage, transfer or destruction, Waste Generator Systems)

☐ No Supporting Documents ☒ All Supporting Documents ☐ Some Supporting Documents

Company Name

☒ Waste Generator Registration - number/class

List any record(s) that should be excluded from the scope of your request (e.g. email correspondences; records originating from your organization/business; records already in your possession, prior year(s) annual reports for approvals)

Please provide any additional relevant information relating to your request. For example, does your request relate to any other ministry business? Please note that this information is being requested only in order to provide contextual information to the Access and Privacy Office and will not in any way affect or expedite the status of any related ministry business identified.

Section 2 – Requester Information

Last Name *

Shaver

First Name *

Kristen

Middle Initial

Business/Organization Name (if applicable or indicate "N/A") *

Grounded Engineering Inc.

Project/Reference Number (if applicable)

22-282

Are you submitting this request on behalf of a client? *

☐ Yes ☒ No

Mailing Address

Unit Number

Street Number *

Street Name *

1

Banigan Drive

PO Box

City/Town *

Province *

Postal Code *

Toronto

ON

M4H 1G3

Telephone Number *

647-370-3140

ext.

Email Address *

kshaver@groundedeng.ca

Is there an alternate contact (e.g. office admin)? *

☒ Yes ☐ No

Alternate Contact

Last Name *

Levesque

First Name *

Lindsay

Telephone Number *

647-361-5254

ext.

Email Address *

llevesque@groundedeng.ca

Section 3 – Current Property Address Information

Is the property a:

☐ Park ☐ Lake ☐ First Nation Band ☐ Wind Farm ☐ Federal Land ☐ Island ☐ Unsurveyed Land

Are you requesting information about multiple addresses? *

☐ Yes ☒ No

Property Address

Unit Number

Street Number

Street Name

2072

Lakeshore Road

Full Lot Number

Concession

Geographic Township

City/Town/Village *

Burlington

Closest Intersection

Pearl Street and Lakeshore Road

Section 4 – Previous Property Address Information

Do you want the ministry to search all prior historical addresses for this property/site for the time period of the records requested? *

☐ Yes

☒ No

Section 5 – Owner Information

Please provide all present and previous property owner and/or tenant names for the search years requested.

Current Property Owner/Tenant

2072 Lakeshore Road
Burlington

Owner Name

Peter John Gerard Landry and Joann Katharine Landry

Date of Ownership (yyyy/mm/dd)

2019/07/12

Tenant Name

Section 6 – Supporting Documents

Please upload any documents (e.g. Maps) that are relevant to your FOI request.

The total size of all attachments must not be more than 8 MB.

1. File Name

Fig 1.pdf

Total File Size

1.02 MB

Payment confirmation number: 26017803


APPENDIX G






YEAR: 1959




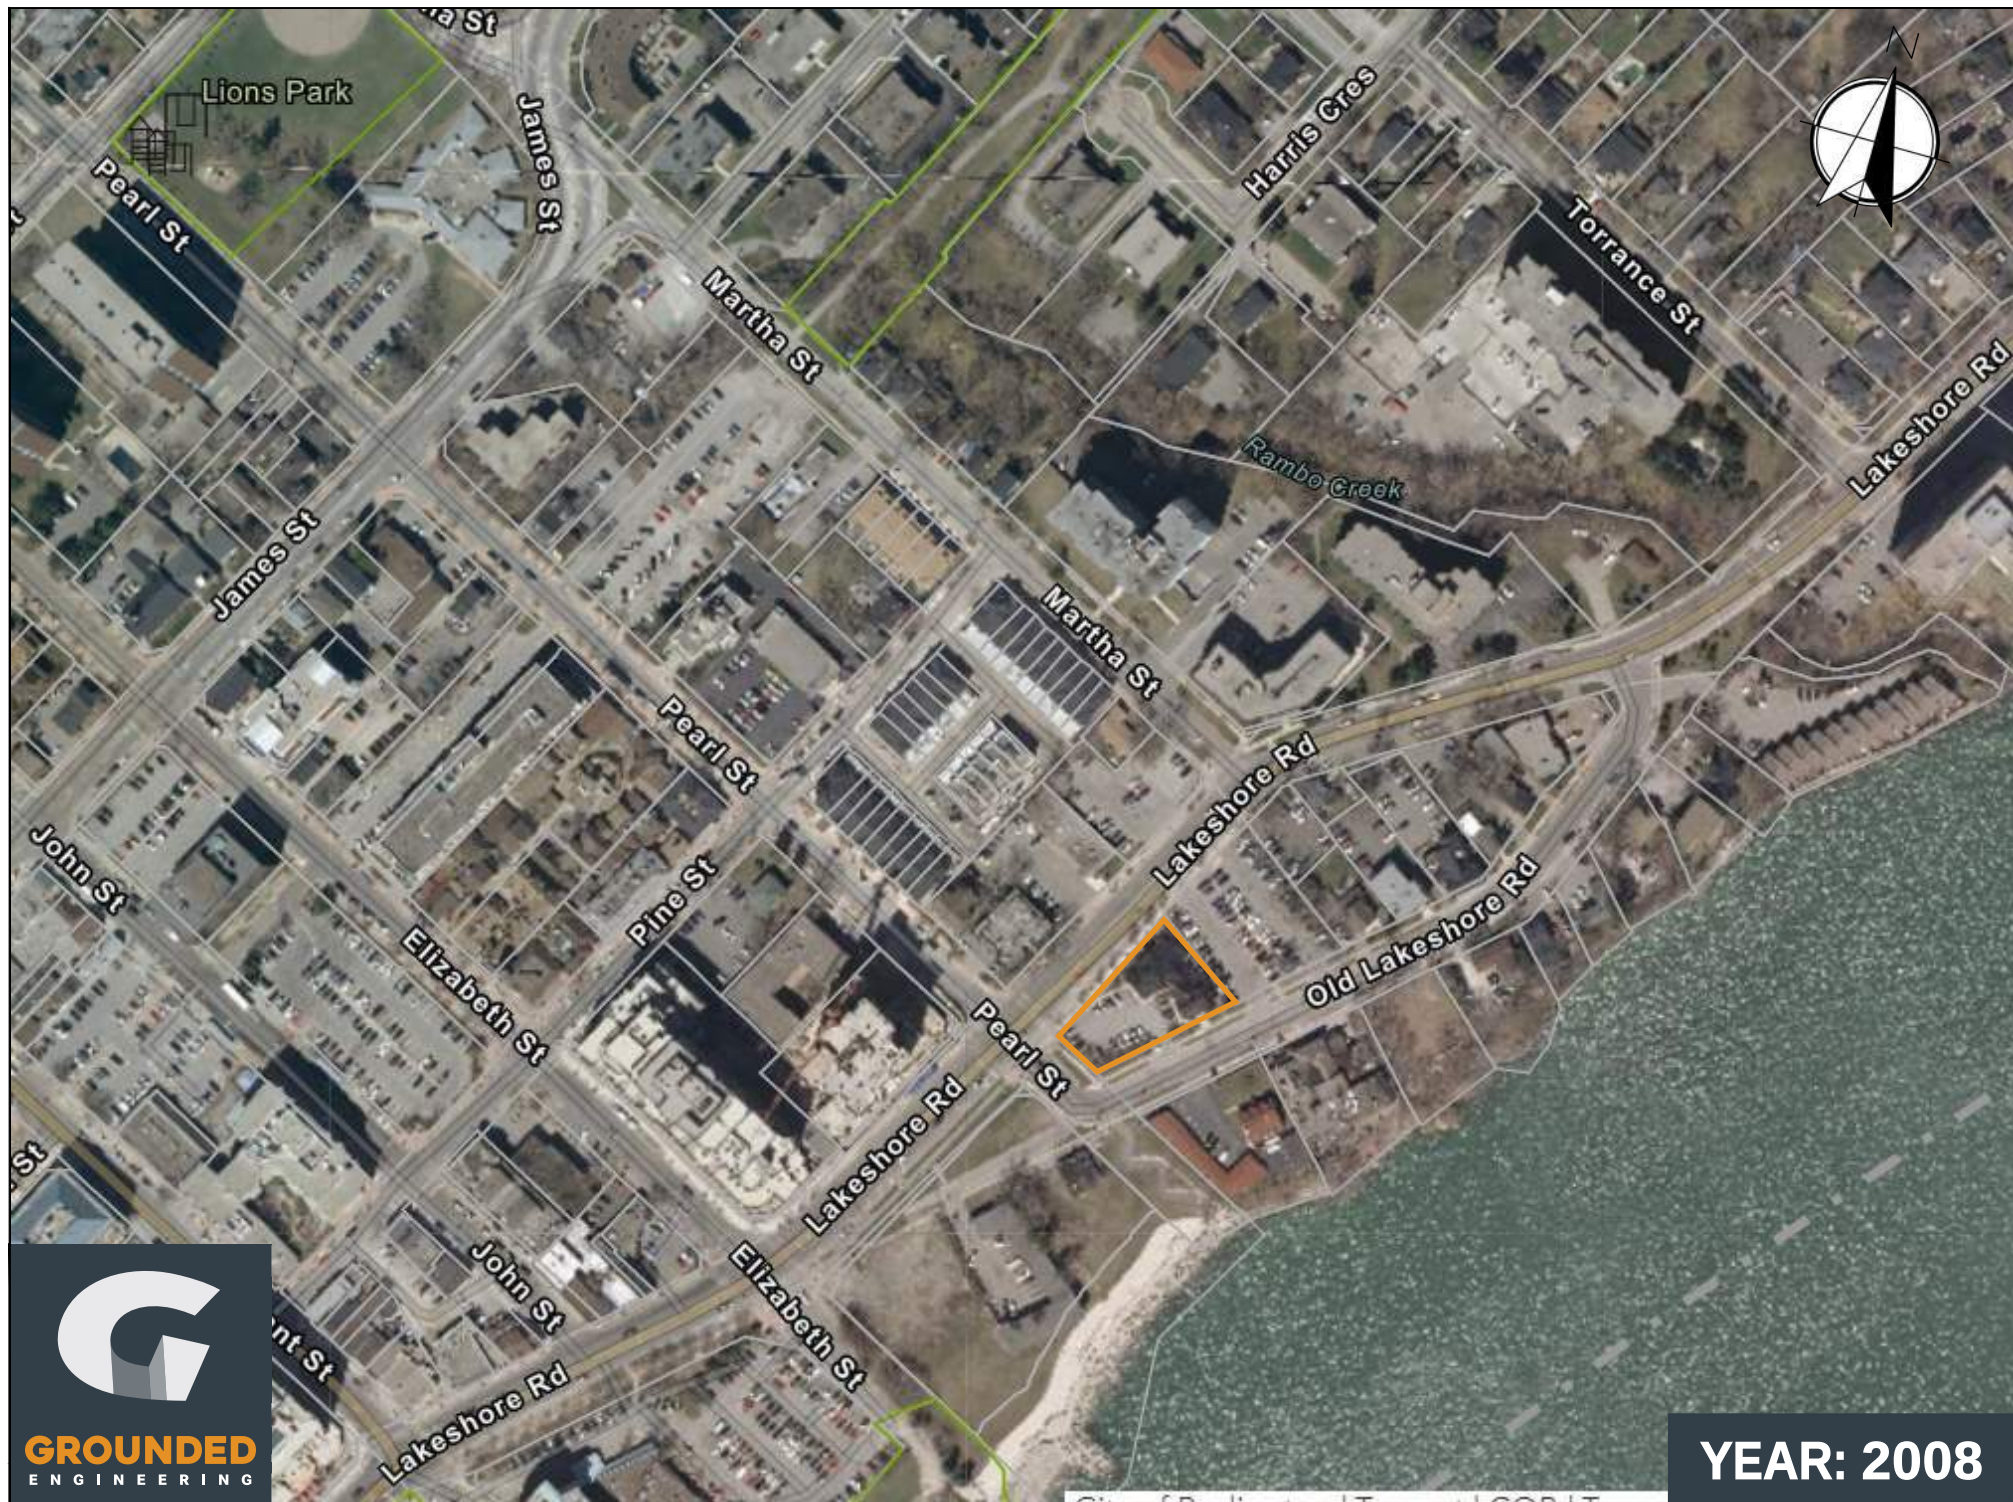

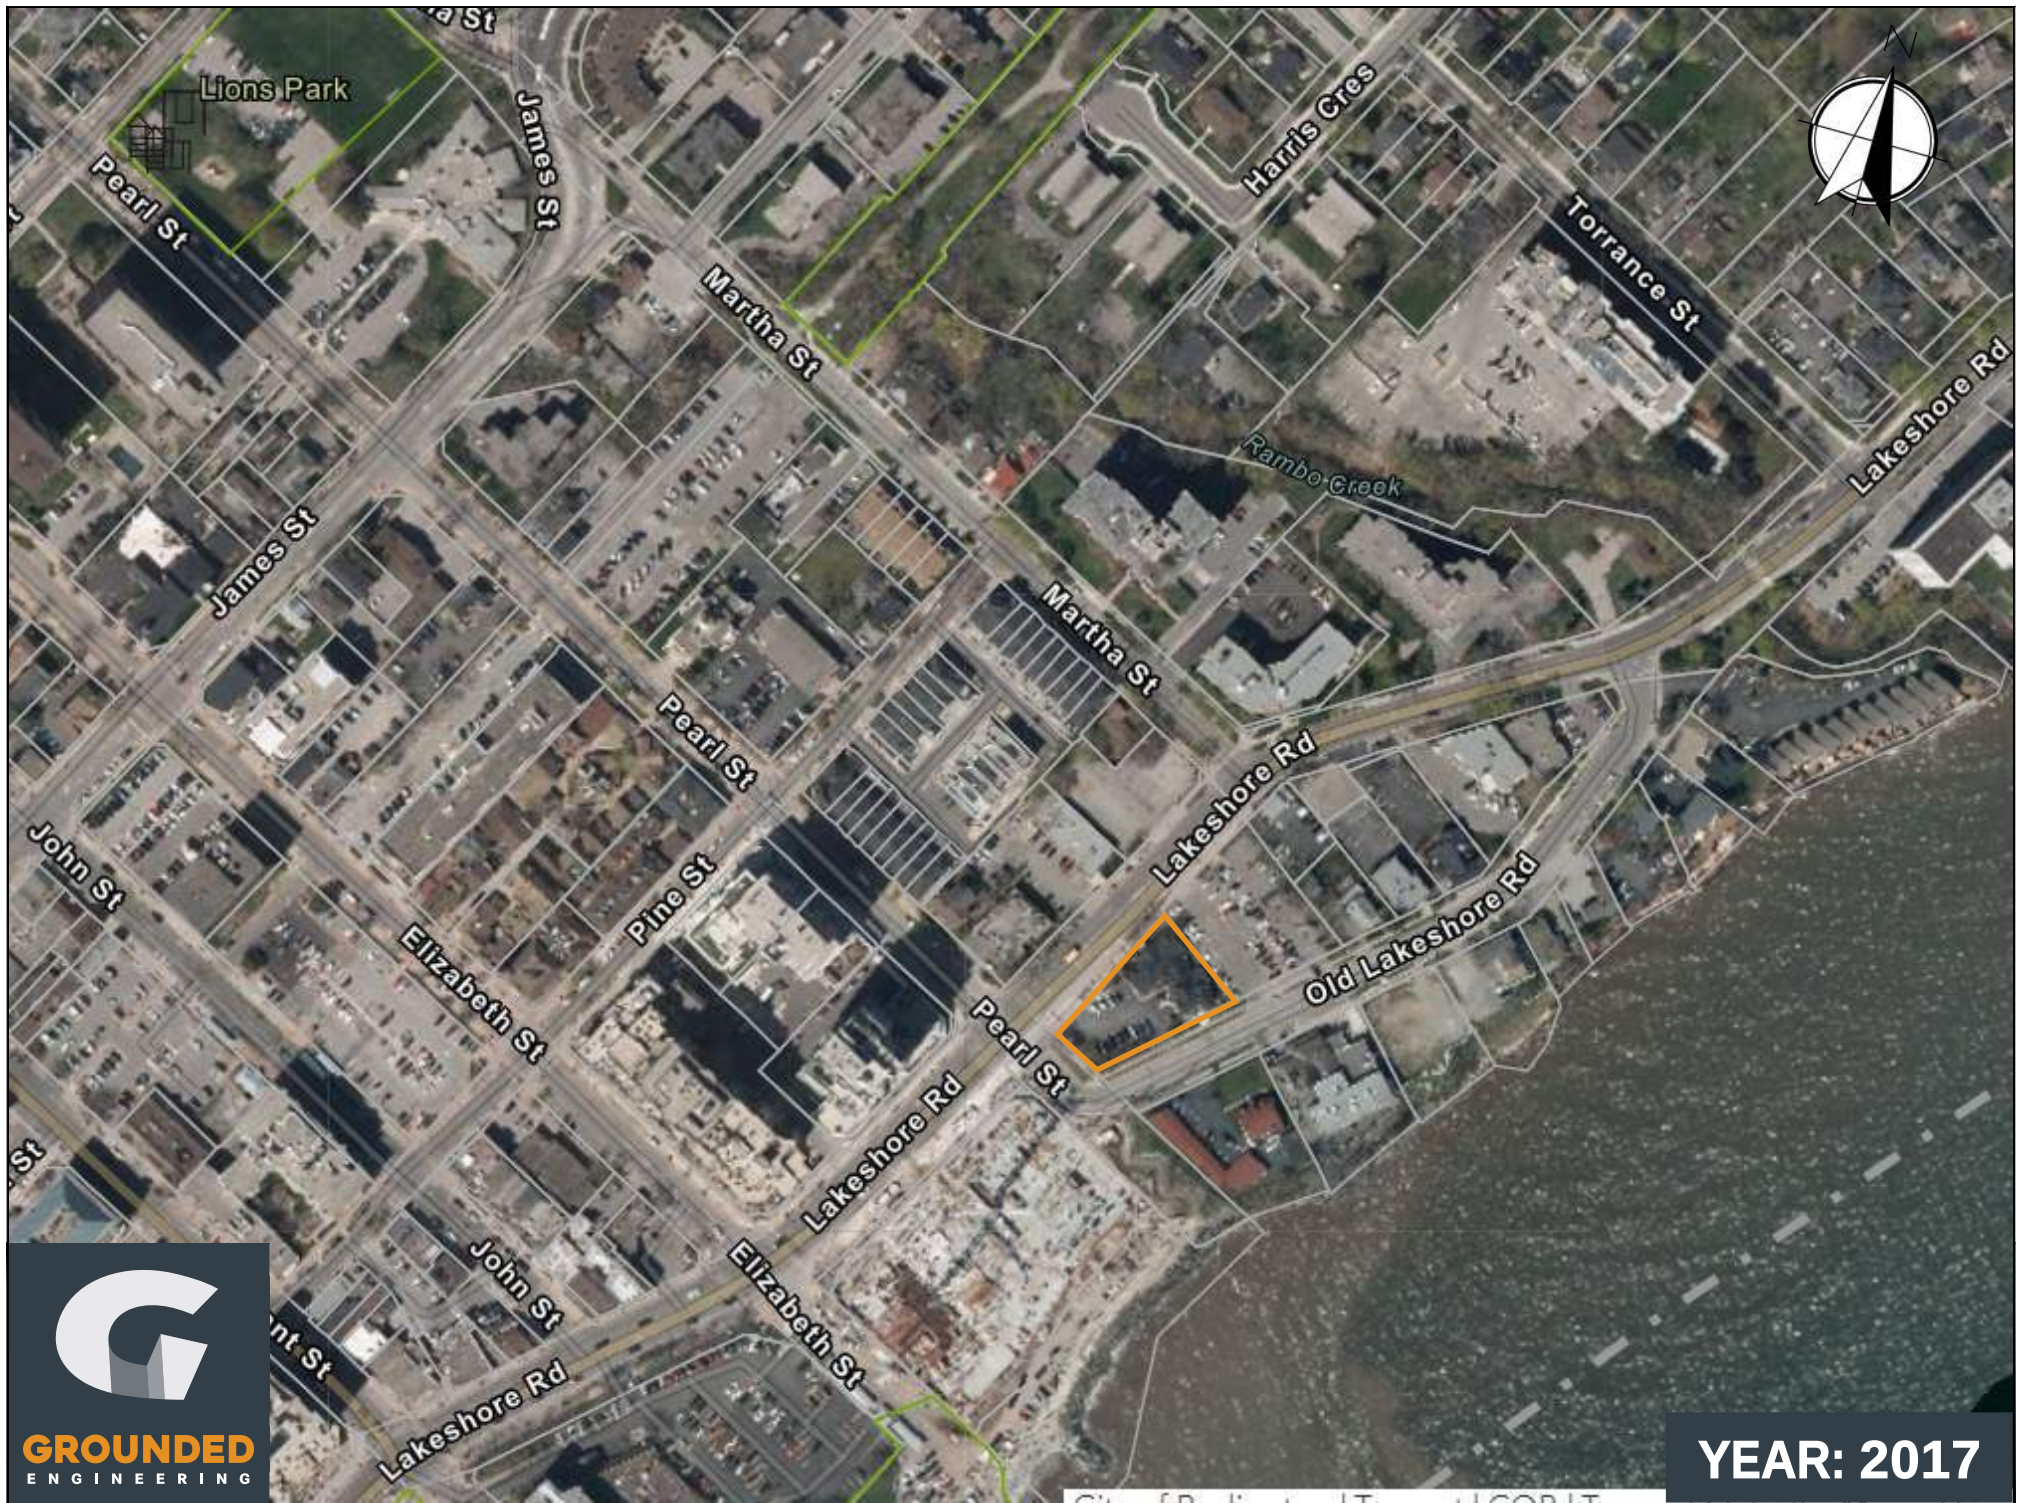

YEAR: 2017



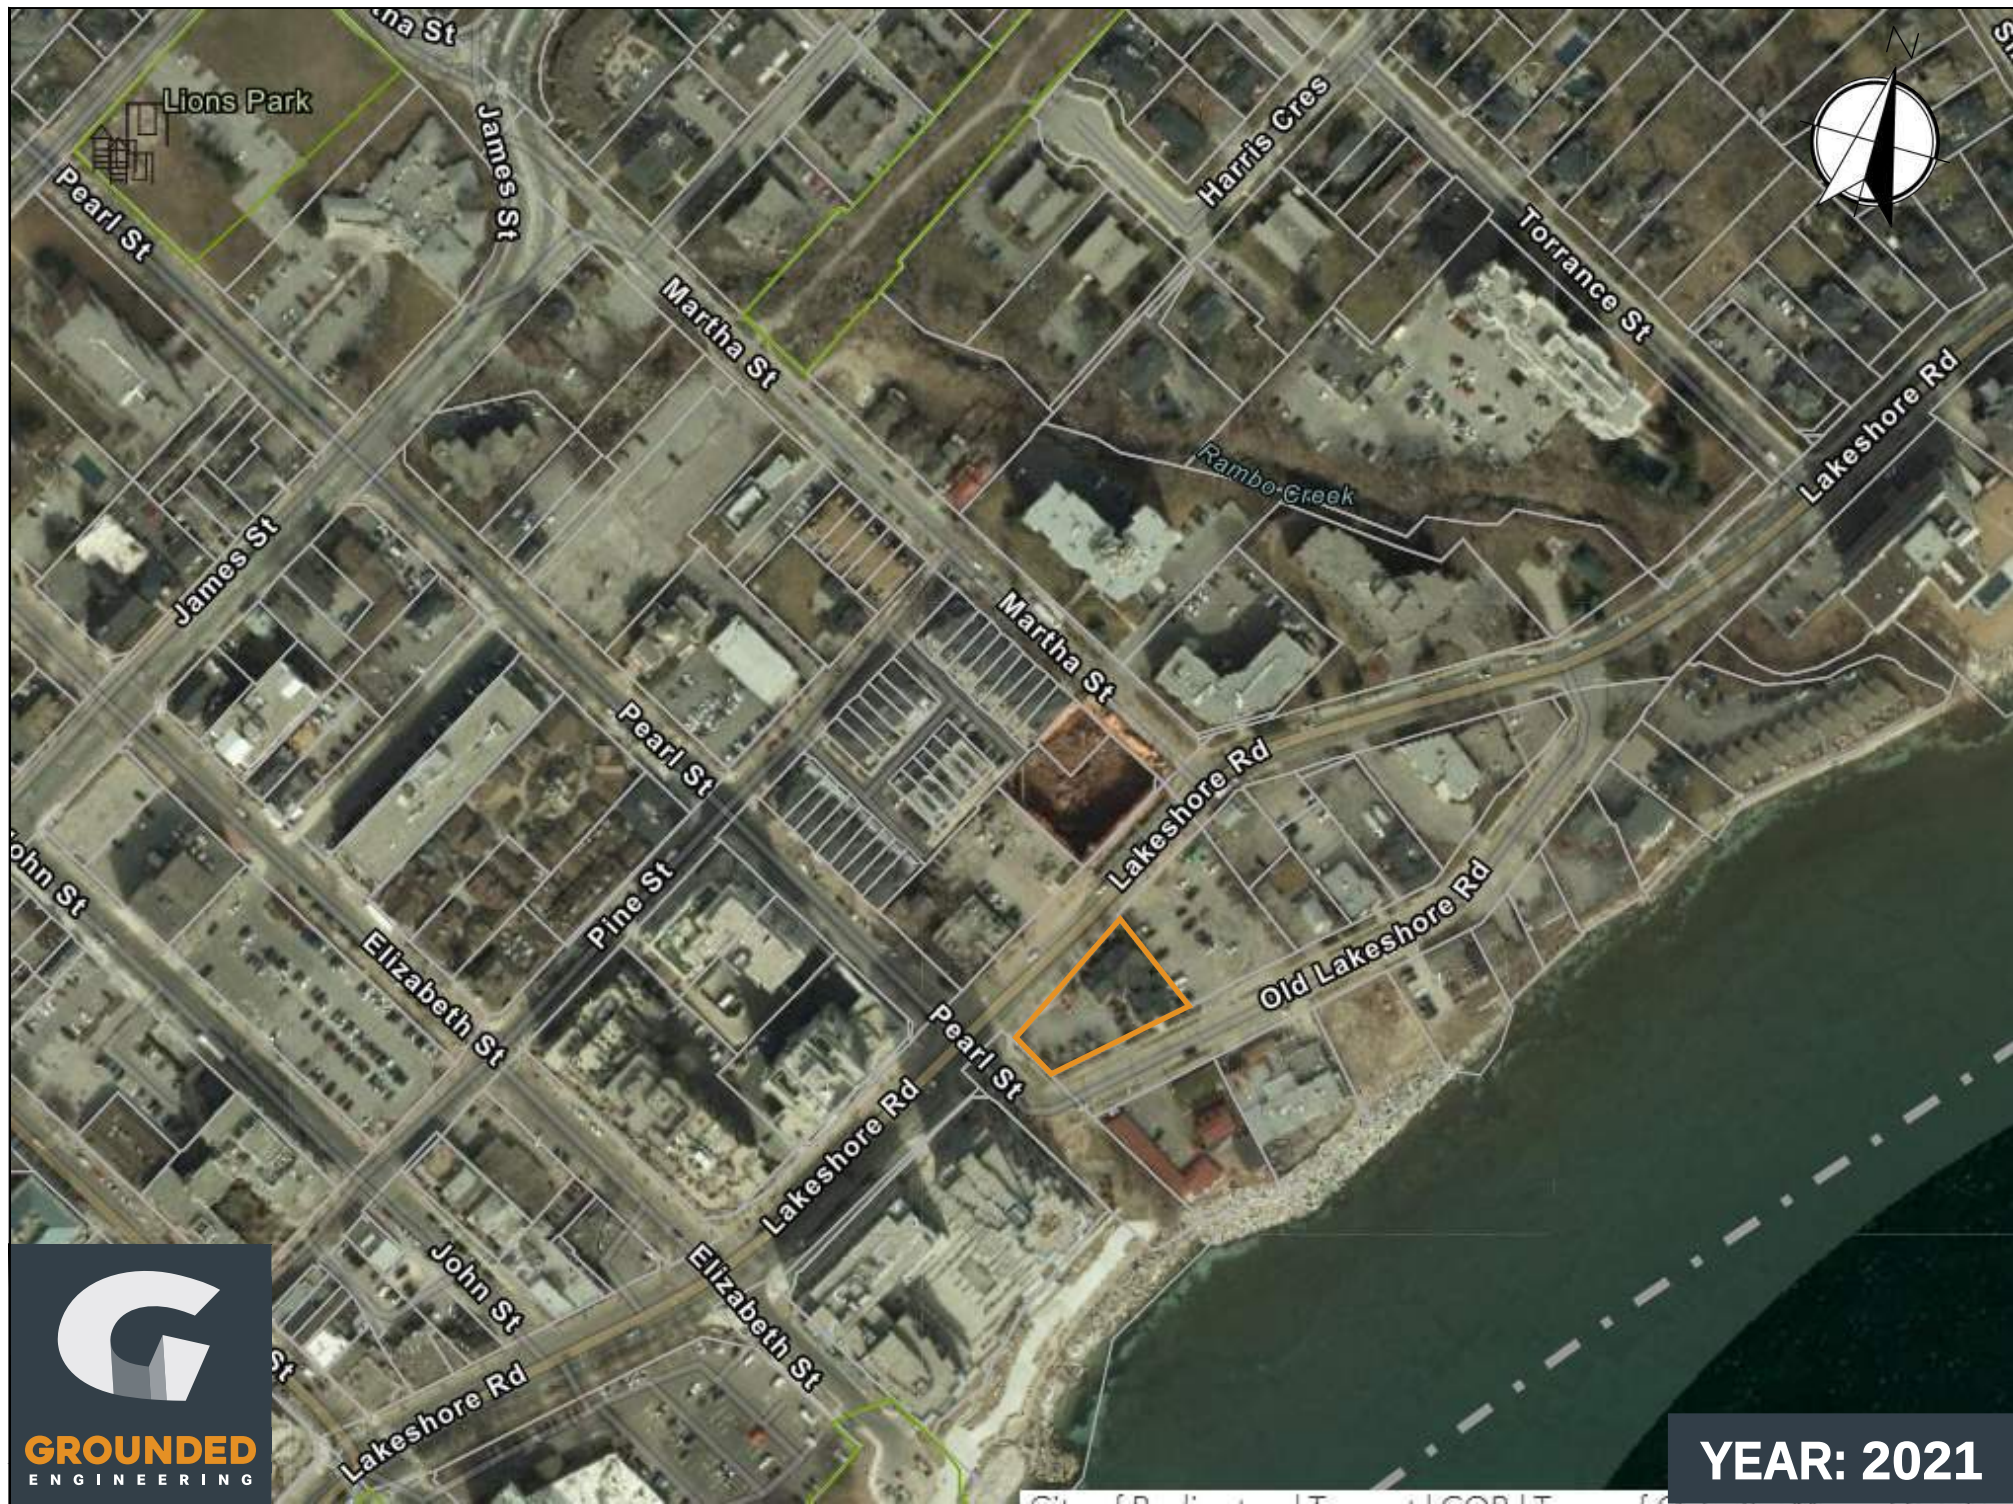

YEAR: 2021

APPENDIX H





Government
of Canada

Gouvernement
du Canada

[Canada.ca](#) > [Natural Resources Canada](#) > [Maps, Tools and Publications](#) > [Maps](#) > [The Atlas of Canada](#) > [Explore Our Maps](#) > [Interactive Maps](#)

The Atlas of Canada - Toporama


Instructions: Keyboard Navigation [?](#)

Toporama



You have questions? [Contact GeoGratis.](#)

Date modified: 2021-01-26

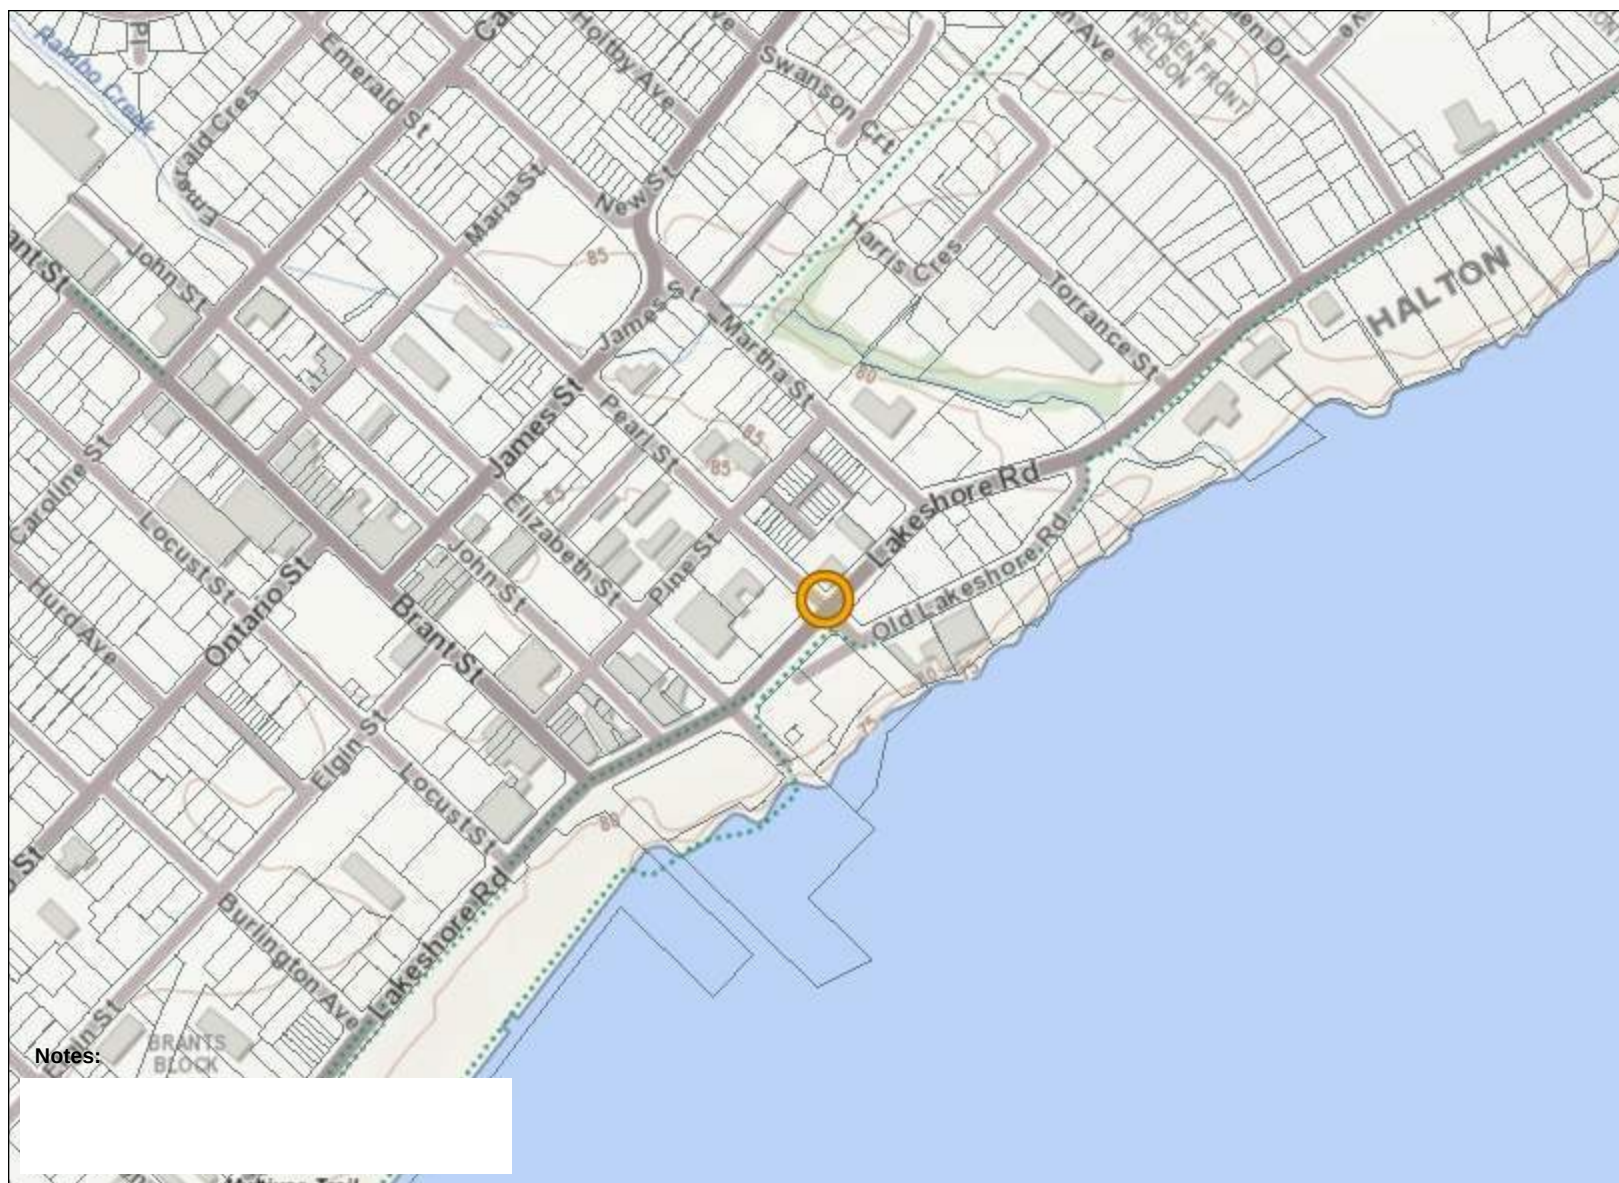

Notes:

Legend

-  Assessment Parcel
-  ANSI
-  Earth Science Provincially Significant/sciences de la terre d'importance provinciale
-  Earth Science Regionally Significant/sciences de la terre d'importance régionale
-  Life Science Provincially Significant/sciences de la vie d'importance provinciale
-  Life Science Regionally Significant/sciences de la vie d'importance régionale
-  Evaluated Wetland
-  Provincially Significant/considérée d'importance provinciale
-  Non-Provincially Significant/non considérée d'importance provinciale
-  Unevaluated Wetland
-  Conservation Reserve
-  Provincial Park
-  Natural Heritage System

0.3 0 0.17 0.3 Kilometres

Absence of a feature in the map does not mean they do not exist in this area.

This map should not be relied on as a precise indicator of routes or locations, nor as a guide to navigation. The Ontario Ministry of Natural Resources and Forestry(OMNRF) shall not be liable in any way for the use of, or reliance upon, this map or any information on this map.


© Copyright for Ontario Parcel data is held by Queen's Printer for Ontario and its licensors and may not be reproduced without permission. THIS IS NOT A PLAN OF SURVEY.



Imagery Copyright Notices: DRAPE © Aéro-Photo (1961) Inc., 2008 - 2009
GTA 2005 / SWOOP 2006 / Simcoe-Muskoka-Dufferin © FirstBase Solutions, 2005 / 2006 / 2008
© Queen's Printer for Ontario, 2022



Source Water Protection

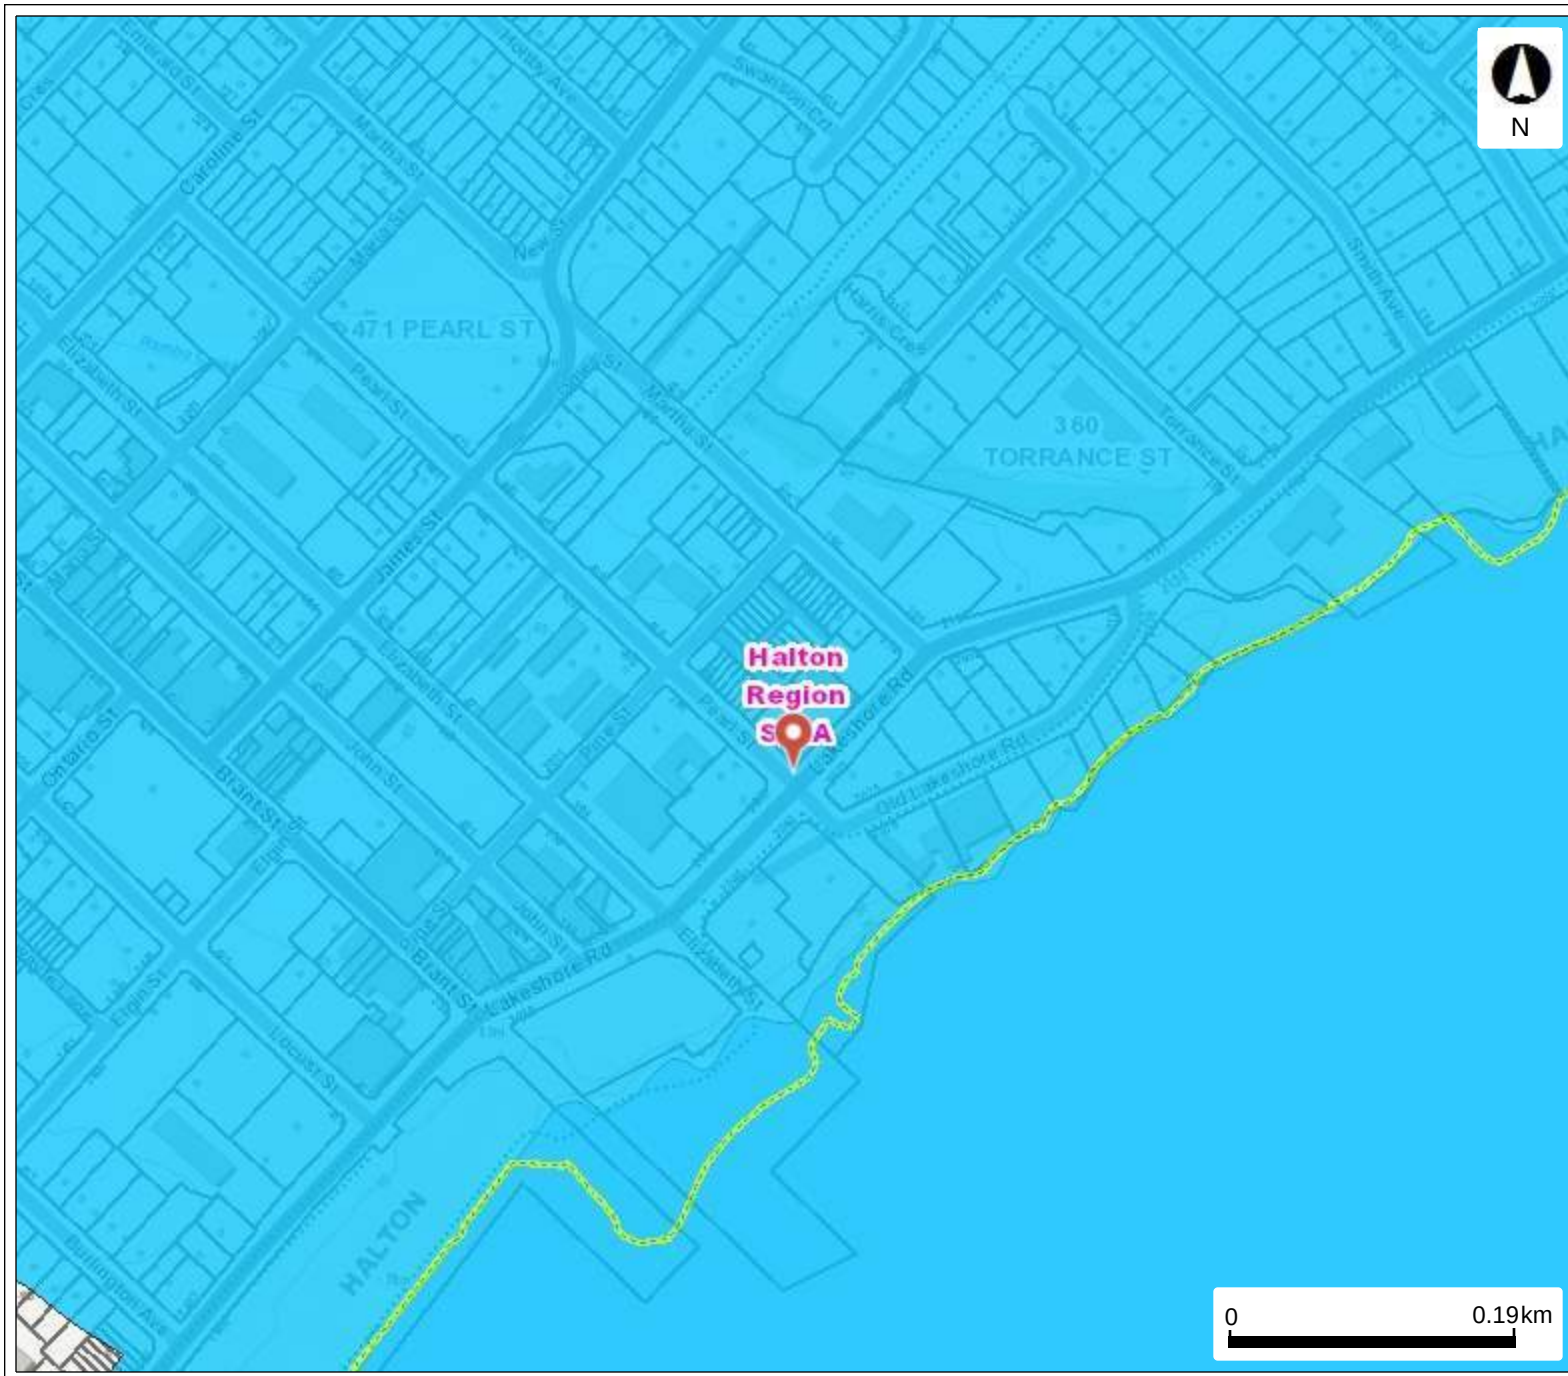

Legend

-  Source Protection Areas
-  Issue Contributing Areas
-  WHPA Groundwater Under Direct Influence (WHPA-E)
- Wellhead Protection Area**
 -  A
 -  B
 -  C
 -  C1
 -  D
 -  F
-  Intake Protection Zone 1
-  Event Based Areas
-  Intake Protection Zone 2
-  Assessment Parcel with Address

This map should not be relied on as a precise indicator of routes or locations, nor as a guide to navigation. The Ontario Ministry of Environment, Conservation and Parks (MECP) shall not be liable in any way for the use or any information on this map. of, or reliance upon, this map.

X

55a
*Shale, limestone, dolostone,
siltstone
Queenston Formation*

2072 Lakeshore Rd.



Ontario

Ontario Geological Survey

11 Sand Plains
Sand Plains

2072 Lakeshore Rd.

Queen Elizabeth Way

Queen Elizabeth Way

Lincoln M. Alexander Pkwy

Red Hill Pkwy

Image NOAA
Image © 2023 TerraMetrics

Google Earth

Imagery Date: 10/4/2022 17 T 604754.04 m E 4800197.62 m N elev 41 m eye alt 49.04 km

25 Glaciolacustrine deposits

Pleistocene

sand, gravelly sand and gravel, nearshore and beach deposits

2072 Lakeshore Rd.

Image NOAA
Image © 2023 TerraMetrics



5d Till
Clay to silt-textured till
(derived from
glaciolacustrine deposits or
shale)

2072 Lakeshore Rd.

APPENDIX I



Water Well Records

June 28, 2022

8:17:21 AM

TOWNSHIP CON LOT	UTM	DATE CNTR	CASING DIA	WATER	PUMP TEST	WELL USE	SCREEN	WELL	FORMATION
BURLINGTON CITY	17 597778 4797624 W	2012-05 7238						7181460 (M08211) A123978 P	
BURLINGTON CITY	17 597782 4797626 W	2004-05 6607	1.97	FR 0010		NU	0005 11	2809958 (Z11846) A010184	BRWN SAND FILL 0010 GREY SAND WTHD 0016
BURLINGTON CITY	17 597799 4797903 W	2016-08 7472	2			MO	0020 30	7272672 (Z239817) A206289	BRWN GRVL SAND FILL 0002 GREY SILT SAND CLAY 0007 GREY SHLE WTHD 0050
BURLINGTON CITY	17 597901 4797676 W	2016-03 7295	1.79			MO		7261445 (Z221860) A	
BURLINGTON CITY	17 597860 4797641 W	2015-10 2123	6	UT 0035	///:	TH		7253016 (Z196169) A170779	RED SHLE CLAY 0022 RED SHLE 0041 GREY SHLE 0043 RED SHLE 0048 RED SHLE LYRD 0071
BURLINGTON CITY	17 597787 4797793 W	2015-07 7484	2			MO	0055 10	7251745 (Z189199) A165794	BRWN CLAY SLTY 0015 RED SHLE 0065
BURLINGTON CITY	17 597876 4797793 W	2015-06 7295	1.79			MO	0015 10	7244963 (Z204800) A179597	GREY CLAY 0006 GREY CLAY 0012 RED SHLE 0025
BURLINGTON CITY	17 597842 4797661 W	2013-09 7484	2			OT	0035 10	7213159 (Z141668) A136427	BRWN SAND GRVL SOFT 0009 RED SHLE HARD DRY 0045
BURLINGTON CITY	17 597660 4797518 W	2013-09 7147	1.25	FR 0020		MO	0010 10	7209538 (Z171605) A149632	BRWN CLAY 0010 BRWN CLAY 0020
BURLINGTON CITY	17 597809 4797776 W	2016-11 7484	2	0002		MO	0030 10	7280353 (Z220724) A125155	BRWN SAND CLAY SILT 0013 RED SHLE 0080
BURLINGTON CITY	17 597869 4797675 W	2013-05 7472	2.04			MO	0010 10	7202389 (Z168486) A145784	BRWN SAND SILT CLAY 0015 RED SHLE HARD 0020
BURLINGTON CITY	17 597918 4797760 W	2016-09 7464	2			MO	0005 10	7287810 (Z237635) A208282	BRWN SILT SAND SOFT 0007 RED SHLE HARD 0015
BURLINGTON CITY	17 597820 4797669 W	2010-05 7238	1.17			MO		7147293 (M06035) A099593	BRWN FILL SOFT 0007 BRWN SAND LOOS 0010 BRWN SHLE LYRD 0063

TOWNSHIP CON LOT	UTM	DATE CNTR	CASING DIA	WATER	PUMP TEST	WELL USE	SCREEN	WELL	FORMATION	
BURLINGTON CITY	17 597797 4797637 W	2009-03 7241	1.5			MT	0004 7	7122728 (Z93193) A081893	BRWN SAND FILL LOOS 0006 GREY CLAY TILL DNSE 0011	
BURLINGTON CITY	17 597774 4797622 W	2009-03 7241	1.5			MT	0005 5	7122727 (Z93174) A081892	BRWN SAND GRVL LOOS 0006 GREY CLAY TILL DNSE 0010	
BURLINGTON CITY	17 597964 4797702 W	2008-05 6607	2.00	0026		MO		7107069 (M01266) A067304	BRWN SAND SILT CLAY 0010 RED CLAY SILT SAND 0014 RED SHLE LMSN WTHD 0030	
BURLINGTON CITY	17 597910 4797720 W	2006-05 6607	0.75	FR 0015		NU	0010 10	2810677 (Z49012) A043879	BRWN SAND SLTY SHLE 0005 RED SHLE 0020	
BURLINGTON CITY	17 597800 4797597 W	2004-07 6607	7.99	0010			0003 11	2810472 (Z15886) A015765	BLUE FILL SILT SAND 0003 BRWN SILT SAND 0004 BRWN SILT SAND 0007 GREY SILT CLAY 0009 RED SILT CLAY TILL 0011 RED SILT CLAY TILL 0014 RED SHLE FCRD DRY 0015	
BURLINGTON CITY	17 597785 4797625 W	2005-06 6607		FR 0003		NU		2810279 (Z28253) A021354 A		
BURLINGTON CITY	17 597785 4797625 W	2005-02 6607	2.00	FR 0008			0005 7	2810175 (Z24232) A021354	BRWN SILT SAND FILL 0010 RED SHLE 0011	
BURLINGTON CITY	17 597888 4797683 W	2013-05 7472	2.04			MO	0020 10	7202390 (Z168485) A145783	BRWN SAND SILT CLAY 0015 RED SHLE HARD 0030	
BURLINGTON CITY	17 597855 4797712 W	2019-02 7241	2		///:	MT	0005 10	7335602 (Z305232) A262989	BLCK ---- 0000 BRWN SAND 0010 RED SHLE 0015	
BURLINGTON CITY	17 597749 4797972 W	2020-08 7215						7367330 (C49410) A295041 P		
BURLINGTON CITY	17 598016 4797805 W	2019-03 7247	2	UT 0020	///:	MT	0015 10	7356014 (Z307809) A174094	BRWN FILL 0005 RED SILT TILL 0025	
BURLINGTON CITY	17 597985 4797789 W	2016-11 7484	2			MO	0030 10	7280352 (Z220723) A165774	BRWN SAND CLAY SILT 0008 RED SHLE 0040	
BURLINGTON CITY	17 597843 4797699 W	2019-02 7241	2		///:	MT	0005 5	7335603 (Z305233) A263100	BLCK ---- 0000 BRWN SAND 0010 RED SHLE 0015	
BURLINGTON CITY	17 597850 4797754 W	2018-12 7247	2		///:	MT	0022 10	7329173 (Z305693) A263860	BRWN FILL 0002 BRWN SAND SILT GRVL 0005 BRWN CLAY SILT 0012 RED SHLE HARD 0032	

TOWNSHIP CON LOT	UTM	DATE CNTR	CASING DIA	WATER	PUMP TEST	WELL USE	SCREEN	WELL	FORMATION	
BURLINGTON CITY	17 597693 4797953 W	2018-09 7472	2		///:	MO	0010 10	7327274 (Z299870) A250417	GREY GRVL SAND LOOS 0010 GREY SILT SAND PCKD 0020	
BURLINGTON CITY	17 597930 4797790 W	2016-09 7464	2			MO	0005 10	7287811 (Z237634) A208286	BRWN SILT SAND SOFT 0007 RED SHLE HARD 0015	
BURLINGTON CITY	17 597693 4797933 W	2018-09 7472	2		///:	MO	0045 10	7327272 (Z299872) A250419	GREY GRVL SAND LOOS 0010 GREY SILT SAND PCKD 0015 GREY SHLE HARD 0055	
BURLINGTON CITY	17 597654 4797937 W	2018-09 7472	2		///:	MO	0045 10	7327271 (Z299873) A250420	BLCK ---- HARD 0001 GREY GRVL SAND LOOS 0010 GREY SILT SAND PCKD 0020 GREY SHLE HARD 0055	
BURLINGTON CITY	17 597675 4797929 W	2018-09 7472	2			MO	0010 10	7327270 (Z299874) A250495	BLCK HARD 0001 GREY GRVL SAND LOOS 0010 GREY SILT SAND PCKD 0020	
BURLINGTON CITY	17 597794 4797901 W	2018-08 7472	2			MO	0010 5	7323240 (Z290747) A250428	BRWN TILL SAND SOFT 0005 RED SHLE HARD 0015	
BURLINGTON CITY	17 597966 4797750 W	2016-09 7464	2			MO	0005 10	7287812 (Z237633) A208287	BRWN SILT SAND SOFT 0007 RED SHLE HARD 0015	
BURLINGTON CITY	17 597696 4797966 W	2018-09 7472	2		///:	MO	0045 10	7327273 (Z299871) A250418	GREY GRVL SAND LOOS 0010 GREY SILT SAND PCKD 0020 GREY SHLE HARD 0055	
BURLINGTON CITY	17 597853 4797698 W	2019-02 7241	2		///:	MT	0005 10	7335604 (Z305234) A263421	BLCK ---- 0000 BRWN SAND 0010 RED SHLE 0015	
BURLINGTON CITY BB	17 597635 4797742 W	2004-10 6607	1.97	0000			0010 10	2810067 (Z19529) A016894	BRWN SAND SILT 0003 GREY CLAY SILT 0013 RED SHLE 0020	
BURLINGTON CITY BB	17 597718 4797582 W	2021-04 7472	2		///:	MO	0040 10	7385418 (ZKKM5CSH) A322956	GREY GRVL LOOS 0002 BRWN FILL LOOS 0006 GREY TILL PCKD 0008 SHLE 0050	
BURLINGTON CITY BB	17 597676 4797552 W	2021-04 7472	2		///:	MO	0046 10	7385417 (KS9M3WZN) A322955	GREY GRVL LOOS 0002 BRWN FILL LOOS 0006 GREY TILL PCKD 0008 SHLE 0056	
BURLINGTON CITY BB	17 597643 4797538 W	2021-04 7472	2		///:	MO	0014 10	7385416 (KFZY3M6J) A322961	GREY GRVL LOOS 0002 GREY TILL PCKD 0008 SHLE 0024	
BURLINGTON CITY BB	17 597734 4797526 W	2021-04 7472	2		///:	MO	0041 10	7385415 (I8QD43KA) A322970	GREY GRVL LOOS 0002 BRWN FILL LOOS 0024 GREY TILL PCKD 0026 SHLE 0051	

TOWNSHIP CON LOT	UTM	DATE CNTR	CASING DIA	WATER	PUMP TEST	WELL USE	SCREEN	WELL	FORMATION
BURLINGTON CITY BB	17 597684 4797491 W	2021-04 7472	2		///:	MO	0015 10	7385413 (KZTOLCM7) A315220	BRWN FILL LOOS 0012 GREY TILL PCKD 0018 SHLE 0025
BURLINGTON CITY BB	17 597775 4797555 W	2021-04 7472	2		///:	MO	0056 10	7385428 (UJNX3FYG) A315215	BRWN FILL LOOS 0018 GREY TILL PCKD 0026 SHLE 0066
BURLINGTON CITY BB	17 597737 4797588 W	2021-04 7472	2		///:	MO	0015 10	7385414 (4AAD09U5) A322954	GREY GRVL LOOS 0002 BRWN FILL LOOS 0008 GREY TILL PCKD 0012 SHLE 0025

Notes:

UTM: UTM in Zone, Easting, Northing and Datum is NAD83; L: UTM estimated from Centroid of Lot; W: UTM not from Lot Centroid

DATE CNTR: Date Work Completedand Well Contractor Licence Number

CASING DIA: Casing diameter in inches

WATER: Unit of Depth in Fee. See Table 4 for Meaning of Code

PUMP TEST: Static Water Level in Feet / Water Level After Pumping in Feet / Pump Test Rate in GPM / Pump Test Duration in Hour : Minutes

WELL USE: See Table 3 for Meaning of Code

SCREEN: Screen Depth and Length in feet

WELL: WEL (AUDIT #) Well Tag . A: Abandonment; P: Partial Data Entry Only

FORMATION: See Table 1 and 2 for Meaning of Code

1. Core Material and Descriptive terms

Code	Description	Code	Description	Code	Description	Code	Description	Code	Description
BLDR	BOULDERS	FCRD	FRACTURED	IRFM	IRON FORMATION	PORS	POROUS	SOFT	SOFT
BSLT	BASALT	FGRD	FINE-GRAINED	LIMY	LIMY	PRDG	PREVIOUSLY DUG	SPST	SOAPSTONE
CGRD	COARSE-GRAINED	FGVL	FINE GRAVEL	LMSN	LIMESTONE	PRDR	PREV. DRILLED	STKY	STICKY
CGVL	COARSE GRAVEL	FILL	FILL	LOAM	TOPSOIL	QRTZ	QUARTZITE	STNS	STONES
CHRT	CHERT	FLDS	FELDSPAR	LOOS	LOOSE	QSND	QUICKSAND	STNY	STONEY
CLAY	CLAY	FLNT	FLINT	LTCL	LIGHT-COLOURED	QTZ	QUARTZ	THIK	THICK
CLN	CLEAN	FOSS	FOSILIFEROUS	LYRD	LAYERED	ROCK	ROCK	THIN	THIN
CLYY	CLAYEY	FSND	FINE SAND	MARL	MARL	SAND	SAND	TILL	TILL
CMTD	CEMENTED	GNIS	GNEISS	MGRD	MEDIUM-GRAINED	SHLE	SHALE	UNKN	UNKNOWN TYPE
CONG	CONGLOMERATE	GRNT	GRANITE	MGVL	MEDIUM GRAVEL	SHLY	SHALY	VERY	VERY
CRYS	CRYSTALLINE	GRSN	GREENSTONE	MRBL	MARBLE	SHRP	SHARP	WBRG	WATER-BEARING
CSND	COARSE SAND	GRVL	GRAVEL	MSND	MEDIUM SAND	SHST	SCHIST	WDFR	WOOD FRAGMENTS
DKCL	DARK-COLOURED	GRWK	GREYWACKE	MUCK	MUCK	SILT	SILT	WTHD	WEATHERED
DLMT	DOLomite	GVLY	GRAVELLY	OBND	OVERBURDEN	SLTE	SLATE		
DNSE	DENSE	GYPS	GYPSUM	PCKD	PACKED	SLTY	SILTY		
DRTY	DIRTY	HARD	HARD	PEAT	PEAT	SNDS	SANDSTONE		
DRY	DRY	HPAN	HARDPAN	PGVL	PEA GRAVEL	SNDY	SANDY		

2. Core Color

Code	Description
WHIT	WHITE
GREY	GREY
BLUE	BLUE
GREN	GREEN
YLLW	YELLOW
BRWN	BROWN
RED	RED
BLCK	BLACK
BLGY	BLUE-GREY

3. Well Use

Code	Description	Code	Description
DO	Domestic	OT	Other
ST	Livestock	TH	Test Hole
IR	Irrigation	DE	Dewatering
IN	Industrial	MO	Monitoring
CO	Commercial	MT	Monitoring TestHole
MN	Municipal		
PS	Public		
AC	Cooling And A/C		
NU	Not Used		

4. Water Detail

Code	Description	Code	Description
FR	Fresh	GS	Gas
SA	Salty	IR	Iron
SU	Sulphur		
MN	Mineral		
UK	Unknown		

APPENDIX J





Photograph 1

Location: Lakeshore Road

Direction: West

Description: Viewing the north side of the Property.



Photograph 2

Location: Lakeshore Road

Direction: Southwest

Description: Viewing the east portion the building on the Property.



Photograph 3

Location: 2069 Lakeshore Road

Direction: South

Description: Viewing the parking lot on the western portion of the Property.



Photograph 4

Location: 2069 Lakeshore Road

Direction: Southeast

Description: Exterior of 2072 Lakeshore Road, an office building.



Photograph 5

Location: Phase One Property

Direction: North

Description: Interior of 2072 Lakeshore Road, an office building.



Photograph 6

Location: Phase One Property

Direction: West

Description: Interior of 2072 Lakeshore Road, an office building.



Photograph 7

Location: Phase One Property

Direction: West

Description: View of the crawl space under the building.



Photograph 8

Location: Phase One Property

Direction: South

Description: View of the possible decommissioned tank in the crawl space under the building.

APPENDIX K



Phase One Environmental Conceptual Site Model

2072 Lakeshore Road, Burlington, Ontario

Phase One ESA including Figures of the Phase One Study Area, which identify the following:	Phase One ESA Information:
Existing buildings and structures	Existing building and structures are presented in Figure 2.
Water bodies located in whole or in part on the Phase One Study Area	All water bodies on the Phase One Property and Phase One Study Area are shown on Figure 3.
Areas of Natural Significance located in whole or in part on the Phase One Study Area	No Life Science ANSIs were identified on the property or within the study area. No Earth Science ANSIs were identified on the property or within the study area.
Roads (including names) within the Phase One Study Area	All roads within the Phase One Study Area are shown on Figure 3.
Use of properties adjacent to the Phase One Property	The land use of properties adjacent to the Phase One Property is shown on Figure 3.
Location of drinking water wells on the Phase One Property	No drinking water wells were present on the Phase One Property.
Areas where any PCA has occurred, and locations of tanks in the Phase One Study Area	The location of PCAs and tanks, if any, is shown on Figure 4.
APECs on the Phase One Property	The location of APECs on the Phase One Property is shown on Figure 5.
Narrative Description and Assessments	
Any areas where Potentially Contaminating Activity (PCAs) on, or potentially affecting, the Phase One Property have occurred	<u>On-site PCAs Associated with APEC 1:</u> #28_A – Gasoline and Associated Products Storage in Fixed Tanks <u>On-site PCAs Associated with APEC 2:</u> #30_A – Importation of Fill Material of Unknown Quality <u>On-site PCAs Associated with APEC 3:</u> #Other1_A – De-icing Activities



	<u>Off-site PCAs Associated with APEC 4:</u> • #34_A – Metal Fabrication <u>Off-site PCAs Associated with APEC 5:</u> • #28_C – Gasoline and Associated Products Storage in Fixed Tanks
Any Contaminants of Potential Concerns (CoPCs)	<u>CoPCs Associated with APEC 1:</u> • PAHs, BTEX, PHCs, and VOCs in soil and groundwater <u>CoPCs Associated with APEC 2:</u> • Metals, As, Sb, Se, CN⁻, Hg, Cr(VI), pH, PAHs, BTEX, and PHCs in soil and groundwater • B-HWS in soil <u>CoPCs Associated with APEC 3:</u> • EC and SAR in soil • Na and Cl in groundwater <u>CoPCs Associated with APEC 4:</u> • Metals, As, Sb, Se, Hg, BTEX, PHCs, and VOCs in groundwater <u>CoPCs Associated with APEC 5:</u> • PAHs, BTEX, PHCs, and VOCs in groundwater
The potential of underground utilities (if any present) to affect contaminant distribution and transport	Buried hydro, gas, communication, water and electrical all run through the Property. Based on these observations, there is the potential for underground utilities to affect the distribution and transportation of contaminants underneath the Property.
Available regional or site specific geological and hydrogeological information	<u>Topography:</u> • The site has an approximate ground surface elevation of 82 - 83 masl and is generally flat lying. <u>Hydrology:</u> • The nearest body of water is Lake Ontario, located approximately 50 m south of the Property. The Property is located within the Lower Rambo Creek Watershed. • Surface water flow is expected to flow to the municipal catch basins located on the Property and the adjacent roadways of the Property. Groundwater is expected to flow south, towards Lake Ontario. <u>Overburden:</u>



	- The overburden soils are composed of clay to silt textured till derived from glacioclustrine deposits or shale, underlain by bedrock. <u>Bedrock:</u> - Bedrock beneath the site is composed of shale, limestone, dolostone and siltstone and are part of the Queenston Formation. - Based on well records within the Study Area, bedrock is encountered at approximately 4 mbgs.
Any uncertainty or absence of information obtained in the Phase One ESA that could affect the validity of the CSM	No uncertainty or absence of information obtained in the Phase One ESA is identified to have an effect on the validity of the CSM.

- Figure 1 – Site Location Plan
 Figure 2 – Phase One Property
 Figure 3 – Phase One Study Area
 Figure 4 – PCA Locations
 Figure 5 – APEC Locations